


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Goulburn South Public School (2056)  
**Region :** Illawarra and South East  
**State Electorate :** Goulburn  
**Local Government Area :** Goulburn Mulwaree

**Initial Survey :** Noel Arnold & Associates : 13 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 13 - Jul - 2015

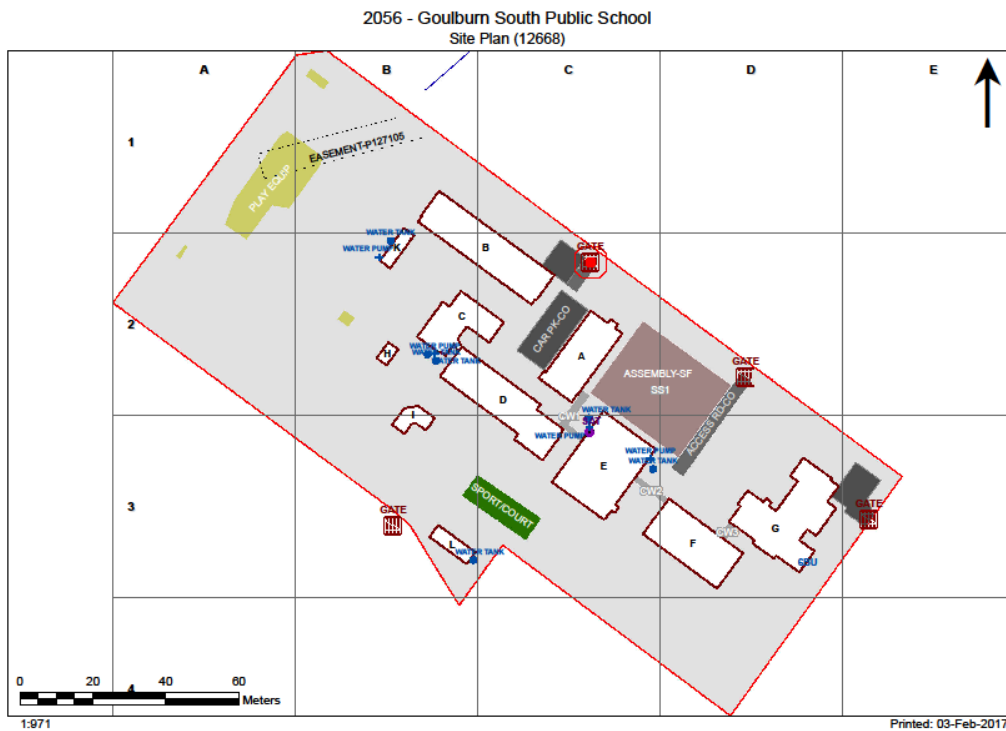

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1975 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/Gable Verge Lining/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	15m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00B/In-fill-panel/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2056/B00A/Underfloor Voids/S17			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2056/B00A/Underfloor Voids - Packing to Floor Joists/S18			<b>Chrysotile (white asbestos)</b>		

**Interior**

**B00A - R0001 - Interview**

No Asbestos

**B00A - R0002 - Security Store**

No Asbestos

**B00A - R0003 - Principal**

No Asbestos

**B00A - R0004 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	2m	Adjacent door	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0005 - Entry Vestibule**

No Asbestos

**B00A - R0007 - Movement**

No Asbestos

**B00A - R0008 - Sick Bay**

No Asbestos

**B00A - R0009 - Cleaning Distributed Store**

No Asbestos

**B00A - R0010 - Staff Room Annexe**

No Asbestos

**B00A - R0012 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0013 - Main Switch Board**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
---------	----------------------	--------	--------------------	--------------------	-------------	------------------

	Sample No	Test Result				
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2056/B00A/R0013/Wall Linings Internal/S10	<b>Chrysotile (white asbestos)</b>				
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0013/Floor Coverings Res/Textile/S11	<b>Chrysotile (white asbestos)</b>				
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2056/B00A/R0013/Wall Linings Internal/S10	<b>Chrysotile (white asbestos)</b>				
Electrical Mounting Board	Resinous Board	1Unit	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2056/B00A/R0013/Electrical Mounting Board/S19	<b>Chrysotile (white asbestos)</b>				

**B00A - R0014 - Duplicating Workroom**

Floor Coverings Res/Textile	Vinyl Tiles					
	2056/B00A/R0014/Floor Coverings Res/Textile/S8	<b>No Asbestos Detected</b>				

**B00A - R0015 - Staff Toilet**

Floor Coverings Res/Textile	Vinyl Tiles					
	2056/B00A/R0016/Floor Coverings Res/Textile/S9	<b>No Asbestos Detected</b>				

**B00A - R0016 - Staff Toilet**

Floor Coverings Res/Textile	Vinyl Tiles					
	2056/B00A/R0016/Floor Coverings Res/Textile/S9	<b>No Asbestos Detected</b>				

**B00A - R0017 - Movement**

No Asbestos

**B00A - R0018 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0019/Ceiling Structures/Linings/S20	<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				

**B00A - R0019 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0019/Ceiling Structures/Linings/S20	<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				

**B00A - R0020 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5	<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				

**B00A - R0022 - Staff Room**

No Asbestos

**B00A - R0023 - Staff Kitchen**

No Asbestos

**B00A - R0024 - Clerical Office**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting 2056/B00B/Gable Verge Lining/S21					<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting 2056/B00B/In-fill-panel/S1	35m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
In-fill-panel	Flat AC Sheeting 2056/B00B/In-fill-panel/S23	20m2	Above windows	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
Eaves Linings	Flat AC Sheeting 2056/B00B/R0001/Ceiling Structures/Linings/S2	35m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 2056/B00B/Underfloor Voids - Packing to Floor Joists/S22	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)

**Interior**

**B00B - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 2056/B00B/R0001/Ceiling Structures/Linings/S2	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---	------	------------	--------------------	---------	--------------------

**B00B - R0002 - Staff Room Annexe**

No Asbestos

**B00B - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00B - R0004 - Movement**

No Asbestos

**B00B - R0005 - Staff Toilet**

No Asbestos

**B00B - R0006 - Cleaning Distributed Store**

Electrical Backing Board	Resinous Board 2056/B00B/R0006/Electrical Backing Board/S24	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	--	-----	------	--------------------	---------	--------------------

**B00B - R0007 - Home Base**

No Asbestos

**B00B - R0008 - Home Base Store**

No Asbestos

**B00B - R0010 - Home Base**

No Asbestos

**B00B - R0011 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles 2056/B00B/R0011/Floor Coverings Res/Textile/S13					<b>No Asbestos Detected</b>
-----------------------------	--	--	--	--	--	-----------------------------

**B00B - R0012 - Toilets - Boys/Girls**

No Asbestos

**B00B - R0013 - Personal Effects Storage**

No Asbestos

**B00B - R0014 - General Storeroom**

No Asbestos

**B00B - R0015 - Home Base Store**

No Asbestos

**B00B - R0016 - Withdrawal Space - 1hb**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00B - R0017 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00C - General Learning - 1880 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	Non Accessible Area - Only inspected ceiling void in CR0005. Ceiling voids are above 4 metres.
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00C - R0002 - Movement**

No Asbestos

**B00C - R0003 - Personal Effects Storage**

No Asbestos

**B00C - R0004 - Other-Vacant**

No Asbestos

**B00C - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00C/R0005/Ceiling Structures/Linings/S25				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R0006 - Other-Vacant**

Non Accessible

**B00C - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00C/R0005/Ceiling Structures/Linings/S25				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Wall Linings Internal	Flat AC Sheeting 2056/B00C/R0007/Wall Linings Internal/S26	<b>No Asbestos Detected</b>				
-----------------------	---	-----------------------------	--	--	--	--

**B00C - R0008 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Unable to sample due to height</b>						

**B00C - R0009 - Practical Activities - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Unable to sample due to height</b>						

**B00C - R0010 - Home Base Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Unable to sample due to height</b>						

**B00C - R0011 - Withdrawal Space - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Unable to sample due to height</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1908 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00D/Gable Verge Lining/S27				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	35m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00B/In-fill-panel/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Eaves Linings	Flat AC Sheeting	45m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00B/R0001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00B/R0001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m	Above windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00B/In-fill-panel/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00D - R0002 - Personal Effects Storage**

No Asbestos

**B00D - R0003 - Home Base**

No Asbestos

**B00D - R0004 - Home Base Store**

No Asbestos

**B00D - R0005 - Home Base**

No Asbestos

**B00D - R0008 - Movement**

No Asbestos

**B00D - R0010 - Disabled Toilet**

Wall Linings Internal	Flat AC Sheeting					
	2056/B00D/R0010/Wall Linings Internal/S15				No Asbestos Detected	

**B00D - R0013 - Movement**

No Asbestos

**B00D - R0014 - General Storeroom**

No Asbestos

**B00D - R0015 - Staff Toilet**

No Asbestos

**B00D - R0016 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00B/R0001/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

**B00D - R0017 - Home Base**

No Asbestos

**B00D - R0018 - Practical Activities - 2hb**

No Asbestos

**B00D - R0019 - Withdrawal Space - 2hb**

No Asbestos

**B00D - R0020 - Home Base Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - R0021 - Home Base Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library/Communal Facilities - 1950 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00E/Gable Verge Lining/S28					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00E - M1001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00E/R0012/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

**B00E - M1002 - Distribution Board**

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00E/R0012/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

**B00E - M1003 - Reading Area**

No Asbestos

**B00E - M1004 - Seminar/Study**

No Asbestos

**B00E - M1005 - Seminar/Study**

No Asbestos

**B00E - M1006 - Stairs**

No Asbestos

**B00E - R0001 - Communal Space**

No Asbestos

**B00E - R0002 - Hall Chair Store**

No Asbestos

**B00E - R0003 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0004 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00E/R0012/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

**B00E - R0005 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00F/R0012/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

**B00E - R0006 - P.E. Store**

No Asbestos

**B00E - R0007 - Music Store**

No Asbestos

**B00E - R0008 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00F/R0012/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

**B00E - R0009 - Canteen**

No Asbestos

**B00E - R0010 - Canteen Office/Store**

No Asbestos

**B00E - R0011 - Staff Toilet**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00F/R0012/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
<b>B00E - R0012 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00E/R0012/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
<b>B00E - R0013 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00E/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
<b>B00E - R0014 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00E/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
<b>B00E - R0015 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00E/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
<b>B00E - R0016 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00E - R0017 - Stairs</b>						
No Asbestos						
<b>B00E - R1001 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00F/R0012/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
<b>B00E - R1002 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00F/R0012/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	
<b>B00E - R1003 - Movement</b>						
No Asbestos						
<b>B00E - R1004 - Library Office/Workroom</b>						
No Asbestos						
<b>B00E - R1005 - Library Office/Workroom</b>						
No Asbestos						
<b>B00E - R1006 - Communications Room</b>						
No Asbestos						
<b>B00E - R1007 - Reading Area</b>						
No Asbestos						
<b>B00E - R1008 - Movement</b>						
No Asbestos						
<b>B00E - R1009 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B00E/R0015/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
<b>B00E - R1010 - Stairs</b>						
No Asbestos						
<b>B00E - R1011 - Stairs</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning/Pupil Facilities - 1950 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00F/Gable Verge Lining/S29				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - No ceiling void access point.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00F - R0001 - Practical Activities - 1hb**

No Asbestos

**B00F - R0002 - Home Base**

No Asbestos

**B00F - R0004 - Home Base**

No Asbestos

**B00F - R0005 - Practical Activities - 1hb**

No Asbestos

**B00F - R0006 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0007 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0008 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0009 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0010 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00A/R0004/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

**B00F - R0011 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	2.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00F/R0011/Partition Walls (Cubicles)/S30				Chrysotile (white asbestos)	

**B00F - R0012 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00F/R0012/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)	

**B00F - R0013 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0014 - Movement**

No Asbestos

**B00F - R0015 - Home Base Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - R0016 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning/Other-D.E.C. Admin - 1908 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Inaccessible due to height</b>					
Ceiling Voids	Non Accessible Area - No access due to height restrictions. Access point is above 4 metres.					
Underfloor Voids	No Asbestos Found					

**Interior****B00G - R0001 - Other-Vacant**

No Asbestos

**B00G - R0002 - Other-Vacant**

No Asbestos

**B00G - R0003 - Other-Vacant**

No Asbestos

**B00G - R0006 - Cleaning Distributed Store**

No Asbestos

**B00G - R0010 - Other - Regional Use**

No Asbestos

**B00G - R0011 - Other - Regional Use**

No Asbestos

**B00G - R0012 - Distribution Board**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	
	2056/B00G/R0012/Wall Linings Internal/S14	

**No Asbestos Detected****B00G - R0013 - Other - Regional Use**

No Asbestos

**B00G - R0014 - Other - Regional Use**

No Asbestos

**B00G - R0015 - Other - Regional Use**

No Asbestos

**B00G - R0016 - Other - Regional Use**

No Asbestos

**B00G - R0017 - Other - Regional Use**

No Asbestos

**B00G - R0018 - Other - Regional Use**

No Asbestos

**B00G - R0019 - Other - Regional Use**

No Asbestos

**B00G - R0020 - Other - Regional Use**

No Asbestos

**B00G - R0021 - Other - Regional Use**

No Asbestos

**B00G - R0022 - Movement**

No Asbestos

**B00G - R0023 - External Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Pupil Facilities - 1950 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Gable Ends	Compressed AC Sheet 2056/B00H/Gable Ends/S3					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 2056/B00H/R0002/Ceiling Structures/Linings/S4					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00H - R0001 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting 2056/B00H/R0002/Ceiling Structures/Linings/S4					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

**B00H - R0002 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting 2056/B00H/R0002/Ceiling Structures/Linings/S4					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Building Services - 1975 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	Non Accessible Area - No ceiling void access point.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B001 - R0001 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting	2056/B001/R0003/Ceiling Structures/Linings/S32				<b>No Asbestos Detected</b>
----------------------------	------------------	--	--	--	--	-----------------------------

**B001 - R0002 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting	2056/B001/R0003/Ceiling Structures/Linings/S32				<b>No Asbestos Detected</b>
----------------------------	------------------	--	--	--	--	-----------------------------

**B001 - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2056/B001/R0003/Ceiling Structures/Linings/S32				<b>No Asbestos Detected</b>
----------------------------	------------------	--	--	--	--	-----------------------------

In-fill-panel	Flat AC Sheeting	3m	Above roller door	Good Condition (1)	Low (1)	Low Priority (2-3)
2056/B001/R0003/In-fill-panel/S31						<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 1950 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2056/B00K/Ceiling Voids - Ceiling lining/S33			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids - Ceiling lining	Flat AC Sheeting	32m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2056/B00K/Ceiling Voids - Ceiling lining/S33			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00K - R0003 - Toilets - Girls**

No Asbestos

**B00K - R0004 - Toilets - Boys**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Storage - 2010 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - Garden Store**

No Asbestos

**B00L - R0002 - General Assistant/Bulk Store**

No Asbestos

**B00L - R0003 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

2056\_ASB\_100913\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017