


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Grafton Public School (2060)
Region : North Coast
State Electorate : Clarence
Local Government Area : Clarence Valley

Initial Survey : Noel Arnold & Associates : 22 - May - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Oct - 2015

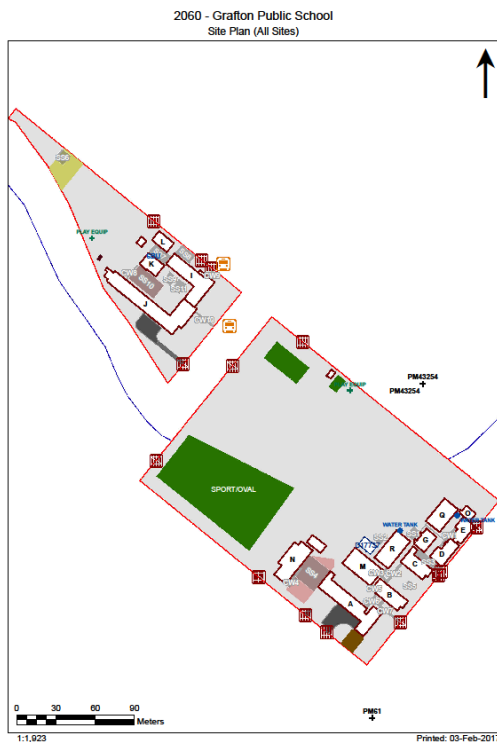

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/Gable Verge Lining/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00A - R0001 - Home Base (57.38 m2)**

No Asbestos

B00A - R0002 - Movement (5.87 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R0002/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00A - R0003 - Staff Kitchen (11.23 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R0002/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00A - R0004 - General Storeroom (11.39 m2)

No Asbestos

B00A - R0005 - Staff Room (85.99 m2)

No Asbestos

B00A - R0006 - External Movement (105.79 m2)

No Asbestos

B00A - R0007 - Kiln Room (10.03 m2)

No Asbestos

B00A - R0008 - Main Switch Board (4.94 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Electrical Backing Board	Resinous Board					No Asbestos Detected
	2060/B00A/R0008/Electrical Backing Board/S22					
Electrical Backing Board	Resinous Board	2Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2060/B00A/R0008/Electrical Backing Board/S21					Chrysotile (white asbestos)

B00A - R0009 - Disabled Toilet (4.16 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0010 - Cleaning Supplies (4.2 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0011 - Toilets - Boys (37.48 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R0011/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
B00A - R0012 - Toilets - Girls (37.48 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R0011/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	
B00A - R0013 - Canteen (27.94 m2)						
No Asbestos						
B00A - R0014 - Movement (3.99 m2)						
No Asbestos						
B00A - R0015 - Canteen Office/Store (3.39 m2)						
No Asbestos						
B00A - R0016 - Canteen Office/Store (3.08 m2)						
No Asbestos						
B00A - R0017 - Staff Toilet (3.29 m2)						
No Asbestos						
B00A - R0018 - External Movement (149.89 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0019 - Sports Store (11.94 m2)						
No Asbestos						
B00A - R0020 - Stairs (7.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R1001 - External Movement (79.35 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
2060/B00A/R1001/In-fill-panel/S7						
B00A - R1002 - Cleaning Distributed Store (4.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R1003 - Home Base (57.38 m2)						
No Asbestos						
B00A - R1004 - Home Base Store (6.92 m2)						
No Asbestos						
B00A - R1005 - Home Base (57.22 m2)						
No Asbestos						
B00A - R1006 - Home Base Store (5.79 m2)						
No Asbestos						
B00A - R1007 - Movement (15.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
2060/B00A/R1007/Floor Coverings Res/Textile/S8						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R1008 - Home Base (57.15 m2)						
No Asbestos						
B00A - R1009 - Home Base Store (5.81 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2060/B00A/R1007/Floor Coverings Res/Textile/S8					No Asbestos Detected	
B00A - R1010 - Home Base (57.08 m2)						
No Asbestos						
B00A - R1011 - Home Base Store (6.38 m2)						
No Asbestos						
B00A - R1012 - Sports Store (5.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R1013 - Sports Store (5.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R1014 - External Movement (9.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting					
2060/B00A/R1001/In-fill-panel/S7					No Asbestos Detected	
B00A - R1015 - External Stairs (15.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Administration - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/Gable Verge Lining/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00B - R0001 - Interview (35.07 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	4m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00B - R0002 - Movement (22.22 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0004 - Distribution Board (0.68 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0006 - Sick Bay (7.31 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1014/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00B - R0007 - Clerical Office (18.4 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0008 - Deputy Principal (17.28 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0009 - Entry Vestibule (11.27 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0010 - Principal (17.27 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0011 - Staff Toilet (2.07 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2060/B00A/R0008/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0012 - Plant (0.65 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1014/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00B - R0013 - Duplicating Workroom (13.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2060/B00A/R0008/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00B - R0014 - Deputy Principal (12.27 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2060/B00A/R0008/Ceiling Structures/Linings/S3				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00B - R0015 - Cleaning Distributed Store (1.99 m2)						
No Asbestos						
B00B - R0016 - External Movement (32.25 m2)						
No Asbestos						
B00B - R0017 - External Movement (2.18 m2)						
No Asbestos						
B00B - R0018 - General Storeroom (7.92 m2)						
No Asbestos						
B00B - R0019 - Cleaning Distributed Store (7.52 m2)						
No Asbestos						
B00B - R0020 - Movement (3.84 m2)						
No Asbestos						
B00B - R0021 - External Stairs (7.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
B00B - R0022 - Toilet - Lobby (3.51 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2060/B00B/R0023/Ceiling Structures/Linings/S42				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00B - R0023 - Staff Toilet (2.04 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2060/B00B/R0023/Ceiling Structures/Linings/S42				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00B - R0024 - Toilet - Lobby (4.06 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2060/B00B/R0023/Ceiling Structures/Linings/S42				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00B - R0025 - Staff Toilet (1.53 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2060/B00B/R0023/Ceiling Structures/Linings/S42				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00B - R1001 - External Movement (50.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
2060/B00A/R1001/In-fill-panel/S7						
B00B - R1002 - Movement (6.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles					
	2060/B00A/R1007/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00B - R1003 - Distribution Board (0.79 m2)						Note: No inspection of live electrical installation.
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	2060/B00A/R1007/Floor Coverings Res/Textile/S8					No Asbestos Detected
B00B - R1004 - Home Base (57.3 m2)						
No Asbestos						
B00B - R1005 - Home Base Store (5.81 m2)						
No Asbestos						
B00B - R1006 - Special Programs Room (57.15 m2)						
No Asbestos						
B00B - R1007 - Home Base Store (5.79 m2)						
No Asbestos						
B00B - R1008 - Movement (7.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	2060/B00A/R1007/Floor Coverings Res/Textile/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	2060/B00B/R1008/Wall Linings Internal/S10					No Asbestos Detected
B00B - R1009 - Movement (7.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00B - R1010 - Stairs (16.47 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - General Learning - 1971 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting 2060/B00A/Eaves Linings/S1	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 2060/B00A/Gable Verge Lining/S2	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Interior						
B00C - R0001 - General Storeroom (7.47 m2)						
No Asbestos						
B00C - R0002 - Movement (6.81 m2)						
Ceiling Structures/Linings	Vermiculite 2060/B00A/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
In-fill-panel	Flat AC Sheeting 2060/B00A/R1001/In-fill-panel/S7					No Asbestos Detected
B00C - R0003 - Distribution Board (0.86 m2)						
				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board 2060/B00C/R0003/Electrical Backing Board/S23	1Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0004 - Home Base (57.22 m2)						
Ceiling Structures/Linings	Vermiculite 2060/B00A/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0005 - Home Base Store (5.79 m2)						
Ceiling Structures/Linings	Vermiculite 2060/B00A/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 2060/B00A/R1014/Floor Coverings Res/Textile/S9	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0006 - Toilets - Boys (30.48 m2)						
Ceiling Structures/Linings	Vermiculite 2060/B00A/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 2060/B00A/R0011/Partition Walls (Cubicles)/S5	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0007 - Toilets - Girls (30.58 m2)						
Ceiling Structures/Linings	Vermiculite 2060/B00A/R0008/Ceiling Structures/Linings/S3					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 2060/B00A/R0011/Partition Walls (Cubicles)/S5	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0008 - External Movement (61.92 m2)						
In-fill-panel	Flat AC Sheeting 2060/B00A/R1001/In-fill-panel/S7					No Asbestos Detected
B00C - R0009 - External Movement (9.87 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0010 - General Storeroom (7.35 m2)						
No Asbestos						
B00C - R0011 - External Stairs (7.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00C - R1001 - Movement (6.88 m2)						
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
2060/B00A/R1001/In-fill-panel/S7						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
2060/B00A/R1007/Floor Coverings Res/Textile/S8						
B00C - R1002 - Distribution Board (0.81 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
2060/B00A/R1007/Floor Coverings Res/Textile/S8						
Electrical Backing Board	Resinous Board	1Unit	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2060/B00C/R1002/Electrical Backing Board/S24					Chrysotile (white asbestos)	
B00C - R1003 - Home Base (57.15 m2)						
No Asbestos						
B00C - R1004 - Home Base Store (5.83 m2)						
No Asbestos						
B00C - R1005 - External Movement (42.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
2060/B00A/R1001/In-fill-panel/S7						
B00C - R1006 - Home Base (57.14 m2)						
No Asbestos						
B00C - R1007 - Home Base Store (5.77 m2)						
No Asbestos						
B00C - R1008 - Movement (7.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
2060/B00A/R1007/Floor Coverings Res/Textile/S8						
B00C - R1009 - Stairs (16.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1971 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	Flat AC Sheeting Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2060/B00D/Underfloor Voids/S19				Chrysotile (white asbestos)	

Interior**B00D - R0009 - External Movement (1.47 m2)**

No Asbestos

B00D - R0010 - Home Base (55.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0010/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0010/Wall Linings Internal/S26				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0011 - Withdrawal Space - 1hb (16.94 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0011/Ceiling Structures/Linings/S27				Chrysotile (white asbestos)	

B00D - R0012 - Practical Activities - 2hb (12.71 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0012/Ceiling Structures/Linings/S28				Chrysotile (white asbestos)	

B00D - R0013 - Home Base Store (6.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0013/Ceiling Structures/Linings/S29				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0014 - Home Base Store (6.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0014/Ceiling Structures/Linings/S30				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0015 - Home Base (55.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0015/Ceiling Structures/Linings/S31				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	40m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0015/Wall Linings Internal/S32				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00D - R0016 - Movement (8.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0016/Ceiling Structures/Linings/S33				Chrysotile (white asbestos)	

B00D - R0017 - Withdrawal Space - 1hb (9.32 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0017/Ceiling Structures/Linings/S34				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0018 - External Movement (31.65 m2)						

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Support Unit - 1971 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	22m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00E - R0001 - Practical Activities - 1hb (10.95 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0006/Wall Linings Internal/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00E/R0001/Ceiling Structures/Linings/S35				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00E - R0002 - Withdrawal Space - 1hb (33.55 m2)

Wall Linings Internal	Flat AC Sheeting	22m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0006/Wall Linings Internal/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00E/R0002/Ceiling Structures/Linings/S36				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00E - R0006 - Home Base - S (44.49 m2)

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0006/Wall Linings Internal/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00E/R0006/Ceiling Structures/Linings/S37				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00E - R0007 - Home Base Store - M (6.22 m2)

Wall Linings Internal	Flat AC Sheeting	6m2	East, West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Wall Linings Internal/S11				Chrysotile (white asbestos)	

B00E - R0008 - External Movement (1.46 m2)

No Asbestos

B00E - R0009 - External Movement (50.61 m2)

No Asbestos

B00E - R0010 - Practical Activities/Movement - 1hb (16.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00E/R0010/Ceiling Structures/Linings/S40				Chrysotile (white asbestos)	

B00E - R0011 - Practical Activities/Movement - 1hb (17.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00E/R0010/Ceiling Structures/Linings/S40				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1971 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	22m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00G - R0001 - Home Base (53.78 m2)**

Wall Linings Internal	Flat AC Sheeting					
	2060/B00O/R0005/Wall Linings Internal/S14				No Asbestos Detected	

B00G - R0002 - Home Base Store (5.72 m2)

No Asbestos

B00G - R0003 - Practical Activities - 1hb (14.59 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0006/Wall Linings Internal/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	

B00G - R0004 - Withdrawal Space - 1hb (14.7 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0006/Wall Linings Internal/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0005 - Home Base (53.85 m2)

Wall Linings Internal	Flat AC Sheeting					
	2060/B00O/R0005/Wall Linings Internal/S14				No Asbestos Detected	

B00G - R0006 - External Stairs (2.56 m2)

No Asbestos

B00G - R0007 - External Stairs (2.56 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 1971 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00H - R0001 - Garden Store (35.45 m2)

No Asbestos

B00H - R0002 - General Assistant/Bulk Store (22.24 m2)

No Asbestos

B00H - R0003 - Sports Store (11.04 m2)

No Asbestos

B00H - R0004 - General Assistant/Bulk Store (18.89 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/Gable Verge Lining/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B001 - R0001 - Toilets - Boys/Girls (6.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2060/B00B/R1008/Wall Linings Internal/S10					

B001 - R0002 - Home Base Store (3.36 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B001/R0009/Floor Coverings Res/Textile/S15					

B001 - R0003 - Movement (3.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B001/R0009/Floor Coverings Res/Textile/S15					

B001 - R0004 - Home Base (86.04 m2)

No Asbestos

B001 - R0007 - Home Base (57.16 m2)

No Asbestos

B001 - R0008 - Home Base Store (4.54 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2060/B00B/R1008/Wall Linings Internal/S10					
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B001 - R0009 - Movement (8.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B001/R0009/Floor Coverings Res/Textile/S15					

B001 - R0010 - Movement (6.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B001/R0009/Floor Coverings Res/Textile/S15					

B001 - R0011 - Distribution Board (0.99 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B001/R0011/Wall Linings Internal/S39					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B001/R0011/Ceiling Structures/Linings/S38					Chrysotile (white asbestos) , Amosite (brown asbestos)

B001 - R0012 - Home Base Store (3.17 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
---------	----------------------	--------	--------------------	--------------------	-------------	------------------

Sample No				Test Result		
-----------	--	--	--	-------------	--	--

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting					
	2060/B00B/R1008/Wall Linings Internal/S10				No Asbestos Detected	

B00I - R0014 - Home Base (86.29 m2)						
No Asbestos						

B00I - R0015 - Home Base (57.31 m2)						
No Asbestos						

B00I - R0016 - Home Base Store (4.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting					
	2060/B00B/R1008/Wall Linings Internal/S10				No Asbestos Detected	

B00I - R0017 - Movement (9.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	2060/B00I/R0009/Floor Coverings Res/Textile/S15				No Asbestos Detected	

B00I - R0018 - External Movement (133.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	134m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

In-fill-panel	Flat AC Sheeting					
	2060/B00A/R1001/In-fill-panel/S7				No Asbestos Detected	

B00I - R0019 - External Movement (32.75 m2)						
No Asbestos						

B00I - R0020 - Handwashing Facilities (1.55 m2)						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00I - R0021 - Toilets - Boys/Girls (1.59 m2)						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00I/R0021/Wall Linings Internal/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Administration/General Learning - 1971 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 2060/B00A/Eaves Linings/S1	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 2060/B00A/Gable Verge Lining/S2	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00J - R0001 - External Movement (43.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2060/B00A/R1001/Ceiling Structures/Linings/S6	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 2060/B00A/R1001/In-fill-panel/S7					No Asbestos Detected

B00J - R0002 - Entry Vestibule (20.75 m2)

No Asbestos

B00J - R0003 - Duplicating Workroom (11.1 m2)

No Asbestos

B00J - R0004 - Cleaning Distributed Store (2.52 m2)

Wall Linings Internal	Flat AC Sheeting 2060/B00B/R1008/Wall Linings Internal/S10					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00J - R0005 - Deputy Principal (11.64 m2)

No Asbestos

B00J - R0006 - Movement (3.19 m2)

No Asbestos

B00J - R0007 - Clerical Office (17.63 m2)

No Asbestos

B00J - R0008 - Interview (10.39 m2)

No Asbestos

B00J - R0009 - Staff Room (52.8 m2)

No Asbestos

B00J - R0010 - General Storeroom (3.26 m2)

No Asbestos

B00J - R0011 - Sick Bay (16.42 m2)

No Asbestos

B00J - R0012 - Sick Bay - Shower/Toilet (1.79 m2)

Wall Linings Internal	Flat AC Sheeting 2060/B00B/R1008/Wall Linings Internal/S10					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00J - R0013 - Movement (9.84 m2)

No Asbestos

B00J - R0014 - Main Switch Board (3.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2060/B00A/R1001/Ceiling Structures/Linings/S6	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 2060/B00B/R1008/Wall Linings Internal/S10					No Asbestos Detected

B00J - R0017 - External Movement (129.05 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	129m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	2060/B00A/R1001/In-fill-panel/S7					
B00J - R0018 - Home Base (57.16 m2)						
No Asbestos						
B00J - R0019 - Home Base Store (4.53 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2060/B00B/R1008/Wall Linings Internal/S10					
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
B00J - R0020 - Withdrawal Space - 1hb (10.95 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
B00J - R0021 - Movement (7.3 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
B00J - R0022 - Home Base Store (5.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2060/B00B/R1008/Wall Linings Internal/S10					
B00J - R0023 - Home Base (57.01 m2)						
No Asbestos						
B00J - R0024 - General Storeroom (12.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
B00J - R0025 - General Storeroom (5.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00J - R0026 - Canteen Office/Store (3.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00J/R0026/Floor Coverings Res/Textile/S17					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R0027 - Canteen Office/Store (3.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00J/R0026/Floor Coverings Res/Textile/S17					
B00J - R0028 - Canteen (21.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00J/R0028/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00J - R0029 - Home Base (56.93 m2)						
No Asbestos						
B00J - R0030 - Home Base Store (3.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2060/B00B/R1008/Wall Linings Internal/S10					
B00J - R0031 - Distribution Board (0.99 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00J - R0032 - Movement (18.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
B00J - R0033 - Home Base Store (4.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2060/B00B/R1008/Wall Linings Internal/S10					
B00J - R0034 - Home Base (57.32 m2)						
No Asbestos						
B00J - R0035 - Home Base (57.1 m2)						
No Asbestos						
B00J - R0036 - Home Base Store (4.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2060/B00B/R1008/Wall Linings Internal/S10					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00J - R0037 - Movement (18.5 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00J - R0038 - Home Base Store (4.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	2060/B00I/R0009/Floor Coverings Res/Textile/S15					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					
	2060/B00B/R1008/Wall Linings Internal/S10					No Asbestos Detected
B00J - R0039 - Home Base (57.01 m2)						
No Asbestos						
B00J - R0040 - Sports Store (13.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00J - R0041 - Sports Store (11.94 m2)						
Wall Linings Internal	Flat AC Sheeting					
	2060/B00B/R1008/Wall Linings Internal/S10					No Asbestos Detected
B00J - R0042 - Toilet - Lobby (1.27 m2)						
No Asbestos						
B00J - R0043 - Staff Toilet (1.56 m2)						
No Asbestos						
B00J - R0044 - Staff Toilet (1.76 m2)						
No Asbestos						
B00J - R0045 - Toilet - Lobby (1.42 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1971 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/Gable Verge Lining/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00K - R0001 - Toilets - Boys (44.04 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R0011/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)

B00K - R0002 - Plant (16.02 m2)

No Asbestos

B00K - R0003 - Toilets - Girls (44.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R0011/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)

B00K - R0004 - Garden Store (5.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00K - R0006 - Disabled Toilet (8.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B00K - R0007 - External Movement (34.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1971 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00L - R0001 - Reading Area (44.23 m2)**

Wall Linings Internal	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0006/Wall Linings Internal/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00L - R0002 - Practical Activities - 1hb (31.69 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Wall Linings Internal/S11				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0004/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)	

B00L - R0003 - Home Base (44.56 m2)

Wall Linings Internal	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2060/B00D/R0006/Wall Linings Internal/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00L - R0004 - General Storeroom (2.09 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Library - 1997 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - External Movement (143.49 m2)

No Asbestos

B00M - R0002 - K.L.A. Store (13.18 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0003 - Library Office/Workroom (25.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0004 - Reading Area (227.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0005 - Distribution Board (1.7 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities - 1997 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - Disabled Toilet (5.09 m2)

No Asbestos

B00N - R0002 - Cleaning Distributed Store (3.04 m2)

No Asbestos

B00N - R0003 - Communal Space (212.04 m2)

No Asbestos

B00N - R0004 - Plant (0.5 m2)

No Asbestos

B00N - R0005 - Music Store (15.84 m2)

No Asbestos

B00N - R0006 - Hall Chair Store (10.96 m2)

No Asbestos

B00N - R0008 - Shower/Change (2.02 m2)

No Asbestos

B00N - R0009 - Movement (6.98 m2)

No Asbestos

B00N - R0010 - Raised Platform (35.06 m2)

No Asbestos

B00N - R0011 - Movement (6.72 m2)

No Asbestos

B00N - R0013 - Distribution Board (0.36 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0014 - General Assistant/Bulk Store (36.31 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00N - R0015 - General Assistant/Bulk Store (13.46 m2)

No Asbestos

B00N - R0016 - Cleaning Supplies (13.42 m2)

No Asbestos

B00N - R0017 - General Storeroom (13.37 m2)

No Asbestos

B00N - R0018 - External Movement (15.74 m2)

No Asbestos

B00N - R0019 - Toilets - Boys (6.13 m2)

No Asbestos

B00N - R0020 - Toilet - Lobby (1.06 m2)

No Asbestos

B00N - R0021 - Toilet - Lobby (1.7 m2)

No Asbestos

B00N - R0022 - Toilets - Girls (6.89 m2)

No Asbestos

B00N - R9001 - General Storeroom (35.73 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 2005 - Brick/Veneer (Brick/Veneer)

Exterior

Wall Cladding	Flat AC Sheeting 2060/B000/R0005/Wall Linings Internal/S14					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2060/B000/Eaves Linings/S20	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B000 - R0001 - Special Programs Store (8.04 m2)

No Asbestos

B000 - R0004 - Cleaning Distributed Store (1.66 m2)

No Asbestos

B000 - R0006 - External Movement (2.51 m2)

No Asbestos

B000 - R0007 - Special Programs Room (54.94 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Communal Facilities - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00P - R0001 - Sports Store (22.57 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00Q - General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00Q - R0001 - External Movement (52.1 m2)

No Asbestos

B00Q - R0002 - Practical Activities - 1hb (19.43 m2)

No Asbestos

B00Q - R0003 - Home Base Store (6.29 m2)

No Asbestos

B00Q - R0004 - Home Base (60.71 m2)

No Asbestos

B00Q - R0005 - Withdrawal Space - 2hb (11.56 m2)

No Asbestos

B00Q - R0006 - Home Base (60.83 m2)

No Asbestos

B00Q - R0007 - Home Base Store (6.16 m2)

No Asbestos

B00Q - R0008 - Practical Activities - 1hb (19.26 m2)

No Asbestos

B00Q - R0009 - Distribution Board (0.45 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00Q - R0010 - Sports Store (12.78 m2)

No Asbestos

B00Q - R0011 - General Assistant/Bulk Store (15.71 m2)

No Asbestos

B00Q - R0012 - Garden Store (12.81 m2)

No Asbestos

B00Q - R9001 - Other (175.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00R - R0001 - External Movement (65.27 m2)

No Asbestos

B00R - R0002 - Cleaning Distributed Store (4.21 m2)

No Asbestos

B00R - R0003 - Special Programs Store (5.07 m2)

No Asbestos

B00R - R0004 - Special Programs Room (38.45 m2)

No Asbestos

B00R - R0005 - Home Base (67.23 m2)

No Asbestos

B00R - R0006 - Home Base Store (5.9 m2)

No Asbestos

B00R - R0007 - Practical Activities/Movement - 2hb (38.83 m2)

No Asbestos

B00R - R0008 - Access Shower/Toilet (6 m2)

No Asbestos

B00R - R0009 - Laundry - S (4.99 m2)

No Asbestos

B00R - R0010 - Disabled Shower/Toilet (18.76 m2)

No Asbestos

B00R - R0011 - Home Base (67.49 m2)

No Asbestos

B00R - R0012 - Home Base Store (5.78 m2)

No Asbestos

B00R - R0013 - Distribution Board (0.46 m2)

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00S - R0001 - General Assistant/Bulk Store (29.97 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Added Building

Exterior

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+2 - Added Building

Exterior

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+3 - Added Building

Exterior

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 621 - D17737 - Single Learning Unit - H/Cap : Placement Date - 14/01/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Home Base-I.O.

No Asbestos Found.

R2 - Toilets-Disabled

No Asbestos Found.

R3 - Laundry

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017