


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Granville Public School (2064)
Region : South Western Sydney
State Electorate : Granville
Local Government Area : Parramatta

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Grencap-NAA : 29 - May - 2015

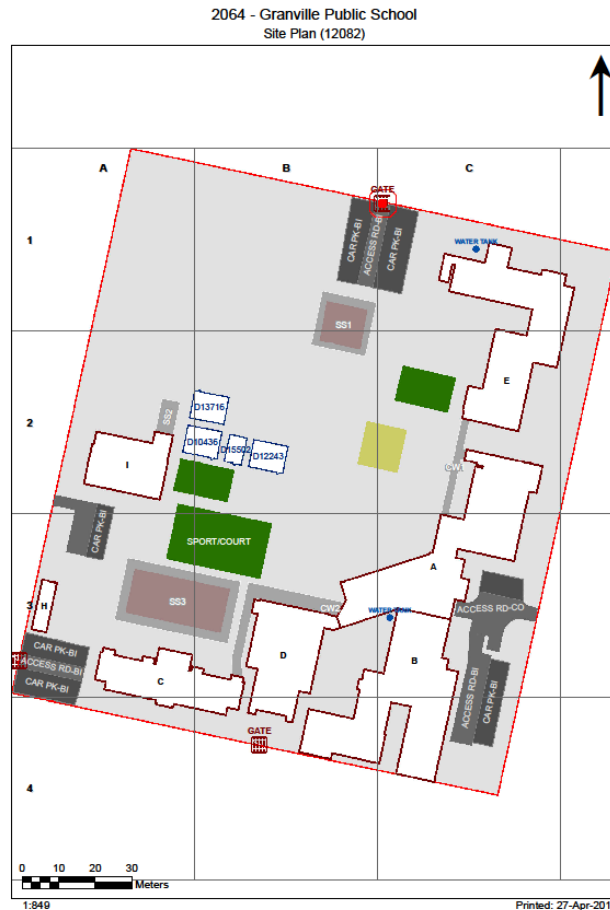

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Area inaccessible

Underfloor Voids - Slab on Ground

Interior

B00A - R0001 - Movement (14.06 m2)

No Asbestos

B00A - R0002 - Clerical Office (13.03 m2)

Ceiling Structures/Linings Vermiculite
 2064/B00A/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Adhesive
 2064/B00A/R0027/Floor Coverings Res/Textile/S9 **No Asbestos Detected**

Floor Coverings Res/Textile Vinyl Tiles 13.03m2 West Good Condition (1) Low (1) Low Priority (2-3)
 2064/B00A/R0006/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0003 - Entry Vestibule (12.92 m2)

Ceiling Structures/Linings Vermiculite
 2064/B00A/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Adhesive
 2064/B00A/R0027/Floor Coverings Res/Textile/S9 **No Asbestos Detected**

Floor Coverings Res/Textile Vinyl Tiles 12.92m2 West Good Condition (1) Low (1) Low Priority (2-3)
 2064/B00A/R0006/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0004 - Clerical Office/Workroom (15.6 m2)

Ceiling Structures/Linings Vermiculite
 2064/B00A/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Adhesive
 2064/B00A/R0027/Floor Coverings Res/Textile/S9 **No Asbestos Detected**

Floor Coverings Res/Textile Vinyl Tiles 15.6m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 2064/B00A/R0006/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0005 - Duplicating Workroom (15.55 m2)

Ceiling Structures/Linings Vermiculite
 2064/B00A/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Adhesive
 2064/B00A/R0027/Floor Coverings Res/Textile/S9 **No Asbestos Detected**

Floor Coverings Res/Textile Vinyl Tiles 15.6m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 2064/B00A/R0006/Floor Coverings Res/Textile/S2 **Chrysotile (white asbestos)**

B00A - R0006 - Staff Room (103.38 m2)

Ceiling Structures/Linings Vermiculite
 2064/B00A/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	103.38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2064/B00A/R0027/Floor Coverings Res/Textile/S9					
B00A - R0007 - Community Clinic (16.33 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2064/B00A/R0003/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2064/B00A/R0027/Floor Coverings Res/Textile/S9					
Floor Coverings Res/Textile	Vinyl Tiles	16.33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0008 - Movement (46.86 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2064/B00A/R0003/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2064/B00A/R0027/Floor Coverings Res/Textile/S9					
B00A - R0009 - Community Clinic (18.29 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2064/B00A/R0003/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	19m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2064/B00A/R0027/Floor Coverings Res/Textile/S9					
B00A - R0010 - Movement (302.94 m2)						
No Asbestos						
B00A - R0011 - Canteen (44.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	45m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2064/B00A/R0027/Floor Coverings Res/Textile/S9					
B00A - R0012 - Staff Toilet (3.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2064/B00A/R0027/Floor Coverings Res/Textile/S9					
B00A - R0013 - Canteen Office/Store (5.86 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	2064/B00A/R0027/Floor Coverings Res/Textile/S9					No Asbestos Detected
B00A - R0014 - Canteen Office/Store (3.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0015 - Drinking Facilities (4.73 m2)						
No Asbestos						
B00A - R0016 - Garden Store (3.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
B00A - R0017 - Toilets - Boys (37.63 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
B00A - R0018 - Toilets - Girls (40.24 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
B00A - R0019 - Sports Store (12.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
B00A - R0020 - Staff Toilet (11.04 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2064/B00A/R0003/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
B00A - R0021 - Staff Toilet (7.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2064/B00A/R0003/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
B00A - R0022 - Cleaning Supplies (10.86 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2064/B00A/R0003/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive					
	2064/B00A/R0027/Floor Coverings Res/Textile/S9					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles	10.86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0023 - Sick Bay (8.7 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 2064/B00A/R0027/Floor Coverings Res/Textile/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles 2064/B00A/R0006/Floor Coverings Res/Textile/S2	8.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R0024 - Deputy Principal (13 m2)						
Ceiling Structures/Linings	Vermiculite 2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 2064/B00A/R0027/Floor Coverings Res/Textile/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles 2064/B00A/R0006/Floor Coverings Res/Textile/S2	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R0025 - Principal (20.83 m2)						
Ceiling Structures/Linings	Vermiculite 2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 2064/B00A/R0027/Floor Coverings Res/Textile/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles 2064/B00A/R0006/Floor Coverings Res/Textile/S2	20.83m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R0026 - Staff Room Annexe (12.85 m2)						
Ceiling Structures/Linings	Vermiculite 2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 2064/B00A/R0027/Floor Coverings Res/Textile/S9				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles 2064/B00A/R0006/Floor Coverings Res/Textile/S2	12.85m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R0027 - Main Switch Board (3.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2064/B00A/R0006/Floor Coverings Res/Textile/S2	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Electrical Mounting Board	Resinous Board 2064/B00A/R0027/Electrical Mounting Board/S8	0.2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 2064/B00A/R0027/Floor Coverings Res/Textile/S9				No Asbestos Detected	
B00A - R0028 - Security Store (23.09 m2)						
Ceiling Structures/Linings	Vermiculite 2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 2064/B00A/R0006/Floor Coverings Res/Textile/S2	24m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	2064/B00A/R0027/Floor Coverings Res/Textile/S9				No Asbestos Detected	
B00A - R0029 - Stairs (16.31 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
B00A - R0030 - Lift (2.97 m2)						
No Asbestos						
B00A - R0031 - Movement (6.79 m2)						
No Asbestos						
B00A - R1001 - Reading Area (250.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1002 - Library Office/Workroom (12.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1003 - Communications Room (14.26 m2)						
Ceiling Structures/Linings	Vermiculite					
	2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1004 - Library Office/Workroom (8.55 m2)						
No Asbestos						
B00A - R1005 - Library Office/Workroom (22.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - Toilets - Girls (3.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - Toilets - Boys (3.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	2064/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - Cleaning Supplies (12.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	13m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
B00A - R1009 - Distribution Board (0.6 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0006/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
B00A - R1010 - Movement (36.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1011 - Seminar/Study (13.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	2064/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1012 - Seminar/Study (13.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	2064/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1013 - Stairs (15.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Support Unit - 1880 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Movement (22.87 m2)

No Asbestos

B00B - R0002 - Movement (1.94 m2)

No Asbestos

B00B - R0003 - Movement (7.63 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00B/R0007/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	7.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00B/R0004/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0004 - No Access (2.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00B/R0007/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	2.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00B/R0004/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0005 - Home Base (55.34 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	2064/B00B/R0005/Floor Coverings Res/Textile/S12				No Asbestos Detected	

B00B - R0006 - Home Base (41.2 m2)

No Asbestos

B00B - R0007 - Practical Activities - 1hb (13.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00B/R0007/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B00B - R0008 - Withdrawal Space - 1hb (6.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00B/R0007/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B00B - R0009 - Home Base (55.24 m2)

No Asbestos

B00B - R0010 - Special Programs Room (55.01 m2)

No Asbestos

B00B - R0011 - Movement (32.69 m2)

Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00B/R0011/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00B - R0012 - Home Base (46.53 m2)

No Asbestos

B00B - R0013 - Home Base (47.04 m2)

No Asbestos

B00B - R0014 - Home Base (70.73 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R0015 - Movement (64.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00B/R0015/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	64.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00B/R0020/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00B - R0016 - Movement (5.75 m2)

No Asbestos

B00B - R0017 - Movement (9.06 m2)

No Asbestos

B00B - R0018 - Staff Room Annexe (21.54 m2)

No Asbestos

B00B - R0019 - Interview (22.74 m2)

Floor Coverings Res/Textile	Vinyl Tiles	22.74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00B/R0007/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	

B00B - R0020 - Movement (1.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00B/R0020/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00B - R0023 - Cleaning Distributed Store (3.69 m2)

No Asbestos

B00B - R0024 - Movement (50.7 m2)

No Asbestos

B00B - R0025 - Withdrawal - M (7.55 m2)

No Asbestos

B00B - R0026 - Home Base - M (45.33 m2)

No Asbestos

B00B - R0027 - Home Base Store - M (7.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00B/R0007/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	

B00B - R0028 - Home Base Store - M (12.32 m2)

No Asbestos

B00B - R0029 - Practical Activities - M - 1hb (12.51 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00B/R0007/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	

B00B - R0030 - Toilet - M (5.6 m2)

No Asbestos

B00B - R0031 - Staff Room Annexe (10.68 m2)

No Asbestos

B00B - R0032 - General Storeroom (7.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles	NA	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00B/R0007/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	

B00B - R0033 - Withdrawal - M (6.78 m2)

No Asbestos

B00B - R0034 - Home Base - M (44.2 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0035 - Practical Activities - M - 1hb (14.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00B/R0007/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00B - R0036 - Toilet - M (5.6 m2)						
No Asbestos						
B00B - R0037 - Disabled Toilet (12.51 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1936 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00C - R0001 - Movement (2.64 m2)

No Asbestos

B00C - R0002 - Movement (8.77 m2)

No Asbestos

B00C - R0003 - Movement (85.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	2064/B00C/R0003/Floor Coverings Res/Textile/S7					No Asbestos Detected

B00C - R0004 - Home Base (46.94 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected

B00C - R0005 - Home Base (47.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected

B00C - R0006 - Movement (5.88 m2)

No Asbestos

B00C - R0007 - Home Base (47.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected

B00C - R0008 - Home Base (47.46 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected

B00C - R0009 - Cleaning Distributed Store (5.45 m2)

No Asbestos

B00C - R0010 - Movement (8.69 m2)

No Asbestos

B00C - R0011 - Movement (2.68 m2)

No Asbestos

B00C - R0012 - Movement (2.65 m2)

No Asbestos

B00C - R0013 - Toilets - Girls (8.98 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00C - R0014 - Interview (13.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected

B00C - R0015 - Toilets - Boys (9.91 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2064/B00A/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0016 - Movement (2.67 m2)						
No Asbestos						
B00C - R0017 - Cleaning Distributed Store (5.45 m2)						
No Asbestos						
B00C - R0018 - Stairs (4.02 m2)						
No Asbestos						
B00C - R0019 - Stairs (4.02 m2)						
No Asbestos						
B00C - R1001 - Movement (88.17 m2)						
No Asbestos						
B00C - R1002 - Home Base (49.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected	
B00C - R1003 - Home Base (48.54 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected	
B00C - R1004 - Security Store (21.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2064/B00C/R0003/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B00C - R1005 - Home Base (48.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected	
B00C - R1006 - Home Base (48.26 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected	
B00C - R1007 - Toilets - Girls (9.2 m2)						
No Asbestos						
B00C - R1008 - General Storeroom (15.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
2064/B00C/R0004/Floor Coverings Res/Textile/S16					No Asbestos Detected	
B00C - R1009 - Toilets - Boys (9.91 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00A/R0017/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00C - R1010 - Stairs (12.46 m2)						
No Asbestos						
B00C - R1011 - Stairs (12.46 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities/Building Services - 1959 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Wall Cladding	Flat AC Sheeting 2064/B00D/Wall Cladding/S15	4.m2	Southwest Corner	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - Movement (8.45 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00D - R0002 - Communal Space (329.8 m2)

Wall Linings Internal	Flat AC Sheeting	6m2	South side above stage	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Height Restriction
-----------------------	------------------	-----	------------------------	--------------------	---------	--

B00D - R0003 - Raised Platform (88.04 m2)

No Asbestos

B00D - R0004 - Staff Kitchen (10.03 m2)

No Asbestos

B00D - R0005 - Movement (2 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00D - R0006 - General Assistant/Bulk Store (14.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00D - R0007 - Toilets - Girls (6.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00D - R0008 - Cleaning Supplies (14.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00D - R0009 - Toilets - Boys (6.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00D - R0010 - Movement (2.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00D - R0011 - Movement (5.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2064/B00D/R0001/Ceiling Structures/Linings/S14	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Pupil Facilities - 1923 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - >8m high					
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Gable Verge Lining	Flat AC Sheeting	18m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Gable Verge Lining	Non Accessible Area - Height Restricted - >8m High					
Eaves Linings	Non Accessible Area - Height Restricted - >8m High					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - >8m high					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Withdrawal Space - 1hb (10.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						

Ceiling Structures/Linings	Non Accessible Area - Height Restricted - >8m High					
----------------------------	---	--	--	--	--	--

B00E - R0003 - Home Base (46.12 m2)

No Asbestos

B00E - R0005 - Home Base (64.97 m2)

No Asbestos

B00E - R0006 - Movement (169.58 m2)

No Asbestos

B00E - R0007 - Toilets - Girls (35.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00E/R0007/Ceiling Structures/Linings/S18				Chrysotile (white asbestos)		

B00E - R0008 - Toilets - Boys (36.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2064/B00E/R0007/Ceiling Structures/Linings/S18				Chrysotile (white asbestos)		

B00E - R0009 - Sports Store (8.82 m2)

No Asbestos

B00E - R0010 - Cleaning Distributed Store (1.4 m2)

No Asbestos

B00E - R0011 - Movement (3.62 m2)

No Asbestos

B00E - R0012 - Interview (18.3 m2)

No Asbestos

B00E - R0013 - Movement (120.26 m2)

No Asbestos

B00E - R0014 - Home Base (47.74 m2)

No Asbestos

B00E - R0015 - Home Base (47.33 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R0016 - Home Base (47.33 m2)

No Asbestos

B00E - R0017 - Movement (7.41 m2)

No Asbestos

B00E - R0019 - Practical Activities - 1hb (13.92 m2)

No Asbestos

B00E - R0020 - Staff Toilet (5.3 m2)

Floor Coverings Res/Textile

Vinyl Tiles

6m2

Throughout

Good Condition (1)

Low (1) Low Priority (2-3)

2064/B00B/R0007/Floor Coverings Res/Textile/S4

Chrysotile (white asbestos)

B00E - R0021 - General Storeroom (4.33 m2)

No Asbestos

B00E - R0022 - Movement (3.46 m2)

No Asbestos

B00E - R0023 - Stairs (2.01 m2)

No Asbestos

B00E - R0024 - Stairs (6.49 m2)

No Asbestos

B00E - R0025 - Home Base Store (8.71 m2)

No Asbestos

B00E - R0026 - Practical Activities - 1hb (7.11 m2)

No Asbestos

B00E - R0027 - Withdrawal Space - 1hb (10.9 m2)

No Asbestos

B00E - R1001 - Home Base (46.25 m2)

No Asbestos

B00E - R1002 - Home Base (45.99 m2)

No Asbestos

B00E - R1003 - Home Base (46.06 m2)

No Asbestos

B00E - R1004 - Cleaning Distributed Store (2.56 m2)

No Asbestos

B00E - R1005 - Practical Activities - 1hb (13.59 m2)

No Asbestos

B00E - R1006 - Movement (110.04 m2)

No Asbestos

B00E - R1007 - Home Base (49.27 m2)

No Asbestos

B00E - R1008 - Home Base (49.27 m2)

No Asbestos

B00E - R1009 - Home Base (49.27 m2)

No Asbestos

B00E - R1010 - Movement (7.61 m2)

No Asbestos

B00E - R1011 - General Storeroom (14.38 m2)

No Asbestos

B00E - R1012 - Practical Activities - 1hb (14.55 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - R1013 - Stairs (9.19 m2)

No Asbestos

B00E - R1014 - Stairs (10.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services/Administration - 1936 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 2064/B00H/Eaves Linings/S17					No Asbestos Detected
Underfloor Voids - Slab on Ground						
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior

B00H - R0001 - General Assistant/Bulk Store (28.93 m2)

No Asbestos

B00H - R0002 - General Storeroom (19.42 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Pre-School Facilities - 2004 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - Movement (2.23 m2)

No Asbestos

B00I - R0002 - Entry Vestibule (13.89 m2)

No Asbestos

B00I - R0003 - Security Store (8.59 m2)

No Asbestos

B00I - R0004 - General Storeroom - Pre (12.39 m2)

No Asbestos

B00I - R0005 - Home Base - Pre (68.95 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0006 - Practical Activities - Pre (46.29 m2)

No Asbestos

B00I - R0007 - Toilets - Boys/Girls - Pre (12.8 m2)

No Asbestos

B00I - R0008 - Laundry - Pre (4.54 m2)

No Asbestos

B00I - R0009 - Access Shower/Toilet - Type 2 (5.55 m2)

No Asbestos

B00I - R0010 - Cleaning Distributed Store (3.54 m2)

No Asbestos

B00I - R0011 - Kitchen - Pre (12.9 m2)

No Asbestos

B00I - R0012 - Clerical Office - Pre (12.42 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0013 - Clerical Office - Pre (8.65 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0014 - General Storeroom - Pre (20.54 m2)

No Asbestos

B00I - R0015 - Movement (69.34 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10436 - Learning Unit - Standard With P.A.A. : Placement Date - 8/07/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12243 - Learning Unit - Standard With P.A.A. : Placement Date - 1/02/2017

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 602 - D13716 - Learning Unit - Standard With P.A.A. : Placement Date - 1/02/2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 750 - D15502 - Learning Unit - ESL : Placement Date - 8/07/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.


Exterior

No Asbestos Found.

Interior

R1 - Esl

No Asbestos Found.

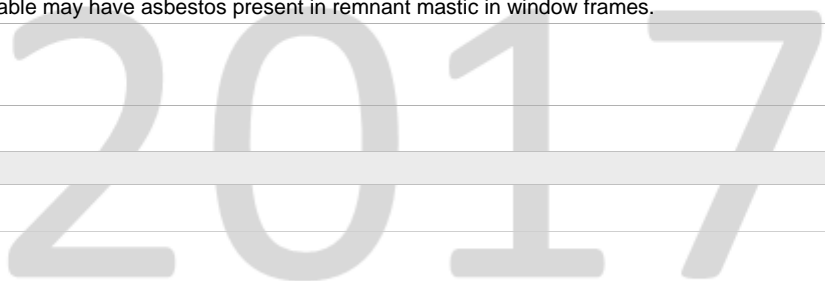

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2064_ASB_281112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017