


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Green Hill Public School (2071)
Region : North Coast
State Electorate : Oxley
Local Government Area : Kempsey

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Register Issue Date : 22 - Mar - 2017

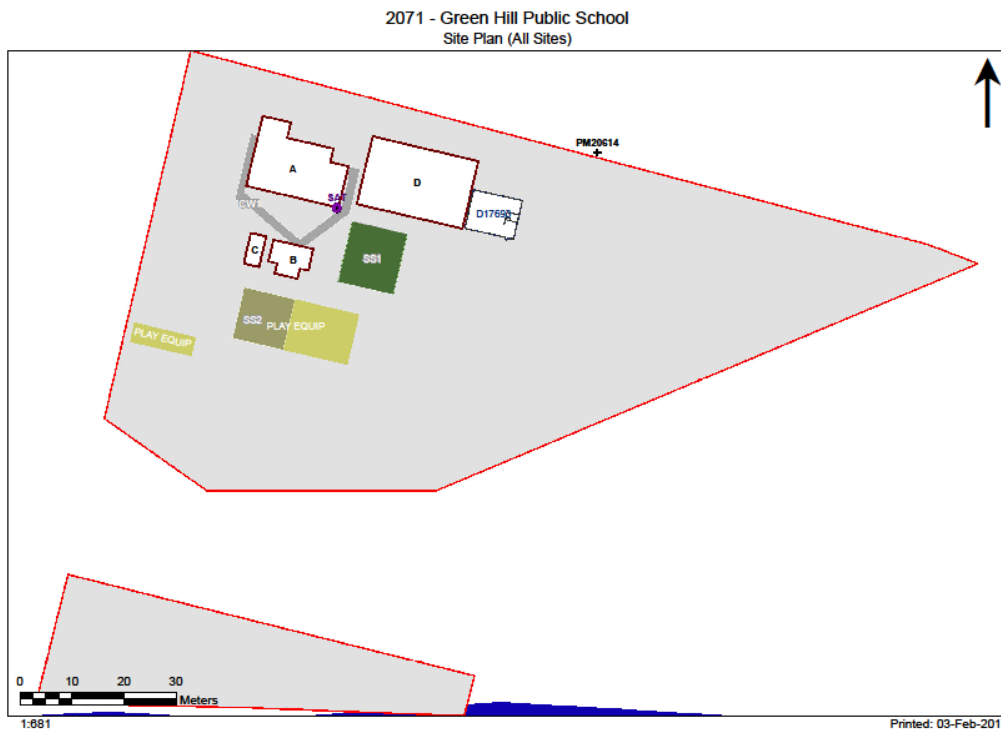

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Library - 1889 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2071/B00A/Eaves Linings/S8					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00A - R0002 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 2071/B00A/R0002/Wall Linings Internal/S7					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00A - R0003 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 2071/B00A/R0002/Wall Linings Internal/S7					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00A - R0005 - Home Base

Wall Linings Internal	Flat AC Sheeting 2071/B00A/R0005/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00A - R0006 - External Movement

No Asbestos

B00A - R0007 - Communal/Performance Store

No Asbestos

B00A - R0008 - Staff Room

Wall Linings Internal	Flat AC Sheeting 2071/B00A/R0005/Wall Linings Internal/S9					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00A - R0009 - Staff Room Annexe

No Asbestos

B00A - R0010 - External Movement

No Asbestos

B00A - R0011 - External Movement

No Asbestos

B00A - R0012 - External Movement

No Asbestos

B00A - R0013 - Home Base Store

No Asbestos

B00A - R0014 - Disabled Shower/Toilet

No Asbestos

B00A - R0015 - Movement

No Asbestos

B00A - R0016 - Movement

No Asbestos

B00A - R0017 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1977 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2071/B00B/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Flue	Fibre Cement Pipe	5m	South	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2071/B00B/Pipe/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00B - R0001 - Toilets - Boys

No Asbestos

B00B - R0002 - Toilets - Girls

Flue	Fibre Cement Pipe	3m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2071/B00B/R0002/Pipe/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2071/B00B/R0002/Partition Walls (Cubicles)/S3			Chrysotile (white asbestos)		

B00B - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2071/B00B/Eaves Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Building Services - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00C - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration/Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - External Movement

No Asbestos

B00D - R0002 - Clerical Office

No Asbestos

B00D - R0003 - Staff Toilet

No Asbestos

B00D - R0004 - Sick Bay

No Asbestos

B00D - R0005 - Security Store

No Asbestos

B00D - R0006 - Access Shower/Toilet

No Asbestos

B00D - R0007 - Movement

No Asbestos

B00D - R0008 - Staff Room

No Asbestos

B00D - R0009 - Staff Kitchen

No Asbestos

B00D - R0010 - Cleaning Distributed Store

No Asbestos

B00D - R0011 - Principal

No Asbestos

B00D - R0012 - Reading Area

No Asbestos

B00D - R0013 - Communications Cupboard

No Asbestos

B00D - R0014 - K.L.A. Store

No Asbestos

B00D - R0015 - Library Office/Workroom

No Asbestos

B00D - R0016 - Main Switch Board

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D17693 - Learning Unit - Standard With P.A.A. : Placement Date - 8/12/2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017