


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Grenfell Public School (2082)
Region : Western NSW
State Electorate : Cootamundra
Local Government Area : Weddin

Initial Survey : Noel Arnold & Associates : 02 - May - 2008
Reviewed By : Grencap-NAA : 08 - Dec - 2016

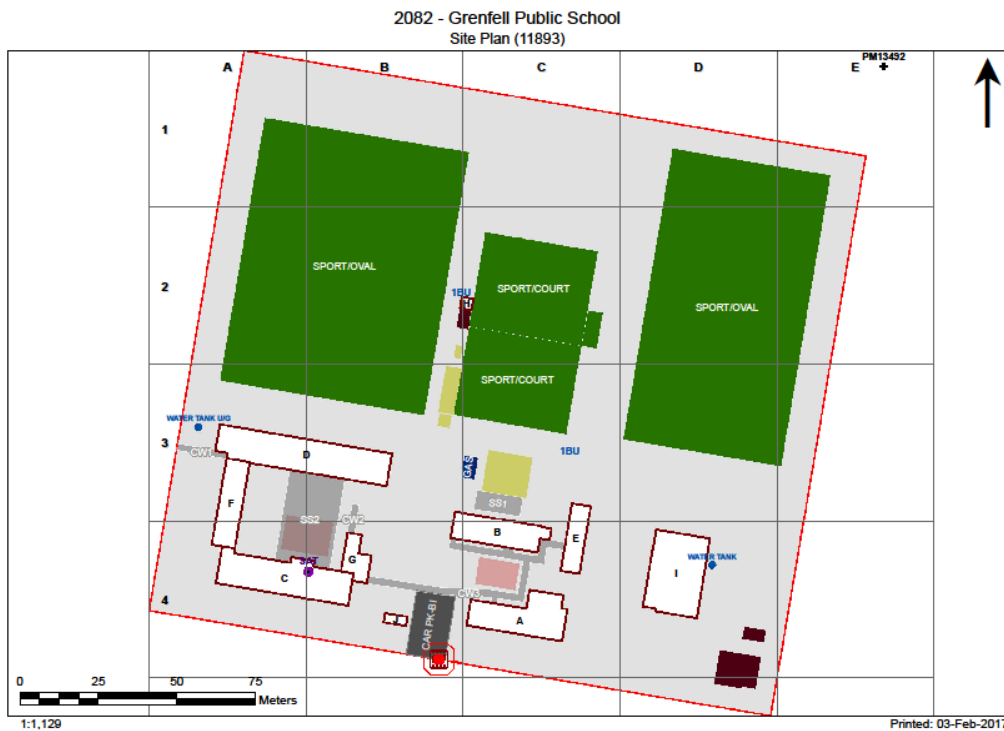

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - General Learning - 1964 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--|------------------------------|--|--|--|--|-----------------------------|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Window Beading | Caulking Material | | | | | No Asbestos Detected |
| | 2082/B00A/Window Beading/S16 | | | | | |
| Pitched Roof - Flat Roof - Void | No Asbestos Found | | | | | |
| Eaves Linings | No Asbestos Found | | | | | |

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Movement

| | | | | | | |
|----------------------------|---|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0012/Ceiling Structures/Linings/S8 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00A - R0003 - Personal Effects Storage

No Asbestos

B00A - R0004 - Toilets - Boys/Girls

No Asbestos

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Personal Effects Storage

No Asbestos

B00A - R0008 - Movement

| | | | | | | |
|----------------------------|---|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0012/Ceiling Structures/Linings/S8 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

| | | | | | | |
|---------------------------|------------------|-------|-------|--------------------|---------|--------------------|
| Electrical Mounting Board | Fibrous Membrane | 1Unit | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
|---------------------------|------------------|-------|-------|--------------------|---------|--------------------|

Assumed Asbestos - Electrical Hazard - Live

B00A - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Movement

| | | | | | | |
|----------------------------|---|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0012/Ceiling Structures/Linings/S8 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

| | | | | | | |
|---------------|----------------------------------|----|----------------------|---|---------|--------------------|
| In-fill-panel | Flat AC Sheeting | 3m | North, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0004/In-fill-panel/S9 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00A - R0012 - Staff Room Annexe

No Asbestos

B00A - R0013 - Staff Toilet

| | | | | | | |
|-------------|--|----------|-------|----------------------|---------|--------------------|
| Incinerette | Encapsulated Insulation material within unit | 1Unit(s) | South | Friable Asbestos (5) | Low (1) | Low Priority (2-3) |
|-------------|--|----------|-------|----------------------|---------|--------------------|

Assumed Asbestos - Cannot sample -Material encased

B00A - R0014 - Withdrawal Space - 1hb

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|--------------------|
| | Sample No | | | | | Test Result |

No Asbestos

B00A - R0015 - General Storeroom

No Asbestos

B00A - R0016 - General Storeroom

No Asbestos

B00A - R0017 - General Storeroom

No Asbestos

B00A - R0018 - Movement

No Asbestos

B00A - R0019 - Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00B - General Learning/Support Unit - 1964 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|--|---|------|--------------|--------------------|---|--------------------|
| Eaves Linings | Flat AC Sheeting | 80m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0012/Ceiling Structures/Linings/S8 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Pitched Roof - Flat Ceiling - Void | No Asbestos Found | | | | | |
| Window Beading | Caulking Material | | | | | |
| | 2082/B00A/Window Beading/S16 | | | | No Asbestos Detected | |

Interior**B00B - R0001 - Sports Store**

| | | | | | | |
|----------------------------|--|------|------------|----------------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Some Damage / Unsealed (3) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0001/Ceiling Structures/Linings/S10 | | | | Chrysotile (white asbestos) | |
| Window Beading | Caulking Material | | | | | |
| | 2082/B00A/Window Beading/S16 | | | | No Asbestos Detected | |

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Personal Effects Storage

| | | | | | | |
|-----------------------|--|------|---------------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 50m2 | Upper portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00D/R0009/Wall Linings Internal/S4 | | | | Chrysotile (white asbestos) | |

B00B - R0004 - Movement

| | | | | | | |
|---------------|----------------------------------|----|----------------------|--------------------|---|--------------------|
| In-fill-panel | Flat AC Sheeting | 2m | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0004/In-fill-panel/S9 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00B - R0005 - Movement

| | | | | | | |
|----------------------------|---|--------|----------------------|--------------------|---|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1.62m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0012/Ceiling Structures/Linings/S8 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |
| In-fill-panel | Flat AC Sheeting | 2m2 | North, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0004/In-fill-panel/S9 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00B - R0006 - Personal Effects Storage

| | | | | | | |
|-----------------------|--|------|---------------|--------------------|------------------------------------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 50m2 | Upper portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00D/R0009/Wall Linings Internal/S4 | | | | Chrysotile (white asbestos) | |

B00B - R0009 - Home Base

No Asbestos

B00B - R0010 - General Storeroom

No Asbestos

B00B - R0011 - Movement

No Asbestos

B00B - R0012 - Movement

| | | | | | | |
|----------------------------|---|-----|------------|--------------------|---|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0012/Ceiling Structures/Linings/S8 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00B - R0013 - Home Base - S

No Asbestos

B00B - R0014 - Movement

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - Administration/Library - 1968 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--|--|--------|-----------------|--------------------|------------------------------------|--------------------|
| Eaves Linings | Flat AC Sheeting | 100m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | Chrysotile (white asbestos) | |
| Electrical Backing Board | Resinous Board | 1m2 | west end, North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Cannot sample - Live. | | | | | |
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Pitched Roof - Flat Ceiling - Void | No Asbestos Found | | | | | |
| In-Fill Panels above Windows | Compressed AC Sheet | 12Unit | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00C/R0023/In-Fill Panels above windows/S15 | | | | Chrysotile (white asbestos) | |

Interior

B00C - R0003 - Staff Toilet

No Asbestos

B00C - R0004 - Sick Bay

| | | | | | | |
|-----------------------------|---|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2082/B00C/R0004/Floor Coverings Res/Textile/S6 | | | | No Asbestos Detected | |
| Floor Coverings Res/Textile | Adhesive under olive-green & white vinyl tiles. | | | | | |
| | 2082/B00C/R0004/Floor Coverings Res/Textile/S14 | | | | No Asbestos Detected | |

B00C - R0005 - Clerical Office/Workroom

No Asbestos

B00C - R0006 - Clerical Office

No Asbestos

B00C - R0007 - Movement

| | | | | | | |
|----------------------------|---|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | Chrysotile (white asbestos) | |

B00C - R0008 - Entry Vestibule

No Asbestos

B00C - R0009 - Principal

No Asbestos

B00C - R0010 - General Storeroom

No Asbestos

B00C - R0011 - General Storeroom

No Asbestos

B00C - R0012 - General Storeroom

No Asbestos

B00C - R0013 - Movement

No Asbestos

B00C - R0014 - General Storeroom

No Asbestos

B00C - R0015 - Main Switch Board

| | | | | | | |
|---------------------------|---|-------|-------|--------------------|---------|--------------------|
| Electrical Mounting Board | Resinous Board | 1Unit | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | Assumed Asbestos - Electrical Hazard | | | | | |

B00C - R0016 - Staff Toilet

No Asbestos

B00C - R0017 - General Storeroom

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|--|--------|-------------------------------------|--------------------|------------------------------------|--------------------|
| Sample No | | | | | Test Result | |
| No Asbestos | | | | | | |
| B00C - R0018 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00C - R0019 - Staff Room | | | | | | |
| No Asbestos | | | | | | |
| B00C - R0020 - General Storeroom | | | | | | |
| No Asbestos | | | | | | |
| B00C - R0021 - Library Office/Workroom | | | | | | |
| No Asbestos | | | | | | |
| B00C - R0022 - Reading Area | | | | | | |
| No Asbestos | | | | | | |
| B00C - R0023 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 87m2 | All except western 10 square metres | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | Chrysotile (white asbestos) | |
| In-Fill Panels above windows | Corrugated AC Sheeting | 13Unit | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00C/R0023/In-Fill Panels above windows/S15 | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning - 1968 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--|--|-------|---------------------------------|--------------------|---|--------------------|
| Eaves Linings | Flat AC Sheeting | 120m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | Chrysotile (white asbestos) | |
| Pitched Roof - Flat Ceiling - Void | No Asbestos Found | | | | | |
| Underfloor Voids - Packing to Floor Joists | AC Fragments/Debris | 1Unit | West adjacent sub-floor opening | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00D/Underfloor Voids - Packing to Floor Joists/S13 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

Interior

B00D - R0001 - Home Base

No Asbestos

B00D - R0002 - Home Base Store

No Asbestos

B00D - R0003 - Personal Effects Storage

| | | | | | | |
|-----------------------|--|--|--|--|-----------------------------|--|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 2082/B00D/R0016/Wall Linings Internal/S3 | | | | No Asbestos Detected | |

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Home Base

No Asbestos

B00D - R0006 - Home Base Store

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base Store

No Asbestos

B00D - R0009 - Distribution Board

Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------|--|------|------------|----------------------------|------------------------------------|--------------------|
| Wall Linings Internal | Flat AC Sheeting | 10m2 | Throughout | Some Damage / Unsealed (3) | Low (1) | Low Priority (2-3) |
| | 2082/B00D/R0009/Wall Linings Internal/S4 | | | | Chrysotile (white asbestos) | |

B00D - R0010 - Withdrawal Space - 1hb

| | | | | | | |
|-----------------------|--|--|--|--|-----------------------------|--|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 2082/B00D/R0016/Wall Linings Internal/S3 | | | | No Asbestos Detected | |

B00D - R0011 - Movement

No Asbestos

B00D - R0012 - Home Base

No Asbestos

B00D - R0013 - Home Base Store

No Asbestos

B00D - R0014 - Home Base

No Asbestos

B00D - R0015 - Home Base Store

No Asbestos

B00D - R0016 - Personal Effects Storage

| | | | | | | |
|-----------------------|--|--|--|--|-----------------------------|--|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 2082/B00D/R0016/Wall Linings Internal/S3 | | | | No Asbestos Detected | |

B00D - R0017 - Movement

No Asbestos

B00D - R0018 - Home Base

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

No Asbestos

B00D - R0019 - Home Base Store

No Asbestos

B00D - R0022 - Movement

| | | | | | | |
|----------------------------|---|------|---------------------------|----------------------------|---|-----------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 93m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | Chrysotile (white asbestos) | |
| Picture boards | Flat AC Sheeting | 10m2 | North, Variable positions | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) |
| | 2082/B00D/R0022/Picture boards/S5 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - Pupil Facilities - 1964 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|------------------------------------|---|------|-----------------------|---|---------|--------------------|
| Eaves Linings | Flat AC Sheeting | 80m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0012/Ceiling Structures/Linings/S8 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |
| Pitched Roof - Flat Ceiling - Void | Flat AC Sheeting | 50m2 | Upper side of ceiling | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00B/R0012/Ceiling Structures/Linings/S8 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

Interior**B00E - R0001 - Toilets - Girls**

| | | | | | | |
|----------------------------|--|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 24m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00E/R0001/Ceiling Structures/Linings/S11 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00E - R0002 - Cleaning Distributed Store

| | | | | | | |
|----------------------------|--|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00E/R0001/Ceiling Structures/Linings/S11 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00E - R0003 - Drinking Facilities

| | | | | | | |
|----------------------------|--|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 41m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| | 2082/B00E/R0001/Ceiling Structures/Linings/S11 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00E - R0004 - Toilets - Boys

| | | | | | | |
|----------------------------|--|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 27m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2082/B00E/R0001/Ceiling Structures/Linings/S11 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00E - R0005 - Movement

| | | | | | | |
|----------------------------|--|---------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 19.18m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| | 2082/B00E/R0005/Ceiling Structures/Linings/S17 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - Pupil Facilities - 1964 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|--|--|--|--|--|--|--|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Pitched Roof - Flat Ceiling - Void | Non Accessible Area - Manhole in R0004. Access to room obstructed by sports equipment. Access to manhole obstructed by shelving & equipment. Ceiling height 2.5m. | | | | | |

Interior

B00F - R0001 - Movement

| | | | | | | |
|---|------------------|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 54m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | | Chrysotile (white asbestos) | |

B00F - R0002 - Toilets - Girls

| | | | | | | |
|---|---------------------|------|--------------------|--------------------|---|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 15m2 | Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00F/R0006/Partition Walls (Cubicles)/S1 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

| | | | | | | |
|---|------------------|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 35m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | | Chrysotile (white asbestos) | |

B00F - R0003 - Drinking Facilities

| | | | | | | |
|---|------------------|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 52m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | | Chrysotile (white asbestos) | |

B00F - R0004 - Craft Store

| | | | | | | |
|---|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | | Chrysotile (white asbestos) | |

B00F - R0005 - Cleaning Distributed Store

| | | | | | | |
|---|------------------|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | | Chrysotile (white asbestos) | |

B00F - R0006 - Toilets - Boys

| | | | | | | |
|---|---------------------|------|--------------------|--------------------|---|--------------------|
| Partition Walls (Cubicles) | Compressed AC Sheet | 10m2 | Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00F/R0006/Partition Walls (Cubicles)/S1 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

| | | | | | | |
|---|------------------|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 34m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00F/R0006/Ceiling Structures/Linings/S2 | | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00G - Pupil Facilities - 1968 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|-----------------------------------|--|--|--|--|--|--|
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |
| Ceiling Voids - Raked Ceiling | Non Accessible Area - No manhole. Ceiling height 2.5m | | | | | |

Interior

B00G - R0001 - Canteen

| | | | | | | |
|---|------------------|---------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 17.47m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00G/R0006/Ceiling Structures/Linings/S7 | | | | | Chrysotile (white asbestos) | |

B00G - R0002 - Uniform Shop

| | | | | | | |
|---|------------------|--------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2.97m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00G/R0006/Ceiling Structures/Linings/S7 | | | | | Chrysotile (white asbestos) | |

B00G - R0003 - Canteen Office/Store

| | | | | | | |
|---|------------------|--------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 3.21m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00G/R0006/Ceiling Structures/Linings/S7 | | | | | Chrysotile (white asbestos) | |

| | | | | | | |
|---------------------------|----------------|-------|-------|--------------------|---------|--------------------|
| Electrical Mounting Board | Resinous Board | 1Unit | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
|---------------------------|----------------|-------|-------|--------------------|---------|--------------------|

Assumed Asbestos - Electrical Hazard

B00G - R0004 - Movement

| | | | | | | |
|---|------------------|---------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 13.73m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00G/R0006/Ceiling Structures/Linings/S7 | | | | | Chrysotile (white asbestos) | |

B00G - R0005 - Sick Bay

No Asbestos

B00G - R0006 - Movement

| | | | | | | |
|---|------------------|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2082/B00G/R0006/Ceiling Structures/Linings/S7 | | | | | Chrysotile (white asbestos) | |

B00G - R0007 - Movement

No Asbestos

B00G - R0008 - Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00H - Communal Facilities - 1980 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00H - R0001 - Sports Store

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00I - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|-----------------------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

Interior

B00I - R0001 - Communal Space

No Asbestos

B00I - R0002 - Raised Platform

No Asbestos

B00I - R0003 - Ramp

No Asbestos

B00I - R0004 - Hall Chair Store

No Asbestos

B00I - R0005 - Communal/Performance Store

No Asbestos

B00I - R0006 - P.E. Store

No Asbestos

B00I - R0007 - Movement

No Asbestos

B00I - R0008 - Toilets - Girls

No Asbestos

B00I - R0009 - Sound Cupboard

No Asbestos

B00I - R0010 - Movement

No Asbestos

B00I - R0011 - Toilets - Boys

No Asbestos

B00I - R0012 - Other

No Asbestos

B00I - R0013 - Cleaning Distributed Store

No Asbestos

B00I - R0014 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00I - R0015 - Access Shower/Toilet/Change

No Asbestos

B00I - R0016 - Covered Outdoor Learning Area

No Asbestos

B00I - R0017 - Movement

No Asbestos

B00I - R0018 - Movement

No Asbestos

B00I - R0019 - Movement

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00J - Administration - 2013 - Metal Shed (Metal Shed)

Exterior

| | |
|--|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found |

Interior

B00J - R0001 - Principal

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00K - Storage Shed

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00K - R0001 - Storage Area

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00L - Storage Shed

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00L - R0001 - Storage Area

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00M - COLA B

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00M - R0001 - Covered Area

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00N - COLA E

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00N - R0001 - Covered Area

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017