


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gresford Public School (2083)
Region : Hunter/Central Coast
State Electorate : Upper Hunter
Local Government Area : Dungog

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : AECOM : 29 - Jun - 2016

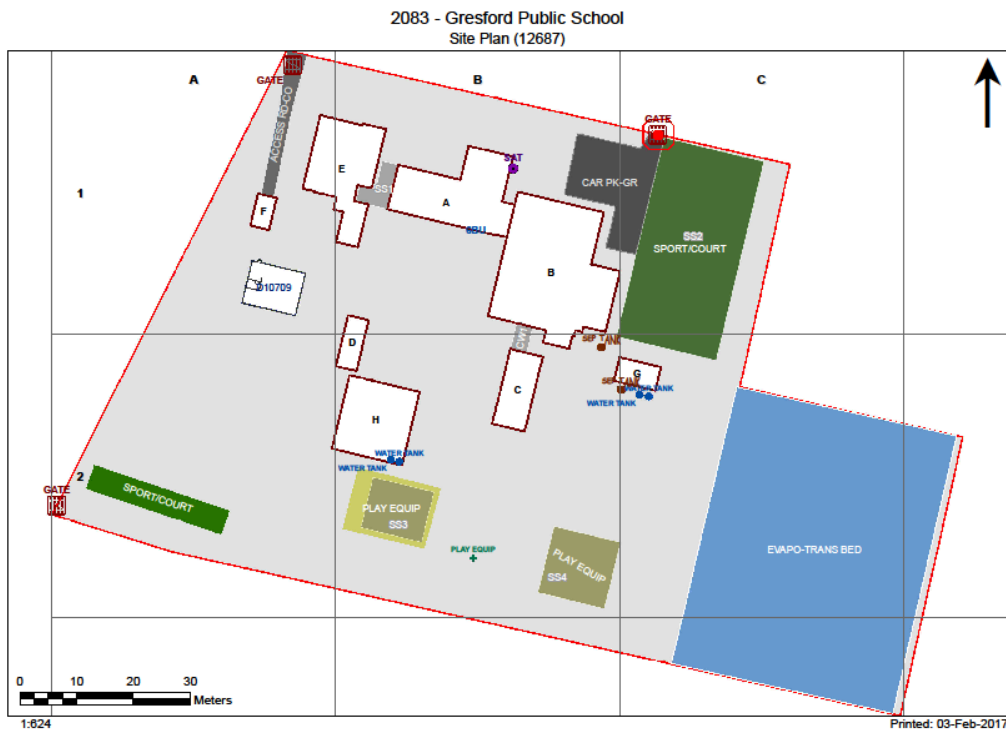

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1881 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction hatch in AR0014					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2083/B00E/Eaves Linings/S16	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting 2083/B00A/Wall Cladding/S10					No Asbestos Detected

Interior**B00A - R0001 - Clerical Office**

No Asbestos

B00A - R0002 - Clerical Office

No Asbestos

B00A - R0003 - Entry Vestibule

No Asbestos

B00A - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2083/B00E/R0012/Ceiling Structures/Linings/S1	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown Asbestos)
----------------------------	---	------	------------	--------------------	---------	---

B00A - R0005 - Staff Toilet

No Asbestos

B00A - R0006 - Staff Toilet

No Asbestos

B00A - R0007 - General Storeroom

No Asbestos

B00A - R0008 - Staff Room

No Asbestos

B00A - R0009 - Sports Store

No Asbestos

B00A - R0010 - Cleaning Distributed Store

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0014 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1970 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible void hatch blocked.					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void entrance located.					
Wall Cladding	Flat AC Sheeting 2083/B00B/Wall Cladding/S7				No Asbestos Detected	
In-fill-panel	Flat AC Sheeting	16m2	East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00B/In-fill-panel/S8				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00B/Eaves Linings/S13				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00B/Gable Verge Lining/S14				Chrysotile (white asbestos)	

Interior

B00B - R0001 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00B/R0001/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	

B00B - R0002 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0003 - Movement

No Asbestos

B00B - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00C/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown Asbestos)	

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base

No Asbestos

B00B - R0008 - Toilets - Boys/Girls

No Asbestos

B00B - R0009 - Home Base Store

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Garden Store

No Asbestos

B00B - R0012 - Special Programs Room

No Asbestos

B00B - R0013 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void entrance found.					
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00B/Gable Verge Lining/S14				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00B/Eaves Linings/S13				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	2083/B00C/In-fill-panel/S5					

Interior

B00C - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00C/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown Asbestos)	

B00C - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00C/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown Asbestos)	

In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	2083/B00C/In-fill-panel/S5					

B00C - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00C/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown Asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1970 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void entrance located.					
Eaves Linings	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00E/R0012/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown Asbestos)		
In-fill-panel	Flat AC Sheeting 2083/B00D/In-fill-panel/S4					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 2083/B00D/Underfloor Voids/S15					No Asbestos Detected

Interior

B00D - R0001 - Movement

No Asbestos

B00D - R0002 - Canteen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Administration/General Learning - 1881 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible Height Restriction also blocked by shelving.					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Height Restriction low access.					
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00E/Eaves Linings/S16				Chrysotile (white asbestos)	
Wall Cladding	Flat AC Sheeting	50m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00E/Wall Cladding/S11				Chrysotile (white asbestos) , Amosite (brown Asbestos)	

Interior

B00E - R0001 - Principal

No Asbestos

B00E - R0002 - Movement

In-fill-panel	Flat AC Sheeting	2083/B00E/R0012/Wall Linings Internal/S2				No Asbestos Detected
---------------	------------------	--	--	--	--	----------------------

B00E - R0003 - Movement

No Asbestos

B00E - R0004 - General Storeroom

No Asbestos

B00E - R0005 - Other-Vacant

No Asbestos

B00E - R0006 - Movement

Wall Linings Internal	Flat AC Sheeting	2083/B00E/R0012/Wall Linings Internal/S2				No Asbestos Detected
-----------------------	------------------	--	--	--	--	----------------------

B00E - R0007 - Other-Vacant

No Asbestos

B00E - R0008 - Other-Vacant

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00E/R0009/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown Asbestos)	

B00E - R0009 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00E/R0009/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown Asbestos)	

B00E - R0012 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2083/B00E/R0012/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown Asbestos)	

Wall Linings Internal	Flat AC Sheeting	2083/B00E/R0012/Wall Linings Internal/S2				No Asbestos Detected
-----------------------	------------------	--	--	--	--	----------------------

B00E - R0014 - Staff Room

No Asbestos

B00E - R0015 - Clerical Office

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Administration - 1950 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 2083/B00F/Wall Cladding/S12	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown Asbestos)

Interior

B00F - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - Reading Area

No Asbestos

B00H - R0002 - Library Office/Workroom

No Asbestos

B00H - R0003 - K.L.A. Store

No Asbestos

B00H - R0004 - Communications Room

No Asbestos

B00H - R0005 - External Movement

No Asbestos

B00H - R0006 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10709 - Learning Unit - Standard With P.A.A. : Placement Date - 17/03/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2083_ASB_060611_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017