


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Greystanes Public School (2086)
Region : Western Sydney
State Electorate : Prospect
Local Government Area : Holroyd

Initial Survey : Noel Arnold & Associates : 22 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 03 - May - 2015

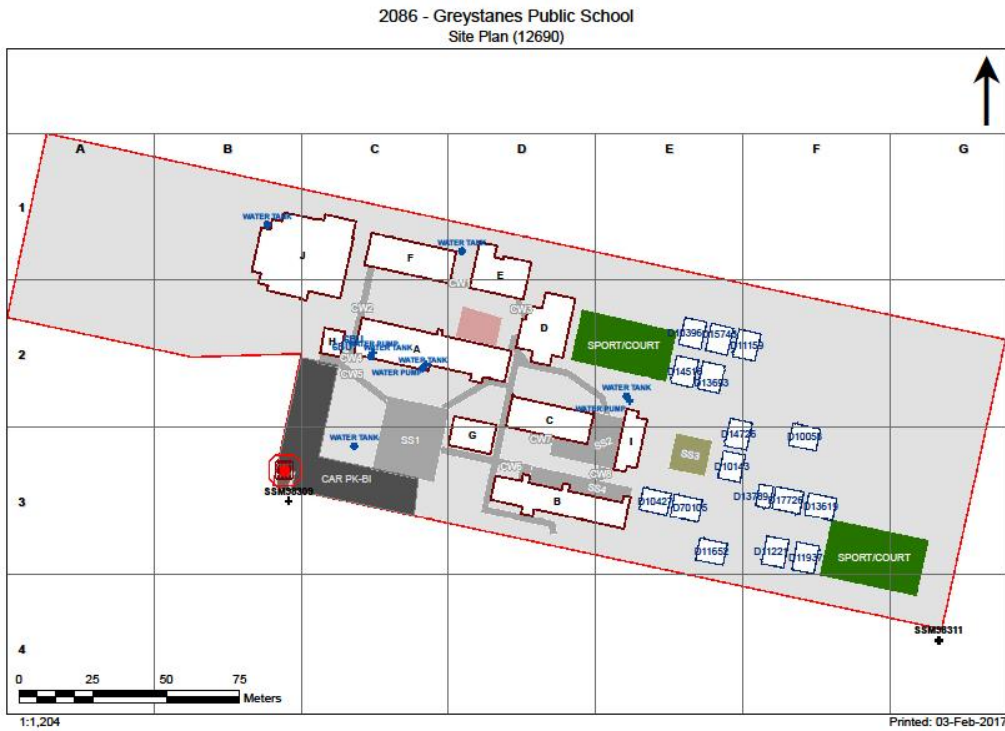

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	South, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00A/Eaves Linings/S2					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - Security Store (2.49 m2)**

No Asbestos

B00A - R0002 - General Assistant/Bulk Store (12.81 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2086/B00A/R0002/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Toilets - Boys (26.81 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2086/B00A/R0002/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0004 - Practical Activities - 1hb (12.6 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2086/B00A/R0002/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Home Base (42.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00A/R0002/Floor Coverings Res/Textile/S5					Clerical Error - No Sample Taken
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2086/B00A/R0002/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Home Base (42.55 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2086/B00A/R0002/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0007 - Practical Activities - 1hb (13.45 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2086/B00A/R0002/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Toilets - Girls (26.38 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2086/B00A/R0002/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0009 - Movement (6.27 m2)

No Asbestos

B00A - R0010 - Sports Store (14.22 m2)

No Asbestos

B00A - R0011 - Movement (47.03 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2086/B00A/R0002/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0012 - Movement (50.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0013 - Stairs (8.85 m2)						
No Asbestos						
B00A - R1001 - Movement (94.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00A/R1001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R1002 - General Storeroom (11.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00A/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00A - R1004 - Movement (6.7 m2)						
In-fill-panel	Flat AC Sheeting	2m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00A/R1004/In-fill-panel/S8					Chrysotile (white asbestos)	
B00A - R1005 - Distribution Board (0.76 m2)						
Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00A/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00A - R1008 - Plant (1.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00A/R1002/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00A - R1009 - Principal (20.77 m2)						
No Asbestos						
B00A - R1011 - Duplicating Workroom (8.72 m2)						
No Asbestos						
B00A - R1014 - Staff Toilet (3.61 m2)						
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Unable to Access Incinerette -						
B00A - R1018 - Home Base (57.17 m2)						
No Asbestos						
B00A - R1019 - Personal Effects Storage (13.35 m2)						
No Asbestos						
B00A - R1020 - Home Base Store (6.94 m2)						
No Asbestos						
B00A - R1021 - Home Base Store (6.94 m2)						
No Asbestos						
B00A - R1022 - Home Base (56.77 m2)						
No Asbestos						
B00A - R1023 - Movement (13.62 m2)						
No Asbestos						
B00A - R1025 - Clerical Office (16.39 m2)						
No Asbestos						
B00A - R1026 - Staff Room (64.82 m2)						
No Asbestos						
B00A - R1027 - Movement (19.13 m2)						
No Asbestos						
B00A - R1028 - Movement (23.75 m2)						
No Asbestos						
B00A - R1029 - Clerical/Printing (25.42 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00A - R1030 - Clerical Office (9.67 m2)

No Asbestos

B00A - R1031 - Toilet - Lobby (2.48 m2)

No Asbestos

B00A - R1032 - Staff Toilet (1.6 m2)

No Asbestos

B00A - R1033 - Toilet - Lobby (2.4 m2)

No Asbestos

B00A - R1034 - Staff Toilet (1.62 m2)

No Asbestos

B00A - R1035 - Clerical Office (8.83 m2)

No Asbestos

B00A - R1036 - Stairs (14.14 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Other-Community Use - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Eaves Linings/S34					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Gable Verge Lining/S36					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2086/B00B/Underfloor Voids - Packing to Floor Joists/S40					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior

B00B - R0002 - Personal Effects Storage (5.31 m2)

No Asbestos

B00B - R0003 - General Storeroom (4.84 m2)

No Asbestos

B00B - R0004 - Toilets - Boys/Girls (3.52 m2)

Wall Linings Internal	Flat AC Sheeting	15m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00B/R0004/Wall Linings Internal/S11					Chrysotile (white asbestos)

B00B - R0005 - Home Base (85.81 m2)

No Asbestos

B00B - R0006 - Home Base (56.59 m2)

No Asbestos

B00B - R0007 - Home Base Store (4.66 m2)

No Asbestos

B00B - R0008 - Personal Effects Storage (17.78 m2)

No Asbestos

B00B - R0009 - Home Base Store (4.66 m2)

No Asbestos

B00B - R0010 - Home Base (55.87 m2)

No Asbestos

B00B - R0011 - Movement (8.39 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2086/B00B/R0020/Ceiling Structures/Linings/S13					

B00B - R0012 - Movement (35.27 m2)

Floor Coverings Res/Textile	Vinyl Tiles	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00B/R0013/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00B - R0013 - Deputy Principal (17.31 m2)

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00B/R0013/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00B - R0014 - Plant (0.45 m2)

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00B/R0013/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00B - R0015 - Staff Toilet (3.38 m2)

Wall Linings Internal	Flat AC Sheeting	15m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00B/R0004/Wall Linings Internal/S11					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R0016 - Staff Room Annexe (21.07 m2)						
No Asbestos						
B00B - R0017 - Other-Community Use (21.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R0013/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00B - R0018 - Cleaning Distributed Store (0.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R0013/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00B - R0019 - General Storeroom (8.96 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R0013/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00B - R0020 - Movement (4.49 m2)						
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R0001/In-fill-panel/S10				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting					
2086/B00B/R0020/Ceiling Structures/Linings/S13				No Asbestos Detected		
B00B - R0021 - Movement (4.97 m2)						
In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R0001/In-fill-panel/S10				Chrysotile (white asbestos)		
B00B - R0022 - External Stairs (4.6 m2)						
No Asbestos						
B00B - R9001 - Cleaning Supplies (12.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R9001/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9002 - P.E. Store (42.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R9001/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9003 - Practical Activities - 1hb (55.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R9001/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9004 - Uniform Shop (42.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R9001/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9005 - Main Switch Board (6.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R9001/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9006 - General Storeroom (7.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00B/R9001/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R9007 - General Storeroom (4.14 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Eaves Linings/S34					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Gable Verge Lining/S36					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	28m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00C/In-fill-panel/S15					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Personal Effects Storage (7.44 m2)

No Asbestos

B00C - R0002 - Home Base (57.13 m2)

No Asbestos

B00C - R0003 - Home Base Store (6.21 m2)

No Asbestos

B00C - R0004 - Home Base (57.13 m2)

No Asbestos

B00C - R0005 - Home Base Store (6.17 m2)

No Asbestos

B00C - R0006 - Personal Effects Storage (14.78 m2)

No Asbestos

B00C - R0007 - Special Programs Room (57.13 m2)

No Asbestos

B00C - R0008 - Home Base Store (6.15 m2)

No Asbestos

B00C - R0009 - Movement (50.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00C/R0009/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00C - R9001 - Cleaning Supplies (57.03 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	2086/B00C/R9001/Floor Coverings Res/Textile/S28					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00D/Eaves Linings/S19				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Gable Verge Lining/S36				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Seminar/Study (16.32 m2)

No Asbestos

B00D - R0002 - K.L.A. Store (16.78 m2)

No Asbestos

B00D - R0003 - Reading Area (175.27 m2)

No Asbestos

B00D - R0004 - Library Office/Workroom (16.64 m2)

No Asbestos

B00D - R0005 - Library Office/Workroom (7.54 m2)

No Asbestos

B00D - R0006 - Entry Vestibule (12.75 m2)

No Asbestos

B00D - R0010 - Movement (23.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00D/R0010/Ceiling Structures/Linings/S33				Chrysotile (white asbestos)	

B00D - R0011 - Disabled Shower/Toilet (8.98 m2)

No Asbestos

B00D - R0012 - Cleaning Distributed Store (0.57 m2)

No Asbestos

B00D - R0013 - Distribution Board (1.78 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00D/R0013/Electrical Backing Board/S39				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Eaves Linings/S34					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Gable Verge Lining/S36					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Movement (28.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0002 - Practical Activities - 1hb (22.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/R0002/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)

B00E - R0003 - Communal Space (135.97 m2)

No Asbestos

B00E - R0004 - Staff Toilet (2.86 m2)

No Asbestos

B00E - R0005 - Staff Toilet (2.82 m2)

No Asbestos

B00E - R0006 - Movement (36.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/R0006/Ceiling Structures/Linings/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Pupil Facilit - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Eaves Linings/S34					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Gable Verge Lining/S36					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - Toilets - Boys (25.1 m2)**

Ceiling Structures/Linings	Vermiculite					
	2086/B00F/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00F - R0002 - Cleaning Distributed Store (7.33 m2)

Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00F/R0002/Electrical Backing Board/S38					Chrysotile (white asbestos)

B00F - R0003 - Toilets - Girls (21.84 m2)

Ceiling Structures/Linings	Vermiculite					
	2086/B00F/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00F - R0004 - Practical Activities - 1hb (4.29 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00F/R0011/Floor Coverings Res/Textile/S24					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	2086/B00F/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00F - R0005 - Home Base (66.62 m2)

Ceiling Structures/Linings	Vermiculite					
	2086/B00F/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00F - R0006 - Home Base (63.78 m2)

Ceiling Structures/Linings	Vermiculite					
	2086/B00F/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00F - R0007 - Practical Activities - 1hb (5.51 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00F/R0011/Floor Coverings Res/Textile/S24					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	2086/B00F/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00F - R0008 - Movement (56.95 m2)

No Asbestos

B00F - R0009 - Movement (6.55 m2)

No Asbestos

B00F - R0011 - General Storeroom (14.21 m2)

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00F/R0011/Floor Coverings Res/Textile/S24					Chrysotile (white asbestos)

B00F - R0012 - Stairs (7.93 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00F - R1001 - Home Base (70.29 m2)						
No Asbestos						
B00F - R1002 - Practical Activities - 1hb (2.82 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2086/B00F/R1005/Floor Coverings Res/Textile/S26					No Asbestos Detected	
B00F - R1003 - Home Base (67.6 m2)						
No Asbestos						
B00F - R1004 - Home Base (51.53 m2)						
No Asbestos						
B00F - R1005 - Practical Activities - 1hb (16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2086/B00F/R1005/Floor Coverings Res/Textile/S26					No Asbestos Detected	
B00F - R1006 - Movement (56.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00F/R1006/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)	
B00F - R1007 - Stairs (14.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2086/B00F/R1007/Ceiling Structures/Linings/S37					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other-After School Care - 1960 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2086/B00G/Eaves Linings/S27					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0002 - Out Of School Hours Care Centre (52.34 m2)

No Asbestos

B00G - R0003 - Home Base (52.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles 2086/B00G/R0003/Floor Coverings Res/Textile/S29					No Asbestos Detected
--------------------------------	--	--	--	--	--	-----------------------------

B00G - R0004 - Movement (3.91 m2)

No Asbestos

B00G - R0005 - Movement (9.84 m2)

No Asbestos

B00G - R0006 - Movement (13.05 m2)

No Asbestos

B00G - R0007 - Toilet - Lobby (1.11 m2)

No Asbestos

B00G - R0008 - Staff Toilet (1.49 m2)

No Asbestos

B00G - R0009 - Toilet - Lobby (1.31 m2)

No Asbestos

B00G - R0010 - Staff Toilet (1.76 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 2086/B00H/Eaves Linings/S35	10m2	Throughout	Some Damage - Unsealed (3) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Medium Priority (4-5)
In-fill-panel	Flat AC Sheeting 2086/B00H/R0003/In-fill-panel/S30					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00H - R0001 - Movement (13.91 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2086/B00H/R0003/Ceiling Structures/Linings/S31	14m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
----------------------------	--	------	------------	--	---------	--------------------

B00H - R0002 - Canteen Office/Store (2.84 m2)

In-fill-panel	Flat AC Sheeting 2086/B00H/R0003/In-fill-panel/S30					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2086/B00H/R0003/Ceiling Structures/Linings/S31	3m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles 2086/B00H/R0003/Floor Coverings Res/Textile/S32	3m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)

B00H - R0003 - Canteen Office/Store (2.49 m2)

In-fill-panel	Flat AC Sheeting 2086/B00H/R0003/In-fill-panel/S30					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2086/B00H/R0003/Ceiling Structures/Linings/S31	3m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles 2086/B00H/R0003/Floor Coverings Res/Textile/S32	3m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)

B00H - R0004 - Canteen (18.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2086/B00H/R0003/Ceiling Structures/Linings/S31	19m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles 2086/B00H/R0003/Floor Coverings Res/Textile/S32	19m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)

B00H - R0005 - Movement (12.35 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2086/B00H/R0003/Ceiling Structures/Linings/S31	13m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
----------------------------	--	------	------------	--	---------	--------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Eaves Linings/S34				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	5m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00E/Gable Verge Lining/S36				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B001 - R0001 - Movement (46.35 m2)

Wall Linings Internal	Flat AC Sheeting	6m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00I/R0001/Wall Linings Internal/S17				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2086/B00I/R0001/Ceiling Structures/Linings/S18				Chrysotile (white asbestos)	

B001 - R0002 - General Storeroom (4.1 m2)

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed Unit - Assumed ACM internally					

B001 - R0003 - Toilets - Girls (35.02 m2)

No Asbestos

B001 - R0004 - Toilets - Boys (35.02 m2)

No Asbestos

B001 - R0005 - Cleaning Distributed Store (4.1 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00J - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0001 - Communal Space (202.94 m2)**

No Asbestos

B00J - R0002 - Raised Platform (61.49 m2)

No Asbestos

B00J - R0003 - Toilet - Lobby (1.84 m2)

No Asbestos

B00J - R0004 - Toilets - Boys (7.92 m2)

No Asbestos

B00J - R0005 - P.E. Store (16.13 m2)

No Asbestos

B00J - R0006 - Movement (2.21 m2)

No Asbestos

B00J - R0007 - Communal/Performance Store (10.98 m2)

No Asbestos

B00J - R0008 - Hall Chair Store (10.95 m2)

No Asbestos

B00J - R0009 - Movement (3.01 m2)

No Asbestos

B00J - R0010 - Cleaning Distributed Store (8.54 m2)

No Asbestos

B00J - R0011 - Toilet - Lobby (3.65 m2)

No Asbestos

B00J - R0012 - Toilets - Girls (10.4 m2)

No Asbestos

B00J - R0013 - Sound Cupboard (2.79 m2)

No Asbestos

B00J - R0014 - Access Shower/Toilet/Change (7.27 m2)

No Asbestos

B00J - R0015 - Main Switch Board (3.08 m2)

No Asbestos

B00J - R0016 - Plant (0.79 m2)

No Asbestos

B00J - R0017 - Movement (5.65 m2)

No Asbestos

B00J - R0018 - Movement (13.59 m2)

No Asbestos

B00J - R0019 - External Movement (6.76 m2)

No Asbestos

B00J - R0020 - External Movement (3.27 m2)

No Asbestos

B00J - R0021 - Ramp (13.24 m2)

No Asbestos

B00J - R0022 - External Movement (69.98 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00J - R0023 - Covered Outdoor Learning Area (231.6 m2)

No Asbestos

B00J - R0024 - Canteen Office/Store (10.23 m2)

No Asbestos

B00J - R0025 - Canteen (41.57 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10058 - Learning Unit - Standard With P.A.A. : Placement Date - 9/01/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D10143 - Learning Unit - Standard/Withdrawal : Placement Date - 2/05/2008

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 603 - D10396 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 22/02/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D10427 - Learning Unit - Standard/Withdrawal : Placement Date - 14/02/2007

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 602 - D11159 - Learning Unit - Standard With P.A.A. : Placement Date - 13/01/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 603 - D11221 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 5/01/2010						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D11652 - Learning Unit - Standard With P.A.A. : Placement Date - 9/01/2013						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D11937 - Learning Unit - Standard With P.A.A. : Placement Date - 23/02/2012						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D13619 - Learning Unit - Standard With P.A.A. : Placement Date - 30/11/2010						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13693 - Learning Unit - Standard With P.A.A. : Placement Date - 26/11/2012

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 750 - D13789 - Learning Unit - ESL : Placement Date - 12/11/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Esl

No Asbestos Found.

OS 602 - D14516 - Learning Unit - Standard With P.A.A. : Placement Date - 24/11/2008

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14726 - Learning Unit - Standard With P.A.A. : Placement Date - 19/04/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15743 - Learning Unit - Standard With P.A.A. : Placement Date - 14/09/2012

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D17726 - Learning Unit - Standard With P.A.A. : Placement Date - 22/01/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D70105 - Learning Unit - Standard/Withdrawal : Placement Date - 25/01/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017