


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Griffith Public School (2087)
Region : Riverina
State Electorate : Murray
Local Government Area : Griffith

Initial Survey : Noel Arnold & Associates : 09 - May - 2008
Reviewed By : Greencap-NAA : 18 - May - 2015

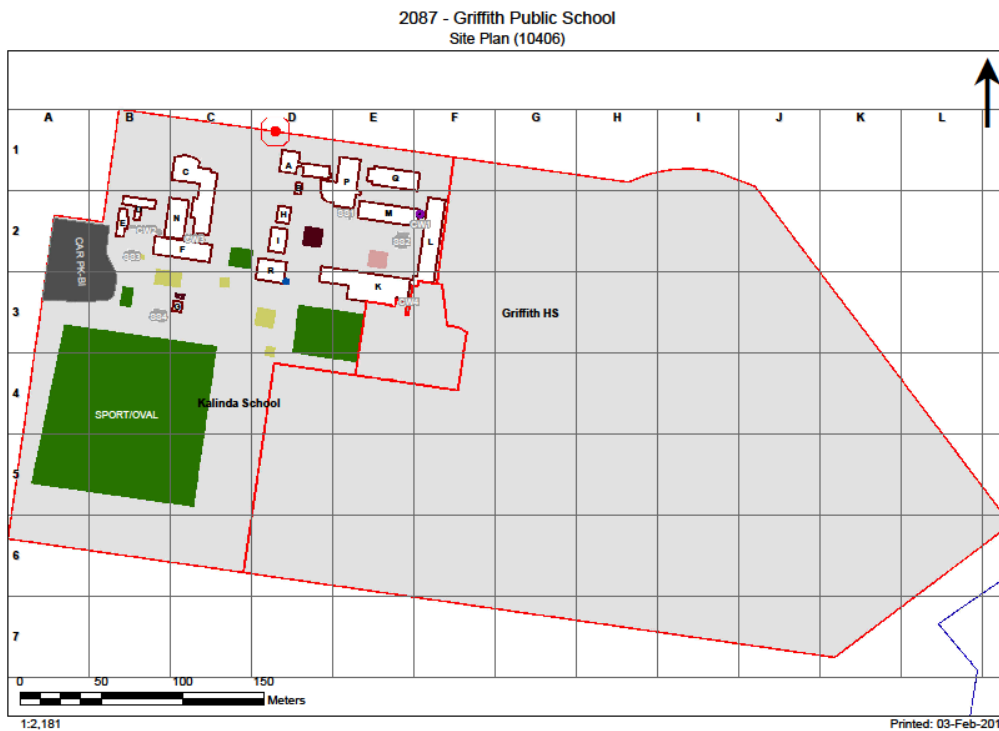

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/Eaves Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Gable Verge Lining	Flat AC Sheeting					No Asbestos Detected
	2087/B00A/Gable Verge Lining/S24					
Ceiling Voids	No Asbestos Found					

Interior**B00A - R0001 - External Movement (2.81 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0014/Ceiling Structures/Linings/S2					
					Chrysotile (white asbestos)	

B00A - R0002 - Staff Room Annexe (27.67 m2)

No Asbestos

B00A - R0003 - Staff Room (62.66 m2)

No Asbestos

B00A - R0004 - Staff Toilet (6.41 m2)

No Asbestos

B00A - R0005 - Staff Toilet (6.45 m2)

No Asbestos

B00A - R0006 - Movement (7.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0014/Ceiling Structures/Linings/S2					
					Chrysotile (white asbestos)	

B00A - R0008 - Interview (13.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0012/Floor Coverings Res/Textile/S25					
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to Sample 25					
	2087/B00A/R0012/Floor Coverings Res/Textile/S30					
					No Asbestos Detected	

B00A - R0012 - Duplicating Workroom (8.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0012/Floor Coverings Res/Textile/S25					
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to Sample 25					
	2087/B00A/R0012/Floor Coverings Res/Textile/S30					
					No Asbestos Detected	

B00A - R0014 - Sick Bay (6.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0014/Ceiling Structures/Linings/S2					
					Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting					
	2087/B00A/R0025/Wall Linings Internal/S1					
					No Asbestos Detected	

B00A - R0015 - Staff Kitchen (8.35 m2)

Wall Linings Internal	Flat AC Sheeting					
	2087/B00A/R0025/Wall Linings Internal/S1					
					No Asbestos Detected	

B00A - R0018 - Movement (6.06 m2)

Wall Linings Internal	Flat AC Sheeting					
	2087/B00A/R0025/Wall Linings Internal/S1					
					No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0019 - General Storeroom (0.88 m2)						
No Asbestos						
B00A - R0021 - Clerical Office (40.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0014/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0012/Floor Coverings Res/Textile/S25				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to Sample 25					
	2087/B00A/R0012/Floor Coverings Res/Textile/S30				No Asbestos Detected	
B00A - R0022 - Entry Vestibule (5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0014/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00A - R0023 - Entry Vestibule (17.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0014/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0012/Floor Coverings Res/Textile/S25				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to Sample 25					
	2087/B00A/R0012/Floor Coverings Res/Textile/S30				No Asbestos Detected	
B00A - R0024 - External Movement (7.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0014/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00A - R0025 - Principal (20.19 m2)						
Wall Linings Internal	Flat AC Sheeting					
	2087/B00A/R0025/Wall Linings Internal/S1				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/R0012/Floor Coverings Res/Textile/S25				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to Sample 25					
	2087/B00A/R0012/Floor Coverings Res/Textile/S30				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Shed - 1962 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00A/Eaves Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00B - R0001 - General Storeroom (24.5 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1941 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Unable to access room, no access to personal access point.					
Ceiling Voids	Non Accessible Area - Height Restriction - Unable to access room, no access to personal access point.					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2087/B00C/Eaves Linings/S32					No Asbestos Detected
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Interior

B00C - R0001 - Staff Toilet (3.82 m2)

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	to wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - item inaccessible						

B00C - R0002 - Deputy Principal (16 m2)

No Asbestos

B00C - R0003 - General Storeroom (3.78 m2)

No Asbestos

B00C - R0004 - Home Base (47.88 m2)

No Asbestos

B00C - R0005 - Home Base (47.41 m2)

No Asbestos

B00C - R0006 - Home Base (47.61 m2)

No Asbestos

B00C - R0007 - Home Base (47.88 m2)

No Asbestos

B00C - R0008 - Withdrawal Space - 2hb (14.25 m2)

No Asbestos

B00C - R0009 - Staff Toilet (1.94 m2)

No Asbestos

B00C - R0010 - General Storeroom (3.11 m2)

No Asbestos

B00C - R0011 - Movement (4.29 m2)

No Asbestos

B00C - R0012 - External Movement (2 m2)

No Asbestos

B00C - R0013 - Movement (101.1 m2)

No Asbestos

B00C - R0014 - Security Store (3.67 m2)

No Asbestos

B00C - R0015 - Personal Effects Storage (8.13 m2)

No Asbestos

B00C - R0016 - External Movement (4.99 m2)

No Asbestos

B00C - R0017 - Personal Effects Storage (8.1 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00C - R0018 - Cleaning Supplies (3.5 m2)

No Asbestos

B00C - R0019 - Shower/Change (4.41 m2)

No Asbestos

B00C - R0020 - Home Base (112 m2)

No Asbestos

B00C - R0021 - Movement (110.26 m2)

No Asbestos

B00C - R0022 - General Storeroom (6.42 m2)

No Asbestos

B00C - R0023 - External Movement (3.9 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1928 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 2087/B00D/Eaves Linings/S12					No Asbestos Detected
Window In-fill-panel	Flat AC Sheeting 2087/B00D/R0002/Wall Linings Internal/S11					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00D - R0001 - Handwashing Facilities (9.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00D/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00D - R0002 - Security Store (33.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00D/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00D/R0003/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting 2087/B00D/R0002/Wall Linings Internal/S11					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00D - R0003 - Special Programs Room (33.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00D/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00D/R0003/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)

B00D - R0004 - Handwashing Facilities (9.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00D/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00D - R0005 - Sports Store (27.79 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1962 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible
Eaves Linings	No Asbestos Found
Ceiling Voids - Raked Ceiling	No Asbestos Found

Interior

B00E - R0001 - Toilets - Boys (21.93 m2)

No Asbestos

B00E - R0002 - Drinking Facilities (14.05 m2)

No Asbestos

B00E - R0003 - Toilets - Girls (21.88 m2)

No Asbestos

B00E - R0004 - Cleaning Supplies (3.02 m2)

No Asbestos

B00E - R0005 - Sports Store (6.05 m2)

No Asbestos

B00E - R0006 - External Movement (10 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1967 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Ends	Flat AC Sheeting	3m2	Gable ends Adjacent to Room 1	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00F/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	40m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00F/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior**B00F - R0001 - External Movement (75.12 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	76m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00F/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Flooring	Compressed AC Sheet	20m2	North Edge, Entire length.	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00L/R0014/Wall Linings Internal/S21				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	3m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00F/R0001/Wall Linings Internal/S8				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Compressed AC Sheet					
	2087/B00F/R0001/Floor Coverings Res/Textile/S28				No Asbestos Detected	

B00F - R0002 - Staff Toilet (3.29 m2)

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	to item	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					

B00F - R0003 - Withdrawal Space - 2hb (21.81 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00F/R0009/Floor Coverings Res/Textile/S27				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to Sample 27					
	2087/B00F/R0009/Floor Coverings Res/Textile/S31				No Asbestos Detected	

B00F - R0004 - Movement (3.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00F/R0009/Floor Coverings Res/Textile/S27				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to Sample 27					
	2087/B00F/R0009/Floor Coverings Res/Textile/S31				No Asbestos Detected	

B00F - R0005 - Personal Effects Storage (5.85 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00F/R0005/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B00F - R0006 - Home Base Store (4.1 m2)


Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00F/R0005/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	

B00F - R0007 - Toilets - Boys/Girls (3.06 m2)

No Asbestos

B00F - R0008 - Home Base (85.68 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00F/R0009/Floor Coverings Res/Textile/S27	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 27 2087/B00F/R0009/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00F - R0009 - Home Base (56.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00F/R0009/Floor Coverings Res/Textile/S27	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 27 2087/B00F/R0009/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00F - R0010 - Home Base Store (4.09 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2087/B00F/R0005/Floor Coverings Res/Textile/S4	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00F - R0011 - Personal Effects Storage (9.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2087/B00F/R0005/Floor Coverings Res/Textile/S4	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00F - R0012 - Distribution Board (0.85 m2) Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting 2087/B00F/R0012/Wall Linings Internal/S5	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Backing Board	Fibre Cement Casting (Monocrete) Assumed Asbestos - Electrical Hazard	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
B00F - R0013 - Personal Effects Storage (8.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2087/B00F/R0005/Floor Coverings Res/Textile/S4	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00F - R0014 - Home Base Store (4.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2087/B00F/R0005/Floor Coverings Res/Textile/S4	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00F - R0015 - Home Base (56.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00F/R0009/Floor Coverings Res/Textile/S27	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 27 2087/B00F/R0009/Floor Coverings Res/Textile/S31					No Asbestos Detected

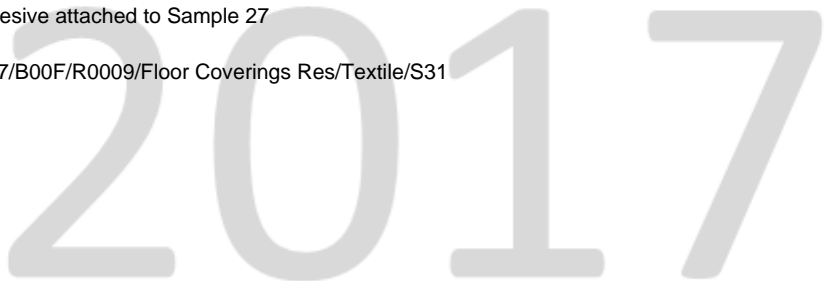

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Shed - 1960 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00G - R0001 - Garden Store (31.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1985 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - No Access Point to Ceiling Void.					
Eaves Linings	Flat AC Sheeting 2087/B00H/Eaves Linings/S15					No Asbestos Detected
Window In-fill-panel	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00H/Infill Panels to Windows/S16					Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	6m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00H/Infill Panels to Windows/S16					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction - No Access Point to Ceiling Void.					
Underfloor Voids	No Asbestos Found					

Interior**B00H - R0001 - Movement (18.97 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00H/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 2087/B00H/R0001/Infill Panel/S14					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00M/R0006/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00M/R0006/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00M/R0006/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)

B00H - R0002 - Craft Store (10.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00H/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00H - R0003 - Home Base (41.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00H/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00M/R0006/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00M/R0006/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B001 - Other-After School Care/Staff Facilities - 1972 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 2087/B00H/Eaves Linings/S15					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

Interior**B001 - R0001 - External Movement (33.63 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2087/B00H/R0001/Ceiling Structures/Linings/S13	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet 2087/B00F/R0012/Wall Linings Internal/S5	34m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B001 - R0002 - Out Of School Hours Care Centre (52.05 m2)

Wall Linings Internal	Flat AC Sheeting 2087/B00I/R0004/Wall Linings Internal/S17	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00M/R0006/Floor Coverings Res/Textile/S22	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22 2087/B00M/R0006/Floor Coverings Res/Textile/S29	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B001 - R0003 - Out Of School Hours Care Centre (37.94 m2)

Wall Linings Internal	Flat AC Sheeting 2087/B00I/R0004/Wall Linings Internal/S17	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00M/R0006/Floor Coverings Res/Textile/S22	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22 2087/B00M/R0006/Floor Coverings Res/Textile/S29	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B001 - R0004 - Out Of School Hours Care Centre (13.21 m2)

Wall Linings Internal	Flat AC Sheeting 2087/B00I/R0004/Wall Linings Internal/S17	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities/General Learning - 1975 - Brick/Block (Brick/Block)**Exterior**

Window In-fill-panel	Flat AC Sheeting 2087/B00M/R0002/Infill panels below windows/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	No Asbestos Found					

Interior**B00K - R0001 - Canteen Office/Store (7.73 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00K/R0022/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00K - R0002 - Canteen Office/Store (3.29 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00K/R0022/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00K - R0003 - Staff Toilet (3 m2)

No Asbestos

B00K - R0004 - Canteen Office/Store (4.58 m2)

No Asbestos

B00K - R0005 - Canteen (35.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00K/R0022/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00K - R0006 - General Assistant/Bulk Store (9.97 m2)

No Asbestos

B00K - R0007 - General Storeroom (10.08 m2)

No Asbestos

B00K - R0008 - Home Base (57.02 m2)

Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Adhesive 2087/B00K/R0008/Floor Coverings Res/Textile/S23					No Asbestos Detected
--------------------------------	---	--	--	--	--	-----------------------------

B00K - R0009 - Home Base Store (6.1 m2)

Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00K - R0010 - Home Base Store (6.14 m2)

Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00K - R0011 - Distribution Board (0.56 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0012 - Personal Effects Storage (13.43 m2)

Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00K - R0013 - Home Base (56.56 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 2087/B00K/R0008/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00K - R0014 - Home Base (56.87 m2)						
Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 2087/B00K/R0008/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00K - R0015 - Home Base Store (6.67 m2)						
Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00K - R0016 - Personal Effects Storage (6.74 m2)						
Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00K - R0017 - Movement (9.75 m2)						
No Asbestos						
B00K - R0018 - Cleaning Supplies (7.16 m2)						
No Asbestos						
B00K - R0019 - Toilets - Girls (47.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	2087/B00K/R0022/Ceiling Structures/Linings/S18					
B00K - R0020 - Toilets - Boys (48.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	2087/B00K/R0022/Ceiling Structures/Linings/S18					
B00K - R0022 - Sports Store (9.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	2087/B00K/R0022/Ceiling Structures/Linings/S18					
B00K - R0023 - External Movement (241.77 m2)						
Window In-fill-panel	Flat AC Sheeting 2087/B00M/R0002/Infill panels below windows/S20					No Asbestos Detected
B00K - R0024 - Movement (9.92 m2)						
No Asbestos						
B00K - R0025 - Distribution Board (7.1 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
	2087/B00K/R0022/Ceiling Structures/Linings/S18					
Electrical Mounting Board	Resinous Board	5Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00K - R0026 - General Storeroom (7.16 m2)						
No Asbestos						
B00K - R0027 - Stairs (7 m2)						
No Asbestos						
B00K - R0028 - Stairs (7.12 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00K - R0029 - Sports Store (9.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2087/B00K/R0022/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
B00K - R1001 - Movement (56.52 m2)						
Window In-fill-panel	Flat AC Sheeting					No Asbestos Detected
2087/B00M/R0002/Infill panels below windows/S20						
B00K - R1002 - Home Base (56.79 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2087/B00K/R0012/Ceiling Structures/Linings/S19					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
2087/B00K/R1004/Floor Coverings Res/Textile/S26						
B00K - R1003 - Home Base Store (6.12 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2087/B00K/R0012/Ceiling Structures/Linings/S19					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
2087/B00K/R1004/Floor Coverings Res/Textile/S26						
B00K - R1004 - Home Base Store (6.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2087/B00K/R0012/Ceiling Structures/Linings/S19					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
2087/B00K/R1004/Floor Coverings Res/Textile/S26						
B00K - R1005 - Distribution Board (0.57 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00K - R1006 - Personal Effects Storage (13.49 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2087/B00K/R0012/Ceiling Structures/Linings/S19					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00K - R1007 - Home Base (56.83 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2087/B00K/R0012/Ceiling Structures/Linings/S19					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
2087/B00K/R1004/Floor Coverings Res/Textile/S26						
B00K - R1008 - Home Base (56.72 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2087/B00K/R0012/Ceiling Structures/Linings/S19					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2087/B00M/R0006/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to Sample 22	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2087/B00M/R0006/Floor Coverings Res/Textile/S29					Chrysotile (white asbestos)	
B00K - R1009 - Home Base Store (6.73 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 2087/B00M/R0006/Floor Coverings Res/Textile/S22	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22 2087/B00M/R0006/Floor Coverings Res/Textile/S29	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00K - R1010 - Movement (6.73 m2)

Ceiling Structures/Linings	Vermiculite 2087/B00K/R0012/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00K - R1011 - Stairs (14.48 m2)

No Asbestos

B00K - R1012 - Stairs (14.3 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Staff Facilities/General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Window In-fill-panel	Flat AC Sheeting 2087/B00M/R0002/Infill panels below windows/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Eaves Linings	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B00L - R0001 - Interview (12.43 m2)**

No Asbestos

B00L - R0002 - Interview (10.48 m2)

No Asbestos

B00L - R0003 - Movement (37.67 m2)

Floor Coverings Res/Textile	Vinyl Sheet 2087/B00K/R1004/Floor Coverings Res/Textile/S26					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00L - R0004 - General Storeroom (10.54 m2)

Floor Coverings Res/Textile	Vinyl Sheet 2087/B00K/R1004/Floor Coverings Res/Textile/S26					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00L - R0005 - Music Store (10.54 m2)

Floor Coverings Res/Textile	Vinyl Sheet 2087/B00K/R1004/Floor Coverings Res/Textile/S26					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00L - R0006 - Special Programs Room (56.73 m2)

Floor Coverings Res/Textile	Vinyl Tiles	30m2	Centre Section	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00D/R0003/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)

B00L - R0007 - Library Office/Workroom (12.25 m2)

No Asbestos

B00L - R0008 - Reading Area (148.25 m2)

No Asbestos

B00L - R0009 - K.L.A. Store (27.96 m2)

No Asbestos

B00L - R0010 - Cleaning Supplies (5.62 m2)

No Asbestos

B00L - R0011 - External Movement (107.63 m2)

Window In-fill-panel	Flat AC Sheeting 2087/B00M/R0002/Infill panels below windows/S20					No Asbestos Detected
----------------------	---	--	--	--	--	-----------------------------

B00L - R0012 - Staff Toilet (4.3 m2)

Incinerator	Encapsulated Insulation material within unit Assumed Asbestos - item inaccessible	1Unit(s)	to wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Wall lining behind Tiles	Compressed AC Sheet 2087/B00L/R0014/Wall Linings Internal/S21	10m2	Lower wall behind tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00L - R0013 - Distribution Board (0.83 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0014 - Staff Toilet (4.3 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall lining behind Tiles	Compressed AC Sheet	6m2	Lower wall behind tiles	Good Condition (1)	Low (1)	Low Priority (2-3)
2087/B00L/R0014/Wall Linings Internal/S21					Chrysotile (white asbestos)	
B00L - R0015 - Interview (16.19 m2)						
No Asbestos						
B00L - R0016 - Interview (10.66 m2)						
No Asbestos						
B00L - R0017 - Deputy Principal (13.91 m2)						
No Asbestos						
B00L - R0018 - Staff Toilet (3.09 m2)						
Wall lining behind Tiles	Compressed AC Sheet	10m2	Lower wall behind tiles	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2087/B00L/R0014/Wall Linings Internal/S21					Chrysotile (white asbestos)	
B00L - R0019 - Library Office/Workroom (10.43 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 1941 - Brick/Block (Brick/Block)**Exterior**

Window In-fill-panel	Flat AC Sheeting 2087/B00M/R0002/Infill panels below windows/S20					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	No Asbestos Found					

Interior**B00M - R0001 - Home Base (56.49 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00M/R0006/Floor Coverings Res/Textile/S22	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22 2087/B00M/R0006/Floor Coverings Res/Textile/S29	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00M - R0002 - External Movement (67.65 m2)

Window In-fill-panel	Flat AC Sheeting 2087/B00M/R0002/Infill panels below windows/S20					No Asbestos Detected
----------------------	---	--	--	--	--	-----------------------------

B00M - R0003 - Personal Effects Storage (15.71 m2)

Electrical Backing Board	Encapsulated Insulation material within unit	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B00M - R0004 - No Access (5.73 m2)

No Asbestos

B00M - R0005 - Home Base Store (5.73 m2)

No Asbestos

B00M - R0006 - Home Base (56.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00M/R0006/Floor Coverings Res/Textile/S22	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22 2087/B00M/R0006/Floor Coverings Res/Textile/S29	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00M - R0007 - Home Base (56.43 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00M/R0006/Floor Coverings Res/Textile/S22	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 22 2087/B00M/R0006/Floor Coverings Res/Textile/S29	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00M - R0008 - Personal Effects Storage (15.75 m2)

No Asbestos

B00M - R0009 - Home Base Store (5.73 m2)

No Asbestos

B00M - R0010 - Home Base Store (5.69 m2)

No Asbestos

B00M - R0011 - Home Base (56.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2087/B00M/R0006/Floor Coverings Res/Textile/S22	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive attached to Sample 22	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2087/B00M/R0006/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Pupil Facilities - 1998 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - Movement (285.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Pupil Facilities - 2005 - Concrete (Concrete)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00P - R0001 - Communal Space (323.24 m2)

No Asbestos

B00P - R0002 - Sports Store (21.78 m2)

No Asbestos

B00P - R0003 - General Storeroom (20.76 m2)

No Asbestos

B00P - R0004 - Distribution Board Cupboard (0.7 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00P - R0005 - External Movement (7.2 m2)

No Asbestos

B00P - R0007 - External Movement (105.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00Q - Administration - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible
Eaves Linings	No Asbestos Found

Interior**B00Q - R0001 - Clerical/Printing (27.24 m2)**

No Asbestos

B00Q - R0002 - Clerical/Printing (24.01 m2)

No Asbestos

B00Q - R0003 - Sick Bay (9.2 m2)

No Asbestos

B00Q - R0004 - Access Shower/Toilet (5.24 m2)

No Asbestos

B00Q - R0005 - Staff Toilet (5 m2)

No Asbestos

B00Q - R0006 - Cleaning Distributed Store (2.64 m2)

No Asbestos

B00Q - R0007 - Main Switch Board (2.66 m2)

No Asbestos

B00Q - R0008 - Interview/Office - Type 3 (16.84 m2)

No Asbestos

B00Q - R0009 - Security Store (13.69 m2)

No Asbestos

B00Q - R0010 - Movement (56.42 m2)

No Asbestos

B00Q - R0011 - Staff Room Annexe (19.79 m2)

No Asbestos

B00Q - R0012 - Staff Room (49.31 m2)

No Asbestos

B00Q - R0013 - Staff Toilet (4.97 m2)

No Asbestos

B00Q - R0014 - Staff Toilet (5.02 m2)

No Asbestos

B00Q - R0015 - Deputy Principal - Type 1 (12.73 m2)

No Asbestos

B00Q - R0016 - Principal (17.37 m2)

No Asbestos

B00Q - R0017 - Interview (13.3 m2)

No Asbestos

B00Q - R0018 - Entry Vestibule (23.48 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids	No Asbestos Found
Eaves Linings	No Asbestos Found

Interior

B00R - R0001 - External Movement (38.48 m2)

No Asbestos

B00R - R0002 - Practical Activities - 1hb (19.36 m2)

No Asbestos

B00R - R0003 - Home Base Store (5.71 m2)

No Asbestos

B00R - R0004 - Home Base (58.76 m2)

No Asbestos

B00R - R0005 - Withdrawal Space - 2hb (10.67 m2)

No Asbestos

B00R - R0006 - Home Base (58.67 m2)

No Asbestos

B00R - R0007 - Home Base Store (5.71 m2)

No Asbestos

B00R - R0008 - Practical Activities - 1hb (19.36 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017