

# Asbestos Register


(Hazardous Materials and Risk Assessment)



**School :** Gulgong Public School (2097)  
**Region :** Western NSW  
**State Electorate :** Dubbo  
**Local Government Area :** Mid-Western

**Initial Survey :** Noel Arnold & Associates : 16 - May - 2008  
**Reviewed By :** Greencap-NAA : 15 - Jun - 2016

2097 - Gulgong Public School  
Site Plan (12993)

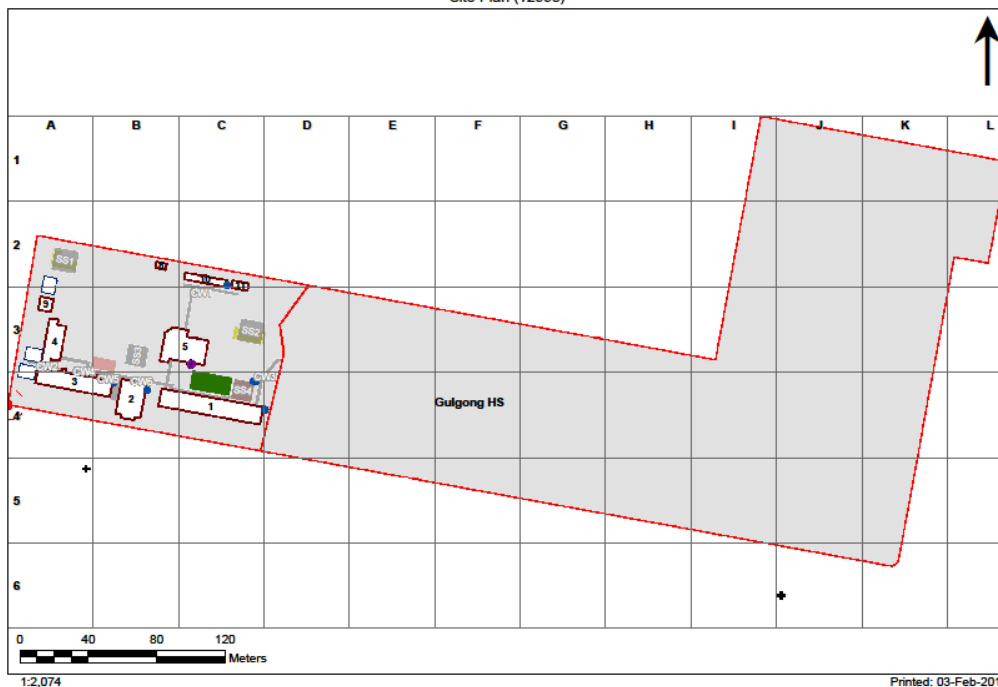

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - General Learning - 1966 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B001/R0019/Ceiling Structures/Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Cannot sample height restricted</b>					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Pitched roof - Flat ceiling	Non Accessible Area - No manhole					

**Interior**

**B001 - R0001 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>

**B001 - R0002 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>

**B001 - R0003 - Home Base**

Window Beading	Caulking Material					
	2097/B001/R0005/window beading/S6					<b>No Asbestos Detected</b>

**B001 - R0004 - Withdrawal Space - 1hb**

No Asbestos

**B001 - R0005 - Home Base**

window beading	Caulking Material					
	2097/B001/R0005/window beading/S6					<b>No Asbestos Detected</b>

**B001 - R0006 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
Window bwading	Caulking Material					
	2097/B001/R0005/window beading/S6					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>

**B001 - R0007 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
Window Beading	Caulking Material					
	2097/B001/R0005/window beading/S6					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>

**B001 - R0008 - Personal Effects Storage**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B001 - R0009 - Home Base</b>						
Window beading	Caulking Material					
	2097/B001/R0005/window beading/S6					No Asbestos Detected
<b>B001 - R0010 - Home Base</b>						
Window Beading	Caulking Material					
	2097/B001/R0005/window beading/S6					No Asbestos Detected
<b>B001 - R0011 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected
Window Beading	Caulking Material					
	2097/B001/R0005/window beading/S6					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B001 - R0012 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected
Window beading	Caulking Material					
	2097/B001/R0005/window beading/S6					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B001 - R0013 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B001 - R0014 - Home Base</b>						
Window beading	Caulking Material					
	2097/B001/R0005/window beading/S6					No Asbestos Detected
<b>B001 - R0015 - General Storeroom</b>						
Window beading	Caulking Material					
	2097/B001/R0005/window beading/S6					No Asbestos Detected
<b>B001 - R0016 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					No Asbestos Detected
<b>B001 - R0017 - Distribution Board</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B001/R0017/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Mounting Board	Resinous Membrane	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Assumed -Live.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R0018 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2097/B001/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2097/B001/R0019/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B001 - R0019 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2097/B001/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2097/B001/R0019/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B001 - R0020 - Staff Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2097/B001/R0019/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B001 - R0021 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	108m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2097/B001/R0019/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B002 - Administration - 1994 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - No sub-floor void opening

**Interior**

**B002 - R0001 - Staff Room**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0002 - Deputy Principal**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0003 - Principal**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0004 - Deputy Principal**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0005 - Interview**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0006 - Clerical Office**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0007 - Duplicating Workroom**

No Asbestos

**B002 - R0008 - Sick Bay**

No Asbestos

**B002 - R0009 - Sick Bay - Shower/Toilet**

No Asbestos

**B002 - R0010 - Distribution Board**

Note: No inspection of live electrical installation.

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0011 - Cleaning Distributed Store**

No Asbestos

**B002 - R0012 - Staff Room Annexe**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0013 - Disabled Toilet**

No Asbestos

**B002 - R0014 - Staff Toilet**

No Asbestos

**B002 - R0015 - Staff Toilet**

No Asbestos

**B002 - R0016 - Security Store**

No Asbestos

**B002 - R0017 - Communications Cupboard**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0018 - Movement**

No Asbestos

**B002 - R0019 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

Vinyl Tiles (Under Floor Covering/Carpet)

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B003 - General Learning - 1996 - Concrete (Concrete)**

**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B001/R0019/Ceiling Structures/Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - height restricted approx 4 m</b>					
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

**Interior**

**B003 - R0001 - Home Base**

No Asbestos

**B003 - R0002 - Personal Effects Storage**

No Asbestos

**B003 - R0003 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4			<b>No Asbestos Detected</b>		
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7			<b>No Asbestos Detected</b>		

**B003 - R0004 - Movement**

No Asbestos

**B003 - R0005 - Home Base**

No Asbestos

**B003 - R0006 - Home Base**

No Asbestos

**B003 - R0007 - Staff Toilet**

No Asbestos

**B003 - R0008 - Handwashing Facilities**

No Asbestos

**B003 - R0009 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4			<b>No Asbestos Detected</b>		

**B003 - R0010 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4			<b>No Asbestos Detected</b>		
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7			<b>No Asbestos Detected</b>		

**B003 - R0011 - Movement**

No Asbestos

**B003 - R0012 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4			<b>No Asbestos Detected</b>		
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7			<b>No Asbestos Detected</b>		

**B003 - R0013 - Withdrawal Space - 1hb**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B003 - R0014 - Cleaning Distributed Store**

Non Accessible

**B003 - R0015 - Craft Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	2097/B001/R0008/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive					
	2097/B003/R0012/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>

**B003 - R0016 - Withdrawal Space - 1hb**

No Asbestos

**B003 - R0017 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B001/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B001/R0019/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B003 - R0018 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B001/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B001/R0019/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B003 - R0019 - Cleaning Supplies**

Non Accessible

**B003 - R0020 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B001/R0019/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B004 - General Learning - 1978 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole					

**Interior**

**B004 - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	2097/B004/R0001/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>

**B004 - R0002 - Home Base**

No Asbestos

**B004 - R0003 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	3.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B004/R0003/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	2097/B004/R0003/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

**B004 - R0004 - Toilets - Boys/Girls**

No Asbestos

**B004 - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Membrane	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - Assumed live</b>

**B004 - R0006 - Toilets - Boys/Girls**

No Asbestos

**B004 - R0007 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	3.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2097/B004/R0003/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	2097/B004/R0003/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

**B004 - R0008 - Home Base**

No Asbestos

**B004 - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	2097/B004/R0001/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>

**B004 - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	2097/B004/R0001/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B005 - Library - 1994 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior****B005 - R0001 - Reading Area**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B005 - R0002 - Library Office/Workroom**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B005 - R0003 - Communications Room**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B005 - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B005 - R0005 - External Movement**

No Asbestos

**B005 - R0006 - Special Programs Room**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B005 - R0007 - Special Programs Store**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B005 - R0008 - Plant**

No Asbestos

**B005 - R0009 - Cleaning Distributed Store**

No Asbestos

**B005 - R0010 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B008 - Shed - 1960 - Timber Shed (Timber Shed)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - No manhole					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2097/B008/Eaves Linings/S10					<b>No Asbestos Detected</b>

**Interior**

**B008 - R0001 - General Storeroom**

Ceiling Structures/Linings	Compressed AC Sheet 2097/B008/Eaves Linings/S10					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B009 - Special Purpose - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B009 - R0001 - Special Programs Room - Type 1**

No Asbestos

**B009 - R0002 - Special Programs Room**

No Asbestos

**B009 - R0003 - Special Programs Store**

No Asbestos

**B009 - R0004 - Special Programs Store**

No Asbestos

**B009 - R0005 - Main Switch Board**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B010 - Building Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B010 - R0001 - General Storeroom**

No Asbestos

**B010 - R0002 - General Storeroom**

No Asbestos

**B010 - R0003 - General Storeroom**

No Asbestos

**B010 - R0004 - General Storeroom**

No Asbestos

**B010 - R0005 - General Storeroom**

No Asbestos

**B010 - R0006 - General Storeroom**

No Asbestos

**B010 - R0007 - Main Switch Board**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B011 - Building Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B011 - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 603 - D10896 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 25/11/2013**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

#### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 601 - D11315 - Learning Unit - Standard/Withdrawal : Placement Date - 14/01/2015**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D15197 - Learning Unit - Standard/Withdrawal : Placement Date - 14/10/2015**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017