


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gundagai Public School (2102)
Region : Riverina
State Electorate : Cootamundra
Local Government Area : Gundagai

Initial Survey : Noel Arnold & Associates : 16 - May - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Feb - 2017

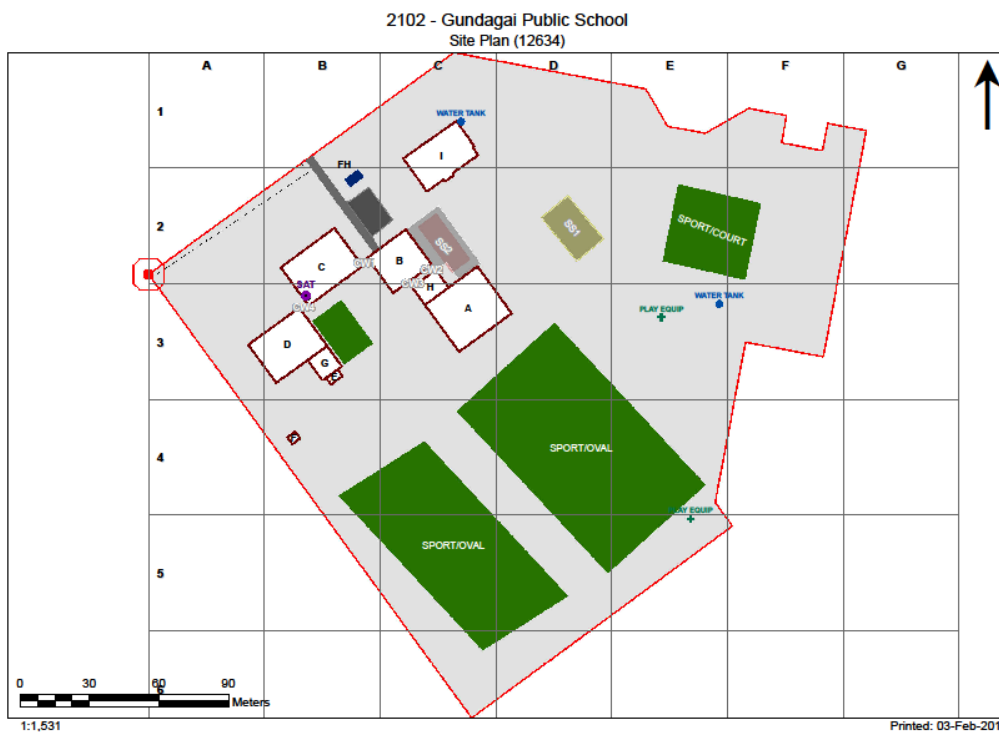

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior**B00A - R0001 - Movement (168.95 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	169m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2102/B00B/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

B00A - R0002 - Personal Effects Storage (8.85 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0003 - Home Base Store (7.95 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0004 - Toilets - Boys/Girls (3.29 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2102/B00D/R0009/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0005 - Toilets - Boys (33.33 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2102/B00D/R0009/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B00A - R0006 - Personal Effects Storage (6.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0007 - Home Base Store (7.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0008 - Home Base (65.9 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0009 - Home Base (65.65 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0010 - Home Base Store (6.83 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2102/B00B/R0010/Floor Coverings Res/Textile/S1	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0011 - Personal Effects Storage (6.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2102/B00B/R0010/Floor Coverings Res/Textile/S1	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0012 - No Access (4.28 m2)						
No Asbestos						
B00A - R0013 - Toilets - Girls (29.24 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 2102/B00D/R0009/Partition Walls (Cubicles)/S5	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0014 - Toilets - Boys/Girls (3.33 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 2102/B00D/R0009/Partition Walls (Cubicles)/S5	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0015 - Home Base Store (8.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2102/B00B/R0010/Floor Coverings Res/Textile/S1	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0016 - Personal Effects Storage (9.05 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2102/B00B/R0010/Floor Coverings Res/Textile/S1	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0017 - Home Base (94.86 m2)						
Ceiling Structures/Linings	Vermiculite 2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0018 - Home Base (95.93 m2)						
Ceiling Structures/Linings	Vermiculite 2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - Music/Pupil Facilities - 1972 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00B - R0001 - Movement (123.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	124m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00B/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
B00B - R0002 - Staff Room Annexe (14.43 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0003 - Movement (22.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0004 - Staff Kitchen (17.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0005 - Main Switch Board (11.04 m2)						
Electrical Mounting Board	Resinous Board	2Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Not able to be sampled due to live
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2102/B00B/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
B00B - R0006 - Sports Store (9.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2102/B00B/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
B00B - R0007 - Cleaning Distributed Store (10.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2102/B00B/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
B00B - R0008 - General Assistant/Bulk Store (12.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2102/B00B/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
B00B - R0009 - Movement (13 m2)						
No Asbestos						
B00B - R0010 - Canteen (27.37 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B00B - R0011 - Staff Toilet (3.88 m2)						
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Area inaccessible Not able to be

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0012 - Movement (10.19 m2)						
Ceiling Structures/Linings	Vermiculite					
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0013 - Withdrawal Space - 1hb (27.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0014 - Staff Toilet (2.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0015 - General Storeroom (2.37 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0018 - Cleaning Supplies (1.2 m2)						
No Asbestos						
B00B - R0019 - Uniform Shop (8.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0020 - General Storeroom (10.39 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B00B - R0021 - Canteen Office/Store (3.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00B/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B00B - R0022 - Staff Toilet (2.25 m2)						
No Asbestos						
B00B - R0023 - Staff Toilet (2.35 m2)						
No Asbestos						
B00B - R0024 - Toilet - Lobby (2.34 m2)						
No Asbestos						
B00B - R0025 - Toilet - Lobby (2.4 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - Administration/Library - 1976 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00C - R0001 - Movement (155.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	156m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00D/R0009/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00C - R0002 - Principal (23.52 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0003 - Staff Room (37.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00B/R0013/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0004 - Library Office/Workroom (10.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00C/R0007/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R0005 - Reading Area (141.89 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0006 - Library Office/Workroom (12.81 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0007 - Duplicating Workroom (13.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00C/R0007/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R0008 - General Storeroom (9.43 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00C/R0007/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R0009 - Sick Bay (9.3 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00C/R0007/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R0010 - Deputy Principal (13.56 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0011 - Entry Vestibule (35.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0012 - Clerical Office (15.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0014 - General Storeroom (13.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00C/R0007/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R0015 - General Storeroom (13.28 m2)						
Ceiling Structures/Linings	Vermiculite					
	2102/B00C/R0007/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00C/R0007/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00C - R0016 - Cleaning Supplies (4.65 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00C/R0007/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00D/R0009/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00C - R0017 - Distribution Board (1.03 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2102/B00D/R0010/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board	2Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Not able to be sampled due to live</i>						
B00C - R0019 - Toilet - Lobby (1.9 m2)						
No Asbestos						
B00C - R0020 - Toilet - Lobby (1.67 m2)						
No Asbestos						
B00C - R0021 - Staff Toilet (2.21 m2)						
No Asbestos						
B00C - R0022 - Staff Toilet (1.94 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - General Learning/Pupil Facilities - 1976 - Brick/Veneer (Brick/Veneer)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00D - R0001 - Movement (150.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	150m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00D/R0009/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00D - R0002 - Home Base (63.17 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00D/R0007/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0003 - Practical Activities - 1hb (9.39 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00D/R0007/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0004 - Toilets - Girls (25.63 m2)						
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Not able to be sampled due to no
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00D/R0009/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00D/R0009/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
B00D - R0005 - Practical Activities - 1hb (9.34 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00D/R0007/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0006 - Special Programs Room (62.61 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00D/R0007/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0007 - Home Base (62.69 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00D/R0007/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0008 - Practical Activities - 1hb (9.28 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2102/B00D/R0007/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0009 - Toilets - Boys (25.64 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00D/R0009/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00D/R0009/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00D - R0010 - Distribution Board (0.19 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2102/B00D/R0010/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Mounting Board	Resinous Membrane	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Not able to be sampled due to live

B00D - R0011 - Practical Activities - 1hb (9.37 m2)

Ceiling Structures/Linings Vermiculite
 2102/B00D/R0007/Ceiling Structures/Linings/S7 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0012 - Home Base (63.5 m2)

Ceiling Structures/Linings Vermiculite
 2102/B00D/R0007/Ceiling Structures/Linings/S7 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1972 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - General Storeroom (19.62 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not able to be sampled due to height						

Ceiling Voids	No Asbestos Found
---------------	-------------------

Underfloor Voids	No Asbestos Found
------------------	-------------------

Interior

B00F - R0001 - Garden Store (12.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - Canteen Covered Area (113.17 m2)

Ceiling Structures/Linings	Flat AC Sheeting	114m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2102/B00D/R0009/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Canteen Covered Area (120 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - Hall Chair Store (9.51 m2)

No Asbestos

B00I - R0002 - Communal/Performance Store (9.57 m2)

No Asbestos

B00I - R0003 - P.E. Store (12.97 m2)

No Asbestos

B00I - R0004 - Toilet - Lobby (2.42 m2)

No Asbestos

B00I - R0005 - Toilets - Girls (7.43 m2)

No Asbestos

B00I - R0006 - Sound Cupboard (2.1 m2)

No Asbestos

B00I - R0007 - Toilet - Lobby (3.4 m2)

No Asbestos

B00I - R0008 - Toilets - Boys (5.74 m2)

No Asbestos

B00I - R0009 - Cleaning Distributed Store (1.91 m2)

No Asbestos

B00I - R0010 - Disabled Toilet (13.37 m2)

No Asbestos

B00I - R0011 - Covered Outdoor Learning Area (145.6 m2)

No Asbestos

B00I - R0012 - Communal Space (165.87 m2)

No Asbestos

B00I - R0013 - Movement (3.88 m2)

No Asbestos

B00I - R0014 - Raised Platform (47.4 m2)

No Asbestos

B00I - R0015 - Movement (10.3 m2)

No Asbestos

B00I - R0016 - Ramp (11.33 m2)

No Asbestos

B00I - R0017 - Distribution Board (3.35 m2)

No Asbestos

Note: No inspection of live electrical installation.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017