


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Gundagai South Public School (2103)  
**Region :** Riverina  
**State Electorate :** Cootamundra  
**Local Government Area :** Gundagai

**Initial Survey :** Noel Arnold & Associates : 16 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 14 - Feb - 2017

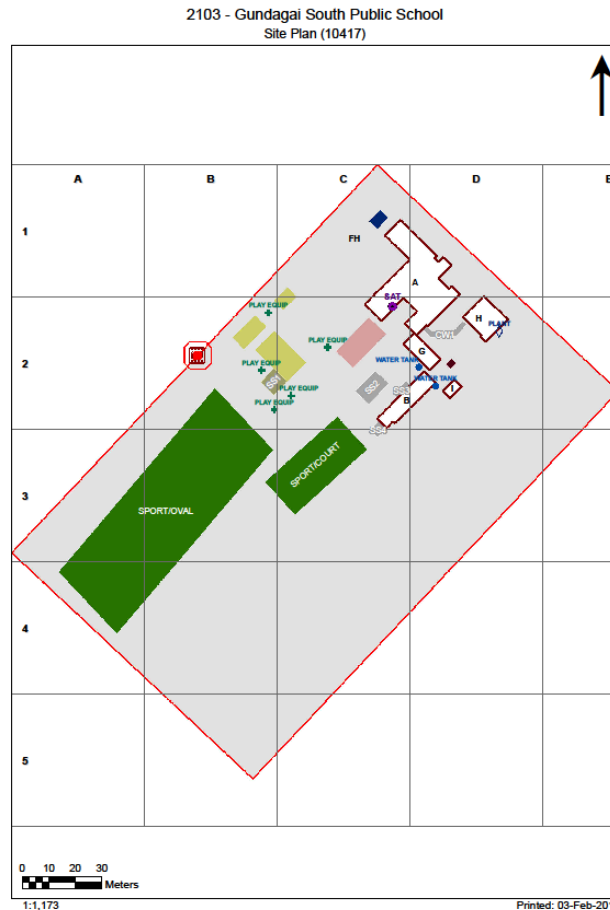

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1930 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	200m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2103/B00A/Eaves Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Cladding	Flat AC Sheeting	8m2	External to Room 29	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2103/B00F/Wall Cladding/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior**

**B00A - R0003 - General Storeroom**

No Asbestos

**B00A - R0004 - Duplicating Workroom**

No Asbestos

**B00A - R0005 - Cleaning Supplies**

Wall Linings Internal	Flat AC Sheeting	2103/B00A/R0001/Wall Linings Internal/S3				<b>No Asbestos Detected</b>
-----------------------	------------------	--	--	--	--	-----------------------------

**B00A - R0007 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	2103/B00A/R0001/Wall Linings Internal/S3				<b>No Asbestos Detected</b>
-----------------------	------------------	--	--	--	--	-----------------------------

**B00A - R0008 - Movement**

No Asbestos

**B00A - R0009 - Home Base**

No Asbestos

**B00A - R0010 - Reading Area**

No Asbestos

**B00A - R0011 - Home Base**

No Asbestos

**B00A - R0012 - Kiln Room**

No Asbestos

**B00A - R0013 - General Storeroom**

No Asbestos

**B00A - R0014 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	2103/B00A/R0014/Floor Coverings Res/Textile/S1				<b>No Asbestos Detected</b>
-----------------------------	-------------	--	--	--	--	-----------------------------

**B00A - R0015 - Home Base**

No Asbestos

**B00A - R0016 - Personal Effects Storage**

No Asbestos

**B00A - R0018 - Movement**

No Asbestos

**B00A - R0019 - Entry Vestibule**

No Asbestos

**B00A - R0020 - Movement**

No Asbestos

**B00A - R0021 - General Storeroom**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2103/B00A/R0021/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2103/B00A/R0021/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R0022 - Distribution Board</b>				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2103/B00A/R0021/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2103/B00A/R0021/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Not able to be sampled due to live</b>						

**B00A - R0023 - Reading Area**

No Asbestos

**B00A - R0024 - Reading Area**

No Asbestos

**B00A - R0025 - Reading Area**

No Asbestos

**B00A - R0026 - Reading Area**

No Asbestos

**B00A - R0027 - Shower/Change**

Wall Linings Internal	Flat AC Sheeting	4m2	Behind Bath	Good Condition (1)	Low (1)	Low Priority (2-3)
2103/B00A/R0027/Wall Linings Internal/S5				<b>Chrysotile (white asbestos)</b>		

**B00A - R0028 - Kitchen - Pre**

No Asbestos

**B00A - R0032 - External Movement**

No Asbestos

**B00A - R0033 - Movement**

No Asbestos

**B00A - R0034 - Staff Room Annexe**

No Asbestos

**B00A - R0035 - Staff Room Annexe**

No Asbestos

**B00A - R0036 - External Movement**

No Asbestos

**B00A - R0037 - Principal**

No Asbestos

**B00A - R0038 - General Storeroom**

No Asbestos

**B00A - R0039 - Entry Vestibule**

No Asbestos

**B00A - R0040 - Clerical Office/Workroom**

No Asbestos

**B00A - R0041 - Sick Bay**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0042 - Staff Room</b>						
No Asbestos						
<b>B00A - R0043 - Staff Kitchen</b>						
No Asbestos						
<b>B00A - R0044 - Staff Room</b>						
No Asbestos						
<b>B00A - R0045 - Staff Kitchen</b>						
No Asbestos						
<b>B00A - R0046 - Staff Toilet</b>						
No Asbestos						
<b>B00A - R9001 - Sports Store</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1989 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00B - R0001 - General Storeroom**

No Asbestos

**B00B - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2103/B00B/R0004/Partition Walls (Cubicles)/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0003 - Communal Space**

No Asbestos

**B00B - R0004 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2103/B00B/R0004/Partition Walls (Cubicles)/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Incinerator	Incinerator lining	1Unit(s)	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Not able to be sampled due to no</b>						

**B00B - R0005 - General Storeroom**

No Asbestos

**B00B - R0006 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
2103/B00B/R0006/Ceiling Structures/Linings/S7						

**B00B - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
2103/B00B/R0006/Ceiling Structures/Linings/S7						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Communal Facilities/Administration - 2009 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - General Storeroom**

No Asbestos

**B00G - R0002 - Sports Store**

No Asbestos

**B00G - R0003 - Covered Outdoor Learning Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Library - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00H - R0001 - Reading Area**

No Asbestos

**B00H - R0002 - Library Office/Workroom**

No Asbestos

**B00H - R0003 - K.L.A. Store**

No Asbestos

**B00H - R0004 - Communications Room**

No Asbestos

**B00H - R0005 - Main Switch Board**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Storage - 2008 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B001 - R0001 - General Storeroom**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017