


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Gundaroo Public School (2104)  
**Region :** Illawarra and South East  
**State Electorate :** Goulburn  
**Local Government Area :** Yass Valley

**Initial Survey :** Noel Arnold & Associates : 08 - May - 2008  
**Reviewed By :** Greencap-NAA : 01 - Aug - 2016

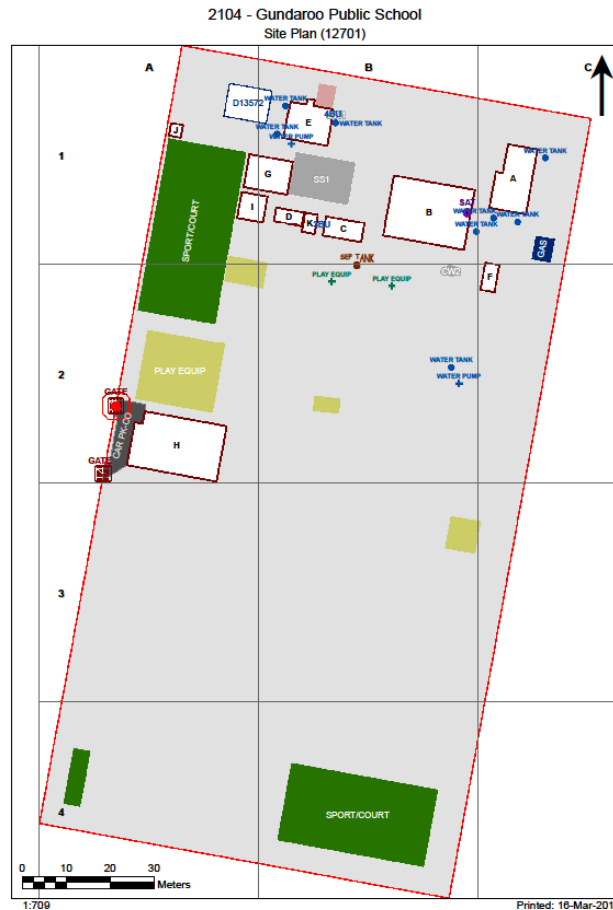

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2104/B00A/Eaves Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**Interior**

**B00A - R0001 - Clerical Office**

No Asbestos

**B00A - R0002 - Duplicating Workroom**

No Asbestos

**B00A - R0003 - Principal**

No Asbestos

**B00A - R0004 - Sick Bay**

No Asbestos

**B00A - R0009 - Staff Room**

No Asbestos

**B00A - R0010 - Entry Vestibule**

No Asbestos

**B00A - R0011 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2104/B00A/Eaves Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**B00A - R0012 - Access Shower/Toilet**

No Asbestos

**B00A - R0013 - Staff Kitchen**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1976 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids	Flat AC Sheeting 2104/B00B/Underfloor Voids/S3					<b>No Asbestos Detected</b>

**Interior**

**B00B - R0001 - Practical Activities - 1hb**

No Asbestos

**B00B - R0002 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00B - R0003 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00B - R0004 - Movement**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

Ceiling Structures/Linings	Flat AC Sheeting 2104/B00B/R0010/Ceiling Structures/Linings/S2					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00B - R0005 - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00B - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 2104/B00B/R0010/Ceiling Structures/Linings/S2					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00B - R0007 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00B - R0008 - Home Base**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00B - R0009 - Practical Activities - 1hb**

No Asbestos

**B00B - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 2104/B00B/R0010/Ceiling Structures/Linings/S2					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1976 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2104/B00C/Eaves Linings/S5			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior**

**B00C - R0001 - Drinking Facilities**

No Asbestos

**B00C - R0002 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2104/B00C/R0002/Ceiling Structures/Linings/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R0003 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2104/B00C/R0002/Ceiling Structures/Linings/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1940 - Timber (Timber)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids - Flat Roof      Non Accessible Area  
 - Area inaccessible

**Interior**

**B00D - R0001 - Movement**

Wall Linings Internal      Flat AC Sheeting  
 2104/B00D/R0001/Wall Linings Internal/S7

**No Asbestos Detected**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library - 1898 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible

**Interior**

**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
	2104/B00E/R0001/Ceiling Structures/Linings/S8					<b>No Asbestos Detected</b>

**B00E - R0002 - Clerical Office**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2104/B00E/R0002/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	2104/B00E/R0002/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>

**B00E - R0003 - General Storeroom**

No Asbestos

**B00E - R0004 - Reading Area**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2104/B00E/R0002/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Building Services - 1976 - Timber (Timber)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids - Flat Roof      No Asbestos Found

**Interior**

**B00F - R0001 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Music - 2003 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Special Programs Room**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00G - R0002 - Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00H - R0001 - Covered Outdoor Learning Area**

No Asbestos

**B00H - R0002 - Communal Space**

No Asbestos

**B00H - R0003 - General Storeroom**

No Asbestos

**B00H - R0004 - P.E. Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Building Services - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B001 - R0001 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Building Services - 2009 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00J - R0001 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Other - 2010 - Brick Shed (Brick Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00K - R0001 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting	9.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	--------	------------	--------------------	---------	--------------------

2104/B00K/R0001/Ceiling Structures/Linings/S6

**Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

**OS 601 - D13572 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 602 - D15582 - Learning Unit - Standard With P.A.A. : Placement Date - 7/12/2004**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

#### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017