


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Guyra Central School (2114)  
**Region :** New England  
**State Electorate :** Northern Tablelands  
**Local Government Area :** Guyra

**Initial Survey :** Noel Arnold & Associates : 20 - May - 2008  
**Reviewed By :** Greencap-NAA : 01 - Apr - 2015

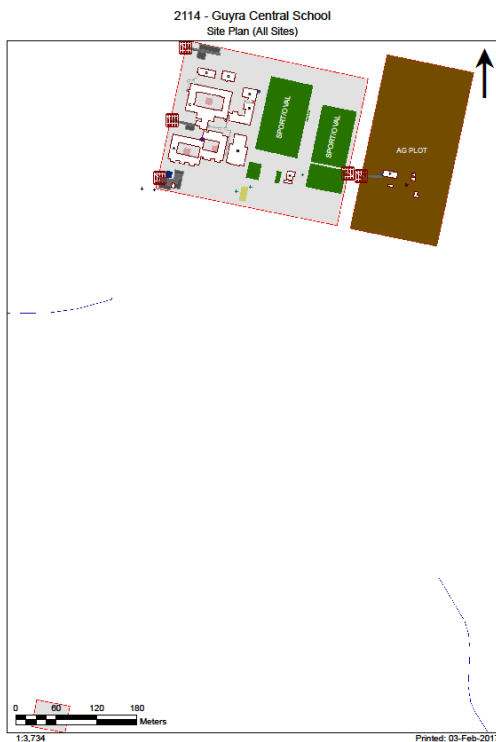

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - General Learning/Administration - 1976 - Brick/Block (Brick/Block)**

**Exterior**

|                                   |  |       |            |                    |                             |                    |
|-----------------------------------|--|-------|------------|--------------------|-----------------------------|--------------------|
| Eaves Linings                     | Flat AC Sheeting                               | 300m2 | Throughout | Good Condition (1) | Low (1)                     | Low Priority (2-3) |
|                                   | 2114/B00A/R0039/Ceiling Structures/Linings/S19 |       |            |                    | Chrysotile (white asbestos) |                    |
| Ceiling Voids                     | No Asbestos Found                              |       |            |                    |                             |                    |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible     |       |            |                    |                             |                    |

**Interior**

**B00A - R0001 - Seminar/Study (11.29 m2)**

No Asbestos

**B00A - R0002 - Seminar/Study (11.29 m2)**

No Asbestos

**B00A - R0003 - Reading Area (286.16 m2)**

No Asbestos

**B00A - R0004 - Cleaning Distributed Store (8.39 m2)**

|                             |   |  |  |  |                      |
|-----------------------------|---|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |                      |
|                             | 2114/B00A/R0049/Floor Coverings Res/Textile/S15 |  |  |  | No Asbestos Detected |

**B00A - R0005 - Garden Store (7.9 m2)**

|                             |   |  |  |  |                      |
|-----------------------------|---|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |                      |
|                             | 2114/B00A/R0049/Floor Coverings Res/Textile/S15 |  |  |  | No Asbestos Detected |

**B00A - R0006 - Toilets - Boys (17.26 m2)**

No Asbestos

**B00A - R0007 - Toilets - Girls (17.21 m2)**

No Asbestos

**B00A - R0008 - General Storeroom (16.82 m2)**

|                             |   |  |  |  |                      |
|-----------------------------|---|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |                      |
|                             | 2114/B00A/R0049/Floor Coverings Res/Textile/S15 |  |  |  | No Asbestos Detected |

**B00A - R0009 - Distribution Board (0.84 m2)**

Note: No inspection of live electrical installation.

|                            |  |     |            |                    |                             |                    |
|----------------------------|--|-----|------------|--------------------|-----------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 1m2 | Throughout | Good Condition (1) | Low (1)                     | Low Priority (2-3) |
|                            | 2114/B00A/R0039/Ceiling Structures/Linings/S19 |     |            |                    | Chrysotile (white asbestos) |                    |

**B00A - R0010 - Withdrawal Space - 1hb (16.66 m2)**

No Asbestos

**B00A - R0011 - Movement (1.47 m2)**

|                            |  |     |            |                    |                             |                    |
|----------------------------|--|-----|------------|--------------------|-----------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 2m2 | Throughout | Good Condition (1) | Low (1)                     | Low Priority (2-3) |
|                            | 2114/B00A/R0039/Ceiling Structures/Linings/S19 |     |            |                    | Chrysotile (white asbestos) |                    |

**B00A - R0012 - Movement (128.33 m2)**

|                             |   |  |  |  |                      |
|-----------------------------|---|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |                      |
|                             | 2114/B00A/R0049/Floor Coverings Res/Textile/S15 |  |  |  | No Asbestos Detected |

**B00A - R0013 - Home Base (56.84 m2)**

No Asbestos

**B00A - R0014 - Practical Activities - 1hb (21.7 m2)**

|                             |   |  |  |  |                      |
|-----------------------------|---|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |                      |
|                             | 2114/B00A/R0049/Floor Coverings Res/Textile/S15 |  |  |  | No Asbestos Detected |

**B00A - R0015 - Home Base (56.6 m2)**

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority                                     |
|---|----------------------|--------|--------------------|--------------------|-------------|--|
| Sample No   |                      |        |                    |                    |             | Test Result  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0016 - Home Base (73.27 m2)</b>                  |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0017 - Toilets - Boys/Girls (2.92 m2)</b>        |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0018 - Practical Activities - 1hb (22.03 m2)</b> |                      |        |                    |                    |             |  |
| Floor Coverings Res/Textile                                 | Vinyl Tiles          |        |                    |                    |             |  |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15             |                      |        |                    |                    |             | No Asbestos Detected                                 |
| <b>B00A - R0019 - Toilets - Boys/Girls (2.92 m2)</b>        |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0020 - Home Base (73.61 m2)</b>                  |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0021 - Home Base (57.25 m2)</b>                  |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0022 - Practical Activities - 1hb (12.45 m2)</b> |                      |        |                    |                    |             |  |
| Floor Coverings Res/Textile                                 | Vinyl Tiles          |        |                    |                    |             |  |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15             |                      |        |                    |                    |             | No Asbestos Detected                                 |
| <b>B00A - R0023 - Practical Activities - 1hb (12.45 m2)</b> |                      |        |                    |                    |             |  |
| Floor Coverings Res/Textile                                 | Vinyl Tiles          |        |                    |                    |             |  |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15             |                      |        |                    |                    |             | No Asbestos Detected                                 |
| <b>B00A - R0024 - Special Programs Room (56.53 m2)</b>      |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0025 - Home Base (56.53 m2)</b>                  |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0026 - Practical Activities - 1hb (21.64 m2)</b> |                      |        |                    |                    |             |  |
| Floor Coverings Res/Textile                                 | Vinyl Tiles          |        |                    |                    |             |  |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15             |                      |        |                    |                    |             | No Asbestos Detected                                 |
| <b>B00A - R0027 - Home Base (56.53 m2)</b>                  |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0028 - Home Base (56.53 m2)</b>                  |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0029 - Practical Activities - 1hb (21.64 m2)</b> |                      |        |                    |                    |             |  |
| Floor Coverings Res/Textile                                 | Vinyl Tiles          |        |                    |                    |             |  |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15             |                      |        |                    |                    |             | No Asbestos Detected                                 |
| <b>B00A - R0030 - Home Base (57.25 m2)</b>                  |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0031 - Movement (5.14 m2)</b>                    |                      |        |                    |                    |             |  |
| Ceiling Structures/Linings                                  | Flat AC Sheeting     | 6m2    | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)                                   |
| 2114/B00A/R0039/Ceiling Structures/Linings/S19              |                      |        |                    |                    |             | Chrysotile (white asbestos)                          |
| <b>B00A - R0032 - Staff Room Annexe (15.57 m2)</b>          |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0033 - Distribution Board (0.88 m2)</b>          |                      |        |                    |                    |             |  |
|   |                      |        |                    |                    |             | Note: No inspection of live electrical installation. |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0034 - Cleaning Distributed Store (0.69 m2)</b>  |                      |        |                    |                    |             |  |
| No Asbestos   |                      |        |                    |                    |             |  |
| <b>B00A - R0035 - Toilets - Boys (17.31 m2)</b>             |                      |        |                    |                    |             |  |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status  | Control Priority   |
|---|----------------------|--------|--------------------|--------------------|--|--------------------|
| Sample No   |                      |        |                    |                    | Test Result  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0036 - Toilets - Girls (16.72 m2)</b>      |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0037 - General Storeroom (17.48 m2)</b>    |                      |        |                    |                    |  |                    |
| Floor Coverings Res/Textile                           | Vinyl Tiles          |        |                    |                    |  |                    |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15       |                      |        |                    |                    | No Asbestos Detected                                 |                    |
| <b>B00A - R0038 - Movement (12.7 m2)</b>              |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0039 - Movement (4.21 m2)</b>              |                      |        |                    |                    |  |                    |
| Ceiling Structures/Linings                            | Flat AC Sheeting     | 5m2    | Throughout         | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 2114/B00A/R0039/Ceiling Structures/Linings/S19        |                      |        |                    |                    | Chrysotile (white asbestos)                          |                    |
| <b>B00A - R0040 - Staff Room (97.79 m2)</b>           |                      |        |                    |                    |  |                    |
| Floor Coverings Res/Textile                           | Vinyl Tiles          |        |                    |                    |  |                    |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15       |                      |        |                    |                    | No Asbestos Detected                                 |                    |
| <b>B00A - R0041 - Movement (1.01 m2)</b>              |                      |        |                    |                    |  |                    |
| Ceiling Structures/Linings                            | Flat AC Sheeting     | 2m2    | Throughout         | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| 2114/B00A/R0039/Ceiling Structures/Linings/S19        |                      |        |                    |                    | Chrysotile (white asbestos)                          |                    |
| <b>B00A - R0042 - Movement (63.31 m2)</b>             |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0043 - Cleaning Supplies (8.8 m2)</b>      |                      |        |                    |                    |  |                    |
| Floor Coverings Res/Textile                           | Vinyl Tiles          |        |                    |                    |  |                    |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15       |                      |        |                    |                    | No Asbestos Detected                                 |                    |
| <b>B00A - R0044 - General Storeroom (13.09 m2)</b>    |                      |        |                    |                    |  |                    |
| Floor Coverings Res/Textile                           | Vinyl Tiles          |        |                    |                    |  |                    |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15       |                      |        |                    |                    | No Asbestos Detected                                 |                    |
| <b>B00A - R0045 - Staff Room (5.4 m2)</b>             |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0046 - Distribution Board (0.69 m2)</b>    |                      |        |                    |                    | Note: No inspection of live electrical installation. |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0047 - Staff Toilet (5.54 m2)</b>          |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0048 - General Storeroom (13.05 m2)</b>    |                      |        |                    |                    |  |                    |
| Floor Coverings Res/Textile                           | Vinyl Tiles          |        |                    |                    |  |                    |
| 2114/B00A/R0049/Floor Coverings Res/Textile/S15       |                      |        |                    |                    | No Asbestos Detected                                 |                    |
| <b>B00A - R0052 - Staff Room Annexe (14.83 m2)</b>    |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0053 - Staff Room Annexe (14.88 m2)</b>    |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0054 - Staff Room Annexe (14.89 m2)</b>    |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0055 - Principal (30.34 m2)</b>            |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0056 - Duplicating Workroom (14.93 m2)</b> |                      |        |                    |                    |  |                    |
| No Asbestos   |                      |        |                    |                    |  |                    |
| <b>B00A - R0059 - Toilets - Boys (5.74 m2)</b>        |                      |        |                    |                    |  |                    |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|---------|----------------------|--------|--------------------|--------------------|-------------|--------------------|
|         | <b>Sample No</b>     |        |                    |                    |             | <b>Test Result</b> |

No Asbestos

**B00A - R0060 - Toilets - Girls (5.67 m2)**

No Asbestos

**B00A - R0061 - Movement (19 m2)**

No Asbestos

**B00A - R0062 - Distribution Board (0.95 m2)** Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0063 - Cleaning Distributed Store (3.21 m2)**

No Asbestos

**B00A - R0064 - Communications Room (19.84 m2)**

No Asbestos

**B00A - R0065 - Library Office/Workroom (13.6 m2)**

No Asbestos

**B00A - R0066 - Librarian (11.33 m2)**

No Asbestos

**B00A - R0071 - Sick Bay (6.87 m2)**

No Asbestos

**B00A - R0072 - Sick Bay (9.02 m2)**

No Asbestos

**B00A - R0073 - Clerical Office (41.57 m2)**

No Asbestos

**B00A - R0074 - Entry Vestibule (37.87 m2)**

No Asbestos

**B00A - R0075 - Movement (318 m2)**

No Asbestos

**B00A - R0076 - Lift (1.14 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - General Learning/Science - 1976 - Brick/Block (Brick/Block)**

**Exterior**

|                                   |  |      |            |                    |                                    |                    |
|-----------------------------------|--|------|------------|--------------------|------------------------------------|--------------------|
| Gable Verge Lining                | Flat AC Sheeting                               | 60m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|                                   | 2114/B00A/R0039/Ceiling Structures/Linings/S19 |      |            |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Ceiling Voids                     | No Asbestos Found                              |      |            |                    |                                    |                    |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible     |      |            |                    |                                    |                    |

**Interior**

**B00B - R0001 - Music Learning Space (96.1 m2)**

No Asbestos

**B00B - R0002 - Seminar/Study (62.29 m2)**

No Asbestos

**B00B - R0003 - Distribution Board (1.02 m2)**

Note: No inspection of live electrical installation.

|                          |                |       |      |                    |         |                    |
|--------------------------|----------------|-------|------|--------------------|---------|--------------------|
| Electrical Backing Board | Resinous Board | 1Unit | East | Good Condition (1) | Low (1) | Low Priority (2-3) |
|--------------------------|----------------|-------|------|--------------------|---------|--------------------|

**Assumed Asbestos - Electrical Hazard**

**B00B - R0004 - Cleaning Distributed Store (0.68 m2)**

No Asbestos

**B00B - R0005 - Staff Room Annexe (28.7 m2)**

No Asbestos

**B00B - R0006 - General Storeroom (9.85 m2)**

|                             |   |  |  |  |                             |  |
|-----------------------------|---|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |                             |  |
|                             | 2114/B00A/R0049/Floor Coverings Res/Textile/S15 |  |  |  | <b>No Asbestos Detected</b> |  |

**B00B - R0007 - General Learning Space (52.84 m2)**

No Asbestos

**B00B - R0008 - Laboratory L.S. (85.69 m2)**

No Asbestos

**B00B - R0009 - Preparation (49.84 m2)**

No Asbestos

**B00B - R0011 - Movement (3.83 m2)**

No Asbestos

**B00B - R0012 - Chemical Store (24.03 m2)**

|                             |   |  |  |  |                             |  |
|-----------------------------|---|--|--|--|-----------------------------|--|
| Floor Coverings Res/Textile | Vinyl Tiles                                     |  |  |  |                             |  |
|                             | 2114/B00A/R0049/Floor Coverings Res/Textile/S15 |  |  |  | <b>No Asbestos Detected</b> |  |

**B00B - R0013 - Staff Toilet (17.8 m2)**

No Asbestos

**B00B - R0014 - Staff Toilet (17.8 m2)**

No Asbestos

**B00B - R0015 - Movement (102.67 m2)**

No Asbestos

**B00B - R0016 - General Learning Space (86.03 m2)**

No Asbestos

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    | Test Result        |             |                  |

**B00C - General Learning/Technological&Applied Sciences - 1969 - Brick/Block (Brick/Block)**

**Exterior**

|                                   |  |       |            |                    |                                    |                    |
|-----------------------------------|--|-------|------------|--------------------|------------------------------------|--------------------|
| Eaves Linings                     | Flat AC Sheeting                               | 200m2 | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|                                   | 2114/B00C/R0030/Ceiling Structures/Linings/S21 |       |            |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible     |       |            |                    |                                    |                    |
| Ceiling Voids                     | No Asbestos Found                              |       |            |                    |                                    |                    |

**Interior**

**B00C - R0001 - Kiln Room (15.95 m2)**

|   |             |                                       |  |  |  |                       |
|---|-------------|---------------------------------------|--|--|--|-----------------------|
| Decorative Coating  | Vermiculite | 2114/B00C/R0050/Decorative Coating/S7 |  |  |  | Limited Samples Taken |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |                                       |  |  |  |                       |

**B00C - R0002 - Materials Store (8.19 m2)**

|   |             |                                       |  |  |  |                       |
|---|-------------|---------------------------------------|--|--|--|-----------------------|
| Decorative Coating  | Vermiculite | 2114/B00C/R0050/Decorative Coating/S7 |  |  |  | Limited Samples Taken |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |                                       |  |  |  |                       |

**B00C - R0005 - Laundry (13.28 m2)**

|   |             |                                       |  |  |  |                       |
|---|-------------|---------------------------------------|--|--|--|-----------------------|
| Decorative Coating  | Vermiculite | 2114/B00C/R0050/Decorative Coating/S7 |  |  |  | Limited Samples Taken |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |                                       |  |  |  |                       |

|           |                               |    |      |                    |                                    |                    |
|-----------|-------------------------------|----|------|--------------------|------------------------------------|--------------------|
| Flue Pipe | Fibre Cement Pipe             | 2m | West | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|           | 2114/B00C/R0005/Flue Pipe/S22 |    |      |                    | <b>Chrysotile (white asbestos)</b> |                    |

**B00C - R0006 - Food Technology L.S. (79.51 m2)**

|                             |             |  |  |  |  |                      |
|-----------------------------|-------------|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |  |  |  | No Asbestos Detected |
|-----------------------------|-------------|--|--|--|--|----------------------|

|   |             |                                       |  |  |  |                       |
|---|-------------|---------------------------------------|--|--|--|-----------------------|
| Decorative Coating  | Vermiculite | 2114/B00C/R0050/Decorative Coating/S7 |  |  |  | Limited Samples Taken |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |                                       |  |  |  |                       |

**B00C - R0007 - Food/Research Space (12.83 m2)**

|                             |             |  |  |  |  |                      |
|-----------------------------|-------------|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |  |  |  | No Asbestos Detected |
|-----------------------------|-------------|--|--|--|--|----------------------|

|   |             |                                       |  |  |  |                       |
|---|-------------|---------------------------------------|--|--|--|-----------------------|
| Decorative Coating  | Vermiculite | 2114/B00C/R0050/Decorative Coating/S7 |  |  |  | Limited Samples Taken |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |                                       |  |  |  |                       |

**B00C - R0008 - Pantry (10.26 m2)**

|                             |             |  |  |  |  |                      |
|-----------------------------|-------------|--|--|--|--|----------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |  |  |  | No Asbestos Detected |
|-----------------------------|-------------|--|--|--|--|----------------------|

|   |             |                                       |  |  |  |                       |
|---|-------------|---------------------------------------|--|--|--|-----------------------|
| Decorative Coating  | Vermiculite | 2114/B00C/R0050/Decorative Coating/S7 |  |  |  | Limited Samples Taken |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |                                       |  |  |  |                       |

**B00C - R0016 - T.A.S. Entry/Display (25.1 m2)**

|   |             |                                       |  |  |  |                       |
|---|-------------|---------------------------------------|--|--|--|-----------------------|
| Decorative Coating  | Vermiculite | 2114/B00C/R0050/Decorative Coating/S7 |  |  |  | Limited Samples Taken |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |                                       |  |  |  |                       |

**B00C - R0017 - Multi-Purpose Space (168.29 m2)**

|   |             |                                       |  |  |  |                       |
|---|-------------|---------------------------------------|--|--|--|-----------------------|
| Decorative Coating  | Vermiculite | 2114/B00C/R0050/Decorative Coating/S7 |  |  |  | Limited Samples Taken |
| <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |             |                                       |  |  |  |                       |

**B00C - R0019 - Toilets - Girls (22.59 m2)**

| Product  | Material Description                            | Extent | Location Reference | Material Condition | Risk Status                        | Control Priority   |
|--|---|--------|--------------------|--------------------|------------------------------------|--------------------|
| Sample No  |   |        |                    | Test Result        |                                    |                    |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet                             | 20m2   | East, West         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0029/Partition Walls (Cubicles)/S11  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 23m2   | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0020 - Canteen (36.3 m2)</b>                    |   |        |                    |                    |                                    |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 37m2   | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0021 - Staff Toilet (3.49 m2)</b>               |   |        |                    |                    |                                    |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 4m2    | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0022 - Canteen Office/Store (3.08 m2)</b>       |   |        |                    |                    |                                    |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 4m2    | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0023 - Canteen Office/Store (6.32 m2)</b>       |   |        |                    |                    |                                    |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 7m2    | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0024 - Main Switch Board (3.47 m2)</b>          |   |        |                    |                    |                                    |                    |
| No Asbestos  |   |        |                    |                    |                                    |                    |
| <b>B00C - R0025 - Canteen (19.13 m2)</b>                   |   |        |                    |                    |                                    |                    |
| No Asbestos  |   |        |                    |                    |                                    |                    |
| <b>B00C - R0026 - Communal Space (117.26 m2)</b>           |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                                | Vinyl Tiles                                     |        |                    |                    |                                    |                    |
|  | 2114/B00C/R0026/Floor Coverings Res/Textile/S12 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00C - R0027 - Cleaning Distributed Store (6.16 m2)</b> |   |        |                    |                    |                                    |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 7m2    | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Flue Pipe  | Fibre Cement Pipe                               | 4m     | Variable positions | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0005/Flue Pipe/S22                   |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0028 - Movement (17.1 m2)</b>                   |   |        |                    |                    |                                    |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 18m2   | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0029 - Toilets - Boys (24.02 m2)</b>            |   |        |                    |                    |                                    |                    |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet                             | 10m2   | East, West         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0029/Partition Walls (Cubicles)/S11  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 24m2   | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0030 - Shower/Change (27.77 m2)</b>             |   |        |                    |                    |                                    |                    |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet                             | 10m2   | East, West         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0029/Partition Walls (Cubicles)/S11  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 28m2   | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|  | 2114/B00C/R0030/Ceiling Structures/Linings/S21  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00C - R0031 - Cleaning Distributed Store (4.66 m2)</b> |   |        |                    |                    |                                    |                    |



| Product  | Material Description                           | Extent | Location Reference | Material Condition | Risk Status  | Control Priority  |
|--|--|--------|--------------------|--------------------|--|---|
| Sample No  |  |        |                    |                    | Test Result  |   |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                               | 5m2    | Throughout         | Good Condition (1) | Low (1)  | Low Priority (2-3)  |
|  | 2114/B00C/R0012/Ceiling Structures/Linings/S20 |        |                    |                    |  | <b>Chrysotile (white asbestos)</b>  |
| Flue Pipe  | Fibre Cement Pipe                              | 2m     | South              | Good Condition (1) | Low (1)  | Low Priority (2-3)  |
|  | 2114/B00C/R0005/Flue Pipe/S22                  |        |                    |                    |  | <b>Chrysotile (white asbestos)</b>  |
| <b>B00C - R0033 - Staff Room (39.36 m2)</b>                |  |        |                    |                    |  |   |
| Decorative Coating   | Vermiculite                                    |        |                    |                    |  | Limited Samples Taken   |
|  | 2114/B00C/R0050/Decorative Coating/S7          |        |                    |                    |  | <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet)      |        |                    |                    |  | No Asbestos Detected  |
|  | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    |  |   |
| <b>B00C - R0035 - Withdrawal Space - 1hb (21.36 m2)</b>    |  |        |                    |                    |  |   |
| Decorative Coating   | Vermiculite                                    |        |                    |                    |  | Limited Samples Taken   |
|  | 2114/B00C/R0050/Decorative Coating/S7          |        |                    |                    |  | <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00C - R0036 - Staff Room Annexe (32.78 m2)</b>         |  |        |                    |                    |  |   |
| Decorative Coating   | Vermiculite                                    |        |                    |                    |  | Limited Samples Taken   |
|  | 2114/B00C/R0050/Decorative Coating/S7          |        |                    |                    |  | <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00C - R0037 - Staff Room Annexe (18.58 m2)</b>         |  |        |                    |                    |  |   |
| Decorative Coating   | Vermiculite                                    |        |                    |                    |  | Limited Samples Taken   |
|  | 2114/B00C/R0050/Decorative Coating/S7          |        |                    |                    |  | <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00C - R0038 - Staff Toilet (3.91 m2)</b>               |  |        |                    |                    |  |   |
| Decorative Coating   | Vermiculite                                    |        |                    |                    |  | Limited Samples Taken   |
|  | 2114/B00C/R0050/Decorative Coating/S7          |        |                    |                    |  | <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00C - R0039 - General Storeroom (5.38 m2)</b>          |  |        |                    |                    |  |   |
| Floor Coverings Res/Textile                                | Vinyl Tiles                                    |        |                    |                    |  | No Asbestos Detected  |
|  | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    |  |   |
| Decorative Coating   | Vermiculite                                    |        |                    |                    |  | Limited Samples Taken   |
|  | 2114/B00C/R0050/Decorative Coating/S7          |        |                    |                    |  | <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00C - R0040 - Cleaning Distributed Store (2.64 m2)</b> |  |        |                    |                    |  |   |
| Flue Pipe  | Fibre Cement Pipe                              | 2m     | North              | Good Condition (1) | Low (1)  | Low Priority (2-3)  |
|  | 2114/B00C/R0005/Flue Pipe/S22                  |        |                    |                    |  | <b>Chrysotile (white asbestos)</b>  |
| <b>B00C - R0041 - Distribution Board (0.86 m2)</b>         |  |        |                    |                    |  |   |
|  |  |        |                    |                    | Note: No inspection of live electrical installation. |   |
| Floor Coverings Res/Textile                                | Vinyl Tiles                                    |        |                    |                    |  | No Asbestos Detected  |
|  | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    |  |   |
| <b>B00C - R0042 - General Storeroom (8.3 m2)</b>           |  |        |                    |                    |  |   |
| Floor Coverings Res/Textile                                | Vinyl Tiles                                    |        |                    |                    |  | No Asbestos Detected  |
|  | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    |  |   |
| Decorative Coating   | Vermiculite                                    |        |                    |                    |  | Limited Samples Taken   |
|  | 2114/B00C/R0050/Decorative Coating/S7          |        |                    |                    |  | <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00C - R0043 - Staff Toilet (3.92 m2)</b>               |  |        |                    |                    |  |   |
| Decorative Coating   | Vermiculite                                    |        |                    |                    |  | Limited Samples Taken   |
|  | 2114/B00C/R0050/Decorative Coating/S7          |        |                    |                    |  | <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b> |
| <b>B00C - R0044 - Staff Toilet (3.92 m2)</b>               |  |        |                    |                    |  |   |

| Product   | Material Description                      | Extent | Location Reference                             | Material Condition | Risk Status | Control Priority      |
|---|---|--------|--|--------------------|-------------|-----------------------|
| Sample No   |   |        |  |                    | Test Result |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| <b>B00C - R0045 - T.A.S. Entry/Display (8.41 m2)</b>  |   |        |  |                    |             |                       |
| No Asbestos   |   |        |  |                    |             |                       |
| <b>B00C - R0046 - General Storeroom (3.92 m2)</b>   |   |        |  |                    |             |                       |
| No Asbestos   |   |        |  |                    |             |                       |
| <b>B00C - R0047 - Clerical Office (21.97 m2)</b>  |   |        |  |                    |             |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| <b>B00C - R0048 - Movement (64.13 m2)</b>   |   |        |  |                    |             |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) |        | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |                    |             | No Asbestos Detected  |
| <b>B00C - R0049 - Public Entry (66.49 m2)</b>   |   |        |  |                    |             |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| <b>B00C - R0050 - Movement (6.4 m2)</b>   |   |        |  |                    |             |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| <b>B00C - R0051 - Interview (12.3 m2)</b>   |   |        |  |                    |             |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| <b>B00C - R0052 - Interview (12.3 m2)</b>   |   |        |  |                    |             |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| <b>B00C - R0053 - General Learning Space (57.49 m2)</b>   |   |        |  |                    |             |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) |        | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |                    |             | No Asbestos Detected  |
| <b>B00C - R0054 - General Storeroom (11.64 m2)</b>  |   |        |  |                    |             |                       |
| Floor Coverings Res/Textile   | Vinyl Tiles                               |        | 2114/B00C/R0039/Floor Coverings Res/Textile/S8 |                    |             | No Asbestos Detected  |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| <b>B00C - R0055 - Staff Room Annexe (9.87 m2)</b>   |   |        |  |                    |             |                       |
| Decorative Coating  | Vermiculite                               |        | 2114/B00C/R0050/Decorative Coating/S7          |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |  |                    |             |                       |
| <b>B00C - R0056 - General Learning Space (52.74 m2)</b>   |   |        |  |                    |             |                       |

| Product  | Material Description  | Extent | Location Reference | Material Condition | Risk Status  | Control Priority   |
|--|---|--------|--------------------|--------------------|--|--------------------|
| Sample No  |   |        |                    |                    | Test Result  |                    |
| Decorative Coating   | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles (Under Floor Covering/Carpet)<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    | No Asbestos Detected   |                    |
| <b>B00C - R0057 - General Learning Space (52.96 m2)</b>  |   |        |                    |                    |  |                    |
| Decorative Coating   | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles (Under Floor Covering/Carpet)<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    | No Asbestos Detected   |                    |
| <b>B00C - R0058 - General Learning Space (52.97 m2)</b>  |   |        |                    |                    |  |                    |
| Decorative Coating   | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles (Under Floor Covering/Carpet)<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    | No Asbestos Detected   |                    |
| <b>B00C - R0059 - General Storeroom (6.13 m2)</b>  |   |        |                    |                    |  |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8                               |        |                    |                    | No Asbestos Detected   |                    |
| Decorative Coating   | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |                    |
| <b>B00C - R0060 - Computer Resource (4.94 m2)</b>  |   |        |                    |                    |  |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8                               |        |                    |                    | No Asbestos Detected   |                    |
| Decorative Coating   | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |                    |
| <b>B00C - R0061 - Cleaning Distributed Store (0.94 m2)</b>   |   |        |                    |                    |  |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8                               |        |                    |                    | No Asbestos Detected   |                    |
| <b>B00C - R0062 - Computer Learning Space (52.74 m2)</b>   |   |        |                    |                    |  |                    |
| Decorative Coating   | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles (Under Floor Covering/Carpet)<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    | No Asbestos Detected   |                    |
| <b>B00C - R0063 - Distribution Board (0.82 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span> |   |        |                    |                    |  |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8                               |        |                    |                    | No Asbestos Detected   |                    |
| Electrical Backing Board   | Resinous Board  | 1Unit  | North              | Good Condition (1) | Low (1)  | Low Priority (2-3) |
| <b>Assumed Asbestos - Electrical Hazard</b>  |   |        |                    |                    |  |                    |
| <b>B00C - R0064 - Resources Store (5.09 m2)</b>  |   |        |                    |                    |  |                    |
| Floor Coverings Res/Textile  | Vinyl Tiles<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8                               |        |                    |                    | No Asbestos Detected   |                    |

| Product   | Material Description  | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|---|---|--------|--------------------|--------------------|-------------|--|
| Sample No   |   |        |                    |                    | Test Result |  |
| Decorative Coating  | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    |             | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| <b>B00C - R0065 - Resources Store (6.31 m2)</b>                 |   |        |                    |                    |             |  |
| Floor Coverings Res/Textile                                     | Vinyl Tiles<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8                               |        |                    |                    |             | No Asbestos Detected   |
| Decorative Coating  | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    |             | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| <b>B00C - R0066 - Art Learning Space (79.56 m2)</b>             |   |        |                    |                    |             |  |
| Decorative Coating  | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    |             | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| <b>B00C - R0067 - Movement (157.48 m2)</b>                      |   |        |                    |                    |             |  |
| Decorative Coating  | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    |             | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| Floor Coverings Res/Textile                                     | Vinyl Tiles (Under Floor Covering/Carpet)<br>2114/B00C/R0039/Floor Coverings Res/Textile/S8 |        |                    |                    |             | No Asbestos Detected   |
| <b>B00C - R0068 - Shower/Change (19.03 m2)</b>                  |   |        |                    |                    |             |  |
| No Asbestos   |   |        |                    |                    |             |  |
| <b>B00C - R0069 - Toilets-Disabled (8.23 m2)</b>                |   |        |                    |                    |             |  |
| Ceiling Structures/Linings                                      | Flat AC Sheeting  | 9m2    | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><i>Chrysotile (white asbestos)</i>   |
| 2114/B00C/R0012/Ceiling Structures/Linings/S20                  |   |        |                    |                    |             |  |
| <b>B00C - R0070 - External Movement (49.15 m2)</b>              |   |        |                    |                    |             |  |
| No Asbestos   |   |        |                    |                    |             |  |
| <b>B00C - R0071 - Movement (3.27 m2)</b>                        |   |        |                    |                    |             |  |
| No Asbestos   |   |        |                    |                    |             |  |
| <b>B00C - R0072 - Materials Store (17.76 m2)</b>                |   |        |                    |                    |             |  |
| Ceiling Structures/Linings                                      | Flat AC Sheeting  | 18m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><i>Chrysotile (white asbestos)</i>   |
| 2114/B00C/R0012/Ceiling Structures/Linings/S20                  |   |        |                    |                    |             |  |
| <b>B00C - R0074 - General Learning Space (90.26 m2)</b>         |   |        |                    |                    |             |  |
| Decorative Coating  | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    |             | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |
| <b>B00C - R0081 - Preparation - Materials (21.83 m2)</b>        |   |        |                    |                    |             |  |
| No Asbestos   |   |        |                    |                    |             |  |
| <b>B00C - R0082 - Toilets - Boys/Disabled Cubicle (13.9 m2)</b> |   |        |                    |                    |             |  |
| No Asbestos   |   |        |                    |                    |             |  |
| <b>B00C - R0083 - Wood Technology Bay (158.37 m2)</b>           |   |        |                    |                    |             |  |
| Decorative Coating  | Vermiculite<br>2114/B00C/R0050/Decorative Coating/S7  |        |                    |                    |             | Limited Samples Taken<br><i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - General Learning/Staff Facilities - 1920 - Timber (Timber)**

**Exterior**

|                          |   |       |            |   |         |                    |
|--------------------------|---|-------|------------|---|---------|--------------------|
| Eaves Linings            | Flat AC Sheeting                              | 20m2  | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                          | 2114/B00D/R0001/Ceiling Structures/Linings/S1 |       |            | <b>Chrysotile (white asbestos) , Amosite (brown Asbestos)</b> |         |                    |
| Electrical Backing Board | Resinous Board                                | 2Unit | North      | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                          | 2114/B00D/Electrical Backing Board/S5         |       |            | <b>Chrysotile (white asbestos)</b>                            |         |                    |
| Ceiling Voids            | No Asbestos Found                             |       |            |   |         |                    |
| Underfloor Voids         | No Asbestos Found                             |       |            |   |         |                    |

**Interior**

**B00D - R0001 - General Learning Space (52.59 m2)**

|                            |   |      |                           |   |         |                             |
|----------------------------|---|------|---------------------------|---|---------|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 53m2 | Throughout                | Good Condition (1)  | Low (1) | Low Priority (2-3)          |
|                            | 2114/B00D/R0001/Ceiling Structures/Linings/S1 |      |                           | <b>Chrysotile (white asbestos) , Amosite (brown Asbestos)</b> |         |                             |
| Chalk Board                | Resinous Board                                |      |                           |   |         | <b>No Asbestos Detected</b> |
|                            | 2114/B00D/R0001/Chalk Board/S3                |      |                           |   |         |                             |
| Wall Linings Internal      | Flat AC Sheeting                              | 60m2 | Throughout, Upper portion | Good Condition (1)  | Low (1) | Low Priority (2-3)          |
|                            | 2114/B00D/R0001/Wall Linings Internal/S4      |      |                           | <b>Chrysotile (white asbestos)</b>                            |         |                             |

**B00D - R0002 - Movement (17.68 m2)**

No Asbestos

**B00D - R0003 - General Learning Space (39.86 m2)**

No Asbestos

**B00D - R0004 - General Learning Space (38.4 m2)**

No Asbestos

**B00D - R0005 - Staff Room Annexe (13.63 m2)**

|                             |  |  |  |  |  |                             |
|-----------------------------|--|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles                                    |  |  |  |  | <b>No Asbestos Detected</b> |
|                             | 2114/B00D/R0005/Floor Coverings Res/Textile/S2 |  |  |  |  |                             |

**B00D - R0006 - Staff Room Annexe (13.63 m2)**

No Asbestos

**B00D - R0007 - Movement (34.8 m2)**

No Asbestos

**B00D - R0008 - Movement (33.75 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00E - Building Services - 1976 - Brick/Block (Brick/Block)**

**Exterior**

|                                   |  |
|-----------------------------------|--|
| Ceiling Voids - Flat Roof         | No Asbestos Found                          |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |

**Interior**

**B00E - R0001 - Cleaning Supplies (26.74 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00F - Mechanical Services - 1976 - Brick/Block (Brick/Block)**

**Exterior**

|                                   |  |
|-----------------------------------|--|
| Ceiling Voids                     | No Asbestos Found                          |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |

**Interior**

**B00F - R0001 - Dust Extraction Space (3.91 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00H - Building Services/Administration - 1976 - Brick/Block (Brick/Block)**

**Exterior**

|                                   |  |    |                    |                    |         |                                    |
|-----------------------------------|--|----|--------------------|--------------------|---------|------------------------------------|
| Gable Verge Lining                | Flat AC Sheeting                           | 4m | Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                                   | 2114/B00H/Gable Verge Lining/S23           |    |                    |                    |         | <b>Chrysotile (white asbestos)</b> |
| Ceiling Voids                     | No Asbestos Found                          |    |                    |                    |         |                                    |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |    |                    |                    |         |                                    |

**Interior**

**B00H - R0001 - Movement (22.54 m2)**

No Asbestos

**B00H - R0002 - General Assistant/Bulk Store (4.94 m2)**

|                            |  |     |            |                    |         |                                    |
|----------------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                            | 2114/B00H/R0002/Ceiling Structures/Linings/S18 |     |            |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00H - R0003 - General Assistant/Bulk Store (22.28 m2)**

|                            |  |      |            |                    |         |                                    |
|----------------------------|--|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 23m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                            | 2114/B00H/R0002/Ceiling Structures/Linings/S18 |      |            |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00H - R0004 - General Assistant/Bulk Store (12.17 m2)**

|                            |  |      |            |                    |         |                                    |
|----------------------------|--|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                            | 2114/B00H/R0002/Ceiling Structures/Linings/S18 |      |            |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00H - R0005 - General Assistant/Bulk Store (9.13 m2)**

|                            |  |      |            |                    |         |                                    |
|----------------------------|--|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 10m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                            | 2114/B00H/R0002/Ceiling Structures/Linings/S18 |      |            |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00H - R0006 - Garden Store (46 m2)**

No Asbestos

**B00H - R0007 - Staff Toilet (2.05 m2)**

|                            |  |     |            |                    |         |                                    |
|----------------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                               | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                            | 2114/B00H/R0002/Ceiling Structures/Linings/S18 |     |            |                    |         | <b>Chrysotile (white asbestos)</b> |

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B001 - Agricultural Science - 1976 - Timber Shed (Timber Shed)**

**Exterior**

|                                   |   |  |  |  |  |                             |
|-----------------------------------|---|--|--|--|--|-----------------------------|
| Gable Ends                        | Flat AC Sheeting<br>2114/B001/R0001/Wall Linings Internal/S17 |  |  |  |  | <b>No Asbestos Detected</b> |
| Ceiling Voids                     | No Asbestos Found   |  |  |  |  |                             |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible                    |  |  |  |  |                             |

**Interior**

**B001 - R0001 - Class Tools Storage (22.81 m2)**

|                       |   |  |  |  |  |                             |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting<br>2114/B001/R0001/Wall Linings Internal/S17 |  |  |  |  | <b>No Asbestos Detected</b> |
|-----------------------|---|--|--|--|--|-----------------------------|

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00J - Agricultural Science - 1976 - Metal Shed (Metal Shed)**

**Exterior**

|                                   |  |       |      |                    |         |                    |
|-----------------------------------|--|-------|------|--------------------|---------|--------------------|
| Ceiling Voids - Flat Roof         | No Asbestos Found                          |       |      |                    |         |                    |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |       |      |                    |         |                    |
| Electrical Backing Board          | Resinous Board                             | 1Unit | West | Good Condition (1) | Low (1) | Low Priority (2-3) |

**Assumed Asbestos - Electrical Hazard**

**Interior**

**B00J - R0001 - Agriculture Covered Area (30.07 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00K - Agricultural Science - 1976 - Steel (Steel)**

**Exterior**

Ceiling Voids                      No Asbestos Found

**Interior**

**B00K - R0001 - Animal Space (18.83 m2)**

No Asbestos

**B00K - R0002 - Animal Space (26.46 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00L - Agricultural Science - 1976 - Timber (Timber)**

**Exterior**

Ceiling Voids                      No Asbestos Found

**Interior**

**B00L - R0001 - Animal Space (6.68 m2)**

No Asbestos

**B00L - R0002 - Animal Space (18.88 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00M - Multi Purpose Facilities - 2007 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                                   |  |
|-----------------------------------|--|
| Ceiling Voids                     | No Asbestos Found                          |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |

**Interior**

**B00M - R0001 - Garden Store (14.97 m2)**

No Asbestos

**B00M - R0002 - Movement (3.49 m2)**

No Asbestos

**B00M - R0003 - Change (17.46 m2)**

No Asbestos

**B00M - R0004 - Shower/Change (6.66 m2)**

No Asbestos

**B00M - R0005 - Toilets-Girls (12.55 m2)**

No Asbestos

**B00M - R0006 - Movement (6.58 m2)**

No Asbestos

**B00M - R0007 - Toilets - Boys (12.66 m2)**

No Asbestos

**B00M - R0008 - Change (6.71 m2)**

No Asbestos

**B00M - R0009 - Plant (0.78 m2)**

No Asbestos

**B00M - R0010 - Change (20.94 m2)**

No Asbestos

**B00M - R0011 - Disabled Shower/Toilet (5.26 m2)**

No Asbestos

**B00M - R0012 - Movement (5.86 m2)**

No Asbestos

**B00M - R0013 - Stairs (1.88 m2)**

No Asbestos

**B00M - R0014 - Stage (61.65 m2)**

No Asbestos

**B00M - R0015 - Movement (24.3 m2)**

No Asbestos

**B00M - R0016 - Large Equipment Store (31.62 m2)**

No Asbestos

**B00M - R0017 - Chair Store (14.95 m2)**

No Asbestos

**B00M - R0018 - Movement (6.54 m2)**

No Asbestos

**B00M - R0019 - Staff Change (7.73 m2)**

No Asbestos

**B00M - R0020 - Cleaning Store - Distributed (3.3 m2)**

No Asbestos

**B00M - R0021 - Distribution Board Cupboard (0.88 m2)**

Note: No inspection of live electrical installation.

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|---------|----------------------|--------|--------------------|--------------------|-------------|--------------------|
|         | <b>Sample No</b>     |        |                    |                    |             | <b>Test Result</b> |

No Asbestos

**B00M - R0022 - Control Room (9.72 m2)**

No Asbestos

**B00M - R0023 - Sport Equipment Store (22.26 m2)**

No Asbestos

**B00M - R0024 - First Aid (11.03 m2)**

No Asbestos

**B00M - R0025 - Covered Outdoor Space (384.07 m2)**

No Asbestos

**B00M - R0026 - Gymnasium (325.15 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00N - Science Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                                   |  |
|-----------------------------------|--|
| Ceiling Voids                     | No Asbestos Found                          |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |

**Interior**

**B00N - R0001 - General Learning Space (59.62 m2)**

No Asbestos

**B00N - R0002 - Science Laboratory (59.62 m2)**

No Asbestos

**B00N - R0003 - Preparation - Science (30.06 m2)**

No Asbestos

**B00N - R0004 - Apparatus Store (13.97 m2)**

No Asbestos

**B00N - R0005 - Chemical Store (11.29 m2)**

No Asbestos

**B00N - R0006 - Staff Room (21.34 m2)**

No Asbestos

**B00N - R0007 - Seminar - Type 1 (21.34 m2)**

No Asbestos

**B00N - R0008 - Movement (5.19 m2)**

No Asbestos

**B00N - R0009 - External Movement (83.12 m2)**

No Asbestos

**B00N - R0010 - Distribution Board (0.6 m2)**

Note: No inspection of live electrical installation.

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B000 - Other - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                                   |  |
|-----------------------------------|--|
| Ceiling Voids                     | No Asbestos Found                          |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |

**Interior**

**B000 - R0001 - Store (21.75 m2)**

No Asbestos

**B000 - R0002 - Store (22 m2)**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00P - Agricultural Science - 2011 - Steel (Steel)**

**Exterior**

|                                   |  |
|-----------------------------------|--|
| Ceiling Voids                     | No Asbestos Found                          |
| Underfloor Voids - Slab on Ground | Non Accessible Area<br>- Area inaccessible |

**Interior**

**B00P - R0001 - Other (140.95 m2)**

No Asbestos

**B00P - R0002 - General Assistant/Bulk Store (49.7 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00Q - Technological & App. Studies - 2015 - Steel (Steel)**

**Exterior**

|                 |                   |
|-----------------|-------------------|
| Ceiling Void    | No Asbestos Found |
| Underfloor Void | No Asbestos Found |

**Interior**

**B00Q - R0001 - Materials Store (20.34 m2)**

No Asbestos

**B00Q - R0002 - Covered Area (38.1 m2)**

No Asbestos

**B00Q - R0003 - Design L.S. (32.79 m2)**

No Asbestos

**B00Q - R0004 - Entry (3.61 m2)**

No Asbestos

**B00Q - R0005 - Workshop Area (129.14 m2)**

No Asbestos

**B00Q - R0006 - Store (11.06 m2)**

No Asbestos

**B00Q - R0007 - Workshop Area (4.01 m2)**

No Asbestos

**B00Q - R0008 - Welding Area (4.01 m2)**

No Asbestos

**B00Q - R0009 - Welding Area (4.01 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**Build+1 - Gymnasium Replacement for Building G**

**Exterior**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**Build+2 - Metal Shed South of Building H**

**Exterior**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**Build+3 - Metal Railway Carriage Next to BuildingH**

**Exterior**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

2114\_ASB\_010713\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017