


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gwabegar Public School (2115)
Region : Western NSW
State Electorate : Barwon
Local Government Area : Narrabri

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Grencap-NAA : 02 - Mar - 2017

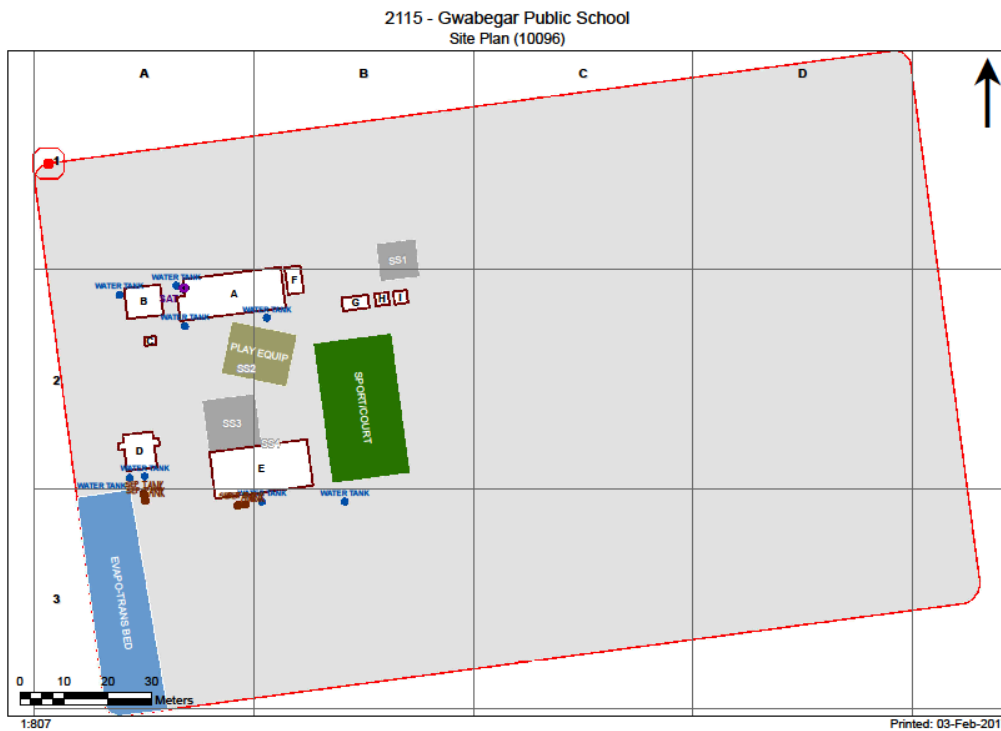

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1924 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

Interior

B00A - R0001 - Principal

No Asbestos

B00A - R0002 - Clerical Office/Workroom

No Asbestos

B00A - R0003 - General Storeroom

No Asbestos

B00A - R0004 - Movement

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Practical Activities - 1hb

No Asbestos

B00A - R0007 - Withdrawal Space - 1hb

No Asbestos

B00A - R0008 - Staff Room

No Asbestos

B00A - R0009 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1944 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00B - R0001 - Cleaning Distributed Store

No Asbestos

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2115/B00B/R0002/Ceiling Structures/Linings/S1	No Asbestos Detected
----------------------------	------------------	---	-----------------------------

B00B - R0003 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities - 1970 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00C - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2115/B00D/Eaves Linings/S3					Chrysotile (white asbestos)
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00D - R0001 - Movement

No Asbestos

B00D - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2115/B00D/R0002/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00D - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2115/B00D/R0002/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)

B00D - R0004 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Communal Facilities - 1972 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00E - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2115/B00E/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					
2115/B00E/R0001/Wall Linings Internal/S5					No Asbestos Detected	

B00E - R0002 - Home Base

No Asbestos

B00E - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2115/B00E/R0008/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00E - R0006 - Communal Space

Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2115/B00E/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					
2115/B00E/R0001/Wall Linings Internal/S5					No Asbestos Detected	

B00E - R0007 - Staff Toilet

No Asbestos

B00E - R0008 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2115/B00E/R0008/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Administration - 1924 - Timber Shed (Timber Shed)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-----	------	--------------------	---------	--------------------

Assumed Asbestos

Ceiling Voids	Requires Inspection
---------------	---------------------

Underfloor Voids	Requires Inspection
------------------	---------------------

Interior

B00F - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting					
	2115/B00F/R0001/Wall Linings Internal/S7					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Shed - 1924 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00G - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00H - R0001 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Other - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00I - R0001 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017