

# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Goulburn West Public School (3741)


**Region :** Illawarra and South East

**State Electorate :** Goulburn

**Local Government Area :** Goulburn Mulwaree

**Initial Survey :** Noel Arnold & Associates : 12 - May - 2008

**Reviewed By :** Parsons Brinckerhoff : 25 - Aug - 2016

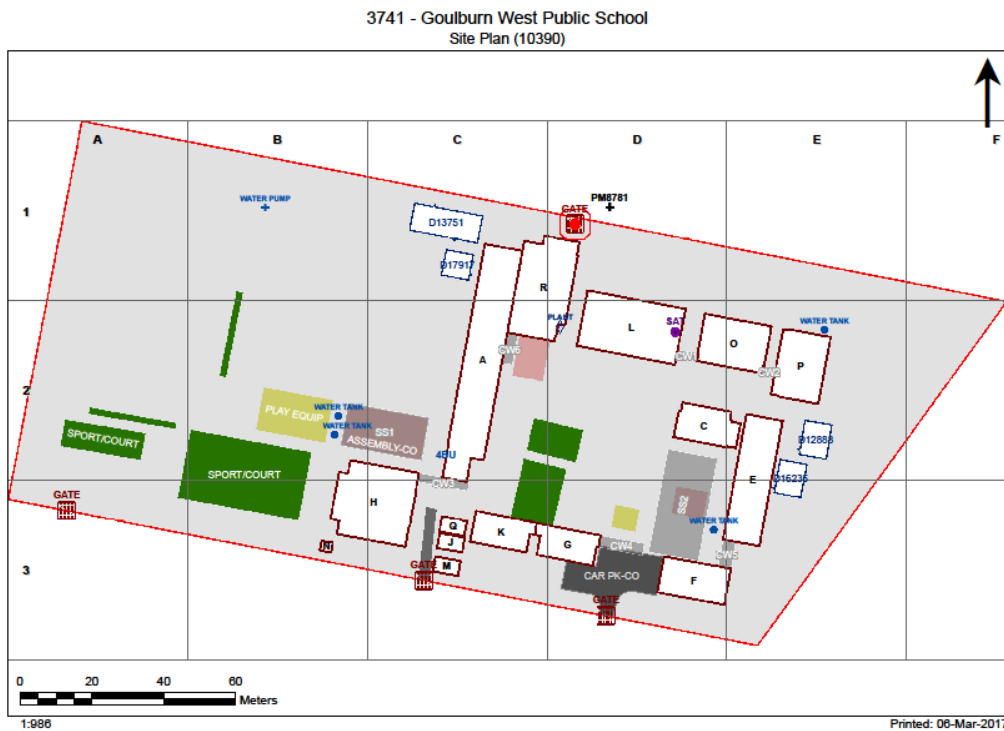

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1965 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	100m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

**Interior****B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0002 - Movement**

No Asbestos

**B00A - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0004 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
	3741/B00A/R0004/Floor Coverings Res/Textile/S2			<b>No Asbestos Detected</b>		

**B00A - R0005 - Movement**

No Asbestos

**B00A - R0006 - Principal**

No Asbestos

**B00A - R0007 - Clerical Office**

No Asbestos

**B00A - R0008 - Clerical Office**

No Asbestos

**B00A - R0009 - Clerical Office/Workroom**

No Asbestos

**B00A - R0010 - Staff Room**

No Asbestos

**B00A - R0011 - Home Base**

No Asbestos

**B00A - R0012 - Personal Effects Storage**

No Asbestos

**B00A - R0013 - Toilets - Girls**

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Encapsulated material within unit</b>					
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0013/Wall Linings Internal/S3			<b>Chrysotile (white asbestos)</b>		

**B00A - R0014 - Toilets - Boys**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0013/Wall Linings Internal/S3			<b>Chrysotile (white asbestos)</b>		

**B00A - R0015 - Home Base**

No Asbestos

**B00A - R0016 - Home Base**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0017 - Home Base</b>						
No Asbestos						
<b>B00A - R0018 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	3741/B00A/R0004/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
<b>B00A - R0019 - Cleaning Distributed Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	3741/B00A/R0019/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
<b>B00A - R0020 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00A - R0021 - Staff Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00A - R0022 - Canteen</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	3741/B00A/R0004/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00A - R0023 - Canteen Office/Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	3741/B00A/R0004/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1956 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

**Interior****B00C - R0001 - P.E. Store**

No Asbestos

**B00C - R0002 - General Storeroom**

No Asbestos

**B00C - R0003 - Home Base**

No Asbestos

**B00C - R0004 - Home Base**

Electrical Mounting Board	Resinous Board	1Unit	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00C/R0004/Electrical Mounting Board/S15					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Administration - 1992 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
In-fill-panel	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00E/In-fill-panel/S13				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3741/B00E/Underfloor Voids/S16				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	30m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00E/Eaves Linings/S8				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	10m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3741/B00E/Gable Verge Lining/S9				<b>Chrysotile (white asbestos)</b>	

**Interior****B00E - R0001 - Toilets - Boys/Girls**

No Asbestos

**B00E - R0002 - Home Base Store**

No Asbestos

**B00E - R0003 - Movement**

No Asbestos

**B00E - R0004 - Home Base**

No Asbestos

**B00E - R0005 - Home Base**

No Asbestos

**B00E - R0006 - Movement**

No Asbestos

**B00E - R0007 - Home Base Store**

No Asbestos

**B00E - R0008 - Personal Effects Storage**

No Asbestos

**B00E - R0009 - Deputy Principal**

No Asbestos

**B00E - R0010 - Home Base Store**

No Asbestos

**B00E - R0011 - Movement**

No Asbestos

**B00E - R0012 - Cleaning Supplies**

No Asbestos

**B00E - R0013 - Distribution Board**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00E/R0013/Wall Linings Internal/S5				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00E/R0013/Floor Coverings Res/Textile/S6				<b>Chrysotile (white asbestos)</b>	

**B00E - R0014 - Staff Toilet**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Encapsulated material within unit</b>						
<b>B00E - R0015 - Special Programs Room</b>						
No Asbestos						
<b>B00E - R0016 - General Storeroom</b>						
No Asbestos						
<b>B00E - R0017 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	4m	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	50m2	Infill panels above and below windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00E/In-fill-panel/S13			<b>Chrysotile (white asbestos)</b>		
<b>B00E - R0018 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	2m	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	8m2	Infill panels above and below windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00E/In-fill-panel/S13			<b>Chrysotile (white asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1958 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00F/In-fill-panel/S12			<b>Chrysotile (white asbestos)</b>		
Eaves Linings	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00F/Eaves Linings/S10			<b>Chrysotile (white asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	10m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3741/B00F/Gable Verge Lining/S11			<b>Chrysotile (white asbestos)</b>		
Infill panel above windows	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00F/Infill panel above windows/S14			<b>Chrysotile (white asbestos)</b>		
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

**Interior****B00F - R0001 - Home Base**

No Asbestos

**B00F - R0002 - Home Base Store**

No Asbestos

**B00F - R0003 - Personal Effects Storage**

No Asbestos

**B00F - R0004 - Home Base Store**

No Asbestos

**B00F - R0005 - Home Base**

No Asbestos

**B00F - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	10m	Infill panels above windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00F/Infill panel above windows/S14			<b>Chrysotile (white asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 1952 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	22m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Void	Non Accessible Area - No Manhole to Access Void					

**Interior****B00G - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R0002 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R0004 - Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 1992 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior****B00H - R0001 - Movement**

No Asbestos

**B00H - R0002 - Disabled Shower/Toilet**

No Asbestos

**B00H - R0003 - Communal/Performance Store**

No Asbestos

**B00H - R0004 - Communal Space**

No Asbestos

**B00H - R0005 - Movement**

No Asbestos

**B00H - R0006 - Cleaning Supplies**

No Asbestos

**B00H - R0007 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0008 - General Assistant/Bulk Store**

No Asbestos

**B00H - R0009 - Plant**

No Asbestos

**B00H - R0010 - Plant**

No Asbestos

**B00H - R0011 - Staff Kitchen**

No Asbestos

**B00H - R0012 - Security Store**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00H - R0013 - Toilets - Boys**

No Asbestos

**B00H - R0014 - Movement**

No Asbestos

**B00H - R0015 - Movement**

No Asbestos

**B00H - R0016 - Raised Platform**

No Asbestos

**B00H - R0017 - Movement**

No Asbestos

**B00H - R0018 - Movement**

No Asbestos

**B00H - R0019 - Shower/Change**

No Asbestos

**B00H - R0020 - Toilets - Girls**

No Asbestos

**B00H - R0021 - Hall Chair Store**

No Asbestos

**B00H - R0022 - Sports Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Communal Facilities - 1990 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00J - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 1952 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	22m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Void	Non Accessible Area - No Manhole to access void					

**Interior****B00K - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00K - R0002 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00K - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3741/B00A/R0001/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00K - R0004 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Library/Pupil Facilities - 1981 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

**Interior****B00L - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3741/B00L/R0002/Partition Walls (Cubicles)/S7					<b>Chrysotile (white asbestos)</b>	

**B00L - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3741/B00L/R0002/Partition Walls (Cubicles)/S7					<b>Chrysotile (white asbestos)</b>	

**B00L - R0003 - Special Programs Room**

No Asbestos

**B00L - R0004 - Plant**

No Asbestos

**B00L - R0005 - Special Programs Store**

No Asbestos

**B00L - R0006 - Main Switch Board**

No Asbestos

**B00L - R0007 - Cleaning Distributed Store**

No Asbestos

**B00L - R0008 - Security Store**

No Asbestos

**B00L - R0009 - Library Office/Workroom**

No Asbestos

**B00L - R0010 - Reading Area**

No Asbestos

**B00L - R0011 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Other - 2004 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00M - R0001 - Home Base Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Other - 2004 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00N - R0001 - Child Care Centre**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior****B000 - R0001 - External Movement**

No Asbestos

**B000 - R0002 - Practical Activities - 1hb**

No Asbestos

**B000 - R0003 - Home Base Store**

No Asbestos

**B000 - R0004 - Home Base**

No Asbestos

**B000 - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B000 - R0006 - Home Base**

No Asbestos

**B000 - R0007 - Home Base Store**

No Asbestos

**B000 - R0008 - Practical Activities - 1hb**

No Asbestos

**B000 - R0009 - Personal Effects Storage**

No Asbestos

**B000 - R0010 - Personal Effects Storage**

No Asbestos

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - General Learning - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior****B00P - R0001 - External Movement**

No Asbestos

**B00P - R0002 - Practical Activities - 1hb**

No Asbestos

**B00P - R0003 - Home Base Store**

No Asbestos

**B00P - R0004 - Home Base**

No Asbestos

**B00P - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00P - R0006 - Home Base**

No Asbestos

**B00P - R0007 - Home Base Store**

No Asbestos

**B00P - R0008 - Practical Activities - 1hb**

No Asbestos

**B00P - R0009 - Personal Effects Storage**

No Asbestos

**B00P - R0010 - Personal Effects Storage**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Q - Storage - 2006 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00Q - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D12888 - Learning Unit - Standard With P.A.A. : Placement Date - 30/04/2012**

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 502 - D13751 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 15/01/2000**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2

### Interior

#### R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2

#### R10 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	12 m2
---------	---------------	------------------	-------

#### R2 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	1 m2
---------	---------------	------------------	------

#### R3 - Duplicating Wookroom

Ceiling	Flat AC Sheet	Assumed Asbestos	12 m2
---------	---------------	------------------	-------

#### R4 - Clinic-Waiting

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

#### R5 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2
---------	---------------	------------------	-------

#### R6 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

#### R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

#### R8 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

#### R9 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	27 m2

**OS 602 - D16235 - Learning Unit - Standard With P.A.A. : Placement Date - 4/03/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 520 - D17917 - Staff Study : Placement Date - 26/02/2003</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Staff Room</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

3741\_ASB\_221112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017