


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Glen Alice Public School (3903)  
**Region :** Western NSW  
**State Electorate :** Bathurst  
**Local Government Area :** Lithgow

**Initial Survey :** Noel Arnold & Associates : 27 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 09 - Nov - 2016

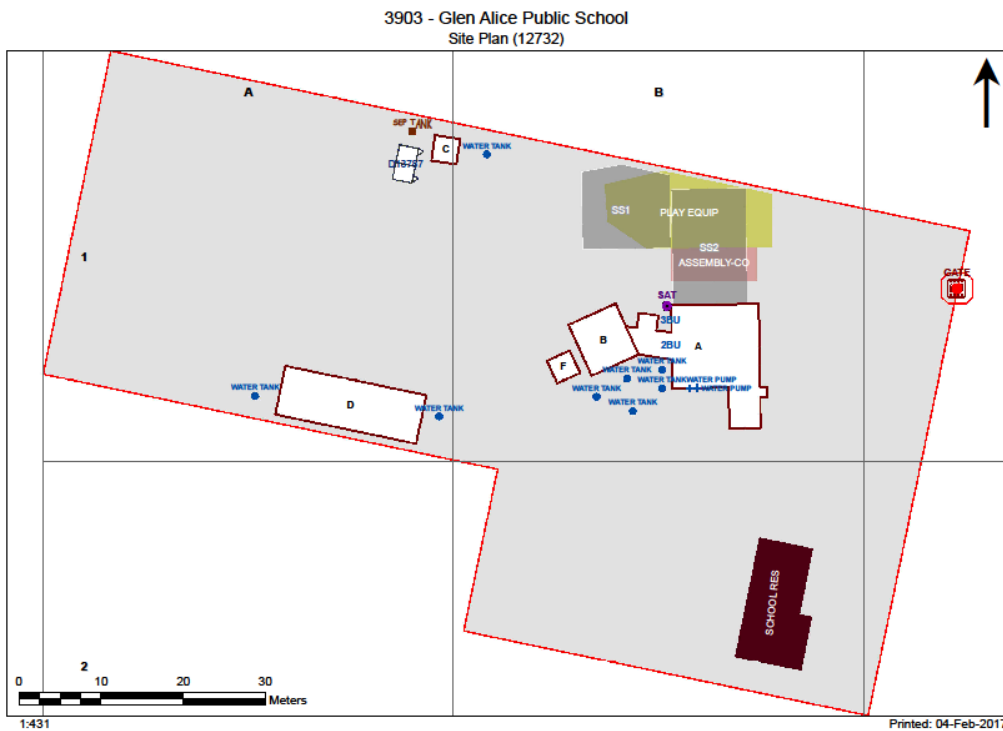

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1960 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3903/B00A/Eaves Linings/S1					<b>No Asbestos Detected</b>
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - No Access - No Key on Site to Padlock</b>						
Ceiling Void	No Asbestos Found					
Underfloor Void	AC Fragments/Debris 3903/B00A/Underfloor Void/S3	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos)</b>

**Interior**

**B00A - R0001 - Personal Effects Storage**

Ceiling Structures/Linings	Flat AC Sheeting 3903/B00A/R0001/Ceiling Structures/Linings/S6					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0002 - Principal**

No Asbestos

**B00A - R0003 - Home Base Store**

No Asbestos

**B00A - R0004 - Home Base**

No Asbestos

**B00A - R0006 - General Storeroom**

No Asbestos

**B00A - R0007 - External Movement**

No Asbestos

**B00A - R0008 - Clerical Office**

No Asbestos

**B00A - R0009 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3903/B00A/R0009/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Special Purpose - 1960 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris					
	3903/B00B/Underfloor Voids/S2					<b>No Asbestos Detected</b>

**Interior**

**B00B - R0001 - Special Programs Room**

Wall Linings Internal	Flat AC Sheeting					
	3903/B00B/R0001/Wall Linings Internal/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting					
	3903/B00B/R0001/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>

**B00B - R0002 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1910 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

**Interior**

**B00C - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet 3903/B00C/R0001/Partition Walls (Cubicles)/S8	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B00C - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet 3903/B00C/R0001/Partition Walls (Cubicles)/S8	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Other - 2007 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00D - R0002 - General Storeroom**

No Asbestos

**B00D - R0003 - General Storeroom**

No Asbestos

**B00D - R0004 - Garage/Carport**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Building Services - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00F - R0001 - Cleaning Distributed Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 844 - D13787 - Country Toilet - Reltc - Boys/Girls : Placement Date - 10/08/2005**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2

**Interior**

**R1 - Staff Toilet**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2

**R2 - Staff Toilet**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017