


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Grays Point Public School (3914)  
**Region :** Sydney  
**State Electorate :** Cronulla  
**Local Government Area :** Sutherland

**Initial Survey :** Noel Arnold & Associates : 12 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

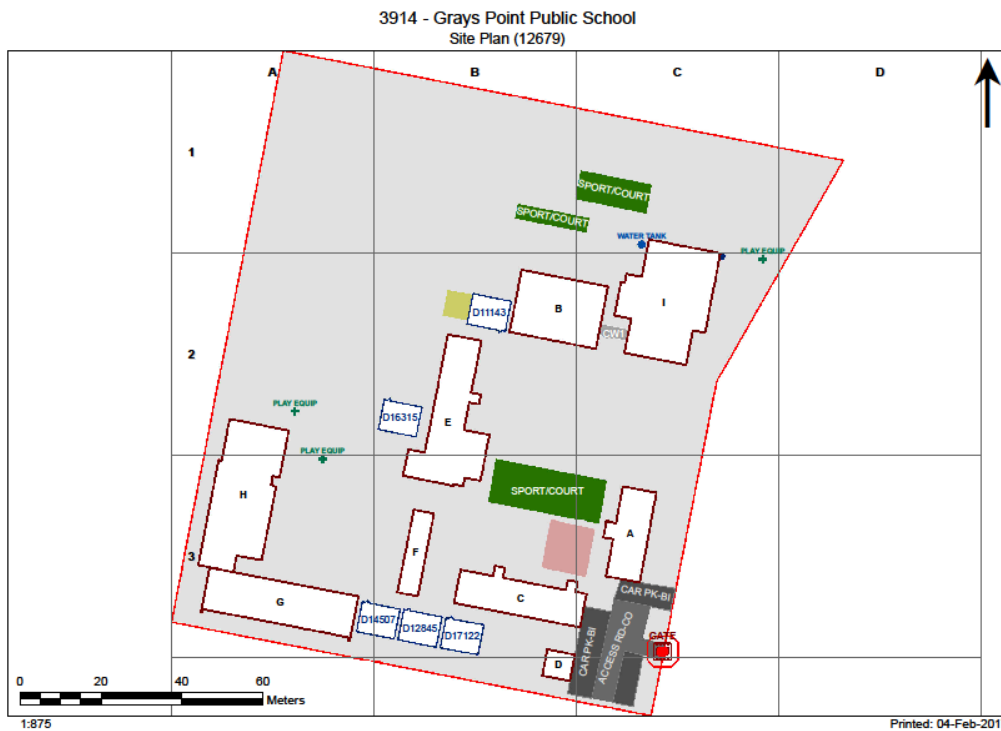

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3914/B00A/Eaves Linings/S13	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Underfloor Voids	Flat AC Sheeting 3914/B00A/Underfloor Voids/S23	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior**

**B00A - R0001 - Principal**

No Asbestos

**B00A - R0002 - Clerical Office**

No Asbestos

**B00A - R0003 - Duplicating Workroom**

No Asbestos

**B00A - R0004 - Staff Toilet**

No Asbestos

**B00A - R0005 - Staff Room**

No Asbestos

**B00A - R0006 - Staff Toilet**

No Asbestos

**B00A - R0007 - Movement**

No Asbestos

**B00A - R0008 - Entry Vestibule**

No Asbestos

**B00A - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3914/B00A/R0009/Ceiling Structures/Linings/S1	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00A - R0010 - Sick Bay**

No Asbestos

**B00A - R9001 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Library/Pupil Facilities - 1960 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

**Interior**

**B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - K.L.A. Store**

No Asbestos

**B00B - R0003 - Library Office/Workroom**

No Asbestos

**B00B - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0005 - Reading Area**

No Asbestos

**B00B - R0006 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3914/B00B/R0007/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

**B00B - R0007 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3914/B00B/R0007/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Administration - 1977 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00C/Eaves Linings/S14				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00C/Gable verge lining/S19				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

**Interior**

**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00C/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00C - R0002 - General Storeroom**

No Asbestos

**B00C - R0003 - Cleaning Distributed Store**

No Asbestos

**B00C - R0004 - Deputy Principal**

No Asbestos

**B00C - R0005 - Movement**

No Asbestos

**B00C - R0006 - Personal Effects Storage**

No Asbestos

**B00C - R0007 - Home Base Store**

No Asbestos

**B00C - R0008 - Home Base**

No Asbestos

**B00C - R0009 - Home Base**

No Asbestos

**B00C - R0010 - Home Base Store**

No Asbestos

**B00C - R0011 - Personal Effects Storage**

No Asbestos

**B00C - R0012 - Movement**

No Asbestos

**B00C - R0013 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00C/R0001/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00C - R0014 - Home Base Store**

No Asbestos

**B00C - R0015 - Home Base**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00D/Eaves Linings/S15			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids - Flat Roof	No Asbestos Found					

**Interior**

**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00D/R0001/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos)</b>		

**B00D - R0002 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00D/R0001/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos)</b>		

**B00D - R0003 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00D/R0001/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos)</b>		

**B00D - R0004 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00D/R0001/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Other - 1960 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting 3914/B00E/Eaves Linings/S16	80m2	East facing, West facing	Good Condition (1)  <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	Low (1)	Low Priority (2-3)
Gable verge lining	Flat AC Sheeting 3914/B00E/Gable verge lining/S20	20m	East facing, West facing	Good Condition (1)  <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	Low (1)	Low Priority (2-3)
Underfloor Voids	Flat AC Sheeting 3914/B00E/Underfloor Voids/S24	1m2	Throughout	Some Damage - Unsealed (3)  <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	Low (1)	Medium Priority (4-5)
Ceiling Void	No Asbestos Found					

**Interior****B00E - R0001 - Craft Store**

No Asbestos

**B00E - R0002 - Home Base Store**

No Asbestos

**B00E - R0003 - Home Base**

No Asbestos

**B00E - R0004 - General Storeroom**

No Asbestos

**B00E - R0005 - Personal Effects Storage**

No Asbestos

**B00E - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3914/B00E/R9001/Ceiling Structures/Linings/S4	5m2	All surfaces	Good Condition (1)  <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------------	---	-----	--------------	--	---------	--------------------

**B00E - R0007 - Movement**

No Asbestos

**B00E - R0008 - General Storeroom**

No Asbestos

**B00E - R0009 - General Storeroom**

No Asbestos

**B00E - R0010 - Out Of School Hours Care Centre**

No Asbestos

**B00E - R0015 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3914/B00E/R9001/Ceiling Structures/Linings/S4	5m2	West facing	Good Condition (1)  <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------------	---	-----	-------------	--	---------	--------------------

**B00E - R0016 - Special Programs Room**

No Asbestos

**B00E - R0017 - Canteen Covered Area**

No Asbestos

**B00E - R0018 - Canteen**

No Asbestos

**B00E - R0019 - Canteen Office/Store**

No Asbestos

**B00E - R9001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting 3914/B00E/R9001/Ceiling Structures/Linings/S4	54m2	All surfaces	Good Condition (1)  <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------------	---	------	--------------	--	---------	--------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - R9002 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities/Building Services - 1960 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00F/Eaves Linings/S17				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

**Interior**

**B00F - R0001 - Drinking Facilities**

No Asbestos

**B00F - R0002 - Toilets - Boys**

No Asbestos

**B00F - R0003 - Cleaning Distributed Store**

No Asbestos

**B00F - R0004 - Toilets - Girls**

No Asbestos

**B00F - R0005 - Drinking Facilities**

No Asbestos

**B00F - R0006 - Cleaning Supplies**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning/Other-After School Care - 1960 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Panels below windows	Compressed AC Sheet	18m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00G/R1001/Panels below windows/S8			Chrysotile (white asbestos)		
Eaves Linings	Flat AC Sheeting	30m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00G/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Void	Non Accessible Area - No Access - Padlocked and chained manhole - No key on site					
Gable Verge Lining	Flat AC Sheeting	20m	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3914/B00G/Gable Verge Lining/S21			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**Interior**

**B00G - R1001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00G/R1001/Ceiling Structures/Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Panels below windows	Compressed AC Sheet	18m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00G/R1001/Panels below windows/S8			Chrysotile (white asbestos)		

**B00G - R1002 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00G/R1002/Wall Linings Internal/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00G - R1003 - Staff Room Annexe**

No Asbestos

**B00G - R1004 - Cleaning Distributed Store**

No Asbestos

**B00G - R1005 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R1006 - General Storeroom**

No Asbestos

**B00G - R1007 - Staff Room Annexe**

No Asbestos

**B00G - R1008 - Movement**

No Asbestos

**B00G - R1009 - Home Base**

No Asbestos

**B00G - R1010 - Home Base Store**

No Asbestos

**B00G - R1011 - Personal Effects Storage**

No Asbestos

**B00G - R1012 - Home Base**

No Asbestos

**B00G - R1013 - Home Base Store**

No Asbestos

**B00G - R1014 - Personal Effects Storage**

No Asbestos

**B00G - R1015 - Home Base**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

**B00G - R1016 - Home Base Store**

No Asbestos

**B00G - R1017 - Home Base Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning/Pupil Facilities - 1977 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	30m	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3914/B00H/Gable Verge Lining/S22			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior**

**B00H - R0001 - Movement**

No Asbestos

**B00H - R0002 - Drinking Facilities**

No Asbestos

**B00H - R0003 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00H/R0003/Partition Walls (Cubicles)/S11			<b>Chrysotile (white asbestos)</b>		

**B00H - R0004 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00H/R0004/Ceiling Structures/Linings/S25			<b>Chrysotile (white asbestos)</b>		

**B00H - R0005 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00H/R0003/Partition Walls (Cubicles)/S11			<b>Chrysotile (white asbestos)</b>		

**B00H - R0006 - Movement**

No Asbestos

**B00H - R0007 - Cleaning Distributed Store**

No Asbestos

**B00H - R0008 - Home Base**

No Asbestos

**B00H - R0009 - Practical Activities - 1hb**

No Asbestos

**B00H - R0010 - Toilets - Boys/Girls**

No Asbestos

**B00H - R0011 - Movement**

No Asbestos

**B00H - R0012 - Movement**

No Asbestos

**B00H - R0013 - Movement**

No Asbestos

**B00H - R0014 - Movement**

No Asbestos

**B00H - R0015 - Home Base**

No Asbestos

**B00H - R0016 - Toilets - Boys/Girls**

No Asbestos

**B00H - R0017 - Practical Activities - 1hb**

No Asbestos

**B00H - R0018 - Movement**

No Asbestos

**B00H - R0019 - Sports Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
<b>B00H - R0020 - Movement</b>						
No Asbestos						
<b>B00H - R0021 - Kiln Room</b>						
Door panel	Flat AC Sheeting					
	3914/B00H/R0021/Door panel/S10					<b>No Asbestos Detected</b>
<b>B00H - R0022 - Movement</b>						
No Asbestos						
<b>B00H - R1001 - Cleaning Distributed Store</b>						
Non Accessible						
<b>B00H - R1002 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	3914/B00H/R1002/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
<b>B00H - R1003 - Distribution Board</b>						
						Note: No inspection of live electrical installation.
No Asbestos						
<b>B00H - R1004 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00H - R1005 - Home Base</b>						
No Asbestos						
<b>B00H - R1006 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00H/R0003/Partition Walls (Cubicles)/S11					<b>Chrysotile (white asbestos)</b>
<b>B00H - R1007 - Home Base Store</b>						
No Asbestos						
<b>B00H - R1008 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3914/B00H/R0003/Partition Walls (Cubicles)/S11					<b>Chrysotile (white asbestos)</b>
<b>B00H - R1009 - Home Base</b>						
No Asbestos						
<b>B00H - R1010 - Practical Activities - 1hb</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior**

**B00I - R0001 - Communal Space**

No Asbestos

**B00I - R0002 - Raised Platform**

No Asbestos

**B00I - R0003 - Communal/Performance Store**

No Asbestos

**B00I - R0004 - Hall Chair Store**

No Asbestos

**B00I - R0005 - P.E. Store**

No Asbestos

**B00I - R0006 - Toilets - Boys**

No Asbestos

**B00I - R0007 - Toilet - Lobby**

No Asbestos

**B00I - R0008 - Sound Cupboard**

No Asbestos

**B00I - R0009 - Access Shower/Toilet**

No Asbestos

**B00I - R0010 - Toilet - Lobby**

No Asbestos

**B00I - R0011 - Toilets - Girls**

No Asbestos

**B00I - R0012 - Main Switch Board**

No Asbestos

**B00I - R0013 - Cleaning Distributed Store**

No Asbestos

**B00I - R0014 - Movement**

No Asbestos

**B00I - R0015 - Ramp**

No Asbestos

**B00I - R0016 - Movement**

No Asbestos

**B00I - R0017 - Movement**

No Asbestos

**B00I - R0018 - Covered Outdoor Learning Area**

No Asbestos

**B00I - R0019 - External Movement**

No Asbestos

**B00I - R0020 - Plant**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 603 - D11143 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 6/01/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 601 - D12845 - Learning Unit - Standard/Withdrawal : Placement Date - 28/02/2000**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

**R2 - General Learning Space**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**R3 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D14507 - Learning Unit - Standard/Withdrawal : Placement Date - 7/05/1999**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

**R2 - General Learning Space**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**R3 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 603 - D16315 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 16/12/2008**

**Exterior**

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D17122 - Learning Unit - Standard With P.A.A. : Placement Date - 30/09/2015</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017