


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gordon West Public School (3943)
Region : Northern Sydney
State Electorate : Ku-ring-gai
Local Government Area : Ku-Ring-Gai

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 13 - Jul - 2016

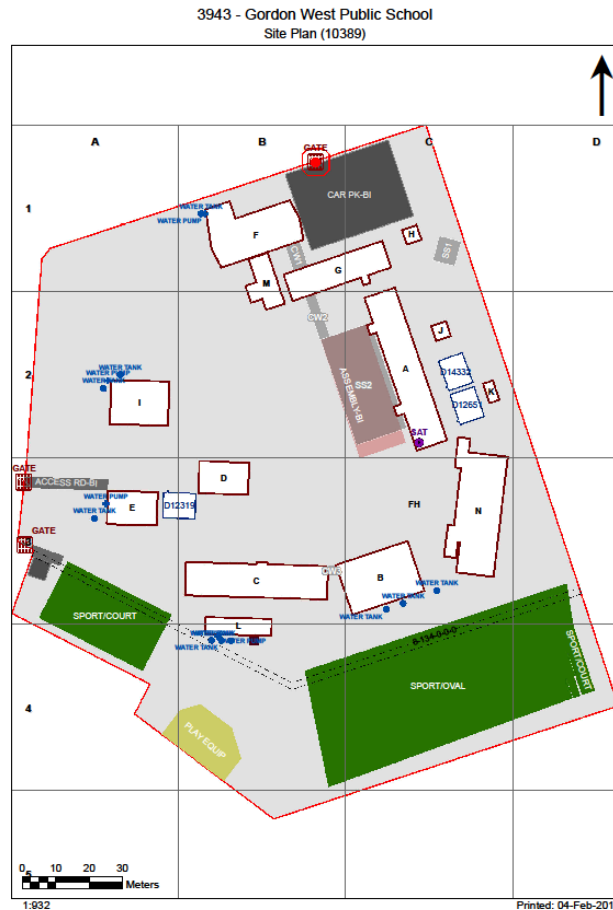

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning - 1951 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area					
	- Height Restriction < 0.4m .					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	200m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/Eaves Linings/S18					, Amosite (brown asbestos)

Interior

B00A - R0001 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00A - R0002 - Craft Store

No Asbestos

B00A - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00A - R0006 - Principal

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00A - R0007 - Staff Toilet

No Asbestos

B00A - R0008 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00A - R0009 - General Storeroom

No Asbestos

B00A - R0010 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00A - R0011 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00A - R0012 - General Storeroom

No Asbestos

B00A - R0013 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)

B00A - R0015 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00A/R0015/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)

B00A - R0016 - Home Base Store

No Asbestos

B00A - R0017 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	69m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
B00A - R0018 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
B00A - R0019 - Home Base Store						
No Asbestos						
B00A - R0020 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
B00A - R0021 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
B00A - R0022 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3943/B00A/R0015/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00A - R0023 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3943/B00A/R0021/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
B00A - R0024 - Home Base Store						
No Asbestos						
B00A - R0025 - Home Base						
No Asbestos						
B00A - R0026 - Personal Effects Storage						
No Asbestos						
B00A - R0027 - Entry Vestibule						
No Asbestos						
B00A - R0028 - Movement						
No Asbestos						
B00A - R0029 - Staff Toilet						
No Asbestos						
B00A - R0030 - Disabled Toilet						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1957 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00B/Eaves Linings/S21				Chrysotile (white asbestos)	
Gable Ends	Flat AC Sheeting					
	3943/B00B/Gable Ends/S20				No Asbestos Detected	

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Personal Effects Storage

No Asbestos

B00B - R0003 - Home Base Store

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Sports Store

No Asbestos

B00B - R0008 - Personal Effects Storage

No Asbestos

B00B - R0009 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00B/R0009/Wall Linings Internal/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00B/R0009/Wall Linings Internal/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0011 - Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1951 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area					
	- Area inaccessible - are fenced off.					
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Height Restriction > 3m.					
Awnings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00C/R0014/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Interior

B00C - R0001 - General Storeroom						
No Asbestos						
B00C - R0002 - General Storeroom						
No Asbestos						
B00C - R0003 - Movement						
No Asbestos						
B00C - R0004 - Home Base						
No Asbestos						
B00C - R0005 - Home Base						
No Asbestos						
B00C - R0006 - Withdrawal Space - 1hb						
No Asbestos						
B00C - R0007 - Interview						
No Asbestos						
B00C - R0008 - Home Base						
No Asbestos						
B00C - R0009 - Home Base						
No Asbestos						
B00C - R0013 - Toilets - Boys/Girls						
No Asbestos						
B00C - R0014 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00C/R0014/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00C - R0015 - External Movement						
No Asbestos						
B00C - R0016 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	44m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00C/R0014/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00C - R0017 - Out Of School Hours Care Centre						
No Asbestos						
B00C - R0018 - Staff Kitchen						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1957 - Steel (Steel)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Height Restriction > 3m.					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area					
	- Area inaccessible - Blocked by fence					
Gable Ends	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction > 3m.						

Interior

B00D - R0001 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00D - R0002 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00D - R0003 - Practical Activities - 1hb

No Asbestos

B00D - R0004 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00D/R0005/Wall Linings Internal/S11				Chrysotile (white asbestos)	

B00D - R0005 - Movement

Wall Linings Internal	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00D/R0005/Wall Linings Internal/S11				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1957 - Steel (Steel)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction > 3m.					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible - access blocked by fence.					
Eaves Linings	Flat AC Sheeting 3943/B00E/Awnings/S10					No Asbestos Detected

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3943/B00E/R0002/Floor Coverings Res/Textile/S8						Chrysotile (white asbestos)

B00E - R0003 - Main Switch Board

No Asbestos

B00E - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 3943/B00E/R0004/Ceiling Structures/Linings/S9					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00E - R0005 - Kiln Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Awnings	Flat AC Sheeting 3943/B00F/Awnings/S1					No Asbestos Detected

Interior

B00F - R0001 - Communal Space	No Asbestos
B00F - R0003 - Hall Chair Store	No Asbestos
B00F - R0004 - Music Store	No Asbestos
B00F - R0005 - Raised Platform	No Asbestos
B00F - R0006 - Lift	No Asbestos
B00F - R0007 - Stairs	No Asbestos
B00F - R0008 - Stairs	No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library/Pupil Facilities - 1957 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Height Restriction > 3m.					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting					No Asbestos Detected
	3943/B00G/Eaves Linings/S4					
Gable Ends	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction > 3m.						

Interior

B00G - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00G/R0001/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00G - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00G/R0001/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)

B00G - R0003 - External Movement

No Asbestos

B00G - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	89m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00G/R0007/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00G - R0005 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00G/R0007/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00G - R0006 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00G/R0007/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00G - R0007 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles	67m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00G/R0007/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00G - R0008 - General Storeroom

No Asbestos

B00G - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3943/B00G/Eaves Linings/S4					



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 1957 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 3943/B00H/Wall Cladding/S14					No Asbestos Detected

Interior

B00H - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 3943/B00H/R0001/Wall Linings Internal/S15					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3943/B00H/R0001/Ceiling Structures/Linings/S16					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B001 - R0001 - External Movement

No Asbestos

B001 - R0002 - Practical Activities - 1hb

No Asbestos

B001 - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B001 - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B001 - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B001 - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B001 - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B001 - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1957 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Wall Cladding	Moulded AC wall cladding	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00J/Wall Cladding/S13				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3943/B00J/Eaves Linings/S17				Chrysotile (white asbestos)	

Interior

B00J - R0001 - Sports Store

No Asbestos

B00J - R0002 - P.E. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Building Services - 1957 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00K - R0001 - Cleaning Supplies

No Asbestos

B00K - R0002 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities/Administration - 1957 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height Restriction > 3m.

Interior

B00L - R0001 - Toilets - Boys

No Asbestos

B00L - R0002 - Garden Store

No Asbestos

B00L - R0003 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 1957 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00M - R0001 - External Movement

No Asbestos

B00M - R0002 - Canteen

No Asbestos

B00M - R0003 - External Movement

No Asbestos

B00M - R0004 - No Access

No Asbestos

B00M - R0005 - Canteen Office/Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Library/General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - External Movement	No Asbestos
B00N - R0002 - Special Programs Room - Type 1	No Asbestos
B00N - R0003 - Special Programs Store	No Asbestos
B00N - R0004 - Staff Toilet	No Asbestos
B00N - R0005 - Toilet - Lobby	No Asbestos
B00N - R0006 - Cleaning Distributed Store	No Asbestos
B00N - R0007 - Main Switch Board	No Asbestos
B00N - R0008 - K.L.A. Store	No Asbestos
B00N - R0009 - Communications Room	No Asbestos
B00N - R0010 - Library Office/Workroom	No Asbestos
B00N - R0011 - Reading Area	No Asbestos
B00N - R0012 - External Stairs	No Asbestos
B00N - R0013 - External Stairs	No Asbestos
B00N - R1001 - External Movement	No Asbestos
B00N - R1002 - Home Base	No Asbestos
B00N - R1003 - Home Base Store	No Asbestos
B00N - R1004 - Practical Activities	No Asbestos
B00N - R1005 - Withdrawal Space - 1hb	No Asbestos
B00N - R1006 - Home Base Store	No Asbestos
B00N - R1007 - Home Base	No Asbestos
B00N - R1008 - Practical Activities	No Asbestos
B00N - R1009 - Withdrawal Space - 2hb	No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R1010 - Home Base						
No Asbestos						
B00N - R1011 - Home Base Store						
No Asbestos						
B00N - R1012 - Practical Activities						
No Asbestos						
B00N - R1013 - External Stairs						
No Asbestos						
B00N - R1014 - External Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D12319 - Learning Unit - Standard/Withdrawal : Placement Date - 31/05/2007

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D12651 - Learning Unit - Standard With P.A.A. : Placement Date - 27/11/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14332 - Learning Unit - Standard With P.A.A. : Placement Date - 18/03/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017