


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Gunnedah South Public School (4018)  
**Region :** New England  
**State Electorate :** Tamworth  
**Local Government Area :** Gunnedah

**Initial Survey :** Noel Arnold & Associates : 05 - Apr - 2008  
**Reviewed By :** Grencap-NAA : 15 - May - 2015

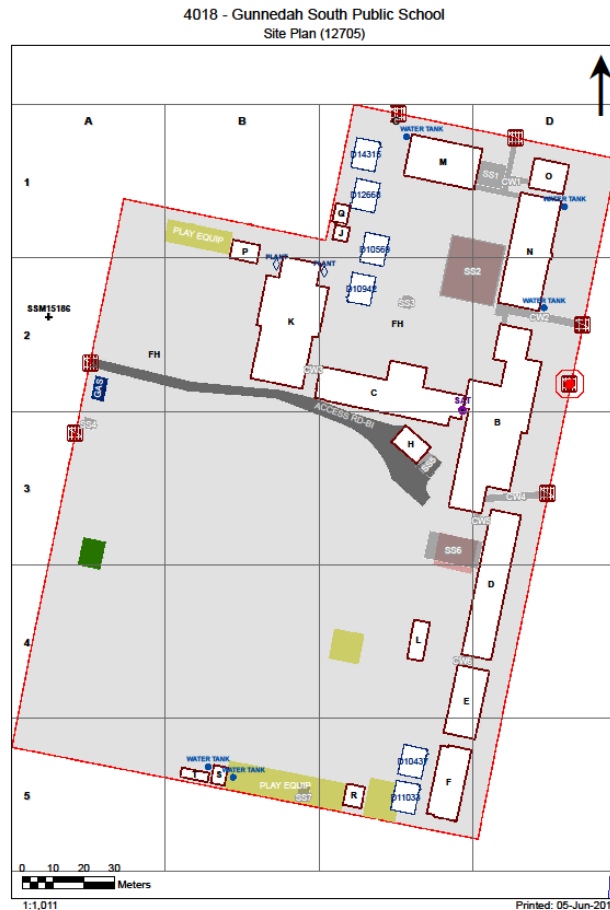

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration/Library - 1982 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4018/B00B/Eaves Linings/S11					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 4018/B00B/Gable Verge Lining/S9					No Asbestos Detected
In-fill-panel	Compressed AC Sheet 4018/B00B/In-fill-panel/S1	9m2	East, West	Good Condition (1)	Low (1) Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris 4018/B00B/Underfloor Voids/S10					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

**Interior**

**B00B - R0001 - Home Base Store (4.06 m2)**

No Asbestos

**B00B - R0002 - Personal Effects Storage (9.31 m2)**

No Asbestos

**B00B - R0003 - Home Base (56.95 m2)**

No Asbestos

**B00B - R0004 - Plant (8.03 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 4018/B00B/R0004/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

**B00B - R0005 - Interview (8.4 m2)**

No Asbestos

**B00B - R0006 - Sick Bay (9.15 m2)**

No Asbestos

**B00B - R0007 - Interview (9.15 m2)**

No Asbestos

**B00B - R0008 - Clerical Office (12.14 m2)**

No Asbestos

**B00B - R0009 - Movement (16.87 m2)**

No Asbestos

**B00B - R0010 - Movement (5.68 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 4018/B00B/R0004/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

**B00B - R0011 - Entry Vestibule (12.11 m2)**

No Asbestos

**B00B - R0012 - Principal (20.6 m2)**

No Asbestos

**B00B - R0013 - General Storeroom (12.35 m2)**

Wall Linings Internal	Flat AC Sheeting 4018/B00B/R0004/Ceiling Structures/Linings/S12					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

**B00B - R0014 - Reading Area (229.55 m2)**

No Asbestos

**B00B - R0017 - Special Programs Room (43.51 m2)**

No Asbestos

**B00B - R0018 - Toilets - Boys (10.6 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 4018/B00B/R0031/Partition Walls (Cubicles)/S2					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

**B00B - R0019 - Cleaning Distributed Store (2.12 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00B - R0020 - Disabled Toilet (7.19 m2)</b>						
No Asbestos						
<b>B00B - R0021 - Toilets - Girls (11.32 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet					
	4018/B00B/R0031/Partition Walls (Cubicles)/S2					<b>No Asbestos Detected</b>
<b>B00B - R0022 - Communications Room (12.18 m2)</b>						
No Asbestos						
<b>B00B - R0023 - Library Office/Workroom (24.78 m2)</b>						
No Asbestos						
<b>B00B - R0024 - Main Switch Board (12.28 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4018/B00B/R0024/Wall Linings Internal/S3					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting					
	4018/B00B/R0004/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
Electrical Backing Board	Resinous Board					
	4018/B00B/R0004/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
<b>B00B - R0025 - General Storeroom (24.78 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4018/B00B/R0004/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
<b>B00B - R0026 - Cleaning Distributed Store (3.42 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	4018/B00B/R0004/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
<b>B00B - R0027 - Movement (20.84 m2)</b>						
No Asbestos						
<b>B00B - R0028 - Deputy Principal (12.68 m2)</b>						
No Asbestos						
<b>B00B - R0029 - Interview (12.35 m2)</b>						
No Asbestos						
<b>B00B - R0030 - Staff Toilet (6.37 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet					
	4018/B00B/R0031/Partition Walls (Cubicles)/S2					<b>No Asbestos Detected</b>
<b>B00B - R0031 - Staff Toilet (5.95 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet					
	4018/B00B/R0031/Partition Walls (Cubicles)/S2					<b>No Asbestos Detected</b>
<b>B00B - R0032 - Duplicating Workroom (33.27 m2)</b>						
No Asbestos						
<b>B00B - R0033 - Interview (12.64 m2)</b>						
No Asbestos						
<b>B00B - R0034 - Movement (168.24 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	4018/B00B/R0004/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
<b>B00B - R0035 - Movement (3.09 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	4018/B00B/R0004/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
<b>B00B - R0041 - Special Programs Room (31.31 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00C - General Learning/Pupil Facilities - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00C/R1001/Ceiling Structures/Linings/S13			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	25m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction</b>					
Gable Verge Lining	Non Accessible Area - Extreme Access Issue - Height Restricted - Approx >6m					
Underfloor Voids - Slab on Ground						
Ceiling Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Movement (99.9 m2)**

No Asbestos

**B00C - R0002 - General Assistant/Bulk Store (10.66 m2)**

No Asbestos

**B00C - R0003 - Toilets - Girls (36.1 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	4018/B00B/R0031/Partition Walls (Cubicles)/S2					
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4018/B00C/R0006/Ceiling Structures/Linings/S5					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00C - R0004 - Toilets - Boys (36.1 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	4018/B00B/R0031/Partition Walls (Cubicles)/S2					
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4018/B00C/R0006/Ceiling Structures/Linings/S5					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00C - R0005 - General Storeroom (29.02 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4018/B00C/R0006/Ceiling Structures/Linings/S5					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00C - R0006 - Special Programs Room (59.96 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4018/B00C/R0006/Ceiling Structures/Linings/S5					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00C - R0007 - Home Base (57.33 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4018/B00C/R0006/Ceiling Structures/Linings/S5					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00C - R0008 - Home Base Store (6.04 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4018/B00C/R0006/Ceiling Structures/Linings/S5					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00C/R0009/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00C - R0009 - Home Base Store (6 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4018/B00C/R0006/Ceiling Structures/Linings/S5					
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4018/B00C/R0009/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>		
<b>B00C - R0010 - Distribution Board (0.53 m2)</b>				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4018/B00C/R0006/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00C - R0011 - Personal Effects Storage (14.61 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4018/B00C/R0006/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00C - R0012 - Home Base (57.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4018/B00C/R0006/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00C - R0013 - Sports Store (15.24 m2)</b>						
No Asbestos						
<b>B00C - R0014 - Cleaning Distributed Store (3.17 m2)</b>						
No Asbestos						
<b>B00C - R0015 - Covered Outdoor Learning Area (76.84 m2)</b>						
No Asbestos						
<b>B00C - R0016 - Stairs (5.7 m2)</b>						
No Asbestos						
<b>B00C - R0017 - Stairs (6.23 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Movement (97.45 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4018/B00C/R1001/Ceiling Structures/Linings/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00C - R1002 - Staff Room (85.71 m2)</b>						
No Asbestos						
<b>B00C - R1003 - Home Base Store (6.98 m2)</b>						
No Asbestos						
<b>B00C - R1004 - Practical Activities - 1hb (16.25 m2)</b>						
No Asbestos						
<b>B00C - R1005 - Home Base (62.25 m2)</b>						
No Asbestos						
<b>B00C - R1006 - Home Base (57.35 m2)</b>						
No Asbestos						
<b>B00C - R1007 - Home Base Store (5.91 m2)</b>						
No Asbestos						
<b>B00C - R1008 - Home Base Store (6 m2)</b>						
No Asbestos						
<b>B00C - R1009 - Distribution Board (0.51 m2)</b>				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4018/B00C/R1009/Electrical Backing Board/S14				<b>Chrysotile (white asbestos)</b>		
<b>B00C - R1010 - Personal Effects Storage (14.69 m2)</b>						
No Asbestos						
<b>B00C - R1011 - Home Base (56.8 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings  
Res/Textile

Vinyl Tiles (Under Floor  
Covering/Carpet)  
4018/B00C/R1011/Floor Coverings Res/Textile/S15

**No Asbestos Detected**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00D - General Learning - 1966 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Gable Verge Lining	Flat AC Sheeting	12m	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Withdrawal Space - 1hb (16.44 m2)**

No Asbestos

**B00D - R0002 - Home Base (51.75 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						

**B00D - R0003 - Home Base Store (12.9 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						

**B00D - R0004 - Personal Effects Storage (6.48 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						

**B00D - R0005 - Personal Effects Storage (6.39 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4018/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						

**B00D - R0006 - Home Base (51.9 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						

**B00D - R0007 - Home Base Store (6.21 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4018/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						

**B00D - R0008 - Home Base Store (6.35 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4018/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						

**B00D - R0009 - Personal Effects Storage (12.96 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 4018/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
<b>B00D - R0010 - Home Base (51.9 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
<b>B00D - R0011 - Home Base (71.49 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
<b>B00D - R0012 - Personal Effects Storage (13.03 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	4018/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
<b>B00D - R0013 - Home Base Store (8.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	4018/B00F/R0007/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
<b>B00D - R0014 - Toilets - Boys/Girls (3.95 m2)</b>						
Wall Linings Internal	Compressed AC Sheet	9m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
<b>B00D - R0015 - Movement (107.52 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	108m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
<b>B00D - R0016 - General Storeroom (8.84 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00E/R0008/Ceiling Structures/Linings/S16				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00E - R0001 - Toilets - Boys/Girls (3.39 m2)**

No Asbestos

**B00E - R0002 - Home Base Store (2.98 m2)**

No Asbestos

**B00E - R0003 - Personal Effects Storage (6.88 m2)**

No Asbestos

**B00E - R0004 - Home Base (86.72 m2)**

No Asbestos

**B00E - R0005 - Home Base (57.12 m2)**

No Asbestos

**B00E - R0006 - Home Base Store (4.18 m2)**

No Asbestos

**B00E - R0007 - Personal Effects Storage (9.25 m2)**

Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00E - R0008 - Movement (41.98 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00E/R0008/Ceiling Structures/Linings/S16				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1970 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00F/Eaves Linings/S17				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00F - R0001 - Home Base Store (7.04 m2)**

No Asbestos

**B00F - R0002 - Practical Activities - 1hb (14.62 m2)**

No Asbestos

**B00F - R0003 - Home Base (53.66 m2)**

No Asbestos

**B00F - R0004 - Home Base (67.38 m2)**

No Asbestos

**B00F - R0005 - Home Base Store (8.86 m2)**

No Asbestos

**B00F - R0006 - Practical Activities - 1hb (17.64 m2)**

No Asbestos

**B00F - R0007 - Cleaning Distributed Store (4.67 m2)**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00F/R0007/Wall Linings Internal/S6				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles				<b>No Asbestos Detected</b>	
	4018/B00F/R0007/Floor Coverings Res/Textile/S7					
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00F/R0007/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00F - R0008 - Movement (45.58 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00F/R0007/Ceiling Structures/Linings/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Pupil Facilities - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00H/R0001/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids - Slab on Ground						
Ceiling Voids	No Asbestos Found					

**Interior**

**B00H - R0001 - Movement (20.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00H/R0001/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos)</b>	

**B00H - R0002 - Canteen (36.52 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00H/R0001/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos)</b>	

**B00H - R0003 - Staff Toilet (1.6 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4018/B00H/R0005/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>	
Incinerette	Millboard	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - item inaccessible</b>					

**B00H - R0004 - Canteen Office/Store (3.2 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00H/R0001/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles					
	4018/B00H/R0005/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>	

**B00H - R0005 - Canteen Office/Store (5.16 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4018/B00H/R0001/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles					
	4018/B00H/R0005/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Communal Facilities - 1970 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4018/B00J/Eaves Linings/S20					<b>No Asbestos Detected</b>
Underfloor Voids - Slab on Ground						
Ceiling Voids - Flat Roof	No Asbestos Found					

**Interior**

**B00J - R0001 - P.E. Store (10.21 m2)**

No Asbestos

**B00J - R0002 - P.E. Store (10.07 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Communal Facilities - 2006 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00K - R0001 - Communal Space (222.69 m2)**

No Asbestos

**B00K - R0002 - Raised Platform (65.52 m2)**

No Asbestos

**B00K - R0003 - Disabled Toilet (6.61 m2)**

No Asbestos

**B00K - R0004 - Toilets - Boys (8.14 m2)**

No Asbestos

**B00K - R0005 - Sound Cupboard (2.03 m2)**

No Asbestos

**B00K - R0006 - General Assistant/Bulk Store (15.98 m2)**

No Asbestos

**B00K - R0007 - Garden Store (9.81 m2)**

No Asbestos

**B00K - R0008 - Hall Chair Store (10.76 m2)**

No Asbestos

**B00K - R0009 - Toilets - Girls (12.56 m2)**

No Asbestos

**B00K - R0010 - P.E. Store (17.23 m2)**

No Asbestos

**B00K - R0011 - Cleaning Distributed Store (3.92 m2)**

No Asbestos

**B00K - R0012 - Main Switch Board (2.05 m2)**

No Asbestos

**B00K - R0013 - Communal/Performance Store (11.06 m2)**

No Asbestos

**B00K - R0014 - Canteen Office/Store (9.78 m2)**

No Asbestos

**B00K - R0015 - Canteen (42.3 m2)**

No Asbestos

**B00K - R0016 - Movement (6.68 m2)**

No Asbestos

**B00K - R0017 - Canteen Covered Area (234.67 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Pupil Facilities - 2006 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground

Ceiling Voids                      No Asbestos Found

**Interior**

**B00L - R0001 - External Movement (13.88 m2)**

No Asbestos

**B00L - R0002 - Toilets - Girls (18.94 m2)**

No Asbestos

**B00L - R0003 - Toilets - Boys (16.65 m2)**

No Asbestos

**B00L - R0004 - Toilets - Boys/Disabled Cubicle (5.04 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00M - General Learning - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00M - R0001 - External Movement (60.08 m2)**

No Asbestos

**B00M - R0002 - Practical Activities - 1hb (18.91 m2)**

No Asbestos

**B00M - R0003 - Home Base Store (6.19 m2)**

No Asbestos

**B00M - R0004 - Home Base (59.4 m2)**

No Asbestos

**B00M - R0005 - Withdrawal Space - 2hb (11.57 m2)**

No Asbestos

**B00M - R0006 - Home Base (60.18 m2)**

No Asbestos

**B00M - R0007 - Home Base Store (6.18 m2)**

No Asbestos

**B00M - R0008 - Practical Activities - 1hb (18.91 m2)**

No Asbestos

**B00M - R0009 - Cleaning Distributed Store (4.14 m2)**

No Asbestos

**B00M - R0010 - Special Programs Store (5.26 m2)**

No Asbestos

**B00M - R0011 - Special Programs Room (38.33 m2)**

No Asbestos

**B00M - R0012 - Distribution Board (0.66 m2)**

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00N - General Learning - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00N - R0001 - External Movement (88.3 m2)**

No Asbestos

**B00N - R0002 - Practical Activities - 1hb (19.03 m2)**

No Asbestos

**B00N - R0003 - Home Base Store (6.22 m2)**

No Asbestos

**B00N - R0004 - Home Base (60.21 m2)**

No Asbestos

**B00N - R0005 - Withdrawal Space - 2hb (11.6 m2)**

No Asbestos

**B00N - R0006 - Home Base (60.8 m2)**

No Asbestos

**B00N - R0007 - Home Base Store (6.21 m2)**

No Asbestos

**B00N - R0008 - Practical Activities - 1hb (19.01 m2)**

No Asbestos

**B00N - R0009 - Practical Activities - 1hb (18.96 m2)**

No Asbestos

**B00N - R0010 - Home Base Store (6.25 m2)**

No Asbestos

**B00N - R0011 - Home Base (60.23 m2)**

No Asbestos

**B00N - R0012 - Withdrawal Space - 2hb (11.6 m2)**

No Asbestos

**B00N - R0013 - Home Base (60.13 m2)**

No Asbestos

**B00N - R0014 - Home Base Store (6.22 m2)**

No Asbestos

**B00N - R0015 - Practical Activities - 1hb (19.01 m2)**

No Asbestos

**B00N - R0016 - Distribution Board (0.83 m2)**

Note: No inspection of live electrical installation.

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B000 - General Learning - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B000 - R0001 - Special Programs Room (96.29 m2)**

No Asbestos

**B000 - R0002 - Pantry (2.9 m2)**

No Asbestos

**B000 - R0003 - Practical Activities (0.66 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 603 - D10437 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 13/01/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D10569 - Learning Unit - Standard With P.A.A. : Placement Date - 20/04/2011**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 603 - D10942 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 1/05/2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 603 - D11033 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 14/01/2013**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D12668 - Learning Unit - Standard With P.A.A. : Placement Date - 9/04/2013**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>OS 602 - D14315 - Learning Unit - Standard With P.A.A. : Placement Date - 23/01/2015</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017