


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Griffith North Public School (4027)
Region : Riverina
State Electorate : Murray
Local Government Area : Griffith

Initial Survey : Noel Arnold & Associates : 08 - May - 2008
Reviewed By : Greencap-NAA : 18 - May - 2015

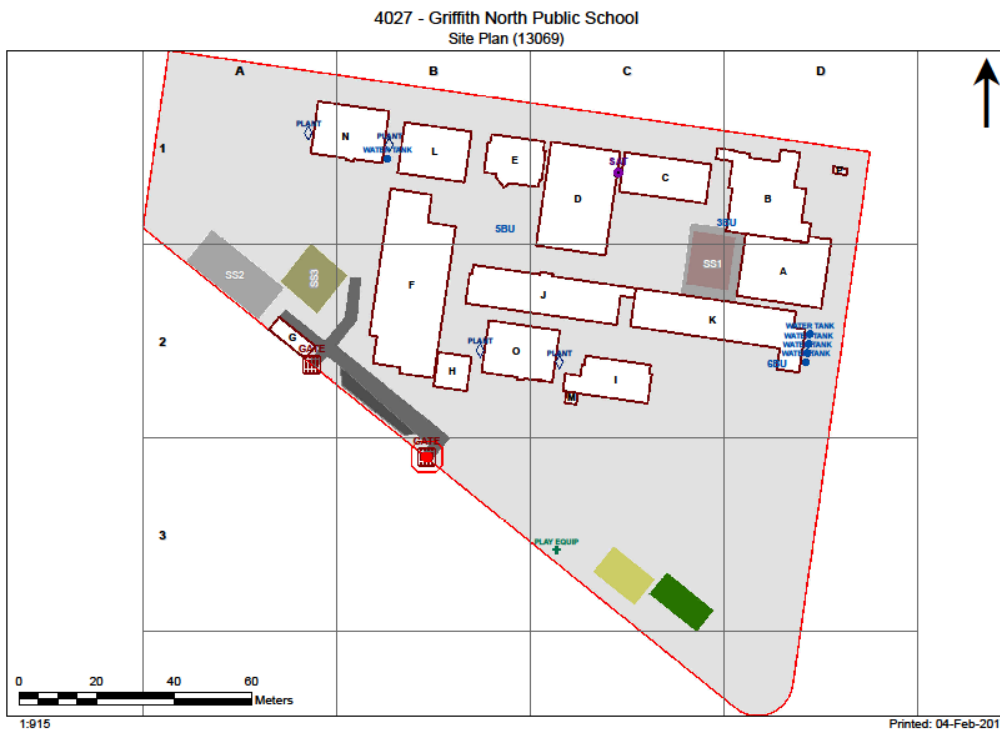

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	70m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00A/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00A/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00A - R0004 - Principal

No Asbestos

B00A - R0010 - Sick Bay

No Asbestos

B00A - R0011 - Disabled Toilet

No Asbestos

B00A - R0012 - Staff Toilet

No Asbestos

B00A - R0013 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00A/R0013/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)

B00A - R0014 - Movement

No Asbestos

B00A - R0015 - Interview

No Asbestos

B00A - R0016 - Cleaning Supplies

No Asbestos

B00A - R0017 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00D/R0012/Electrical Backing Board/S34					Chrysotile (white asbestos)
Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00A - R0019 - Duplicating Workroom

No Asbestos

B00A - R0020 - Clerical Office

No Asbestos

B00A - R0021 - Security Store

No Asbestos

B00A - R0022 - Interview/Office - Type 3

No Asbestos

B00A - R0023 - Deputy Principal

No Asbestos

B00A - R0024 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting	100m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/Wall Cladding/S14					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00A/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

Interior**B00B - R0001 - Withdrawal Space - 1hb**

Window In-fill-panel	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/R0002/Window In-fill-panel/S29					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0002 - Movement

Window In-fill-panel	Flat AC Sheeting	3m2	Adjacent to room 8	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/R0002/Window In-fill-panel/S29					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00A/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00B - R0003 - Craft Store

Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/R0003/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

B00B - R0004 - Cleaning Distributed Store

No Asbestos

B00B - R0005 - Movement

Window In-fill-panel	Flat AC Sheeting	3m2	adjacent to Room 6	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/R0002/Window In-fill-panel/S29					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0006 - Staff Room Annexe

No Asbestos

B00B - R0007 - Staff Room Annexe

No Asbestos

B00B - R0008 - Staff Room Annexe

No Asbestos

B00B - R0009 - Staff Room

No Asbestos

B00B - R0010 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/R0010/Floor Coverings Res/Textile/S30					Chrysotile (white asbestos)
Window In-fill-panel	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/R0002/Window In-fill-panel/S29					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Adhesive attached to sample 30	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/R0010/Floor Coverings Res/Textile/S39					Chrysotile (white asbestos)

B00B - R0011 - Toilets - Boys/Girls

No Asbestos

B00B - R0012 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4027/B00B/R0010/Floor Coverings Res/Textile/S30	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to sample 30 4027/B00B/R0010/Floor Coverings Res/Textile/S39	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00B - R0013 - Main Switch Board						
Ceiling Structures/Linings	Flat AC Sheeting 4027/B00B/R0013/Ceiling Structures/Linings/S12	5m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting 4027/B00B/R0013/Wall Linings Internal/S13	20m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
B00B - R0014 - Disabled Shower/Toilet						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Corrugated AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00C/R0001/Ceiling Structures/Linings/S32				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Window In-fill-panel	Flat AC Sheeting	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00B/R0002/Window In-fill-panel/S29				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Gable Verge Lining	Flat AC Sheeting	10m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00C/Gable Verge Lining/S33				Chrysotile (white asbestos)	

Interior

B00C - R0001 - Movement

Ceiling Structures/Linings	Compressed AC Sheet	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00C/R0001/Ceiling Structures/Linings/S32				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Window In-fill-panel	Flat AC Sheeting	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00C/R0005/Window In-fill-panel/S31				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0002 - Personal Effects Storage

Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Medium (2)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0004 - Toilets - Boys/Girls

No Asbestos

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - Home Base Store

No Asbestos

B00C - R0008 - Personal Effects Storage

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library/Pupil Facilities - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0001/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior

B00D - M0001 - Reading Area

No Asbestos

B00D - M0002 - Stairs

No Asbestos

B00D - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	139m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00D/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B00D - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00D/R0013/Partition Walls (Cubicles)/S11				Chrysotile (white asbestos)	

B00D - R0003 - Cleaning Supplies

No Asbestos

B00D - R0004 - Reading Area

No Asbestos

B00D - R0005 - Clerical Office/Workroom

No Asbestos

B00D - R0006 - Communications Room

No Asbestos

B00D - R0007 - Withdrawal Space - 1hb

No Asbestos

B00D - R0008 - Withdrawal Space - 1hb

No Asbestos

B00D - R0009 - Clerical Office/Workroom

No Asbestos

B00D - R0010 - Special Programs Room

No Asbestos

B00D - R0011 - Cleaning Supplies

No Asbestos

B00D - R0012 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00D/R0012/Electrical Backing Board/S34				Chrysotile (white asbestos)	
Electrical Mounting Board	Encapsulated Insulation material within unit	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00D - R0013 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00D/R0013/Partition Walls (Cubicles)/S11				Chrysotile (white asbestos)	

B00D - R0014 - Stairs

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1967 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00E/Eaves Linings/S10				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Withdrawal Space - 1hb

No Asbestos

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Movement

Flooring	Compressed AC Sheet					No Asbestos Detected
	4027/B00E/R0003/Floor Coverings Res/Textile/S9					
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00E/Eaves Linings/S10				Chrysotile (white asbestos)	
Electrical Backing Board	Fibre Cement Casting (Monocrete)	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00E - R0004 - Home Base

No Asbestos

B00E - R0005 - Withdrawal Space - 1hb

No Asbestos

B00E - R0006 - Practical Activities - 1hb

Benchtop	Vinyl Sheet					No Asbestos Detected
	4027/B00E/R0006/Benchtop/S35					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities/Pupil Facilities - 1978 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4027/B00K/R0001/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)	

Interior

B00F - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4027/B00F/R0003/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)	

B00F - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4027/B00F/R0003/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)	

B00F - R0004 - Cleaning Supplies

No Asbestos

B00F - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4027/B00D/R0012/Electrical Backing Board/S34					Chrysotile (white asbestos)	

B00F - R0007 - Hall Chair Store

No Asbestos

B00F - R0008 - P.E. Store

No Asbestos

B00F - R0009 - Raised Platform

No Asbestos

B00F - R0010 - Movement

No Asbestos

B00F - R0011 - General Storeroom

No Asbestos

B00F - R0012 - Staff Toilet

No Asbestos

B00F - R0013 - Staff Shower/Change

Floor Coverings Res/Textile	Vinyl Tiles					
4027/B00J/R0005/Floor Coverings Res/Textile/S3					No Asbestos Detected	

B00F - R0014 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles					
4027/B00J/R0005/Floor Coverings Res/Textile/S3					No Asbestos Detected	

B00F - R0015 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles					
4027/B00J/R0005/Floor Coverings Res/Textile/S3					No Asbestos Detected	
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4027/B00D/R0012/Electrical Backing Board/S34					Chrysotile (white asbestos)	

B00F - R0016 - Communal Space

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0017 - Chair Storeroom						
No Asbestos Found						
B00F - R0018 - Covered Outdoor Learning Area						
No Asbestos						
B00F - R0019 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4027/B00K/R0001/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)	
B00F - R0020 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	114m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4027/B00K/R0001/Ceiling Structures/Linings/S26					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Shed - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00G/R0002/Ceiling Structures/Linings/S25				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible					

Interior

B00G - R0001 - Garden Store

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00G/R0002/Ceiling Structures/Linings/S25				Chrysotile (white asbestos)	

B00G - R0002 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00G/R0002/Ceiling Structures/Linings/S25				Chrysotile (white asbestos)	

B00G - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00G/R0002/Ceiling Structures/Linings/S25				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00H/R0005/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior

B00H - R0001 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4027/B00H/R0004/Floor Coverings Res/Textile/S36				No Asbestos Detected
-----------------------------	---	---	--	--	--	-----------------------------

B00H - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4027/B00H/R0004/Floor Coverings Res/Textile/S36				No Asbestos Detected
-----------------------------	---	---	--	--	--	-----------------------------

B00H - R0003 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4027/B00H/R0004/Floor Coverings Res/Textile/S36				No Asbestos Detected
-----------------------------	---	---	--	--	--	-----------------------------

B00H - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4027/B00H/R0004/Floor Coverings Res/Textile/S36				No Asbestos Detected
-----------------------------	---	---	--	--	--	-----------------------------

B00H - R0006 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00D/R0012/Electrical Backing Board/S34				Chrysotile (white asbestos)	

B00H - R0007 - Cleaning Supplies

Wall Linings Internal	Flat AC Sheeting	4027/B00H/R0007/Wall Linings Internal/S23				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

B00H - R0008 - Staff Toilet

No Asbestos

B00H - R0009 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning/Support Unit - 1967 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Obstructed Area.					
Eaves Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B001/R0006/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Obstructed Area.					
Underfloor Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting					
	4027/B001/Wall Cladding/S37				No Asbestos Detected	

Interior

B001 - R0002 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0006/Floor Coverings Res/Textile/S28				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to sample 28					
	4027/B00K/R0006/Floor Coverings Res/Textile/S38				No Asbestos Detected	

B001 - R0003 - Home Base - E

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0006/Floor Coverings Res/Textile/S28				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to sample 28					
	4027/B00K/R0006/Floor Coverings Res/Textile/S38				No Asbestos Detected	

B001 - R0006 - Shower/Change

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B001/R0006/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

B001 - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B001/R0006/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Compressed AC Sheet					
	4027/B001/R0008/Floor Coverings Res/Textile/S22				No Asbestos Detected	

B001 - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B001/R0006/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Compressed AC Sheet					
	4027/B001/R0008/Floor Coverings Res/Textile/S22				No Asbestos Detected	

B001 - R0009 - Covered Outdoor Learning Area

No Asbestos

B001 - R0010 - Practical Activities - E

No Asbestos

B001 - R0011 - Staff Kitchen

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1978 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Obstructed Area - To tight to access with ladder					
Eaves Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00J/R0008/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Obstructed Area - To tight to access with ladder					
Underfloor Voids	No Asbestos Found					

Interior

B00J - R0002 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4027/B00J/R0005/Floor Coverings Res/Textile/S3			No Asbestos Detected		
Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					

B00J - R0003 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4027/B00J/R0005/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00J - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4027/B00J/R0005/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00J - R0005 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4027/B00J/R0005/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00J - R0006 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4027/B00J/R0005/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00J - R0007 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4027/B00J/R0005/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00J - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	99m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00J/R0008/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Flooring	Compressed AC Sheet					
	4027/B00J/R0008/Floor Coverings Res/Textile/S2			No Asbestos Detected		
Gable End	Flat AC Sheeting	6m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00J/R0008/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning/Pupil Facilities - 1978 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0001/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)	
Wall Cladding	Flat AC Sheeting	6m2	Adjacent to room 2	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0001/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior**B00K - R0001 - Movement**

Flooring	Compressed AC Sheet					No Asbestos Detected
	4027/B00K/R0001/Floor Coverings Res/Textile/S20					
Gable end	Flat AC Sheeting	4m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00J/R0008/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0001/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)	

B00K - R0002 - Sports Store

No Asbestos

B00K - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0003/Partition Walls (Cubicles)/S21				Chrysotile (white asbestos)	

B00K - R0004 - Cleaning Supplies

No Asbestos

B00K - R0005 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0003/Partition Walls (Cubicles)/S21				Chrysotile (white asbestos)	

B00K - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0011/Wall Linings Internal/S4				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0001/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0006/Floor Coverings Res/Textile/S28				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive attached to sample 28					
	4027/B00K/R0006/Floor Coverings Res/Textile/S38				No Asbestos Detected	

B00K - R0007 - Home Base

Wall Linings Internal	Flat AC Sheeting	90m2	North facing, South facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0011/Wall Linings Internal/S4				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	71m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4027/B00K/R0003/Partition Walls (Cubicles)/S21				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4027/B00K/R0006/Floor Coverings Res/Textile/S28	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to sample 28 4027/B00K/R0006/Floor Coverings Res/Textile/S38					No Asbestos Detected
B00K - R0008 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting 4027/B00K/R0011/Wall Linings Internal/S4	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4027/B00K/R0001/Ceiling Structures/Linings/S26	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 4027/B00K/R0009/Floor Coverings Res/Textile/S27					No Asbestos Detected
B00K - R0009 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting 4027/B00K/R0011/Wall Linings Internal/S4	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4027/B00K/R0001/Ceiling Structures/Linings/S26	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 4027/B00K/R0009/Floor Coverings Res/Textile/S27					No Asbestos Detected
B00K - R0010 - Home Base						
Wall Linings Internal	Flat AC Sheeting 4027/B00K/R0011/Wall Linings Internal/S4	90m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4027/B00K/R0001/Ceiling Structures/Linings/S26	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4027/B00K/R0006/Floor Coverings Res/Textile/S28	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to sample 28 4027/B00K/R0006/Floor Coverings Res/Textile/S38					No Asbestos Detected
B00K - R0011 - Home Base						
Wall Linings Internal	Flat AC Sheeting 4027/B00K/R0011/Wall Linings Internal/S4	90m2	North facing, South facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4027/B00K/R0001/Ceiling Structures/Linings/S26	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4027/B00K/R0006/Floor Coverings Res/Textile/S28	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Backing Board	Encapsulated Insulation material within unit Assumed Asbestos - Electrical Hazard	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive attached to sample 28 4027/B00K/R0006/Floor Coverings Res/Textile/S38					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Movement

No Asbestos

B00L - R0002 - Practical Activities - 1hb

No Asbestos

B00L - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 2008 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00M - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	

B00N - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible
Eaves Linings	No Asbestos Found

Interior

B00N - R0001 - Practical Activities

No Asbestos Found

B00N - R0002 - Home Base

No Asbestos Found

B00N - R0003 - Home Base Store

No Asbestos Found

B00N - R0004 - Practical Activities

No Asbestos Found

B00N - R0005 - Home Base

No Asbestos Found

B00N - R0006 - Home Base Store

No Asbestos Found

B00N - R0007 - Withdrawal Space - 2hb

No Asbestos Found

B00N - R0008 - External Movement

No Asbestos Found

B00N - R0009 - Main Switch Board

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B000 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible
Eaves Linings	No Asbestos Found

Interior

B000 - R0001 - Practical Activities	No Asbestos Found
B000 - R0002 - Home Base	No Asbestos Found
B000 - R0003 - Home Base Store	No Asbestos Found
B000 - R0004 - Practical Activities	No Asbestos Found
B000 - R0005 - Home Base	No Asbestos Found
B000 - R0006 - Home Base Store	No Asbestos Found
B000 - R0007 - Withdrawal Space - 2hb	No Asbestos Found
B000 - R0008 - Main Switch Board	No Asbestos Found
B000 - R0009 - External Movement	No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Electrical Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible
Eaves Linings	No Asbestos Found

Interior

B00P - R0001 - Distribution Board	Note: No inspection of live electrical installation.
--	--

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017