


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Garden Suburb Public School (4136)
Region : Hunter/Central Coast
State Electorate : Charlestown
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : Greencap-NAA : 24 - Jun - 2015

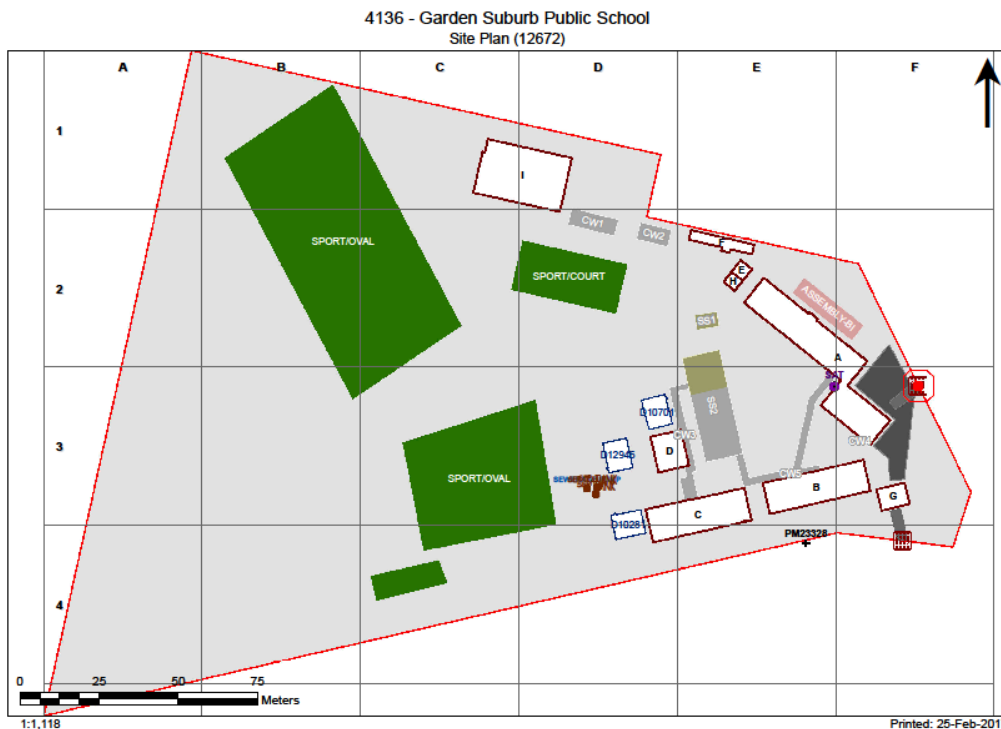

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1958 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/Eaves Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/Eaves Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Backing Board	Resinous Board	1m2	North, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	5m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4136/B00A/Underfloor Voids/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00A - R0001 - Home Base Store**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/R0010/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00A - R0002 - General Storeroom

No Asbestos

B00A - R0003 - General Storeroom

No Asbestos

B00A - R0004 - Special Programs Room

No Asbestos

B00A - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/R0010/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/R0010/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00A - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/R0010/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00A - R0011 - Sick Bay

No Asbestos

B00A - R0012 - Movement

No Asbestos

B00A - R0013 - Interview

No Asbestos

B00A - R0014 - Principal

No Asbestos

B00A - R0015 - Deputy Principal

No Asbestos

B00A - R0016 - Staff Room

No Asbestos

B00A - R0017 - Staff Toilet

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0022 - Library Office/Workroom						
No Asbestos						
B00A - R0023 - K.L.A. Store						
No Asbestos						
B00A - R0025 - Reading Area						
No Asbestos						
B00A - R0026 - Entry Vestibule						
Recently Modified Space Requires Inspection						
B00A - R0027 - Clerical Office						
Recently Modified Space Requires Inspection						
B00A - R0028 - Uniform Shop						
Recently Modified Space Requires Inspection						
B00A - R0029 - Reading Area						
Recently Modified Space Requires Inspection						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1964 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/Eaves Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/Eaves Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0002 - Practical Activities - 1hb

No Asbestos

B00B - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00B/R0007/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00B - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0009 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0010 - Home Base

No Asbestos

B00B - R9001 - General Assistant/Bulk Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Special Learning - 1958 - Brick/Block (Brick/Block)

Exterior

In-fill-panel	Flat AC Sheeting	50m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0001/In-fill-panel/S2				Chrysotile (white asbestos)	
Awnings	Flat AC Sheeting	12m2	Walkway, North, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Movement

In-fill-panel	Flat AC Sheeting	50m	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0001/In-fill-panel/S2				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0001/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)	

B00C - R0002 - Home Base

No Asbestos

B00C - R0003 - Home Base Store

No Asbestos

B00C - R0004 - Personal Effects Storage

No Asbestos

B00C - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Wall Linings Internal	Flat AC Sheeting	1m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4136/B00C/R0005/Wall Linings Internal/S14				Chrysotile (white asbestos)	

B00C - R0006 - Movement

No Asbestos

B00C - R0007 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	4136/B00C/R0007/Floor Coverings Res/Textile/S12				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	4136/B00C/R0007/Floor Coverings Res/Textile/S13				No Asbestos Detected	

B00C - R0008 - Personal Effects Storage

No Asbestos

B00C - R0009 - Home Base Store

No Asbestos

B00C - R0010 - Home Base

No Asbestos

B00C - R0011 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0012/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

B00C - R0012 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0012/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0013 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4136/B00C/R0012/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00C - R9001 - Movement						
No Asbestos						
B00C - R9002 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4136/B00C/R9002/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	
B00C - R9003 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4136/B00C/R9002/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)	
B00C - R9004 - Staff Toilet						
Incinerette	Millboard	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed Unit						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - General Learning - 1958 - Brick/Veneer (Brick/Veneer)						
Exterior						
In-fill-panel	Flat AC Sheeting	30m2	East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0001/In-fill-panel/S2					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	4136/B00D/Wall Cladding/S15					
Interior						
B00D - R0001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B00D - R0002 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	4136/B00C/R0007/Floor Coverings Res/Textile/S12					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	4136/B00C/R0007/Floor Coverings Res/Textile/S13					
B00D - R0003 - Distribution Board						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
Wall Linings Internal	Flat AC Sheeting	1m2	East, Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4136/B00C/R0005/Wall Linings Internal/S14					Chrysotile (white asbestos)
B00D - R0004 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0012/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00D/R0004/Wall Linings Internal/S4					Chrysotile (white asbestos)
B00D - R0005 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0012/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00D/R0004/Wall Linings Internal/S4					Chrysotile (white asbestos)
B00D - R0006 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	4136/B00C/R0007/Floor Coverings Res/Textile/S12					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	4136/B00C/R0007/Floor Coverings Res/Textile/S13					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities/Pupil Facilities - 1969 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4136/B00A/Eaves Linings/S6	8m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00E - R0001 - P.E. Store

Ceiling Structures/Linings	Flat AC Sheeting 4136/B00E/R0001/Wall Linings Internal/S5					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 4136/B00E/R0001/Wall Linings Internal/S5					No Asbestos Detected

B00E - R0002 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1958 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4136/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4136/B00B/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1958 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00A/Eaves Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00G - R0001 - Canteen

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0012/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting				No Asbestos Detected	
	4136/B00G/R0004/Ceiling Structures/Linings/S16					

B00G - R0002 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0012/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting				No Asbestos Detected	
	4136/B00G/R0004/Ceiling Structures/Linings/S16					

B00G - R0003 - Canteen Office/Store

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4136/B00C/R0012/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting				No Asbestos Detected	
	4136/B00G/R0004/Ceiling Structures/Linings/S16					

B00G - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting				No Asbestos Detected	
	4136/B00G/R0004/Ceiling Structures/Linings/S16					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other - 2008 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00H - R0001 - Other

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00I - R0001 - Covered Outdoor Learning Area

No Asbestos

B00I - R0002 - Communal Space

No Asbestos

B00I - R0003 - Movement

No Asbestos

B00I - R0004 - Raised Platform

No Asbestos

B00I - R0005 - Movement

No Asbestos

B00I - R0006 - Movement

No Asbestos

B00I - R0007 - Hall Chair Store

No Asbestos

B00I - R0008 - Communal/Performance Store

No Asbestos

B00I - R0009 - P.E. Store

No Asbestos

B00I - R0010 - Toilet - Lobby

No Asbestos

B00I - R0011 - Toilets - Girls

No Asbestos

B00I - R0012 - Sound Cupboard

No Asbestos

B00I - R0013 - Toilet - Lobby

No Asbestos

B00I - R0014 - Toilets - Boys

No Asbestos

B00I - R0015 - Cleaning Distributed Store

No Asbestos

B00I - R0016 - General Storeroom

No Asbestos

B00I - R0017 - Main Switch Board

No Asbestos

B00I - R0018 - Access Shower/Toilet

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10281 - Learning Unit - Standard With P.A.A. : Placement Date - 30/12/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D10701 - Learning Unit - Standard/Withdrawal : Placement Date - 9/02/2007

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D10747 - Learning Unit - Standard With P.A.A. : Placement Date - 17/04/2015

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12946 - Learning Unit - Standard With P.A.A. : Placement Date - 12/11/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4136_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017