


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gosford East Public School (4218)
Region : Hunter/Central Coast
State Electorate : Gosford
Local Government Area : Gosford

Initial Survey : Noel Arnold & Associates : 03 - Apr - 2008
Reviewed By : AECOM : 27 - Jun - 2016

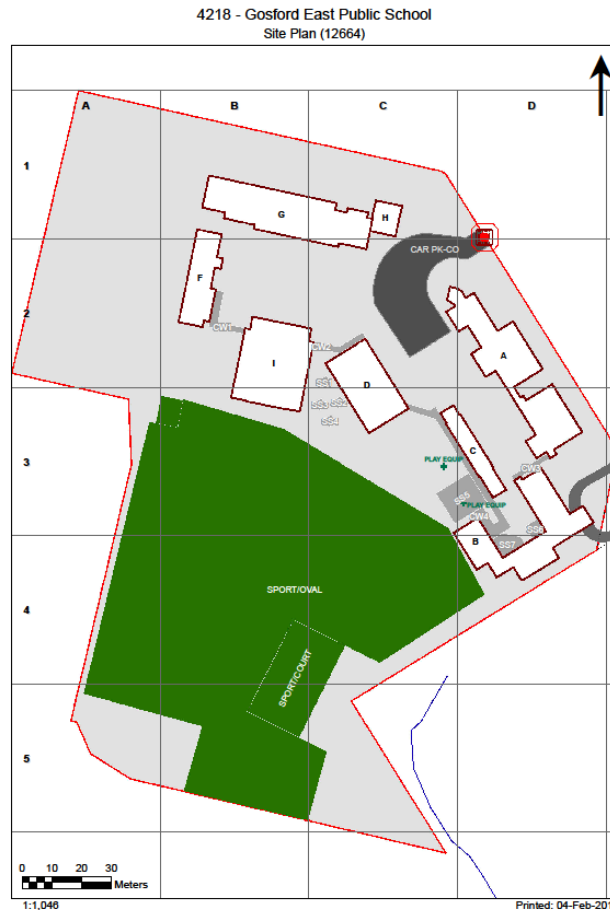

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning - 1960 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 4218/B00A/R0031/Ceiling Structures/Linings/S6	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Window In-fill Panel	Flat AC Sheeting 4218/B00A/Window In-fill Panel/S7					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting Assumed Asbestos - Height Restriction 6m	60m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior

B00A - R0001 - Home Base Store (4.63 m2)

No Asbestos

B00A - R0002 - General Storeroom (3.97 m2)

Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00A - R0003 - Movement (7.64 m2)

Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00A - R0004 - General Storeroom (0.99 m2)

No Asbestos

B00A - R0005 - Movement (6.29 m2)

Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00A - R0006 - Movement (44.96 m2)

Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00A - R0008 - Distribution Board (0.88 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 4218/B00A/R0008/Wall Linings Internal/S16	7.8m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8) Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board Assumed Asbestos - Area inaccessible electrical hazard.	0.2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles 4218/B00A/R0009/Floor Coverings Res/Textile/S2	0.88m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
FSC debris	AC Fragments/Debris 4218/B00A/R0008/Wall Linings Internal/S16	0.005m2	South	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8) Chrysotile (white asbestos)

B00A - R0009 - Home Base Store (4.16 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4218/B00A/R0009/Floor Coverings Res/Textile/S2	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Wall Linings Internal	Flat AC Sheeting 4218/B00A/R0009/Wall Linings Internal/S3	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0010 - Home Base (57.13 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0011 - Staff Toilet (3.19 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Wall Linings Internal	Flat AC Sheeting 4218/B00A/R0009/Wall Linings Internal/S3	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00A - R0012 - Movement (10.9 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0013 - Movement (43.62 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0014 - Cleaning Distributed Store (4.09 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0015 - Home Base Store (4.19 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4218/B00A/R0015/Floor Coverings Res/Textile/S17				No Asbestos Detected	
B00A - R0016 - Home Base (57.08 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0017 - Home Base (56.92 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00A - R0018 - Main Switch Board (2.45 m2)						
Ceiling Structures/Linings	Vermiculite 4218/B00A/R0003/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Electrical Mounting Board	Flat AC Sheeting	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Electrical Hazard</i>
B00A - R0019 - Home Base Store (5.88 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite					
	4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00A - R020 - Movement (11.61 m2)
No Asbestos

B00A - R021 - Security Store (9.21 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4218/B00A/R0021/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00A - R022 - Security Store (21.37 m2)
No Asbestos

B00A - R023 - Staff Toilet (4.96 m2)
No Asbestos

B00A - R024 - General Storeroom (4.92 m2)
No Asbestos

B00A - R025 - Staff Toilet (5.92 m2)
No Asbestos

B00A - R026 - Principal (19.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R027 - Movement (36.08 m2)
No Asbestos

B00A - R028 - Entry Vestibule (8.85 m2)
No Asbestos

B00A - R029 - Clerical Office (12.13 m2)
No Asbestos

B00A - R030 - Movement (1.32 m2)
No Asbestos

B00A - R031 - Movement (10.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R032 - Movement (1.84 m2)
No Asbestos

B00A - R033 - Movement (4.2 m2)
No Asbestos

B00A - R034 - Clerical Office (18.17 m2)
No Asbestos

B00A - R035 - Sick Bay (8.52 m2)
No Asbestos

B00A - R036 - Stairs (10.32 m2)
No Asbestos

B00A - R037 - Stairs (4.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R038 - Stairs (2.78 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0039 - Practical Activities - 1hb (17.1 m2)						
No Asbestos						
B00A - R0040 - Personal Effects Storage (6.26 m2)						
No Asbestos						
B00A - R0041 - Withdrawal Space - 2hb (12.44 m2)						
No Asbestos						
B00A - R0042 - Practical Activities - 1hb (17.92 m2)						
No Asbestos						
B00A - R0043 - Personal Effects Storage (6.83 m2)						
No Asbestos						
B00A - R0044 - Practical Activities - 1hb (17.58 m2)						
No Asbestos						
B00A - R0045 - Personal Effects Storage (5.94 m2)						
No Asbestos						
B00A - R0046 - Withdrawal Space - 2hb (13.31 m2)						
No Asbestos						
B00A - R0047 - Practical Activities - 1hb (17.4 m2)						
No Asbestos						
B00A - R0048 - Personal Effects Storage (5.9 m2)						
No Asbestos						
B00A - R0049 - Home Base (57.15 m2)						
No Asbestos						
B00A - R1001 - Home Base Store (5.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4218/B00A/R0021/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R1002 - General Storeroom (4.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R1004 - Home Base Store (7.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4218/B00A/R1012/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00A - R1005 - Distribution Board (1.77 m2)						
Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4218/B00A/R0009/Wall Linings Internal/S3					Chrysotile (white asbestos)
B00A - R1006 - Home Base (57.09 m2)						
No Asbestos						
B00A - R1007 - Movement (6.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1008 - Movement (45.44 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1009 - Movement (11.35 m2)						
No Asbestos						
B00A - R1010 - Cleaning Distributed Store (3.84 m2)						
No Asbestos						
B00A - R1011 - Home Base Store (4.45 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
4218/B00A/R1012/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R1012 - Movement (43.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
4218/B00A/R1012/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R1013 - Home Base (57.09 m2)						
No Asbestos						
B00A - R1014 - Home Base (56.54 m2)						
No Asbestos						
B00A - R1015 - General Storeroom (3.12 m2)						
Wall Linings Internal	Millboard	18NA	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
4218/B00A/R1015/Wall Linings Internal/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
4218/B00A/R1015/Floor Coverings Res/Textile/S19					No Asbestos Detected	
B00A - R1016 - Home Base Store (5.94 m2)						
No Asbestos						
B00A - R1017 - Movement (6.07 m2)						
Ceiling Structures/Linings	Vermiculite					
4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1018 - Stairs (14.92 m2)						
Ceiling Structures/Linings	Vermiculite					
4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1019 - Stairs (5.39 m2)						
Ceiling Structures/Linings	Vermiculite					
4218/B00A/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1020 - Practical Activities - 1hb (17.09 m2)						
No Asbestos						
B00A - R1021 - Personal Effects Storage (6.19 m2)						
No Asbestos						
B00A - R1022 - Withdrawal Space - 2hb (12.59 m2)						
No Asbestos						
B00A - R1023 - Practical Activities - 1hb (17.91 m2)						
No Asbestos						
B00A - R1024 - Personal Effects Storage (6.93 m2)						
No Asbestos						
B00A - R1025 - Practical Activities - 1hb (17.51 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1026 - Personal Effects Storage (5.93 m2)						
No Asbestos						
B00A - R1027 - Withdrawal Space - 2hb (13.38 m2)						
No Asbestos						
B00A - R1028 - Practical Activities - 1hb (17.37 m2)						
No Asbestos						
B00A - R1029 - Personal Effects Storage (5.91 m2)						
No Asbestos						
B00A - R1030 - Home Base (57.03 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Support Unit - 1960 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction 3.2m					
Eaves Linings	Flat AC Sheeting	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0010/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

Interior

B00B - R0001 - Movement (23.2 m2)

No Asbestos

B00B - R0002 - Staff Room (52.53 m2)

No Asbestos

B00B - R0010 - Movement (154.38 m2)

Ceiling Structures/Linings	Flat AC Sheeting	155m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0010/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00B - R0011 - Distribution Board (0.92 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00B - R0012 - Staff Toilet (2.08 m2)

Non Accessible

B00B - R0013 - Disabled Toilet (3.15 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00B - R0014 - Disabled Toilet (3.15 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00B - R0015 - Disabled Toilet (3.15 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00B - R0016 - Practical Activities - P - 1hb (11.53 m2)

No Asbestos

B00B - R0017 - Other - Regional Use (40.33 m2)

No Asbestos

B00B - R0018 - Home Base - P (52.23 m2)

No Asbestos

B00B - R0019 - Disabled Toilet (3.19 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9					Chrysotile (white asbestos)

B00B - R0020 - Disabled Toilet (3.17 m2)

No Asbestos

B00B - R0021 - Disabled Toilet (3.14 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0022 - Disabled Toilet (3.15 m2)						
No Asbestos						
B00B - R0023 - Other - Regional Use (40.24 m2)						
No Asbestos						
B00B - R0024 - Withdrawal Space - 1hb (32.74 m2)						
No Asbestos						
B00B - R0025 - Staff Room (18.8 m2)						
No Asbestos						
B00B - R0026 - Practical Activities - P - 1hb (10.93 m2)						
Wall Linings Internal	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9				Chrysotile (white asbestos)	
B00B - R0027 - Covered Vehicle Area/Porte Cochere (33.35 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00B/R0026/Wall Linings Internal/S9				Chrysotile (white asbestos)	
B00B - R0028 - Home Base - P (53.32 m2)						
No Asbestos						
B00B - R0029 - Access Shower/Toilet/Change (13.22 m2)						
No Asbestos						
B00B - R0030 - Home Base Store - S (8.45 m2)						
No Asbestos						
B00B - R0031 - Staff Toilet (4.01 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior**B00C - R0001 - Drinking Facilities (16.92 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0002 - Toilets - Boys (15.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0003 - Toilets - Boys (35.72 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	32m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00C/R0003/Partition Walls (Cubicles)/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0004 - General Storeroom (5.11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0005 - Sports Store (4.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0006 - Toilets - Girls (30.54 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00C/R0003/Partition Walls (Cubicles)/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0007 - Toilets - Girls (15.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4218/B00A/R0031/Ceiling Structures/Linings/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0008 - Drinking Facilities (16.79 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00A/R0031/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0009 - General Assistant/Bulk Store (21.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00A/R0031/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 1960 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

Interior

B00D - R0001 - Staff Toilet (7.08 m2)

No Asbestos

B00D - R0002 - Disabled Toilet (6.9 m2)

No Asbestos

B00D - R0003 - Special Programs Room (43.29 m2)

No Asbestos

B00D - R0004 - Special Programs Store (5.15 m2)

No Asbestos

B00D - R0005 - Distribution Board (1.79 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0006 - Library Office/Workroom (24.65 m2)

No Asbestos

B00D - R0007 - Security Store (13.16 m2)

No Asbestos

B00D - R0008 - Reading Area (153.93 m2)

No Asbestos

B00D - R0009 - Plant (1.71 m2)

No Asbestos

B00D - R0010 - Movement (143.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/General Learning - 1962 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no access point					
Eaves Linings	Flat AC Sheeting 4218/B00F/Eaves Linings/S20	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior

B00F - R0001 - Movement (20.29 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4218/B00F/R9006/Ceiling Structures/Linings/S11	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	--------------	--------------------	---------	---

B00F - R0002 - Cleaning Distributed Store (3.43 m2)

No Asbestos

B00F - R0003 - Movement (5.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4218/B00F/R0003/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00F - R0004 - Teachers Aide Special Ed (23.83 m2)

No Asbestos

B00F - R0005 - Personal Effects Storage (5.78 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4218/B00F/R0003/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00F - R0006 - Home Base Store (3.42 m2)

No Asbestos

B00F - R0009 - Home Base Store (3.44 m2)

No Asbestos

B00F - R0010 - General Storeroom (5.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4218/B00F/R0003/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00F - R0011 - Home Base Store (5.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4218/B00F/R0003/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00F - R0012 - Home Base Store (3.5 m2)

No Asbestos

B00F - R0013 - Movement (4.75 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4218/B00F/R0003/Floor Coverings Res/Textile/S15	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00F - R0014 - Home Base (59.29 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4218/B00F/R9006/Ceiling Structures/Linings/S11	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	--------------	--------------------	---------	---

B00F - R0015 - Movement (6.52 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00F/R9006/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0016 - Withdrawal Space - 1hb (28.36 m2)						
No Asbestos						
B00F - R0017 - Home Base (82.78 m2)						
No Asbestos						
B00F - R0018 - Practical Activities - 1hb (4.45 m2)						
No Asbestos						
B00F - R9001 - Cleaning Distributed Store (4.6 m2)						
No Asbestos						
B00F - R9002 - Staff Toilet (3.44 m2)						
No Asbestos						
B00F - R9003 - Canteen Office/Store (2.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00F/R9006/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R9004 - Canteen (18.84 m2)						
No Asbestos						
B00F - R9005 - Canteen (18.19 m2)						
No Asbestos						
B00F - R9006 - Movement (21.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00F/R9006/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R9007 - Garden Store (25.23 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00F/R9006/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R9008 - Movement (15.55 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no access point					
Eaves Linings	Flat AC Sheeting 4218/B00G/R0024/Ceiling Structures/Linings/S12	80m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris 4218/B00G/Underfloor Voids/S21	0.1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)

Interior

B00G - R0001 - Movement (6.27 m2)

No Asbestos

B00G - R0002 - Personal Effects Storage (5.22 m2)

No Asbestos

B00G - R0003 - Staff Toilet (1.82 m2)

No Asbestos

B00G - R0004 - Home Base (79.31 m2)

No Asbestos

B00G - R0005 - Home Base Store (4.64 m2)

No Asbestos

B00G - R0006 - Home Base (58.33 m2)

No Asbestos

B00G - R0007 - Home Base Store (3.8 m2)

No Asbestos

B00G - R0008 - Personal Effects Storage (5.95 m2)

No Asbestos

B00G - R0009 - Movement (12.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
4218/B00G/R0017/Floor Coverings Res/Textile/S13						

B00G - R0010 - Cleaning Distributed Store (3.23 m2)

No Asbestos

B00G - R0012 - Home Base Store (3.81 m2)

No Asbestos

B00G - R0013 - Personal Effects Storage (5.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
4218/B00G/R0017/Floor Coverings Res/Textile/S13						

B00G - R0014 - Home Base (56.62 m2)

No Asbestos

B00G - R0015 - Home Base (56.47 m2)

No Asbestos

B00G - R0016 - Personal Effects Storage (6.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
4218/B00G/R0017/Floor Coverings Res/Textile/S13						

B00G - R0017 - Movement (11.14 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00G/R0017/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00G - R0018 - Staff Toilet (3.36 m2)						
No Asbestos						
B00G - R0020 - Cleaning Distributed Store (9.44 m2)						
No Asbestos						
B00G - R0021 - Home Base Store (3.69 m2)						
No Asbestos						
B00G - R0022 - Home Base (59.45 m2)						
No Asbestos						
B00G - R0023 - Personal Effects Storage (2.85 m2)						
No Asbestos						
B00G - R0027 - Movement (12.51 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00G/R0024/Ceiling Structures/Linings/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00G - R0028 - Practical Activities - 1hb (10.62 m2)						
No Asbestos						
B00G - R0029 - Personal Effects Storage (4.19 m2)						
No Asbestos						
B00G - R0030 - Withdrawal Space - 2hb (12.92 m2)						
No Asbestos						
B00G - R0031 - Withdrawal Space - 2hb (13.97 m2)						
No Asbestos						
B00G - R0032 - Practical Activities - 1hb (10.82 m2)						
No Asbestos						
B00G - R0033 - Personal Effects Storage (4.48 m2)						
No Asbestos						
B00G - R0034 - Practical Activities - 1hb (10.67 m2)						
No Asbestos						
B00G - R0035 - Personal Effects Storage (4.52 m2)						
No Asbestos						
B00G - R0036 - Withdrawal Space - 2hb (12.99 m2)						
No Asbestos						
B00G - R0037 - Withdrawal Space - 2hb (16.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
4218/B00A/R0021/Floor Coverings Res/Textile/S4					No Asbestos Detected	
B00G - R0038 - External Movement (138.2 m2)						
No Asbestos						
B00G - R0039 - Practical Activities - 1hb (10.67 m2)						
No Asbestos						
B00G - R0040 - Personal Effects Storage (5.18 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible previous tenants have moved out and taken the only keys					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible previous tenants have moved out and taken the only keys					
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00A/R0031/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00H - R0001 - Movement (12.68 m2)						
ceiling lining	Flat AC Sheeting	12.67m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4218/B00H/R0001/ceiling lining/S22				Chrysotile (white asbestos)		

B00H - R0002 - Entry Vestibule (14.81 m2)						
Non Accessible						

B00H - R0003 - Staff Toilet (3.17 m2)						
Non Accessible						

B00H - R0004 - Clerical Office (9 m2)						
Non Accessible						

B00H - R0005 - Dental Clinic (7.47 m2)						
Non Accessible						

B00H - R0006 - Community Clinic (5.08 m2)						
Non Accessible						

B00H - R0007 - Community Clinic (19.93 m2)						
Non Accessible						

B00H - R0008 - Staff Toilet (2.86 m2)						
Non Accessible						

B00H - R0009 - Cleaning Distributed Store (3.59 m2)						
Non Accessible						

B00H - R0010 - Distribution Board (0.4 m2)				Note: No inspection of live electrical installation.		
Non Accessible						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Communal Facilities/Building Services - 1997 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids No Asbestos Found

Interior

B00I - R0001 - Movement (203.03 m2)

No Asbestos

B00I - R0002 - External Movement (38.51 m2)

No Asbestos

B00I - R0003 - Movement (1.89 m2)

No Asbestos

B00I - R0004 - Sports Store (11.29 m2)

No Asbestos

B00I - R0005 - Movement (12.31 m2)

No Asbestos

B00I - R0006 - Raised Platform (46.65 m2)

No Asbestos

B00I - R0007 - Movement (14.42 m2)

No Asbestos

B00I - R0008 - External Movement (43.83 m2)

No Asbestos

B00I - R0009 - General Assistant/Bulk Store (15.46 m2)

No Asbestos

B00I - R0010 - Cleaning Supplies (10.19 m2)

No Asbestos

B00I - R0011 - Cleaning Supplies (7.72 m2)

No Asbestos

B00I - R0012 - Plant (0.76 m2)

No Asbestos

B00I - R0013 - Cleaning Distributed Store (3.23 m2)

No Asbestos

B00I - R0014 - Garden Store (7.17 m2)

No Asbestos

B00I - R0015 - Toilets - Boys (11.32 m2)

No Asbestos

B00I - R0016 - Communal Space (141.27 m2)

No Asbestos

B00I - R0017 - Toilets - Girls (13.97 m2)

No Asbestos

B00I - R0018 - Shower/Change (2.88 m2)

No Asbestos

B00I - R0019 - Disabled Toilet (5.02 m2)

No Asbestos

B00I - R0020 - Hall Chair Store (8.79 m2)

No Asbestos

B00I - R0021 - P.E. Store (12.62 m2)

No Asbestos

B00I - R0022 - Distribution Board (0.95 m2)

No Asbestos

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - R0023 - Stairs (2.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017