

# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Griffith East Public School (4268)  
**Region :** Riverina  
**State Electorate :** Murray  
**Local Government Area :** Griffith

**Initial Survey :** Noel Arnold & Associates : 09 - May - 2008  
**Reviewed By :** Greencap-NAA : 18 - May - 2015



# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00A/R0045/Ceiling Structures/Linings/S15			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Resinous Membrane					
	4268/B00A/Underfloor Voids - Packing to Floor Joists/S16			<b>No Asbestos Detected</b>		

**Interior**

**B00A - R0002 - Home Base Store (9.45 m2)**

No Asbestos

**B00A - R0003 - Home Base Store (9.41 m2)**

No Asbestos

**B00A - R0026 - Home Base (53.97 m2)**

No Asbestos

**B00A - R0027 - Home Base (53.52 m2)**

No Asbestos

**B00A - R0028 - Staff Room (44.22 m2)**

No Asbestos

**B00A - R0029 - Staff Room (13.69 m2)**

No Asbestos

**B00A - R0030 - Principal (19.25 m2)**

No Asbestos

**B00A - R0031 - Security Store (16.18 m2)**

Safe	Encapsulated Insulation material within unit	1Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - item inaccessible</b>					

**B00A - R0032 - Interview (14.47 m2)**

No Asbestos

**B00A - R0033 - External Movement (4.78 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00A/R0045/Ceiling Structures/Linings/S15			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0034 - Entry Vestibule (27.13 m2)**

No Asbestos

**B00A - R0035 - Clerical Office (39.83 m2)**

No Asbestos

**B00A - R0036 - External Movement (7.41 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00A/R0045/Ceiling Structures/Linings/S15			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0037 - Distribution Board (1.92 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0038 - Cleaning Distributed Store (4.55 m2)**

No Asbestos

**B00A - R0039 - Access Shower/Toilet (5.19 m2)**

No Asbestos

**B00A - R0040 - Sick Bay (9.57 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00A - R0041 - Deputy Principal (18 m2)**

No Asbestos

**B00A - R0042 - Movement (37.31 m2)**

No Asbestos

**B00A - R0045 - External Movement (5.68 m2)**

Ceiling Structures/Linings Flat AC Sheeting 6m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

4268/B00A/R0045/Ceiling Structures/Linings/S15

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00A - R0046 - Staff Room Annexe (19.53 m2)**

No Asbestos

**B00A - R0047 - Practical Activities - 1hb (10.75 m2)**

No Asbestos

**B00A - R0048 - External Movement (5.69 m2)**

Ceiling Structures/Linings Flat AC Sheeting 6m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

4268/B00A/R0045/Ceiling Structures/Linings/S15

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00A - R0049 - Movement (14.36 m2)**

No Asbestos

**B00A - R0050 - Practical Activities - 1hb (10.81 m2)**

No Asbestos

**B00A - R0052 - Staff Toilet (2.8 m2)**

No Asbestos

**B00A - R0053 - Toilet - Lobby (2.59 m2)**

No Asbestos

**B00A - R0054 - Staff Toilet (2.8 m2)**

No Asbestos

**B00A - R0055 - Toilet - Lobby (2.47 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1961 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R1001/Ceiling Structures/Linings/S8				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					

**Interior****B00B - R0001 - External Movement (53.52 m2)**

Window In-fill-panel	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0001/Infill below windows/S3				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Entry to R0005	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0001/Floor Coverings Res/Textile/S4				<b>Chrysotile (white asbestos)</b>	
Caulking to window frames	Mastic	30m	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0001/Caulking to window frames/S5				<b>Chrysotile (white asbestos)</b>	

**B00B - R0002 - Distribution Board (0.89 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/R0005/Electrical Backing Board/S19				<b>Chrysotile (white asbestos)</b>	
Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					

**B00B - R0003 - Movement (17.62 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4268/B00B/R0004/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0007/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	4268/B00B/R0003/Floor Coverings Res/Textile/S17					

**B00B - R0004 - Disabled Toilet (13.1 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4268/B00B/R0004/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00B - R0005 - Withdrawal Space - 2hb (13.14 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4268/B00B/R0004/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0007/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>	

**B00B - R0006 - Home Base (57.24 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4268/B00B/R0004/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0007/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0007 - Home Base Store (6.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0007/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4268/B00B/R0004/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00B - R0008 - Home Base Store (6.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0007/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4268/B00B/R0004/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00B - R0009 - Personal Effects Storage (13.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0007/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4268/B00B/R0004/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00B - R0010 - Home Base (56.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4268/B00B/R0004/Ceiling Structures/Linings/S1				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0007/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0011 - Cleaning Distributed Store (7.91 m2)</b>						
No Asbestos						
<b>B00B - R0012 - General Storeroom (5.19 m2)</b>						
No Asbestos						
<b>B00B - R0013 - Movement (9.48 m2)</b>						
No Asbestos						
<b>B00B - R0014 - Stairs (4.21 m2)</b>						
No Asbestos						
<b>B00B - R0015 - Stairs (9.16 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Movement (64.06 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R1001/Ceiling Structures/Linings/S8				<b>Chrysotile (white asbestos)</b>	
Window In-fill-panel	Flat AC Sheeting	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0001/Infill below windows/S3				<b>Chrysotile (white asbestos)</b>	
Caulking to window frames	Mastic	50m	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0001/Caulking to window frames/S5				<b>Chrysotile (white asbestos)</b>	
<b>B00B - R1002 - Special Programs Room (41.03 m2)</b>						
Wall Linings Internal	Compressed AC Sheet	2m2	Above doorway	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R1002/Wall Linings Internal/S7				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R1002/Floor Coverings Res/Textile/S6				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4268/B00B/R1002/Floor Coverings Res/Textile/S6	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00B - R1003 - Home Base Store (6.74 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4268/B00B/R0001/Floor Coverings Res/Textile/S4	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00B - R1004 - Movement (6.85 m2)</b>						
No Asbestos						
<b>B00B - R1005 - Home Base (56.87 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4268/B00B/R0007/Floor Coverings Res/Textile/S2	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00B - R1006 - Home Base (56.25 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4268/B00B/R0007/Floor Coverings Res/Textile/S2	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00B - R1007 - Home Base Store (6.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4268/B00B/R0007/Floor Coverings Res/Textile/S2	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00B - R1008 - General Storeroom (8.27 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4268/B00B/R0007/Floor Coverings Res/Textile/S2	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00B - R1009 - Movement (6.98 m2)</b>						
No Asbestos						
<b>B00B - R1010 - Stairs (11.64 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4268/B00B/R1001/Ceiling Structures/Linings/S8	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						
<b>B00B - R1011 - Stairs (10.13 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4268/B00B/R1001/Ceiling Structures/Linings/S8	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Library - 1974 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/Eaves Linings/S20					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00C - R0001 - Seminar/Study (22.16 m2)**

No Asbestos

**B00C - R0003 - Library Office/Workroom (19.5 m2)**

No Asbestos

**B00C - R0004 - Communications Room (13.03 m2)**

No Asbestos

**B00C - R0005 - Distribution Board (1.51 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/R0005/Electrical Backing Board/S19					<b>Chrysotile (white asbestos)</b>
Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					

**B00C - R0006 - Cleaning Supplies (2.1 m2)**

No Asbestos

**B00C - R0007 - Library Office/Workroom (6.87 m2)**

No Asbestos

**B00C - R0008 - Staff Toilet (2.97 m2)**

No Asbestos

**B00C - R0009 - Staff Toilet (3.01 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/R0009/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>

**B00C - R0010 - Movement (8.91 m2)**

No Asbestos

**B00C - R0011 - Reading Area (174.13 m2)**

No Asbestos

**B00C - R0012 - Withdrawal Space - 1hb (13.03 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00D - Communal Facilities - 1974 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/Eaves Linings/S20					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Telecom Pit	Moulded Fibre Cement	1Unit	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00D/Telecom Pit/S22					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00D - R0002 - Hall Chair Store (9.09 m2)**

No Asbestos

**B00D - R0003 - Cleaning Supplies (11.06 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4268/B00D/R0003/Floor Coverings Res/Textile/S21					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive attached to sample 21					
	4268/B00D/R0003/Floor Coverings Res/Textile/S26					<b>No Asbestos Detected</b>

**B00D - R0004 - Toilets - Boys (11.38 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/R0009/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>

**B00D - R0005 - External Movement (13.58 m2)**

No Asbestos

**B00D - R0006 - Toilets - Girls (12.57 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/R0009/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>

**B00D - R0007 - General Storeroom (6.35 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00D/R0009/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>

**B00D - R0008 - Canteen (30.51 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00D/R0009/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>

**B00D - R0009 - General Storeroom (5.76 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00D/R0009/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>

Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					

**B00D - R0010 - Distribution Board (7.76 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	4Unit	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/R0005/Electrical Backing Board/S19					<b>Chrysotile (white asbestos)</b>

**B00D - R0011 - Cleaning Supplies (3.95 m2)**

No Asbestos

**B00D - R0012 - Movement (49.49 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00D - R0013 - Raised Platform (27.57 m2)**

No Asbestos

**B00D - R0014 - Sports Store (13.07 m2)**

No Asbestos

**B00D - R0015 - Staff Toilet (2.6 m2)**

No Asbestos

**B00D - R0016 - Communal Space (311.28 m2)**

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities/General Learning - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0001/Ceiling Structures/Linings/S10				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00F - R0001 - External Movement (68.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0001/Ceiling Structures/Linings/S10				<b>Chrysotile (white asbestos)</b>	

**B00F - R0002 - Toilets - Boys (28.62 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00F/R0002/Partition Walls (Cubicles)/S13				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0001/Ceiling Structures/Linings/S10				<b>Chrysotile (white asbestos)</b>	

**B00F - R0003 - Toilets - Girls (40.98 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00F/R0002/Partition Walls (Cubicles)/S13				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0001/Ceiling Structures/Linings/S10				<b>Chrysotile (white asbestos)</b>	

**B00F - R0004 - Home Base (57.67 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00F/R0014/Floor Coverings Res/Textile/S12				<b>Chrysotile (white asbestos)</b>	

**B00F - R0005 - Home Base Store (5 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00F/R0014/Floor Coverings Res/Textile/S12				<b>Chrysotile (white asbestos)</b>	

**B00F - R0006 - Personal Effects Storage (7.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00F/R0014/Floor Coverings Res/Textile/S12				<b>Chrysotile (white asbestos)</b>	

**B00F - R0007 - Distribution Board (0.55 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Encapsulated Insulation material within unit	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4268/B00F/R0007/Wall Linings Internal/S23				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4268/B00F/R0007/Wall Linings Internal/S23				<b>Chrysotile (white asbestos)</b>	

**B00F - R0008 - External Movement (3.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0001/Ceiling Structures/Linings/S10				<b>Chrysotile (white asbestos)</b>	

**B00F - R0009 - Personal Effects Storage (7.23 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4268/B00F/R0014/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
<b>B00F - R0010 - Home Base Store (4.96 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4268/B00F/R0014/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
<b>B00F - R0011 - Home Base (57.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4268/B00F/R0014/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
<b>B00F - R0012 - Home Base (57.75 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4268/B00F/R0014/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
<b>B00F - R0013 - Home Base Store (6.73 m2)</b>						
No Asbestos						
<b>B00F - R0014 - Personal Effects Storage (6.39 m2)</b>						
No Asbestos						
<b>B00F - R0015 - Movement (1.36 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4268/B00G/R0001/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00G - Administration - 1967 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Height Restriction					

**Interior**

**B00G - R0001 - External Movement (49.03 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	

**B00G - R0002 - Interview (15.02 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0002/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

**B00G - R0003 - Movement (20.51 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0002/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

**B00G - R0004 - Movement (8.05 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0002/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

**B00G - R0005 - Withdrawal Space - 1hb (19.87 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0002/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

**B00G - R0006 - Special Programs Room (20.58 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0002/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

**B00G - R0007 - General Storeroom (7.49 m2)**


No Asbestos

**B00G - R0008 - Staff Toilet (4.94 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00G/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	

**B00G - R0009 - Cleaning Supplies (1.84 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4268/B00G/R0002/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

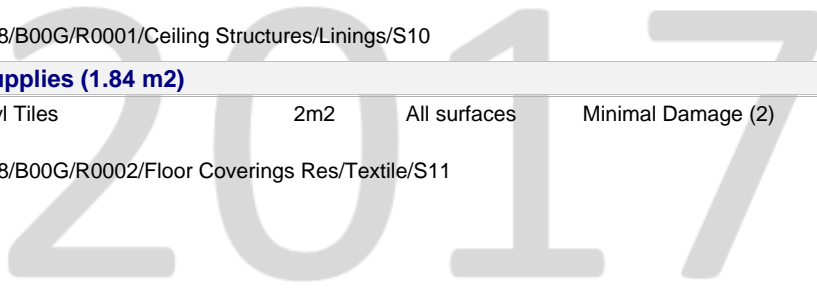

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 1967 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Window In-fill-panel	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0001/Infill below windows/S3					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00H/Eaves Linings/S25					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00H - R0001 - Home Base Store (9.94 m2)**

No Asbestos

**B00H - R0002 - Home Base (71.25 m2)**

No Asbestos

**B00H - R0003 - External Movement (28.99 m2)**

Window In-fill-panel	Flat AC Sheeting	6m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0001/Infill below windows/S3					<b>Chrysotile (white asbestos)</b>

**B00H - R0004 - Withdrawal Space - 1hb (12.14 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - General Learning - 1967 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00H/Eaves Linings/S25					<b>Chrysotile (white asbestos)</b>
Window In-fill-panel	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00B/R0001/Infill below windows/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior****B00I - R0001 - Home Base (98.41 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	4268/B00I/R0001/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>

**B00I - R0002 - External Movement (52.7 m2)**

No Asbestos

**B00I - R0003 - Home Base (97.88 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	4268/B00I/R0001/Floor Coverings Res/Textile/S24					<b>No Asbestos Detected</b>

**B00I - R0004 - Toilets - Boys/Girls (3.27 m2)**

No Asbestos

**B00I - R0005 - Distribution Board (0.78 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2Unit	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4268/B00C/R0005/Electrical Backing Board/S19					<b>Chrysotile (white asbestos)</b>
Electrical Mounting Board	Encapsulated Insulation material within unit	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					

**B00I - R0006 - General Storeroom (11.99 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4268/B00D/R0003/Floor Coverings Res/Textile/S21					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive attached to sample 21					
	4268/B00D/R0003/Floor Coverings Res/Textile/S26					<b>No Asbestos Detected</b>

**B00I - R0007 - General Storeroom (13.03 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4268/B00D/R0003/Floor Coverings Res/Textile/S21					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive attached to sample 21					
	4268/B00D/R0003/Floor Coverings Res/Textile/S26					<b>No Asbestos Detected</b>

**B00I - R0008 - Toilets - Boys/Girls (3.26 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - General Learning - 2006 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible
Eaves Linings	No Asbestos Found

**Interior**

**B00J - R0001 - External Movement (38.47 m2)**

No Asbestos

**B00J - R0002 - Practical Activities - 1hb (19.4 m2)**

No Asbestos

**B00J - R0003 - Home Base Store (6.02 m2)**

No Asbestos

**B00J - R0004 - Home Base (59.21 m2)**

No Asbestos

**B00J - R0005 - Withdrawal Space - 2hb (11.36 m2)**

No Asbestos

**B00J - R0006 - Home Base (59.2 m2)**

No Asbestos

**B00J - R0007 - Home Base Store (6.02 m2)**

No Asbestos

**B00J - R0008 - Practical Activities - 1hb (19.41 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Eaves Linings	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

**Interior**

**B00K - R0001 - General Assistant/Bulk Store (18.71 m2)**

No Asbestos Found

**B00K - R0002 - Toilets - Girls (32.38 m2)**

No Asbestos Found

**B00K - R0003 - Access Shower/Toilet (7.81 m2)**

No Asbestos Found

**B00K - R0004 - Toilets - Boys (23.33 m2)**

No Asbestos Found

**B00K - R0005 - Plant (0.74 m2)**

No Asbestos Found

**B00K - R0006 - Garden Store (18.54 m2)**

No Asbestos Found

**B00K - R0007 - Main Switch Board (0.72 m2)**

No Asbestos Found

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found
Eaves Linings	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

**Interior**

**B00L - R0001 - External Movement (41.12 m2)**

No Asbestos Found

**B00L - R0002 - Practical Activities - 1hb (21.61 m2)**

No Asbestos Found

**B00L - R0003 - Home Base Store (6.49 m2)**

No Asbestos Found

**B00L - R0004 - Home Base (63.98 m2)**

No Asbestos Found

**B00L - R0005 - Withdrawal Space - 2hb (10.84 m2)**

No Asbestos Found

**B00L - R0006 - Home Base (63.98 m2)**

No Asbestos Found

**B00L - R0007 - Home Base Store (6.49 m2)**

No Asbestos Found

**B00L - R0008 - Practical Activities - 1hb (21.61 m2)**

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found
Eaves Linings	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

**Interior**

**B00M - R0001 - External Movement (41.12 m2)**

No Asbestos Found

**B00M - R0002 - Practical Activities - 1hb (21.61 m2)**

No Asbestos Found

**B00M - R0003 - Home Base Store (6.49 m2)**

No Asbestos Found

**B00M - R0004 - Home Base (63.98 m2)**

No Asbestos Found

**B00M - R0005 - Withdrawal Space - 2hb (10.84 m2)**

No Asbestos Found

**B00M - R0006 - Home Base (63.98 m2)**

No Asbestos Found

**B00M - R0007 - Home Base Store (6.49 m2)**

No Asbestos Found

**B00M - R0008 - Practical Activities - 1hb (21.61 m2)**

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

**OS 602 - D12835 - Learning Unit - Standard With P.A.A. : Placement Date - 29/11/2012**

### Exterior

Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

#### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 601 - D13570 - Learning Unit - Standard/Withdrawal : Placement Date - 25/01/2008**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 602 - D13631 - Learning Unit - Standard With P.A.A. : Placement Date - 1/05/2014**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

#### R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 601 - D14024 - Learning Unit - Standard/Withdrawal : Placement Date - 5/02/1997**

### Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D14532 - Learning Unit - Standard/Withdrawal : Placement Date - 22/01/2003</b>						
<b>Exterior</b>						
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 602 - D18237 - Learning Unit - Standard With P.A.A. : Placement Date - 18/01/2017</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017