


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gymea North Public School (4389)
Region : Sydney
State Electorate : Miranda
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 13 - Jun - 2008
Reviewed By : AECOM : 26 - May - 2015

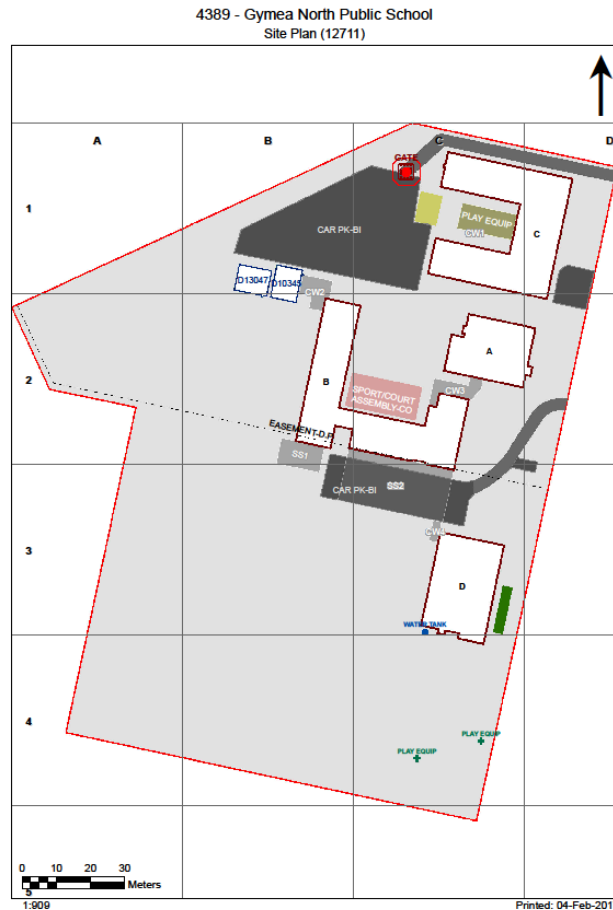

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Administration - 1969 - Brick/Block (Brick/Block)

Exterior

Gable Verge linings	Flat AC Sheeting	50m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00A/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00A - R0001 - Movement (4.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00A/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0002 - Interview (13.28 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4389/B00A/R0002/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Clerical Office (13.46 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4389/B00A/R0002/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0004 - Duplicating Workroom (12.99 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4389/B00A/R0002/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00A/R0004/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00A - R0005 - Principal (22.47 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4389/B00A/R0002/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Sick Bay (10.33 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4389/B00A/R0002/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00A/R0004/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00A - R0007 - Cleaning Distributed Store (4.35 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4389/B00A/R0002/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00A/R0004/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00A - R0008 - Staff Room Annexe (14.47 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4389/B00A/R0002/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0009 - Movement (2.35 m2)

No Asbestos

B00A - R0010 - Staff Room (80.94 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4389/B00A/R0002/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4389/B00A/R0004/Floor Coverings Res/Textile/S3	81m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0011 - Movement (2.26 m2)						
Ceiling Structures/Linings	Vermiculite 4389/B00A/R0002/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0012 - Security Store (11.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4389/B00A/R0004/Floor Coverings Res/Textile/S3	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0013 - Staff Toilet (3.83 m2)						
No Asbestos						
B00A - R0014 - Staff Toilet (3.83 m2)						
No Asbestos						
B00A - R0015 - General Storeroom (15.61 m2)						
Ceiling Structures/Linings	Vermiculite 4389/B00A/R0002/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4389/B00A/R0004/Floor Coverings Res/Textile/S3	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0016 - Plant (9.14 m2)						
Ceiling Structures/Linings	Vermiculite 4389/B00A/R0002/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0017 - Deputy Principal (15.07 m2)						
Ceiling Structures/Linings	Vermiculite 4389/B00A/R0002/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0018 - Entry Vestibule (17.17 m2)						
Ceiling Structures/Linings	Vermiculite 4389/B00A/R0002/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0019 - Movement (27.53 m2)						
Ceiling Structures/Linings	Vermiculite 4389/B00A/R0002/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0020 - General Storeroom (12.04 m2)						
No Asbestos						
B00A - R0021 - Movement (1.43 m2)						
No Asbestos						
B00A - R1001 - Movement (3.47 m2)						
No Asbestos						
B00A - R1002 - Reading Area (54.58 m2)						
No Asbestos						
B00A - R1003 - Distribution Board (0.75 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting 4389/B00A/R1003/Ceiling Structures/Linings/S5	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1004 - Reading Area (179.97 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1005 - Library Office/Workroom (17.07 m2)

No Asbestos

B00A - R1006 - Communications Room (9.18 m2)

No Asbestos

B00A - R1007 - Library Office/Workroom (7.4 m2)

No Asbestos

B00A - R1008 - K.L.A. Store (10.9 m2)

No Asbestos

B00A - R1009 - K.L.A. Store (12.04 m2)

No Asbestos

B00A - R1010 - Toilets - Boys (3.72 m2)

Partition Walls (Cubicles) Compressed AC Sheet 2m2 Middle portion Good Condition (1) Low (1) Low Priority (2-3)

4389/B00A/R1010/Partition Walls (Cubicles)/S4

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R1011 - Toilets - Girls (3.42 m2)

Partition Walls (Cubicles) Compressed AC Sheet 4m2 Middle portion Good Condition (1) Low (1) Low Priority (2-3)

4389/B00A/R1010/Partition Walls (Cubicles)/S4

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R1012 - Cleaning Distributed Store (2.12 m2)

No Asbestos

B00A - R1013 - Movement (5.16 m2)

No Asbestos

B00A - R1014 - Movement (13.05 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	140m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00B/R1020/In-fill beneath windows/S10					Chrysotile (white asbestos)
In-fill-panels below Window	Compressed AC Sheet	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00B/R1020/In-fill beneath windows/S10					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Practical Activities - 1hb (13.19 m2)**

Ceiling Structures/Linings	Vermiculite					
	4389/B00B/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0002 - Home Base (57.43 m2)

Ceiling Structures/Linings	Vermiculite					
	4389/B00B/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0003 - General Storeroom (17.38 m2)

Ceiling Structures/Linings	Vermiculite					
	4389/B00B/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00B/R0003/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00B - R0005 - Kiln Room (9.36 m2)

No Asbestos

B00B - R0006 - Home Base (56.88 m2)

Ceiling Structures/Linings	Vermiculite					
	4389/B00B/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0007 - Practical Activities - 1hb (12.8 m2)

Ceiling Structures/Linings	Vermiculite					
	4389/B00B/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0008 - Distribution Board (0.35 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0009 - Practical Activities - 1hb (12.64 m2)

Ceiling Structures/Linings	Vermiculite					
	4389/B00B/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0010 - Home Base (58.31 m2)

Ceiling Structures/Linings	Vermiculite					
	4389/B00B/R0003/Ceiling Structures/Linings/S7					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0011 - Movement (90.76 m2)

No Asbestos

B00B - R0012 - Canteen Office/Store (3.32 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00B - R0013 - Canteen Office/Store (2.92 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0014 - Canteen (23.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0015 - General Assistant/Bulk Store (6.41 m2)						
No Asbestos						
B00B - R0016 - Movement (88.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	60m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0017 - Cleaning Distributed Store (4.41 m2)						
No Asbestos						
B00B - R0018 - Sports Store (12.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0019 - Movement (4.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0020 - Toilets - Boys (40.33 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1020/In-fill beneath windows/S10					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0021 - Staff Toilet (2.06 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0022 - Toilets - Girls (42.65 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	24m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1020/In-fill beneath windows/S10					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	43m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R0023 - Practical Activities - 1hb (12.88 m2)						
Ceiling Structures/Linings	Vermiculite	4389/B00B/R0003/Ceiling Structures/Linings/S7			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0024 - Home Base (57.04 m2)						
Ceiling Structures/Linings	Vermiculite	4389/B00B/R0003/Ceiling Structures/Linings/S7			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0025 - Stairs (5.21 m2)						
No Asbestos						
B00B - R0026 - Stairs (9.85 m2)						
No Asbestos						
B00B - R1001 - Practical Activities - 1hb (12 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1002 - Home Base (59.64 m2)						
No Asbestos						
B00B - R1003 - General Storeroom (16.11 m2)						
No Asbestos						
B00B - R1004 - Home Base (58.69 m2)						
No Asbestos						
B00B - R1005 - Practical Activities - 1hb (11.21 m2)						
No Asbestos						
B00B - R1006 - Distribution Board (0.38 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R1007 - Home Base (59.71 m2)						
No Asbestos						
B00B - R1008 - Practical Activities - 1hb (10.7 m2)						
No Asbestos						
B00B - R1009 - Practical Activities - 1hb (11.1 m2)						
No Asbestos						
B00B - R1010 - Home Base (59.08 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible - material						
B00B - R1011 - Cleaning Supplies (13.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00B - R1012 - Movement (80.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	3m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1012/Wall Linings Internal/S12					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	70m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1012/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	
In-fill-panel below Window	Compressed AC Sheet	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1020/In-fill beneath windows/S10					Chrysotile (white asbestos)	
B00B - R1014 - Movement (27.4 m2)						
No Asbestos						
B00B - R1015 - Home Base (60.83 m2)						
No Asbestos						
B00B - R1016 - Practical Activities - 1hb (11.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1019/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00B - R1017 - Home Base (81.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1019/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00B - R1018 - Home Base (43.92 m2)						
No Asbestos						
B00B - R1019 - Practical Activities - 1hb (16.27 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1019/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00B - R1020 - Movement (71.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R0012/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
In-fill-panel below Window	Compressed AC Sheet	17m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1020/In-fill beneath windows/S10					Chrysotile (white asbestos)	
B00B - R1021 - Home Base (55.74 m2)						
No Asbestos						
B00B - R1022 - Practical Activities - 1hb (12.4 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00B/R1019/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00B - R1023 - Stairs (15.34 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Other-Non-Govt Pre-School/Pupil Facilities - 1969 - Brick/Block (Brick/Block)

Exterior

In-fill-panel below Window	Compressed AC Sheet	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0011/In-fill beneath windows/S17					Chrysotile (white asbestos)
Eaves Linings	Corrugated AC Sheeting	140m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel above Window	Flat AC Sheeting	40m2	North facing, South facing, East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0011/In-fill above windows/S16					Chrysotile (white asbestos)
Gable verge linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible Occupied by preschool.					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Kitchen - Pre (28.68 m2)

Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0001/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00C - R0002 - Movement (5 m2)

Ceiling Structures/Linings	Corrugated AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0003 - Movement (43.48 m2)

No Asbestos

B00C - R0004 - Movement (5.05 m2)

Ceiling Structures/Linings	Corrugated AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0005 - Distribution Board (4.78 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	25m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0005/Wall Linings Internal/S22					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0005/Floor Coverings Res/Textile/S23					, Crocidolite (blue asbestos)
Electrical Backing Board	Resinous Board	4m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B00C - R0007 - Toilets - Boys (33.79 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0007/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4389/B00C/R0007/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0008 - Cleaning Distributed Store (7.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0007/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00C - R0009 - Other-Non Government Pre-Sch (66.26 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible - material						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0009/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)	
B00C - R0010 - Movement (32.27 m2)						
No Asbestos						
B00C - R0011 - Movement (43.12 m2)						
Ceiling Structures/Linings	Corrugated AC Sheeting	43m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel above Window	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/In-fill above windows/S16					Chrysotile (white asbestos)	
In-fill-panel below Window	Compressed AC Sheet	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/In-fill beneath windows/S17					Chrysotile (white asbestos)	
B00C - R0012 - Movement (28.21 m2)						
Ceiling Structures/Linings	Corrugated AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel above Window	Flat AC Sheeting	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/In-fill above windows/S16					Chrysotile (white asbestos)	
In-fill-panel below Window	Compressed AC Sheet	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/In-fill beneath windows/S17					Chrysotile (white asbestos)	
B00C - R0013 - Clerical Office - Pre (9.58 m2)						
No Asbestos						
B00C - R0014 - Other-Non Government Pre-Sch (16.85 m2)						
No Asbestos						
B00C - R0015 - Other-Non Government Pre-Sch (73.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0009/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)	
B00C - R0016 - Movement (20.43 m2)						
No Asbestos						
B00C - R0017 - Movement (4.18 m2)						
No Asbestos						
B00C - R0018 - Toilets - Boys/Girls - Pre (2.3 m2)						
Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0018/Wall Linings Internal/S20					Chrysotile (white asbestos)	
B00C - R0022 - Toilets - Boys/Girls - Pre (32.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0007/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0023 - General Storeroom (6.93 m2)						
No Asbestos						
B00C - R0024 - Movement (47.88 m2)						
Ceiling Structures/Linings	Corrugated AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/Ceiling Structures/Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel above Window	Flat AC Sheeting	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/In-fill above windows/S16				Chrysotile (white asbestos)		
In-fill-panel below Window	Compressed AC Sheet	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0011/In-fill beneath windows/S17				Chrysotile (white asbestos)		
B00C - R0025 - Practical Activities (144.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0025/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
B00C - R0029 - Practical Activities (59.34 m2)						
No Asbestos						
B00C - R0030 - Out Of School Hours Care Centre (47.7 m2)						
No Asbestos						
B00C - R0031 - Out Of School Hours Care Centre (37.84 m2)						
No Asbestos						
B00C - R0032 - Practical Activities - 1hb (59.44 m2)						
No Asbestos						
B00C - R0033 - Toilet - Lobby (1.53 m2)						
Wall Linings Internal	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0025/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4389/B00C/R0025/Floor Coverings Res/Textile/S24				Chrysotile (white asbestos)		
B00C - R0034 - Toilets - Boys/Girls (1.69 m2)						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4389/B00C/R0034/Wall Linings Internal/S25				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4389/B00C/R0034/Wall Linings Internal/S25				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00D - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

No Asbestos

Interior**B00D - R0001 - Communal Space (143.34 m2)**

No Asbestos

B00D - R0002 - Raised Platform (62.07 m2)

No Asbestos

B00D - R0003 - Communal/Performance Store (9.35 m2)

No Asbestos

B00D - R0004 - P.E. Store (9.8 m2)

No Asbestos

B00D - R0005 - Chair Storeroom (13.04 m2)

No Asbestos

B00D - R0006 - Toilet - Lobby (2.35 m2)

No Asbestos

B00D - R0007 - Toilets - Girls (7.44 m2)

No Asbestos

B00D - R0008 - General Storeroom (2.07 m2)

No Asbestos

B00D - R0009 - Toilets - Boys (5.74 m2)

No Asbestos

B00D - R0010 - Toilet - Lobby (3.36 m2)

No Asbestos

B00D - R0011 - General Storeroom (1.6 m2)

No Asbestos

B00D - R0012 - Cleaning Distributed Store (2.8 m2)

No Asbestos

B00D - R0013 - Access Shower/Toilet/Change (6.71 m2)

No Asbestos

B00D - R0014 - Main Switch Board (3.48 m2)

No Asbestos

B00D - R0015 - External Movement (15.93 m2)

No Asbestos

B00D - R0016 - General Storeroom (0.51 m2)

No Asbestos

B00D - R0017 - Canteen (27.19 m2)

No Asbestos

B00D - R0018 - Canteen Office/Store (8.24 m2)

No Asbestos

B00D - R0019 - Canteen Covered Area (94.96 m2)

No Asbestos

B00D - R0020 - External Movement (56.7 m2)

No Asbestos

B00D - R0021 - Movement (13.15 m2)

No Asbestos

B00D - R0022 - Movement (6.92 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - R0023 - Stairs (9.42 m2)

No Asbestos

B00D - R0024 - General Storeroom (1.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10345 - Learning Unit - Standard/Withdrawal : Placement Date - 30/01/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 602 - D13047 - Learning Unit - Standard With P.A.A. : Placement Date - 14/03/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017