


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gillwinga Public School (4421)
Region : North Coast
State Electorate : Clarence
Local Government Area : Clarence Valley

Initial Survey : Noel Arnold & Associates : 26 - May - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Oct - 2015

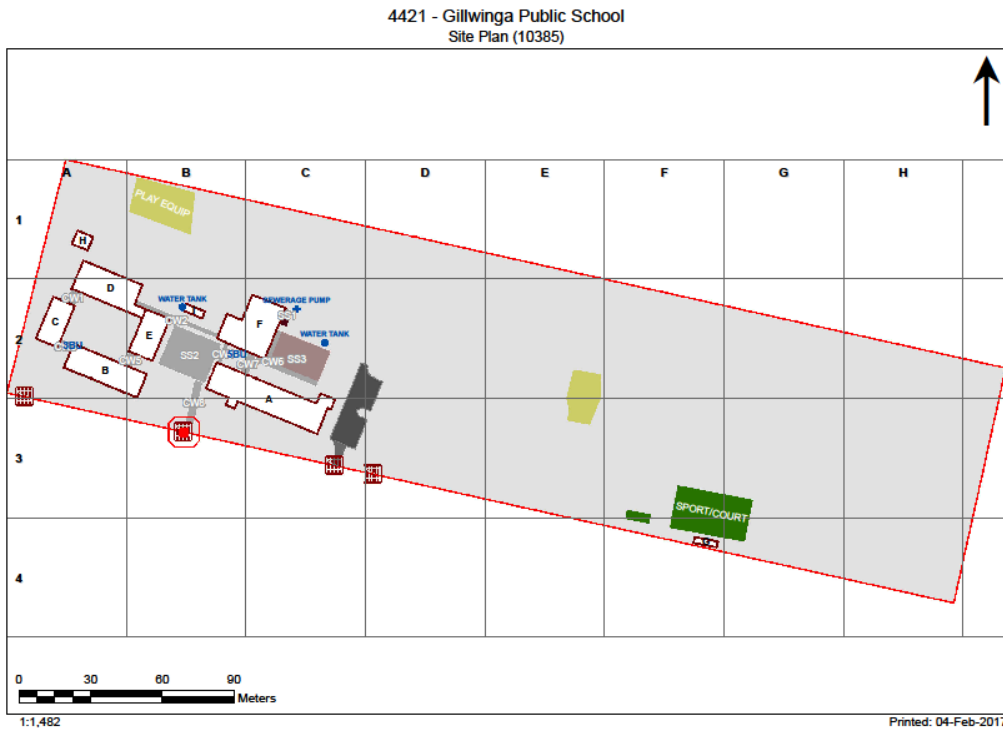

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1976 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	52m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0007/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	10m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4421/B00A/Gable Verge Lining/S7				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00A - R0001 - Practical Activities - 1hb (21.53 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4421/B00A/R0009/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4421/B00A/R0013/Floor Coverings Res/Textile/S2					

B00A - R0002 - Home Base (57.76 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4421/B00A/R0009/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0003 - Home Base (57.76 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4421/B00A/R0009/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0004 - Practical Activities - 1hb (20.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4421/B00A/R0013/Floor Coverings Res/Textile/S2					
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4421/B00A/R0009/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00A - R0005 - Distribution Board (0.8 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0006 - Staff Room (52.23 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4421/B00A/R0009/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4421/B00A/R0006/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)	

B00A - R0007 - Staff Toilet (8.03 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4421/B00A/R0009/Ceiling Structures/Linings/S1				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00A/R0007/Partition Walls (Cubicles)/S23				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0008 - Movement (37.52 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4421/B00A/R0008/Floor Coverings Res/Textile/S24	38m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
B00A - R0009 - Staff Toilet (3.75 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Partition Walls (Cubicles)	Compressed AC Sheet 4421/B00A/R0009/Partition Walls (Cubicles)/S25	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0010 - Deputy Principal (12.63 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0011 - Duplicating Workroom (12.6 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0012 - General Storeroom (12.67 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0013 - Sick Bay (8.21 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4421/B00A/R0013/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00A - R0014 - Clerical Office (12.63 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0015 - Deputy Principal (12.57 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0016 - Entry Vestibule (12.99 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0017 - General Storeroom (10.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4421/B00A/R0013/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00A - R0018 - Principal (20.6 m2)						
Ceiling Structures/Linings	Vermiculite 4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0019 - Cleaning Supplies (5.78 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0020 - Movement (135.5 m2)						
No Asbestos						
B00A - R0021 - General Storeroom (18.22 m2)						
No Asbestos						
B00A - R0022 - Movement (10.47 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00F/R0008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00A - R0023 - Stairs (8.78 m2)						
No Asbestos						
B00A - R0024 - Stairs (16.26 m2)						
No Asbestos						
B00A - R1001 - Practical Activities - 1hb (21.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
4421/B00A/R0013/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00A - R1002 - Home Base (58.82 m2)						
No Asbestos						
B00A - R1003 - Home Base (58.26 m2)						
No Asbestos						
B00A - R1004 - Practical Activities - 1hb (20.37 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
4421/B00A/R0013/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00A - R1005 - Distribution Board (0.8 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R1006 - K.L.A. Store (10.08 m2)						
No Asbestos						
B00A - R1007 - K.L.A. Store (10.18 m2)						
No Asbestos						
B00A - R1008 - Reading Area (163.73 m2)						
No Asbestos						
B00A - R1009 - Entry Vestibule (9.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00F/R0008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00F/R0008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00A - R1010 - Library Office/Workroom (6.93 m2)						
No Asbestos						
B00A - R1011 - Library Office/Workroom (13.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00F/R0008/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
4421/B00A/R0013/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00A - R1012 - K.L.A. Store (13.46 m2)						
Ceiling Structures/Linings	Vermiculite					
4421/B00A/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles					
	4421/B00A/R0013/Floor Coverings Res/Textile/S2				No Asbestos Detected	
B00A - R1013 - Toilets - Girls (6.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00F/R0008/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00A/R1013/Partition Walls (Cubicles)/S26				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1014 - Toilets - Boys (4.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00F/R0008/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00A/R1014/Partition Walls (Cubicles)/S28				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00A/R1014/Ceiling Structures/Linings/S27				Chrysotile (white asbestos)	
B00A - R1015 - Movement (111.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	112m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00F/R0008/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	112m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00A/R1015/Ceiling Structures/Linings/S29				Chrysotile (white asbestos)	
B00A - R1016 - Stairs (10.74 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00A/R1016/Ceiling Structures/Linings/S32				Chrysotile (white asbestos)	
B00A - R1017 - Stairs (23.47 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00A/R1016/Ceiling Structures/Linings/S32				Chrysotile (white asbestos)	
B00A - R9001 - Garden Store (5.57 m2)						
No Asbestos						
B00A - R9002 - Stairs (20.7 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1971 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0007/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	4m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4421/B00B/Gable Verge Lining/S9				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	Flat Cement Debris	<1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	4421/B00B/Underfloor Void/S11				Chrysotile (white asbestos)	
Infill Panels under Windows	Flat AC Sheeting	30m2	North & South	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	4421/B00B/Infill Panels under Windows/S10				Chrysotile (white asbestos)	
Downpipes	Fibre Cement Pipe	4m	North-West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4421/B00B/Downpipes/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior**B00B - R0008 - External Movement (6.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0007/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0009 - Distribution Board (1.29 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0004/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0004/Wall Linings Internal/S3				Chrysotile (white asbestos)	

B00B - R0016 - External Movement (61.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0007/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0017 - Special Programs Room (56.77 m2)

No Asbestos

B00B - R0018 - Movement (17.55 m2)

No Asbestos

B00B - R0019 - Home Base (71.24 m2)

No Asbestos

B00B - R0020 - Practical Activities/Movement - 2hb (10.18 m2)

No Asbestos

B00B - R0021 - Withdrawal Space - 2hb (8.09 m2)

No Asbestos

B00B - R0022 - Home Base Store (5.66 m2)

No Asbestos

B00B - R0023 - Home Base Store (5.79 m2)

No Asbestos

B00B - R0024 - Home Base (73.57 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Special Purpose - 1971 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0007/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	4m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4421/B00C/Gable Verge Lining/S13				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Downpipes	Fibre Cement Pipe	4m	South-West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00C/Downpipes/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior

B00C - R0001 - Toilets - Girls (32.73 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00C/R0001/Partition Walls (Cubicles)/S30				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0002 - General Storeroom (2.04 m2)

No Asbestos

B00C - R0003 - Toilets - Boys (28.49 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00C/R0003/Partition Walls (Cubicles)/S31				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0004 - Staff Toilet (2.04 m2)

No Asbestos

B00C - R0006 - Movement (35.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0007/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0007 - Home Base (56.69 m2)

No Asbestos

B00C - R0008 - Practical Activities - 1hb (6.5 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1971 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Void	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	8m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00D/Gable Verge Lining/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Debris Flat AC Sheeting	<1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	4421/B00D/Underfloor Voids/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	<1m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	4421/B00D/Underfloor Voids - Packing to Floor Joists/S17					Chrysotile (white asbestos)
Infill Panels under Windows	Flat AC Sheeting	30m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00D/Infill Panels under Windows/S15					Chrysotile (white asbestos)

Interior**B00D - R0003 - Distribution Board (0.38 m2)** Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0004/Wall Linings Internal/S3					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0004/Wall Linings Internal/S3					Chrysotile (white asbestos)

B00D - R0010 - External Movement (69.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	4421/B00E/R0007/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0011 - External Movement (51.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0007/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0012 - Practical Activities/Movement - 1hb (10.99 m2)

No Asbestos

B00D - R0013 - Home Base Store (6.59 m2)

No Asbestos

B00D - R0014 - Home Base (86.37 m2)

No Asbestos

B00D - R0015 - Home Base (87.35 m2)

No Asbestos

B00D - R0016 - Home Base Store (8.28 m2)

No Asbestos

B00D - R0017 - Practical Activities/Movement - 1hb (9.09 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1976 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00E/R0007/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	6m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4421/B00E/Gable Verge Lining/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Void	Debros Flat AC Sheeting	<1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
4421/B00E/Underfloor Void/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Infill Panel under Windows	Flat AC Sheeting	20m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00E/Infill Panel under Windows/S19				Chrysotile (white asbestos)		

Interior

B00E - R0001 - Home Base (59.77 m2)

No Asbestos

B00E - R0003 - Movement (12.43 m2)

No Asbestos

B00E - R0004 - Distribution Board (0.38 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00E/R0004/Wall Linings Internal/S3				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00E/R0004/Wall Linings Internal/S3				Chrysotile (white asbestos)		

B00E - R0006 - Home Base (59.77 m2)

No Asbestos

B00E - R0007 - External Movement (35.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4421/B00E/R0007/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0008 - Withdrawal Space - 2hb (8.18 m2)

No Asbestos

B00E - R0009 - Home Base Store (2.82 m2)

No Asbestos

B00E - R0010 - Home Base Store (2.81 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities/Pupil Facilities - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00E/R0007/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Void	Debris Flat AC Sheeting	<1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4421/B00F/Underfloor Void/S21			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00F - R0004 - External Movement (13.19 m2)

No Asbestos

B00F - R0005 - Sports Store (14.27 m2)

No Asbestos

B00F - R0006 - Hall Chair Store (17.26 m2)

No Asbestos

B00F - R0011 - Toilets - Girls (44.62 m2)

No Asbestos

B00F - R0012 - Movement (10.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4421/B00F/R0008/Ceiling Structures/Linings/S5			Chrysotile (white asbestos)		

B00F - R0013 - Toilets - Boys (32.48 m2)

No Asbestos

B00F - R0014 - Access Shower/Toilet/Change (5.9 m2)

No Asbestos

B00F - R0015 - Communal Space (165.76 m2)

No Asbestos

B00F - R0016 - Raised Platform (47.53 m2)

No Asbestos

B00F - R0017 - Communal/Performance Store (10.02 m2)

No Asbestos

B00F - R0018 - Distribution Board (0.39 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0019 - Ramp (13.25 m2)

No Asbestos

B00F - R0020 - Movement (3.06 m2)

No Asbestos

B00F - R9001 - Garden Store (8.14 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00G - R0001 - Sports Store (19.28 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00H - R0001 - Sports Store (40.21 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B001 - R0001 - Canteen (13.62 m2)

No Asbestos

B001 - R0002 - Canteen Office/Store (6.66 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Added Building

Exterior

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017