


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Guise Public School (4461)  
**Region :** South Western Sydney  
**State Electorate :** Macquarie Fields  
**Local Government Area :** Campbelltown

**Initial Survey :** Noel Arnold & Associates : 14 - Jan - 2010  
**Reviewed By :** Parsons Brinckerhoff : 16 - Oct - 2015

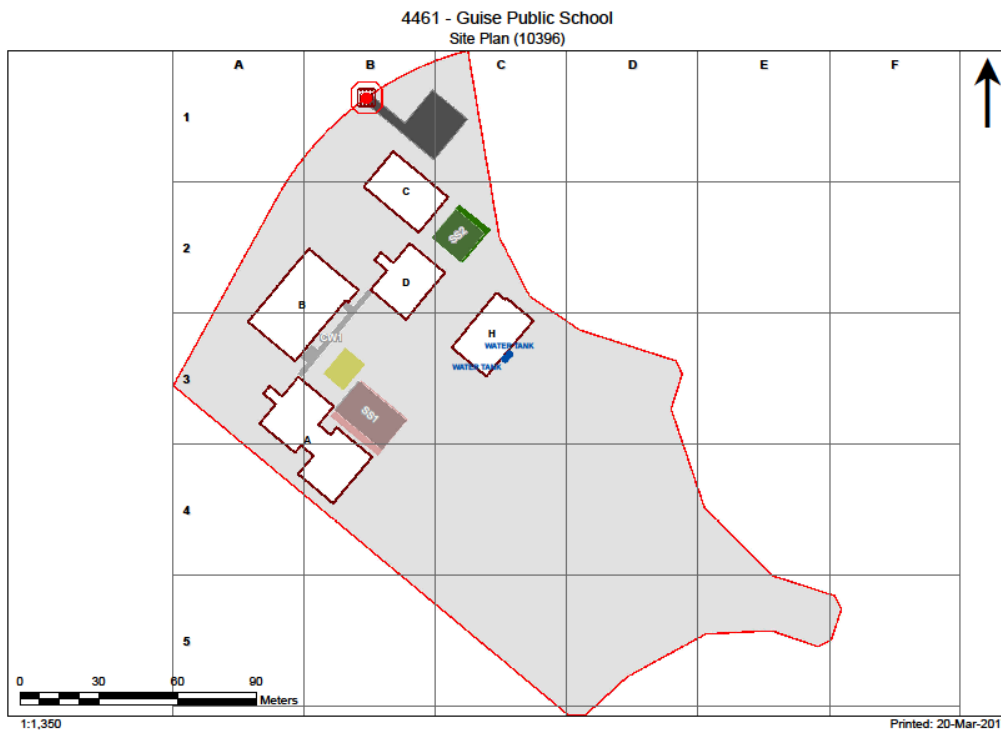

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1975 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	400m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00A/Eaves Linings/S23					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Packing	NA	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4461/B00A/Ceiling Voids/S25					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00A/Gable Verge Lining/S26					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior****B00A - R0001 - Practical Activities - 1hb (9.93 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4461/B00A/R0021/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite					
	4461/B00A/R0021/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0002 - Toilets - Boys/Girls (3.43 m2)**

Ceiling Structures/Linings	Vermiculite					
	4461/B00A/R0021/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0003 - Home Base (89.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4461/B00A/R0021/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite					
	4461/B00A/R0021/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Heater Bank	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4461/B00A/R0003/Heater Bank/S34					<b>Assumed Asbestos</b>

**B00A - R0004 - Home Base (89.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4461/B00A/R0021/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite					
	4461/B00A/R0021/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Heater Bank	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4461/B00A/R0004/Heater Bank/S35					<b>Assumed Asbestos</b>

**B00A - R0005 - Practical Activities - 1hb (9.93 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4461/B00A/R0021/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite					
	4461/B00A/R0021/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>
						<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0006 - Toilets - Boys/Girls (3.43 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0007 - Toilets - Girls (33.38 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 4461/B00A/R0007/Partition Walls (Cubicles)/S5	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0008 - Handwashing Facilities (20.94 m2)</b>						
Ledge	Compressed AC Sheet 4461/B00A/R0009/Ledge/S6					No Asbestos Detected
<b>B00A - R0009 - Handwashing Facilities (16.99 m2)</b>						
Ledge	Compressed AC Sheet 4461/B00A/R0009/Ledge/S6					No Asbestos Detected
<b>B00A - R0010 - Toilets - Boys (34.58 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 4461/B00A/R0007/Partition Walls (Cubicles)/S5	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0011 - Cleaning Distributed Store (7.83 m2)</b>						
No Asbestos						
<b>B00A - R0012 - General Storeroom (11.51 m2)</b>						
No Asbestos						
<b>B00A - R0013 - Drinking Facilities (34.78 m2)</b>						
No Asbestos						
<b>B00A - R0014 - Sports Store (17.25 m2)</b>						
Non Accessible						
<b>B00A - R0015 - General Storeroom (16.59 m2)</b>						
No Asbestos						
<b>B00A - R0016 - Distribution Board (0.85 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Electrical Backing Board	Resinous Board 4461/B00A/R0016/Electrical Backing Board/S36	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Door lining	Flat AC Sheeting 4461/B00A/R0017/Door lining/S4	4m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0017 - Distribution Board (0.83 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Electrical Backing Board	Resinous Board 4461/B00A/R0017/Electrical Backing Board/S38	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Door lining	Flat AC Sheeting 4461/B00A/R0017/Door lining/S4	4m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0018 - Communal Space (114.03 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Withdrawal Space - 1hb (33.85 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0019/Floor Coverings Res/Textile/S3					No Asbestos Detected
<b>B00A - R0020 - Toilets - Boys/Girls (3.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0021 - Practical Activities - 1hb (9.93 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2				No Asbestos Detected	
<b>B00A - R0022 - Home Base (89.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Thermacon Heater	Encapsulated Insulation material within unit	4Unit	East, west	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Unable to sample</i>
<b>B00A - R0023 - Home Base (89.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Heater Bank	Encapsulated Insulation material within unit 4461/B00A/R0023/Heater Bank/S40	2Unit	East, west	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos</i>
<b>B00A - R0024 - Practical Activities - 1hb (9.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2				No Asbestos Detected	
<b>B00A - R0025 - Toilets - Boys/Girls (3.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0026 - General Storeroom (3.84 m2)</b>						
No Asbestos						
<b>B00A - R0027 - Movement (6.55 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Home Base (54.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Heater Bank	Encapsulated Insulation material within unit 4461/B00A/R1001/Heater Bank/S41	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos</i>
<b>B00A - R1002 - Practical Activities - 1hb (19.84 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R1003 - Personal Effects Storage (9.52 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2				No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R1004 - Home Base (64.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Heater Bank	Encapsulated Insulation material within unit 4461/B00A/R1004/Heater Bank/S42	1Unit	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00A - R1005 - Home Base (65.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Heater Bank	Encapsulated Insulation material within unit 4461/B00A/R1005/Heater Bank/S43	1Unit	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00A - R1006 - Practical Activities - 1hb (9.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R1007 - Practical Activities - 1hb (9.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R1008 - Home Base (65.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Heater Bank	Encapsulated Insulation material within unit 4461/B00A/R1008/Heater Bank/S44	1Unit	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00A - R1009 - Movement (6.02 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00A/R1011/Ceiling Structures/Linings/S7	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1010 - Movement (56.27 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00A/R1011/Ceiling Structures/Linings/S7	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1011 - Movement (105.05 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00A/R1011/Ceiling Structures/Linings/S7	60m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1012 - Home Base (75.05 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2				No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Heater Bank	Encapsulated Insulation material within unit 4461/B00A/R1012/Heater Bank/S45	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)  Assumed Asbestos
<b>B00A - R1013 - Home Base (64.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit 4461/B00A/R1013/Thermacon Heater/S46	2Unit	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)  Assumed Asbestos
<b>B00A - R1014 - Practical Activities - 1hb (9.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1015 - Practical Activities - 1hb (9.66 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1016 - Home Base (63.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Heater Bank	Encapsulated Insulation material within unit 4461/B00A/R1016/Heater Bank/S47	2Unit	South, west	Friable Asbestos (5)	Low (1)	Low Priority (2-3)  Assumed Asbestos
<b>B00A - R1017 - Home Base (64.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Heater Bank	Encapsulated Insulation material within unit 4461/B00A/R1017/Heater Bank/S48	1Unit	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)  Assumed Asbestos
<b>B00A - R1018 - Personal Effects Storage (9.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00A/R0021/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 4461/B00A/R0021/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - Administration/Library - 1975 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00B/Eaves Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0001 - Movement (2.79 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00B/R0012/Ceiling Structures/Linings/S8				<b>Chrysotile (white asbestos)</b>	

**B00B - R0002 - Movement (15.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00B/R0018/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Security Store (23.56 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00B/R0018/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	

**B00B - R0004 - Community Clinic (16.98 m2)**

Heater Bank	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4461/B00B/R0004/Heater Bank/S49				<b>Assumed Asbestos</b>	

**B00B - R0005 - Cleaning Distributed Store (5.12 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00B/R0018/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	

**B00B - R0006 - Staff Toilet (12.43 m2)**

No Asbestos

**B00B - R0007 - Staff Toilet (12.49 m2)**

No Asbestos

**B00B - R0008 - Interview (16.98 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00B/R0018/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	
Heater Bank	Encapsulated Insulation material within unit	17Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00B/R0018/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	

**B00B - R0009 - Sick Bay (15.83 m2)**

No Asbestos

**B00B - R0010 - Duplicating Workroom (17.44 m2)**

No Asbestos

**B00B - R0011 - Main Switch Board (4.32 m2)**

Electrical Backing Board	Resinous Board	2m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4461/B00B/R0011/Electrical Backing Board/S50				<b>Chrysotile (white asbestos)</b>	

**B00B - R0012 - Movement (4.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00B/R0012/Ceiling Structures/Linings/S8				<b>Chrysotile (white asbestos)</b>	

**B00B - R0013 - Entry Vestibule (14.43 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Heater Bank	Encapsulated Insulation material within unit 4461/B00B/R0013/Heater Bank/S51	1Unit	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00B - R0014 - Clerical Office (15.95 m2)</b>						
No Asbestos						
<b>B00B - R0015 - Principal (17.05 m2)</b>						
No Asbestos						
<b>B00B - R0016 - Staff Toilet (1.93 m2)</b>						
No Asbestos						
<b>B00B - R0017 - General Storeroom (2.66 m2)</b>						
No Asbestos						
<b>B00B - R0018 - General Storeroom (2.7 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00B/R0018/Floor Coverings Res/Textile/S9	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R0019 - Staff Toilet (1.93 m2)</b>						
No Asbestos						
<b>B00B - R0020 - Staff Room Annexe (15.12 m2)</b>						
No Asbestos						
<b>B00B - R0021 - Staff Room Annexe (15.12 m2)</b>						
No Asbestos						
<b>B00B - R0022 - Reading Area (230.69 m2)</b>						
Heater Bank	Encapsulated Insulation material within unit 4461/B00B/R0022/Heater Bank/S52	3Unit	South, east, west	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00B - R0023 - Library Office/Workroom (19.8 m2)</b>						
No Asbestos						
<b>B00B - R0024 - Library Office/Workroom (10.22 m2)</b>						
Heater Bank	Encapsulated Insulation material within unit 4461/B00B/R0024/Heater Bank/S53	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00B - R0025 - Movement (6.21 m2)</b>						
No Asbestos						
<b>B00B - R0026 - Movement (2.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00B/R0012/Ceiling Structures/Linings/S8	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R0027 - Toilets - Girls (9.7 m2)</b>						
No Asbestos						
<b>B00B - R0028 - Toilets - Boys (9.7 m2)</b>						
No Asbestos						
<b>B00B - R0029 - K.L.A. Store (12.18 m2)</b>						
Heater Bank	Encapsulated Insulation material within unit 4461/B00B/R0029/Heater Bank/S54	1Unit	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00B - R0030 - K.L.A. Store (16.89 m2)</b>						
Heater Bank	Encapsulated Insulation material within unit 4461/B00B/R0030/Heater Bank/S55	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00B - R0033 - Staff Room (56.67 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00B/R0033/Floor Coverings Res/Textile/S56	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0034 - Movement (40.63 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4461/B00B/R0012/Ceiling Structures/Linings/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0035 - Staff Room Annexe (20.2 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4461/B00B/R0035/Floor Coverings Res/Textile/S57					<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0036 - Staff Kitchen (19.56 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4461/B00B/R0036/Floor Coverings Res/Textile/S58					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00C - General Learning/Pupil Facilities - 1975 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	270m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00C/Eaves Linings/S29			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Packing	NA	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4461/B00C/Ceiling Voids/S28			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00C/Gable Verge Lining/S30			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior**

**B00C - R0001 - Home Base (55.22 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4461/B00C/R0001/Ceiling Structures/Linings/S13			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4461/B00C/R0001/Thermacon Heater/S59			<b>Assumed Asbestos</b>		
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	4461/B00C/R0001/In-fill-panel/S14					

**B00C - R0002 - Practical Activities - 1hb (18.76 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4461/B00C/R0001/Ceiling Structures/Linings/S13			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00C - R0003 - Practical Activities - 1hb (18.76 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4461/B00C/R0001/Ceiling Structures/Linings/S13			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		

**B00C - R0004 - Home Base (55.22 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4461/B00C/R0001/Ceiling Structures/Linings/S13			<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4461/B00C/R0004/Thermacon Heater/S60			<b>Assumed Asbestos</b>		
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	4461/B00C/R0001/In-fill-panel/S14					

**B00C - R0005 - Canteen Office/Store (2.45 m2)**

No Asbestos

**B00C - R0006 - Cleaning Distributed Store (2.82 m2)**

No Asbestos

**B00C - R0007 - Staff Toilet (1.99 m2)**

No Asbestos

**B00C - R0008 - Canteen (47.13 m2)**

No Asbestos

**B00C - R0009 - General Storeroom (16.91 m2)**

No Asbestos

**B00C - R0010 - Other-Community Use (21.07 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet 4461/B00C/R0010/Partition Walls (Cubicles)/S11					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00C/R0010/Ceiling Structures/Linings/S12	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0011 - Hall Chair Store (5.54 m2)</b>						
In-fill-panel	Flat AC Sheeting 4461/B00C/R0011/In-fill-panel/S10					<b>No Asbestos Detected</b>
<b>B00C - R0012 - General Assistant/Bulk Store (6.52 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00C/R0010/Ceiling Structures/Linings/S12	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0013 - Distribution Board (0.37 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Electrical Backing Board	Resinous Board 4461/B00C/R0013/Electrical Backing Board/S61	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00C - R0014 - General Storeroom (18.49 m2)</b>						
No Asbestos						
<b>B00C - R0017 - Handwashing Facilities (8.4 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00C/R0010/Ceiling Structures/Linings/S12	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0018 - Toilets - Boys (10.75 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00C/R0010/Ceiling Structures/Linings/S12	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet 4461/B00C/R0018/Partition Walls (Cubicles)/S15	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0019 - Movement (79.78 m2)</b>						
No Asbestos						
<b>B00C - R0020 - General Assistant/Bulk Store (43.03 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1975 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	390m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00D/Eaves Linings/S32					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Packing	NA	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4461/B00D/Ceiling Voids/S31					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00D/Gable Verge Lining/S33					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior****B00D - R0001 - Home Base (55.23 m2)**

Ceiling Structures/Linings	Vermiculite					
	4461/B00D/R0010/Ceiling Structures/Linings/S19					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Heater Bank	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4461/B00D/R0001/Heater Bank/S62					<b>Assumed Asbestos</b>
In-fill-panel	Flat AC Sheeting					
	4461/B00D/R0009/In-fill-panel/S20					<b>No Asbestos Detected</b>

**B00D - R0002 - Practical Activities - 1hb (18.7 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00D/R0010/Floor Coverings Res/Textile/S18					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
	4461/B00D/R0010/Ceiling Structures/Linings/S19					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00D - R0003 - Practical Activities - 1hb (18.7 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00D/R0010/Floor Coverings Res/Textile/S18					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					
	4461/B00D/R0010/Ceiling Structures/Linings/S19					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00D - R0004 - Home Base (55.23 m2)**

Ceiling Structures/Linings	Vermiculite					
	4461/B00D/R0010/Ceiling Structures/Linings/S19					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Heater Bank	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	4461/B00D/R0004/Heater Bank/S63					<b>Assumed Asbestos</b>
In-fill-panel	Flat AC Sheeting					
	4461/B00D/R0009/In-fill-panel/S20					<b>No Asbestos Detected</b>

**B00D - R0005 - Toilets - Boys (15.23 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4461/B00D/R0011/Partition Walls (Cubicles)/S17					<b>Chrysotile (white asbestos)</b>

**B00D - R0006 - Handwashing Facilities (11.46 m2)**

No Asbestos

**B00D - R0007 - Practical Activities - 1hb (18.7 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4461/B00D/R0010/Floor Coverings Res/Textile/S18				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
4461/B00D/R0010/Ceiling Structures/Linings/S19				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0008 - Home Base (55.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
4461/B00D/R0010/Ceiling Structures/Linings/S19				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Heater Bank	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
4461/B00D/R0008/Heater Bank/S64				<b>Assumed Asbestos</b>		
In-fill-panel	Flat AC Sheeting					
4461/B00D/R0009/In-fill-panel/S20				<b>No Asbestos Detected</b>		
<b>B00D - R0009 - Home Base (55.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
4461/B00D/R0010/Ceiling Structures/Linings/S19				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Heater Bank	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	High Priority (6-8)
4461/B00D/R0009/Heater Bank/S65				<b>Assumed Asbestos</b>		
In-fill-panel	Flat AC Sheeting					
4461/B00D/R0009/In-fill-panel/S20				<b>No Asbestos Detected</b>		
<b>B00D - R0010 - Practical Activities - 1hb (18.7 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4461/B00D/R0010/Floor Coverings Res/Textile/S18				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
4461/B00D/R0010/Ceiling Structures/Linings/S19				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0011 - Toilets - Girls (25.4 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4461/B00D/R0011/Partition Walls (Cubicles)/S17				<b>Chrysotile (white asbestos)</b>		
<b>B00D - R0012 - Distribution Board (1.35 m2)</b>						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4461/B00D/R0012/Electrical Backing Board/S66				<b>Chrysotile (white asbestos)</b>		
Door lining	Flat AC Sheeting	2m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
4461/B00D/R0012/Door lining/S16				<b>Chrysotile (white asbestos)</b>		
<b>B00D - R0013 - Cleaning Distributed Store (3.77 m2)</b>						
No Asbestos						
<b>B00D - R0014 - Movement (6.55 m2)</b>						
No Asbestos						
<b>B00D - R1001 - Home Base (54.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
4461/B00D/R0010/Ceiling Structures/Linings/S19				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R1002 - Practical Activities - 1hb (19.68 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4461/B00D/R0010/Floor Coverings Res/Textile/S18				<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4461/B00D/R0010/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00D - R1003 - Home Base (54.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00D/R0010/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Heater Bank	Encapsulated Insulation material within unit 4461/B00D/R1003/Heater Bank/S67	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00D - R1004 - Practical Activities - 1hb (19.84 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00D/R0010/Floor Coverings Res/Textile/S18	16m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 4461/B00D/R0010/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00D - R1005 - Practical Activities - 1hb (18.89 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00D/R0010/Floor Coverings Res/Textile/S18	16m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 4461/B00D/R0010/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00D - R1006 - Home Base (54.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00D/R0010/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit 4461/B00D/R1006/Thermacon Heater/S68	2Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00D - R1007 - Home Base (54.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4461/B00D/R0010/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit 4461/B00D/R1007/Thermacon Heater/S69	2Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos</b>
<b>B00D - R1008 - Practical Activities - 1hb (18.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4461/B00D/R0010/Floor Coverings Res/Textile/S18	16m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 4461/B00D/R0010/Ceiling Structures/Linings/S19					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00D - R1009 - Movement (54.64 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00D/R1010/Ceiling Structures/Linings/S21	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting 4461/B00D/R1009/In-fill-panel/S22	2m	Above doors	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00D - R1010 - Movement (6.04 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4461/B00D/R1010/Ceiling Structures/Linings/S21	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

### B00H - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

#### Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

#### Interior

##### B00H - R0001 - Communal Space (144.8 m2)

No Asbestos

##### B00H - R0002 - Raised Platform (60.45 m2)

No Asbestos

##### B00H - R0003 - Hall Chair Store (9.57 m2)

No Asbestos

##### B00H - R0004 - Communal/Performance Store (9.49 m2)

No Asbestos

##### B00H - R0005 - P.E. Store (13.09 m2)

No Asbestos

##### B00H - R0006 - Toilet - Lobby (2.37 m2)

No Asbestos

##### B00H - R0007 - Toilets - Girls (7.31 m2)

No Asbestos

##### B00H - R0008 - Sound Cupboard (2.06 m2)

No Asbestos

##### B00H - R0009 - Toilet - Lobby (3.3 m2)

No Asbestos

##### B00H - R0010 - Toilets - Boys (5.71 m2)

No Asbestos

##### B00H - R0011 - Cleaning Distributed Store (3.51 m2)

No Asbestos

##### B00H - R0012 - General Storeroom (1.6 m2)

No Asbestos

##### B00H - R0013 - Main Switch Board (3.23 m2)

No Asbestos

##### B00H - R0014 - Access Shower/Toilet/Change (6.87 m2)

No Asbestos

##### B00H - R0015 - Covered Outdoor Learning Area (148.35 m2)

No Asbestos

##### B00H - R0016 - Movement (7.58 m2)

No Asbestos

##### B00H - R0017 - Movement (12.7 m2)

No Asbestos

##### B00H - R0018 - Ramp (11.19 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017