


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Glenroy Public School (4468)
Region : Riverina
State Electorate : Albury
Local Government Area : Albury

Initial Survey : Noel Arnold & Associates : 15 - May - 2008
Reviewed By : AECOM : 29 - Oct - 2014

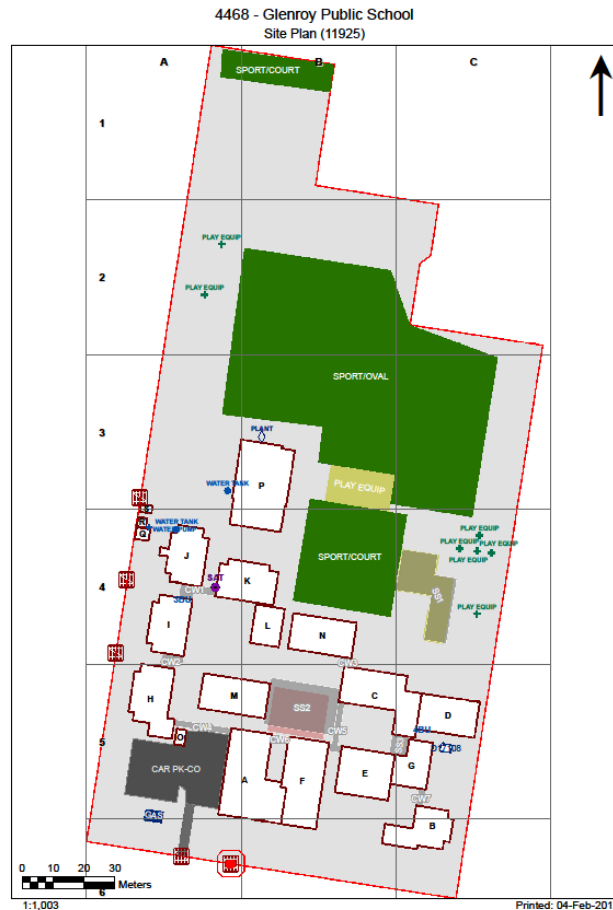

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1975 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	3m2	Eaves to clear storey window	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00A/Eaves Linings/S11					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground						
Ceiling Voids	Non Accessible Area - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.					

Interior**B00A - R0001 - Movement (140.18 m2)**

Ceiling Structures/Linings	Vermiculite					
	4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Interview (13.09 m2)

Ceiling Structures/Linings	Vermiculite					
	4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0004 - Staff Toilet (5.33 m2)

Ceiling Structures/Linings		6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0005 - Staff Toilet (5.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0006 - Cleaning Supplies (8.34 m2)

Ceiling Structures/Linings	Vermiculite					
	4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings
Res/Textile

	4468/B00C/R0004/Floor Coverings Res/Textile/S7					No Asbestos Detected
--	--	--	--	--	--	-----------------------------

B00A - R0007 - Distribution Board (0.24 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0008 - Entry Vestibule (36.45 m2)

Ceiling Structures/Linings	Vermiculite					
	4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0009 - Principal (12.19 m2)

Ceiling Structures/Linings	Vermiculite					
	4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings
Res/Textile

	4468/B00C/R0004/Floor Coverings Res/Textile/S7					No Asbestos Detected
--	--	--	--	--	--	-----------------------------

B00A - R0010 - Interview (15.81 m2)

Ceiling Structures/Linings	Vermiculite					
	4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0011 - Security Store (26.91 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0012 - Clerical Office (13.77 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		4468/B00E/R0003/Ceiling Structures/Linings/S5				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0013 - Clerical Office (22.14 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		4468/B00E/R0003/Ceiling Structures/Linings/S5				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0014 - Deputy Principal (13.31 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		4468/B00E/R0003/Ceiling Structures/Linings/S5				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - Sick Bay (8.97 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		4468/B00E/R0003/Ceiling Structures/Linings/S5				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile						No Asbestos Detected
		4468/B00C/R0004/Floor Coverings Res/Textile/S7				
B00A - R0016 - Duplicating Workroom (13.02 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		4468/B00E/R0003/Ceiling Structures/Linings/S5				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile						No Asbestos Detected
		4468/B00C/R0004/Floor Coverings Res/Textile/S7				
B00A - R0017 - Staff Room Annexe (12.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		4468/B00E/R0003/Ceiling Structures/Linings/S5				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile						No Asbestos Detected
		4468/B00C/R0004/Floor Coverings Res/Textile/S7				
B00A - R0018 - Movement (15.07 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		4468/B00E/R0003/Ceiling Structures/Linings/S5				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Movement (6.08 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		4468/B00E/R0003/Ceiling Structures/Linings/S5				
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0020 - Staff Kitchen (17.96 m2)						
No Asbestos						
B00A - R0021 - Staff Room (34.54 m2)						
Timber window frames	Window putty					No Asbestos Detected
		4468/B00A/R0021/Timber window frames/S10				

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00B/Eaves Linings/S12				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.					
Underfloor Voids - Slab on Ground						

Interior

B00B - R0001 - Toilets - Boys/Girls (2.65 m2)

No Asbestos

B00B - R0002 - Home Base (90.63 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4				No Asbestos Detected	

B00B - R0003 - General Storeroom (12.72 m2)

No Asbestos

B00B - R0004 - Distribution Board (0.27 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00B - R0005 - General Storeroom (12.48 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4				No Asbestos Detected	

B00B - R0006 - General Assistant/Bulk Store (12.52 m2)

No Asbestos

B00B - R0007 - Movement (38.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00B - R0008 - Movement (13.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids Non Accessible Area
- Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.

Underfloor Voids - Slab on Ground

Interior

B00C - R0001 - General Storeroom (1.11 m2)

Wall Linings Internal Flat AC Sheeting 5m2 All surfaces Some Damage / Unsealed (3) Low (1) Low Priority (2-3)
4468/B00C/R0008/Wall Linings Internal/S8 **Chrysotile (white asbestos)**

B00C - R0002 - Home Base (69.07 m2)

Floor Coverings Res/Textile Vinyl Tiles
4468/B00C/R0004/Floor Coverings Res/Textile/S7 **No Asbestos Detected**

Ceiling Structures/Linings Vermiculite
4468/B00E/R0003/Ceiling Structures/Linings/S5 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0003 - Staff Room Annexe (16.18 m2)

Ceiling Structures/Linings Vermiculite
4468/B00E/R0003/Ceiling Structures/Linings/S5 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0004 - Sports Store (14.42 m2)

Floor Coverings Res/Textile Vinyl Tiles
4468/B00C/R0004/Floor Coverings Res/Textile/S7 **No Asbestos Detected**

Ceiling Structures/Linings Flat AC Sheeting 15m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00C - R0005 - Sports Store (13.66 m2)

Ceiling Structures/Linings Flat AC Sheeting 13.67m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00C - R0006 - Movement (10.29 m2)

Ceiling Structures/Linings Flat AC Sheeting 11m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00C - R0007 - Home Base (68.99 m2)

Floor Coverings Res/Textile Vinyl Tiles
4468/B00C/R0004/Floor Coverings Res/Textile/S7 **No Asbestos Detected**

Ceiling Structures/Linings Vermiculite
4468/B00E/R0003/Ceiling Structures/Linings/S5 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0008 - General Storeroom (1.09 m2)

Wall Linings Internal Flat AC Sheeting 6m2 All surfaces Some Damage / Unsealed (3) Low (1) Low Priority (2-3)
4468/B00C/R0008/Wall Linings Internal/S8 **Chrysotile (white asbestos)**

B00C - R0010 - Movement (67.16 m2)

Wall Linings Internal Flat AC Sheeting 2m2 Electrical Cupboard East of Room 8 Some Damage / Unsealed (3) Low (1) Low Priority (2-3)
4468/B00C/R0008/Wall Linings Internal/S8 **Chrysotile (white asbestos)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00C - R0011 - Movement (37.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids Non Accessible Area
 - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.

Underfloor Voids - Slab on Ground

Interior

B00D - R0001 - Movement (48.17 m2)

Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00D - R0002 - General Storeroom (1.13 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
4468/B00C/R0008/Wall Linings Internal/S8					Chrysotile (white asbestos)	

B00D - R0003 - Home Base (69.56 m2)

Ceiling Structures/Linings	Vermiculite					
4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0004 - Movement (5.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00D - R0005 - Home Base (69.46 m2)

Ceiling Structures/Linings	Vermiculite					
4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00D - R0006 - General Storeroom (1.11 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
4468/B00C/R0008/Wall Linings Internal/S8					Chrysotile (white asbestos)	

B00D - R0007 - Movement (5.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids Non Accessible Area
 - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.

Underfloor Voids - Slab on Ground

Interior

B00E - R0001 - Movement (43.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting	44m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

B00E - R0002 - Toilets - Boys/Girls (2.89 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
4468/B00E/R0003/Ceiling Structures/Linings/S5							
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00E - R0003 - Home Base (88.29 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
4468/B00E/R0003/Ceiling Structures/Linings/S5							
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00E - R0004 - Movement (4.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

In-fill-panel	Flat AC Sheeting	5m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00G/R0004/Infill above Windows/S3						

B00E - R0005 - Home Base (88.31 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
4468/B00E/R0003/Ceiling Structures/Linings/S5							
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00E - R0006 - Toilets - Boys/Girls (2.84 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
4468/B00E/R0003/Ceiling Structures/Linings/S5							
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00E - R0007 - Movement (4.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids Non Accessible Area
- Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.

Underfloor Voids - Slab on Ground

Interior

B00F - R0001 - Movement (49.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00F - R0002 - Library Office/Workroom (18.08 m2)

No Asbestos

B00F - R0003 - Reading Area (170.33 m2)

No Asbestos

B00F - R0004 - Seminar/Study (9.02 m2)

No Asbestos

B00F - R0005 - Seminar/Study (8.7 m2)

No Asbestos

B00F - R0006 - Toilets - Girls (3 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0003/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

B00F - R0007 - General Storeroom (0.99 m2)

No Asbestos

B00F - R0008 - Distribution Board (1.07 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00F - R0009 - Movement (9.17 m2)

No Asbestos

B00F - R0010 - Staff Toilet (2.82 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0003/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

B00F - R0011 - No Access (2.34 m2)

No Asbestos

B00F - R0012 - Communications Room (12.87 m2)

No Asbestos

B00F - R0013 - Library Office/Workroom (7.39 m2)

No Asbestos

B00F - R0014 - Movement (25.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids Non Accessible Area
- Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.

Underfloor Voids - Slab on Ground

Interior

B00G - R0001 - Toilets - Boys (32.48 m2)

Partition Walls (Cubicles) Compressed AC Sheet 10m2 East facing Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0003/Partition Walls (Cubicles)/S1 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Flat AC Sheeting 33m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00G - R0002 - Toilets - Girls (35.24 m2)

Partition Walls (Cubicles) Compressed AC Sheet 10m2 East facing Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0003/Partition Walls (Cubicles)/S1 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Flat AC Sheeting 36m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00G - R0003 - Shower/Change (3.31 m2)

Ceiling Structures/Linings Flat AC Sheeting 4m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

B00G - R0004 - Movement (50.94 m2)

Ceiling Structures/Linings Flat AC Sheeting 51m2 West facing Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

In-fill-panel Flat AC Sheeting 5m2 West facing, Upper portion Good Condition (1) Low (1) Low Priority (2-3)
4468/B00G/R0004/Infill above Windows/S3 **Chrysotile (white asbestos)**

B00G - R0005 - Movement (20.77 m2)

Ceiling Structures/Linings Flat AC Sheeting 21m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2 **Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	3m2	Eaves to clear storey window	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00K/Eaves Linings/S13					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.					
Underfloor Voids - Slab on Ground						

Interior**B00H - R0001 - Home Base (69.51 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00H - R0002 - Movement (47.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00H - R0003 - Cleaning Supplies (0.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	0.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	1m2	South wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00H - R0004 - Distribution Board (0.3 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00H - R0005 - Home Base (69.48 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00H - R0006 - General Storeroom (12.95 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00H - R0007 - General Storeroom (12.69 m2)

No Asbestos

B00H - R0008 - Movement (23.51 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	3m2	Eaves to clear storey window	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00K/Eaves Linings/S13					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.					
Underfloor Voids - Slab on Ground						

Interior

B00I - R0001 - Home Base (69.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00I - R0002 - Movement (37.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00I - R0003 - General Storeroom (0.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	0.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	1m2	South wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00I - R0004 - Distribution Board (0.31 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00I - R0005 - Home Base (69.38 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00I - R0006 - Movement (23.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00J - General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	3m2	Eaves to clear storey window	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00K/Eaves Linings/S13				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.					
Underfloor Voids - Slab on Ground						

Interior**B00J - R0001 - Home Base (69.12 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4				No Asbestos Detected	

B00J - R0002 - External Movement (31.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00J - R0003 - General Storeroom (0.29 m2)

Ceiling Structures/Linings	Flat AC Sheeting	0.29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	1m2	South wall	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00J - R0004 - Distribution Board (0.29 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00J - R0005 - Home Base (69.29 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4				No Asbestos Detected	

B00J - R0007 - Main Switch Board (2.79 m2)

Electrical Backing Board	Non Accessible Area - Live electrical board				
--------------------------	--	--	--	--	--

B00J - R0008 - External Movement (26.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1978 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	3m2	Eaves to clear storey window	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00K/Eaves Linings/S13					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground						
Ceiling Voids	Non Accessible Area - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.					

Interior

B00K - R0001 - Home Base (69.51 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00K - R0002 - Movement (36.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00K - R0003 - General Storeroom (0.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting	0.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	1m2	West wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00K - R0004 - Distribution Board (0.31 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00K - R0005 - Home Base (69.82 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4468/B00B/R0002/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00K - R0006 - Movement (23.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1978 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids Non Accessible Area
 - Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.

Underfloor Voids - Slab on Ground

Interior

B00L - R0001 - Toilets - Boys (35.82 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	11m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0003/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

B00L - R0002 - No Access (1.48 m2)

No Asbestos

B00L - R0003 - Toilets - Girls (34.46 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	13m2	East facing, West facing, All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0003/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

Incinerette	Encapsulated Insulation material within unit	1Unit	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Item previously identified in archived						

B00L - R0006 - Movement (26.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting	27m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00L - R0007 - Cleaning Distributed Store (2.91 m2)

No Asbestos

B00L - R0008 - Cleaning Supplies (2.73 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Communal Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids Non Accessible Area
- Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.

Underfloor Voids - Slab on Ground

Interior

B00M - R0001 - Movement (40.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

B00M - R0003 - General Storeroom (3.83 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

B00M - R0004 - No Access (2.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

B00M - R0005 - Staff Toilet (1.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

Infill above door	Flat AC Sheeting	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00G/R0004/Infill above Windows/S3						

B00M - R0006 - Movement (3.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

B00M - R0007 - Canteen (24.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

B00M - R0008 - Movement (3.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

B00M - R0010 - Distribution Board (4.81 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00L/R0006/Ceiling Structures/Linings/S2						

Electrical Mounting Board	Resinous Board	1Unit	West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00M/R0010/Electrical Mounting Board/S14						

B00M - R0011 - Raised Platform (22.2 m2)

No Asbestos

B00M - R0013 - Garden Store (8.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
4468/B00M/R0013/Ceiling Structures/Linings/S9						

B00M - R0014 - Special Programs Room (48.88 m2)

Recently Modified Space Requires Inspection

B00M - R0015 - Communal Space (58.38 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids Non Accessible Area
- Area inaccessible - Fixed raked (low angle) ceilings. No access point identified.

Underfloor Voids - Slab on Ground

Interior

B00N - R0001 - General Storeroom (1.13 m2)

Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
4468/B00C/R0008/Wall Linings Internal/S8					Chrysotile (white asbestos)	

B00N - R0002 - Home Base (69.51 m2)

Ceiling Structures/Linings	Vermiculite					
4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00N - R0003 - Movement (5.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00N - R0004 - Home Base (69.63 m2)

Ceiling Structures/Linings	Vermiculite					
4468/B00E/R0003/Ceiling Structures/Linings/S5					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00N - R0005 - General Storeroom (1.71 m2)

Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
4468/B00C/R0008/Wall Linings Internal/S8					Chrysotile (white asbestos)	

B00N - R0006 - Movement (66.03 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Electrical Cupboard east of Room 5	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
4468/B00C/R0008/Wall Linings Internal/S8					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	67m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00N - R0007 - Movement (5.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4468/B00L/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B000 - Building Services - 1975 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground

Ceiling Voids No Asbestos Found

Interior

B000 - R0001 - Garden Store (13.8 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00P - Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00P - R0001 - Hall Chair Store (9.52 m2)

No Asbestos

B00P - R0002 - Communal/Performance Store (9.52 m2)

No Asbestos

B00P - R0003 - P.E. Store (12.92 m2)

No Asbestos

B00P - R0004 - Toilet - Lobby (2.44 m2)

No Asbestos

B00P - R0005 - Toilets - Girls (7.97 m2)

No Asbestos

B00P - R0006 - Sound Cupboard (2.06 m2)

No Asbestos

B00P - R0007 - Toilet - Lobby (2.2 m2)

No Asbestos

B00P - R0008 - Toilets - Boys (7.77 m2)

No Asbestos

B00P - R0009 - Cleaning Distributed Store (3.83 m2)

No Asbestos

B00P - R0010 - Access Shower/Toilet (6.93 m2)

No Asbestos

B00P - R0011 - Main Switch Board (3.49 m2)

No Asbestos

B00P - R0012 - Covered Outdoor Learning Area (140.53 m2)

No Asbestos

B00P - R0013 - Communal Space (147.49 m2)

No Asbestos

B00P - R0014 - Movement (6.02 m2)

No Asbestos

B00P - R0015 - Raised Platform (59.9 m2)

No Asbestos

B00P - R0016 - Ramp (10.84 m2)

No Asbestos

B00P - R0017 - Movement (10.77 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Building Services - 2015 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00Q - R0001 - Garden Store (16.42 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - - Metal Shed (Metal Shed)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00R - R0001 - Practical Activities (8.76 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - General Learning - - Greenhouse (Greenhouse)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00S - R0001 - Practical Activities (9.38 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 837 - D17108 - Hcap Shower/Change/Toilet : Placement Date - 20/01/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		2.88 m2

Interior

R1 - Disabled Shower/Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		12 m2
End wall panel	Flat AC Sheet	Assumed Asbestos		36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017