


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Grose View Public School (4483)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

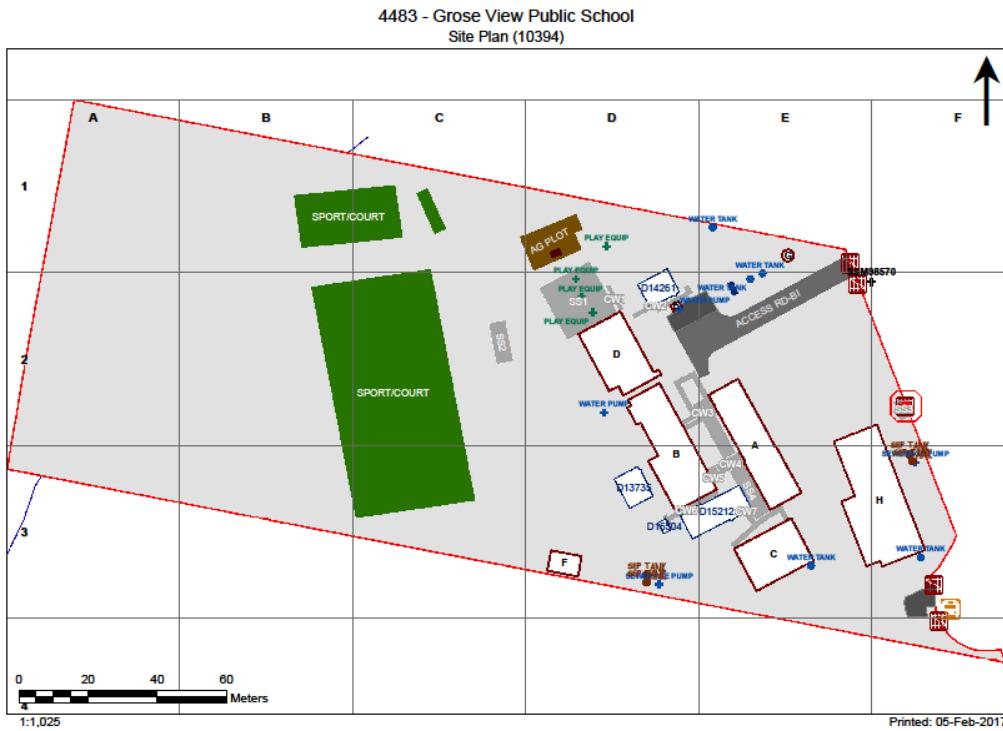

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Pupil Facilities - 1971 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	24m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00A/Eaves Linings/S3					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00A - R0001 - External Movement (154.1 m2)

No Asbestos

B00A - R0002 - Main Switch Board (1.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00A/Eaves Linings/S3					Chrysotile (white asbestos)

B00A - R0003 - General Storeroom (11.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00A/Eaves Linings/S3					Chrysotile (white asbestos)

B00A - R0004 - Toilets - Girls (13 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00A/Eaves Linings/S3					Chrysotile (white asbestos)

B00A - R0005 - Toilets - Boys (12.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00A/Eaves Linings/S3					Chrysotile (white asbestos)

B00A - R0006 - External Movement (113.29 m2)

Ceiling Structures/Linings	Flat AC Sheeting	114m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00A/Eaves Linings/S3					Chrysotile (white asbestos)

B00A - R0007 - Canteen (16.62 m2)

No Asbestos

B00A - R0008 - Canteen Office/Store (1.73 m2)

No Asbestos

B00A - R0009 - Staff Toilet (4.32 m2)


No Asbestos

B00A - R0010 - Movement (2.42 m2)

No Asbestos

B00A - R0011 - Sports Store (12.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00A/Eaves Linings/S3					Chrysotile (white asbestos)

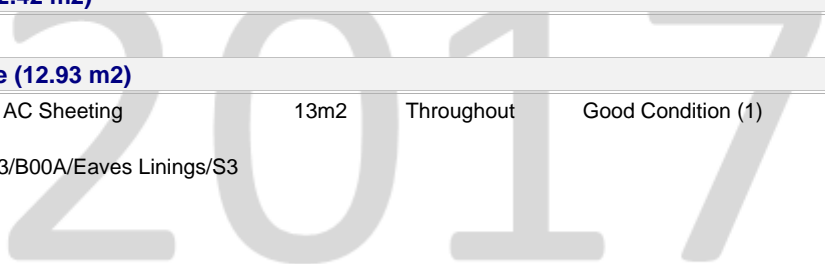

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Administration - 1977 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	17m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00A/Eaves Linings/S3				Chrysotile (white asbestos)	
Window Frames	Putty	500m	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)
	4483/B00B/Window Frames/S6				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

Interior

B00B - R0001 - General Assistant/Bulk Store (12.72 m2)

No Asbestos

B00B - R0002 - Distribution Board (0.3 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0003 - Cleaning Distributed Store (7.05 m2)

No Asbestos

B00B - R0004 - Home Base Store (3.82 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4483/B00B/R0006/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0005 - Toilets - Boys/Girls (2.04 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4483/B00B/R0006/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0006 - Practical Activities - 1hb (26.18 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4483/B00B/R0006/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0007 - Home Base (65.79 m2)

No Asbestos

B00B - R0008 - Movement (13.39 m2)

No Asbestos

B00B - R0009 - Movement (11.3 m2)

No Asbestos

B00B - R0010 - Home Base (51.2 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4483/B00B/R0006/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0011 - Practical Activities - 1hb (18.33 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4483/B00B/R0006/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0012 - Toilets - Girls (14.04 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4483/B00B/R0006/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0013 - Toilets - Boys (14.12 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4483/B00B/R0006/Ceiling Structures/Linings/S2					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0014 - Home Base (51.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	4483/B00B/R0006/Ceiling Structures/Linings/S2					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0015 - Practical Activities - 1hb (17.53 m2)						
Ceiling Structures/Linings	Vermiculite					
	4483/B00B/R0006/Ceiling Structures/Linings/S2					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0016 - Movement (64.2 m2)						
No Asbestos						
B00B - R0017 - Movement (6.49 m2)						
No Asbestos						
B00B - R1001 - Movement (64.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00B/R1001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00B - R1002 - Distribution Board (0.32 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4483/B00B/R1001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00B - R1003 - General Storeroom (28.58 m2)						
No Asbestos						
B00B - R1004 - Staff Room (45.85 m2)						
No Asbestos						
B00B - R1005 - Staff Toilet (5.55 m2)						
No Asbestos						
B00B - R1006 - Staff Toilet (5.4 m2)						
No Asbestos						
B00B - R1007 - Staff Room Annexe (13.63 m2)						
No Asbestos						
B00B - R1009 - Movement (29.29 m2)						
No Asbestos						
B00B - R1010 - Principal (15.97 m2)						
No Asbestos						
B00B - R1011 - Home Base (51.37 m2)						
No Asbestos						
B00B - R1012 - Staff Room Annexe (11.77 m2)						
No Asbestos						
B00B - R1013 - Entry Vestibule (12.81 m2)						
No Asbestos						
B00B - R1014 - Clerical Office (12.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00B/R1008/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B00B - R1015 - Duplicating Workroom (13.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00B/R1008/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)
B00B - R1016 - Sick Bay (11.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4483/B00B/R1008/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1017 - Staff Room (16.21 m2)						
No Asbestos						
B00B - R1018 - Practical Activities - 1hb (18.29 m2)						
No Asbestos						
B00B - R1019 - Clerical Office (6.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4483/B00B/R1020/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00B - R1020 - Sick Bay (6.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4483/B00B/R1020/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1976 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole in building
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Movement (33.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4483/B00C/R0001/Ceiling Structures/Linings/S4	No Asbestos Detected
----------------------------	---	-----------------------------

B00C - R0002 - Practical Activities - 1hb (16.52 m2)

No Asbestos

B00C - R0003 - Home Base (59.28 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0004 - Home Base Store (5.78 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0005 - Movement (13.93 m2)

No Asbestos

B00C - R0006 - Withdrawal Space - 1hb (11.87 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0007 - Movement (13.93 m2)

No Asbestos

B00C - R0008 - Home Base Store (5.8 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0009 - Home Base (59.7 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00C - R0010 - Practical Activities - 1hb (17.61 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1997 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Practical Activities - 1hb (17.01 m2)

No Asbestos

B00D - R0002 - Home Base (59.9 m2)

No Asbestos

B00D - R0003 - Home Base Store (5.85 m2)

No Asbestos

B00D - R0004 - Movement (14.2 m2)

No Asbestos

B00D - R0005 - Special Programs Room (11.77 m2)

No Asbestos

B00D - R0006 - Practical Activities - 1hb (17.03 m2)

No Asbestos

B00D - R0007 - Home Base (59.77 m2)

No Asbestos

B00D - R0008 - Home Base Store (5.83 m2)

No Asbestos

B00D - R0009 - Movement (14.2 m2)

No Asbestos

B00D - R0010 - Movement (36.41 m2)

No Asbestos

B00D - R0011 - Ramp (35.65 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Mechanical Services - 2008 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Plant (4.08 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - General Storeroom (54.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2008 - Concrete (Concrete)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - Hall Chair Store (7.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Communal Space (199.1 m2)

No Asbestos

B00H - R0002 - Raised Platform (58.82 m2)

No Asbestos

B00H - R0003 - Hall Chair Store (12.65 m2)

No Asbestos

B00H - R0004 - Communal/Performance Store (10.37 m2)

No Asbestos

B00H - R0005 - P.E. Store (16.33 m2)

No Asbestos

B00H - R0006 - Toilet - Lobby (2.37 m2)

No Asbestos

B00H - R0007 - Toilets - Girls (7.32 m2)

No Asbestos

B00H - R0008 - Sound Cupboard (2.06 m2)

No Asbestos

B00H - R0009 - Toilet - Lobby (3.31 m2)

No Asbestos

B00H - R0010 - Toilets - Boys (5.71 m2)

No Asbestos

B00H - R0011 - Cleaning Distributed Store (3.51 m2)

No Asbestos

B00H - R0012 - Plant (1.6 m2)

No Asbestos

B00H - R0013 - Main Switch Board (3.23 m2)

No Asbestos

B00H - R0014 - Access Shower/Toilet/Change (6.87 m2)

No Asbestos

B00H - R0015 - Covered Outdoor Learning Area (201.81 m2)

No Asbestos

B00H - R0016 - Movement (7.69 m2)

No Asbestos

B00H - R0017 - Movement (15.01 m2)

No Asbestos

B00H - R0018 - Movement (11.24 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 603 - D13735 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 24/12/2005

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D14261 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 534 - D15212 - Library/Group Study/Office/A V Store : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Clerical Office						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - Staff Room						
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
R3 - Security Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R4 - Principal						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
R5 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
R6 - Staff Toilet						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
R7 - Reading Area						
Ceiling	Flat AC Sheet	Assumed Asbestos				54 m2
R8 - Entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				14 m2
OS 837 - D16504 - Hcap Shower/Change/Toilet : Placement Date - 10/07/2013						
Exterior						
No Asbestos Found.						
Interior						
R1 - Disabled Shower/Toilet						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017