


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Glen Innes West Infants School (5116)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Glen Innes Severn

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : Grencap-NAA : 01 - Apr - 2015

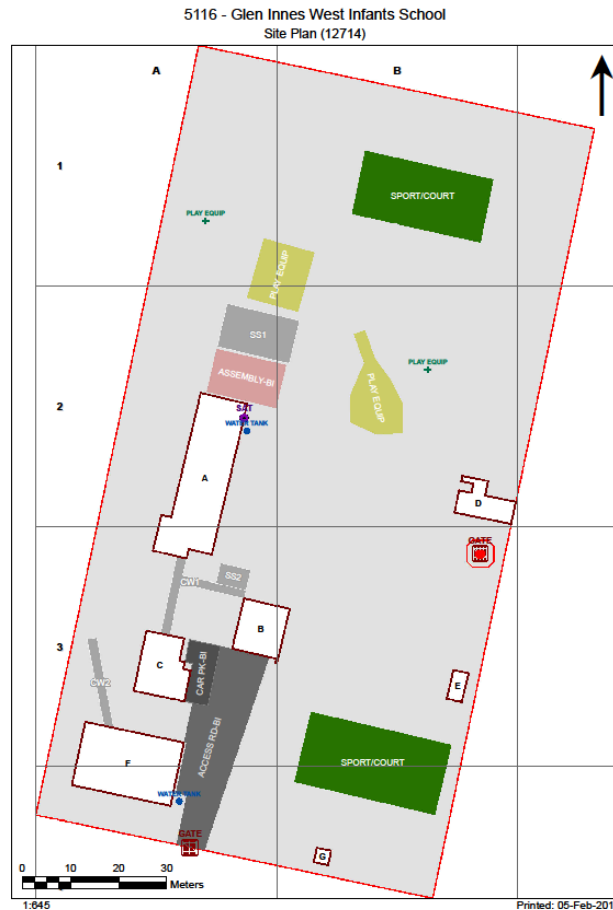

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1926 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Extreme Access Issue - No Access Point into ceiling void identified					
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - No Access Point into ceiling void identified					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - Staff Room**

Ceiling Structures/Linings	Flat AC Sheeting 5116/B00A/R0008/Ceiling Structures/Linings/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 5116/B00A/R0008/Wall Linings Internal/S5	40m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 5116/B00A/R0010/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00A - R0003 - Home Base

Panel Behind Heater	Flat AC Sheeting 5116/B00A/R0003/Panel Behind Heater/S8	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------------	--	-----	-------	--------------------	---------	--

B00A - R0004 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 5116/B00A/R0010/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 5116/B00A/R0010/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 5116/B00A/R0008/Ceiling Structures/Linings/S6					No Asbestos Detected

B00A - R0007 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 5116/B00A/R0008/Ceiling Structures/Linings/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 5116/B00A/R0008/Wall Linings Internal/S5	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0008 - Principal

Wall Linings Internal	Flat AC Sheeting 5116/B00A/R0008/Wall Linings Internal/S5	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	------	------------	--------------------	---------	--

B00A - R0009 - Clerical Office

Ceiling Structures/Linings	Flat AC Sheeting 5116/B00A/R0008/Ceiling Structures/Linings/S6					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 5116/B00A/R0008/Wall Linings Internal/S5	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0010 - Movement

Wall Linings Internal	Flat AC Sheeting 5116/B00A/R0008/Wall Linings Internal/S5	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	-------	------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	5116/B00A/R0010/Floor Coverings Res/Textile/S7				No Asbestos Detected	
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00A/R0010/Electrical Backing Board/S9				Chrysotile (white asbestos)	

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - Pupil Facilities/Building Services - 1971 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Gable Verge Lining/S14					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Interior						
B00B - R0001 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
B00B - R0003 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
B00B - R0004 - General Assistant/Bulk Store						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
B00B - R0005 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
B00B - R0006 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/R0006/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)
B00B - R0007 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
B00B - R0008 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/R0006/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)
B00B - R0009 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)
B00B - R0010 - Garden Store						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00B/Eaves Linings/S13					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1981 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00C/Gable Verge Lining/S3					Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	5116/B00C/Wall Cladding/S4					
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00C/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R0002 - Reading Area

Floor Coverings Res/Textile	Sheet Vinyl under carpet					No Asbestos Detected
	5116/B00C/R0002/Floor Coverings Res/Textile/S12					
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard**B00C - R0003 - K.L.A. Store**

No Asbestos

B00C - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00C/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R0005 - K.L.A. Store

No Asbestos

B00C - R0006 - Movement

No Asbestos

B00C - R0007 - Library Office/Workroom

No Asbestos

B00C - R0008 - Movement

No Asbestos

B00C - R0009 - Staff Toilet

No Asbestos

B00C - R0011 - Garden Store

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00C/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5116/B00C/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities - 1925 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - Sports Store

No Asbestos

B00D - R0002 - Movement

No Asbestos

B00D - R0003 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other - 2008 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00E - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Administration/Library - 2011 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00F - R0001 - External Movement**

No Asbestos

B00F - R0002 - Library Office/Workroom

No Asbestos

B00F - R0003 - K.L.A. Store

No Asbestos

B00F - R0004 - Main Switch Board

No Asbestos

B00F - R0005 - Communications Room

No Asbestos

B00F - R0006 - Reading Area

No Asbestos

B00F - R0007 - Principal

No Asbestos

B00F - R0008 - Cleaning Distributed Store

No Asbestos

B00F - R0009 - Staff Room

No Asbestos

B00F - R0010 - Access Shower/Toilet/Change

No Asbestos

B00F - R0011 - Entry Vestibule

No Asbestos

B00F - R0012 - Security Store

No Asbestos

B00F - R0013 - Sick Bay

No Asbestos

B00F - R0014 - Staff Toilet

No Asbestos

B00F - R0015 - Clerical Office

No Asbestos

B00F - R0016 - Staff Kitchen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00G - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+3 - Wooden play Hut East of Building A

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

Build+3 - Room+1 - play Room

Wall Linings Internal	Flat AC Sheeting 5116/Build+3/Room+1/Wall Linings Internal/S11	No Asbestos Detected
-----------------------	---	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+4 - Creative Arts

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

Build+4 - Room+1 - Added Room

No Asbestos

Build+4 - Room+2 - Added Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017