


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Glenfield Park School (5401)
Region : South Western Sydney
State Electorate : Macquarie Fields
Local Government Area : Campbelltown

Initial Survey : Noel Arnold & Associates : 01 - May - 2008
Reviewed By : Parsons Brinckerhoff : 08 - Jul - 2015

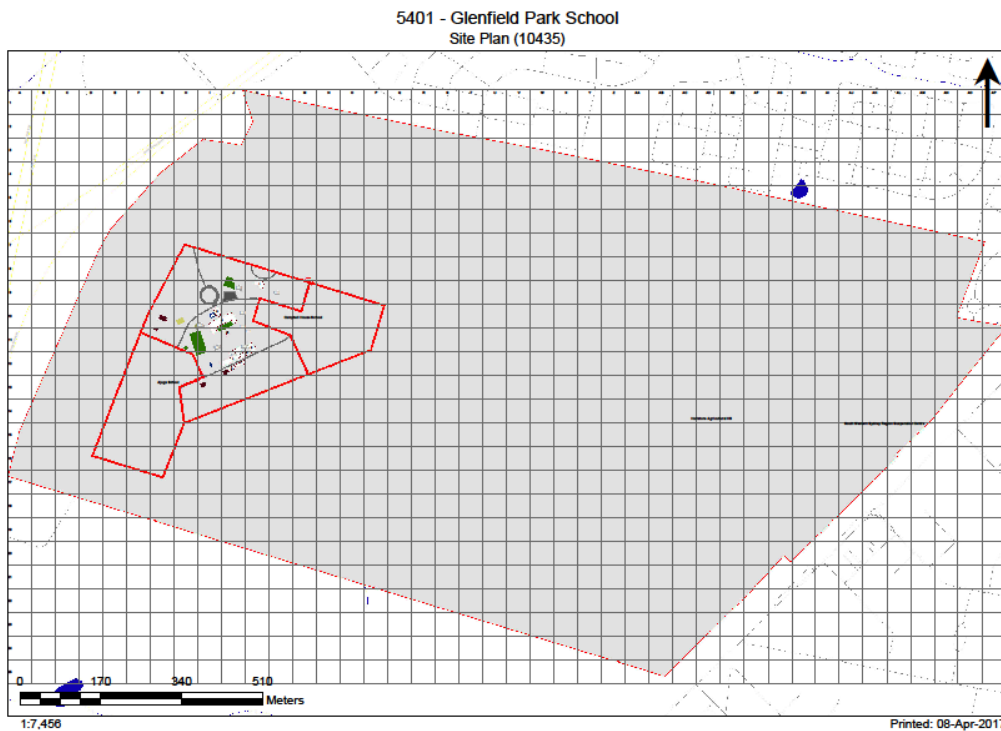

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - General Learning - 1927 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00E/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Flue Pipe	Fibre Cement Pipe	2m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00E/Room+2/Flue Pipe/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	5401/B00E/Underfloor Voids - Packing to Floor Joists/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior**B00E - R0001 - Shower/Change (2.67 m2)**

No Asbestos

B00E - R0002 - Toilets - Girls (1.48 m2)

No Asbestos

B00E - R0003 - Staff Toilet (3.12 m2)

No Asbestos

B00E - R0004 - General Storeroom (0.44 m2)

No Asbestos

B00E - R0005 - Staff Room Annexe (9.18 m2)

No Asbestos

B00E - R0006 - Personal Effects Storage (4.32 m2)

No Asbestos

B00E - R0007 - Distribution Board (0.21 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	5401/B00E/R0007/Ceiling Structures/Linings/S21			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0008 - Laundry (7.05 m2)

No Asbestos

B00E - R0009 - Movement (1.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00E/R0009/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0010 - General Storeroom (0.36 m2)

No Asbestos

B00E - R0011 - Cleaning Distributed Store (0.36 m2)

No Asbestos

B00E - R0012 - Staff Toilet (3.89 m2)

No Asbestos

B00E - R0013 - Staff Room Annexe (11.09 m2)

No Asbestos

B00E - R0014 - Movement (3.33 m2)

No Asbestos

B00E - R0015 - Withdrawal Space - 1hb (10.08 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0016 - General Storeroom (0.5 m2)						
No Asbestos						
B00E - R0017 - Shower/Change (3.74 m2)						
No Asbestos						
B00E - R0018 - Toilets - Boys (1.31 m2)						
No Asbestos						
B00E - R0019 - Res. Locker Area (3.13 m2)						
No Asbestos						
B00E - R0020 - General Learning Space (25.87 m2)						
No Asbestos						
B00E - R0021 - Pupil Entry (15.96 m2)						
No Asbestos						
B00E - R0022 - Staff Kitchen (7.46 m2)						
No Asbestos						
B00E - R0023 - Pantry (3.79 m2)						
No Asbestos						
B00E - R0024 - General Learning Space (25.87 m2)						
No Asbestos						
B00E - R0025 - Movement (18.66 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1927 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Staff Shower/Change (1.08 m2)

No Asbestos

B00F - R0002 - Staff Toilet (6.65 m2)

No Asbestos

B00F - R0003 - General Assistant/Bulk Store (27.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B00F/R0003/Ceiling Structures/Linings/S22				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0004 - General Assistant/Bulk Store (35.87 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B00F/R0003/Ceiling Structures/Linings/S22				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0005 - General Storeroom (4.99 m2)

No Asbestos

B00F - R0006 - Cleaning Supplies (20.8 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Technological & Applied Studies - 1927 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior

B00G - R0001 - Art Learning Space (29.81 m2)

No Asbestos

B00G - R0002 - Staff Room Annexe (9.3 m2)

No Asbestos

B00G - R0003 - Movement (3.9 m2)

No Asbestos

B00G - R0004 - Movement (7.69 m2)

No Asbestos

B00G - R0005 - Materials Technology L.S. (29.96 m2)

No Asbestos

B00G - R0006 - Kiln Room (25.62 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration - 1927 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00H - R0001 - Deputy Principal (16 m2)**

No Asbestos

B00H - R0002 - Pupil Entry (15.8 m2)

No Asbestos

B00H - R0003 - Community Clinic (3.15 m2)

No Asbestos

B00H - R0006 - General Storeroom (3.5 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
		5401/B00H/R0007/Floor Coverings Res/Textile/S1				No Asbestos Detected

B00H - R0007 - Staff Kitchen (6.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
		5401/B00H/R0007/Floor Coverings Res/Textile/S1				No Asbestos Detected

B00H - R0008 - Principal (20.19 m2)

No Asbestos

B00H - R0009 - Public Entry (14.39 m2)

No Asbestos

B00H - R0010 - Clerical Office (31.44 m2)

No Asbestos

B00H - R0011 - Movement (20.64 m2)

No Asbestos

B00H - R0012 - Toilet - Lobby (1.06 m2)

No Asbestos

B00H - R0013 - Staff Toilet (1.81 m2)

No Asbestos

B00H - R0014 - Toilet - Lobby (1.05 m2)

No Asbestos

B00H - R0015 - Staff Toilet (1.82 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Dormitory - 1927 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00E/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00I - R0001 - Dormitory (12.19 m2)**

No Asbestos

B00I - R0002 - Dormitory (20.64 m2)

No Asbestos

B00I - R0003 - Dormitory (16.83 m2)

No Asbestos

B00I - R0004 - Movement (7.19 m2)

No Asbestos

B00I - R0005 - Res. Common Room (16.67 m2)

No Asbestos

B00I - R0006 - Res. Common Room (21.54 m2)

No Asbestos

B00I - R0007 - Residential Kitchen (18.62 m2)

No Asbestos

B00I - R0008 - Residential Laundry (6.67 m2)

No Asbestos

B00I - R0009 - General Storeroom (2.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00I/R0009/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00I - R0010 - Staff Toilet (2.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00I/R0009/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00I - R0011 - Movement (2.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00I/R0009/Ceiling Structures/Linings/S23			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00I - R0012 - Movement (18.77 m2)

No Asbestos

B00I - R0013 - General Storeroom (3.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00I/R0013/Ceiling Structures/Linings/S12			Chrysotile (white asbestos)		

B00I - R0014 - Dormitory (14.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00I/R0018/Ceiling Structures/Linings/S13			Chrysotile (white asbestos)		

B00I - R0015 - Residential Showers (7.07 m2)

No Asbestos

B00I - R0016 - Residential Pantry (0.31 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B001 - R0017 - Staff Room Annexe (7.59 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B001/R0018/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	1m2	West, Lower portion	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
5401/B001/R0017/Wall Linings Internal/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B001 - R0018 - Movement (14.94 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B001/R0018/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning/Library - 1927 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	46m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00E/Eaves Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00J - R0001 - Sports Store (16.07 m2)**

Wall Linings Internal	Flat AC Sheeting	26m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00J/R0001/Wall Linings Internal/S10				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting				No Asbestos Detected	
	5401/B00J/R0001/In-fill-panel/S25					

B00J - R0002 - Communal Space (80.92 m2)

In-fill-panel	Flat AC Sheeting				No Asbestos Detected	
	5401/B00J/R0001/In-fill-panel/S25					

B00J - R0003 - General Learning Space (38.38 m2)

Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
	5401/B00J/R0018/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00J - R0004 - General Storeroom (15.94 m2)

No Asbestos

B00J - R0005 - Movement (5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00J/R0005/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00J - R0006 - Movement (65.49 m2)

Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
	5401/B00J/R0018/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00J - R0007 - General Learning Space (38.89 m2)

Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
	5401/B00J/R0018/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00J - R0008 - General Learning Space (38.62 m2)

Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
	5401/B00J/R0018/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00J - R0009 - General Learning Space (39.92 m2)

Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
	5401/B00J/R0018/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00J - R0010 - Reading Area (39.28 m2)

Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
	5401/B00J/R0018/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00J - R0011 - Reading Area (39.08 m2)

Ceiling Structures/Linings	Vermiculite				Limited Samples Taken	
	5401/B00J/R0018/Ceiling Structures/Linings/S9				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00J - R0012 - General Learning Space (38.76 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	5401/B00J/R0018/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R0013 - Laundry (8.88 m2)						
No Asbestos						
B00J - R0015 - General Storeroom (6.24 m2)						
No Asbestos						
B00J - R0016 - Staff Room (38.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	5401/B00J/R0018/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R0017 - General Storeroom (15.94 m2)						
No Asbestos						
B00J - R0018 - Movement (58.75 m2)						
Ceiling Structures/Linings	Vermiculite					
	5401/B00J/R0018/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R0019 - Movement (5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00J/R0005/Ceiling Structures/Linings/S24					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R0020 - General Learning Space (36.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	5401/B00J/R0018/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R0021 - Multi-Purpose Space (128.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	5401/B00J/R0018/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R0022 - Raised Platform (17.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	5401/B00J/R0018/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R0023 - Withdrawal Space - 1hb (16.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	5401/B00J/R0018/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R0024 - Communications Room (36.41 m2)						
Ceiling Structures/Linings	Vermiculite					
	5401/B00J/R0018/Ceiling Structures/Linings/S9					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00J - R0025 - Movement (19.66 m2)						
No Asbestos						
B00J - R0026 - Special Programs Room (48.37 m2)						
No Asbestos						
B00J - R0027 - Craft Store (24.57 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Other-D.E.C. Admin - 1927 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	North & South, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00L/Eaves Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00L - R0001 - Pantry (13.61 m2)

No Asbestos

B00L - R0002 - Pantry (6.22 m2)

No Asbestos

B00L - R0003 - General Storeroom (8.88 m2)

No Asbestos

B00L - R0004 - Cleaning Distributed Store (1.98 m2)

No Asbestos

B00L - R0005 - General Storeroom (4.63 m2)

No Asbestos

B00L - R0006 - Movement (4.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00L/R0013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00L - R0007 - Security Store (15.43 m2)

No Asbestos

B00L - R0008 - Distribution Board (0.07 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0009 - Movement (10.92 m2)

No Asbestos

B00L - R0010 - General Storeroom (9.76 m2)

No Asbestos

B00L - R0011 - Staff Kitchen (77.68 m2)

No Asbestos

B00L - R0012 - Security Store (4.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	5401/B00L/R0012/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00L - R0013 - Movement (6 m2)

Wall Linings Internal	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00L/R0013/Wall Linings Internal/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5401/B00L/R0013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00L - R0014 - Residential Dining Room (178.13 m2)

No Asbestos

B00L - R0015 - Movement (17.86 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B00L/R0013/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00L - R0016 - Staff Room (45.97 m2)						
No Asbestos						
B00L - R0017 - Movement (2.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B00L/R0013/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00L - R0018 - Cleaning Supplies (10.29 m2)						
No Asbestos						
B00L - R0019 - Shower/Change (6.47 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B00L/R0019/Partition Walls (Cubicles)/S7				Chrysotile (white asbestos)		
B00L - R0020 - Dormitory (15.47 m2)						
No Asbestos						
B00L - R0021 - Shower/Change (5.58 m2)						
No Asbestos						
B00L - R0022 - Walk-In Robe (3.22 m2)						
No Asbestos						
B00L - R0023 - General Storeroom (4.03 m2)						
No Asbestos						
B00L - R0024 - Walk-In Robe (3.22 m2)						
No Asbestos						
B00L - R0025 - Shower/Change (5.58 m2)						
No Asbestos						
B00L - R0026 - Dormitory (15.47 m2)						
No Asbestos						
B00L - R0027 - Seminar/Study (31.22 m2)						
No Asbestos						
B00L - R0028 - Movement (5.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B00L/R0013/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00L - R0029 - Clerical Office (14.07 m2)						
No Asbestos						
B00L - R0030 - General Storeroom (3.45 m2)						
No Asbestos						
B00L - R0031 - Shower/Change (3.76 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B00L/R0032/Wall Linings Internal/S8				Chrysotile (white asbestos)		
B00L - R0032 - Shower/Change (3.83 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
5401/B00L/R0032/Wall Linings Internal/S8				Chrysotile (white asbestos)		
B00L - R0033 - Walk-In Robe (3.51 m2)						
No Asbestos						
B00L - R0034 - Clerical Office (15.47 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00L - R0035 - Dormitory (15.41 m2)

No Asbestos

B00L - R0036 - Shower/Change (3.83 m2)

Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	-------	--------------------	---------	--------------------

5401/B00L/R0032/Wall Linings Internal/S8

Chrysotile (white asbestos)

B00L - R0037 - Walk-In Robe (3.53 m2)

No Asbestos

B00L - R0038 - General Storeroom (20.09 m2)

No Asbestos

B00L - R0039 - Movement (31.84 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 2008 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - Toilets - Girls (7.93 m2)

No Asbestos

B00M - R0002 - Toilets - Boys (11.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D11174 - Learning Unit - Standard/Withdrawal : Placement Date - 21/11/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017