

# Asbestos Register


(Hazardous Materials and Risk Assessment)



**School :** Gibberagong Environmental Education Centre (5714)  
**Region :** Northern Sydney  
**State Electorate :** Hornsby  
**Local Government Area :** Hornsby

**Initial Survey :** Noel Arnold & Associates : 15 - Jan - 2008  
**Reviewed By :** AECOM : 28 - Jun - 2016

5714 - Gibberagong Environmental Education Centre  
Site Plan (12688)

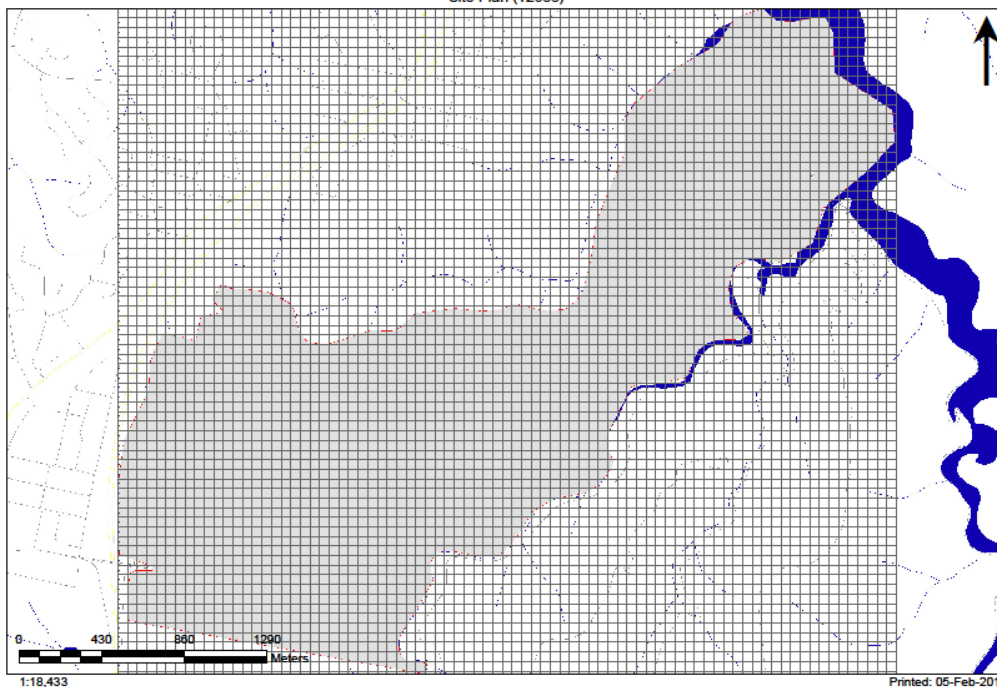

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Pupil Facilities - 1971 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 5714/B00A/R1023/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
Wall Cladding	Flat AC Sheeting 5714/B00A/R1023/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>

**Interior**

**B00A - R0002 - Maintenance Bulk Store**

No Asbestos

**B00A - R0003 - General Storeroom**

No Asbestos

**B00A - R0004 - General Storeroom**

No Asbestos

**B00A - R0005 - General Storeroom**

No Asbestos

**B00A - R0006 - General Storeroom**

No Asbestos

**B00A - R0007 - General Storeroom**

No Asbestos

**B00A - R0008 - General Storeroom**

No Asbestos

**B00A - R0009 - General Storeroom**

No Asbestos

**B00A - R0010 - General Storeroom**

No Asbestos

**B00A - R0011 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	5714/B00A/R0011/Wall Linings Internal/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0012 - General Storeroom**

No Asbestos

**B00A - R0013 - General Storeroom**

No Asbestos

**B00A - R0014 - Clerical Office/Workroom**

No Asbestos

**B00A - R0015 - Movement**

No Asbestos

**B00A - R0016 - Special Programs Room**

Ceiling Structures/Linings	Flat AC Sheeting 5714/B00A/R0016/Ceiling Structures/Linings/S3					<b>No Asbestos Detected</b>
Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - Electrical Hazard**

**B00A - R0017 - Home Base Store**

Ceiling Structures/Linings	Flat AC Sheeting 5714/B00A/R0016/Ceiling Structures/Linings/S3					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00A - R1001 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1002 - Reading Area</b>						
No Asbestos						
<b>B00A - R1003 - Clerical Office</b>						
Wall Linings Internal	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5714/B00A/R1010/Wall Linings Internal/S2					Chrysotile (white asbestos)	
<b>B00A - R1004 - Clerical Office</b>						
Wall Linings Internal	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5714/B00A/R1010/Wall Linings Internal/S2					Chrysotile (white asbestos)	
<b>B00A - R1005 - Covered Outdoor Learning Area</b>						
No Asbestos						
<b>B00A - R1006 - Movement</b>						
No Asbestos						
<b>B00A - R1007 - Dormitory</b>						
Wall Linings Internal	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5714/B00A/R1010/Wall Linings Internal/S2					Chrysotile (white asbestos)	
<b>B00A - R1008 - Dormitory</b>						
Wall Linings Internal	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5714/B00A/R1010/Wall Linings Internal/S2					Chrysotile (white asbestos)	
<b>B00A - R1009 - Dormitory</b>						
Wall Linings Internal	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5714/B00A/R1010/Wall Linings Internal/S2					Chrysotile (white asbestos)	
<b>B00A - R1010 - Dormitory</b>						
Wall Linings Internal	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
5714/B00A/R1010/Wall Linings Internal/S2					Chrysotile (white asbestos)	
<b>B00A - R1013 - Staff Kitchen</b>						
No Asbestos						
<b>B00A - R1014 - General Storeroom</b>						
No Asbestos						
<b>B00A - R1015 - Duplicating Workroom</b>						
No Asbestos						
<b>B00A - R1020 - Security Store</b>						
No Asbestos						
<b>B00A - R1021 - Nutrition Room</b>						
No Asbestos						
<b>B00A - R1022 - Staff Room Annexe</b>						
No Asbestos						
<b>B00A - R1023 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
5714/B00A/R1023/Ceiling Structures/Linings/S1					No Asbestos Detected	
<b>B00A - R1024 - Staff Shower/Change</b>						
No Asbestos						
<b>B00A - R1025 - Shower/Change</b>						
No Asbestos						
<b>B00A - R1026 - Shower/Change</b>						
No Asbestos						
<b>B00A - R1027 - Staff Shower/Change</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017