


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gardeners Road Public School (7418)
Region : Sydney
State Electorate : Heffron
Local Government Area : Sydney

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Grencap-NAA : 20 - Jul - 2015

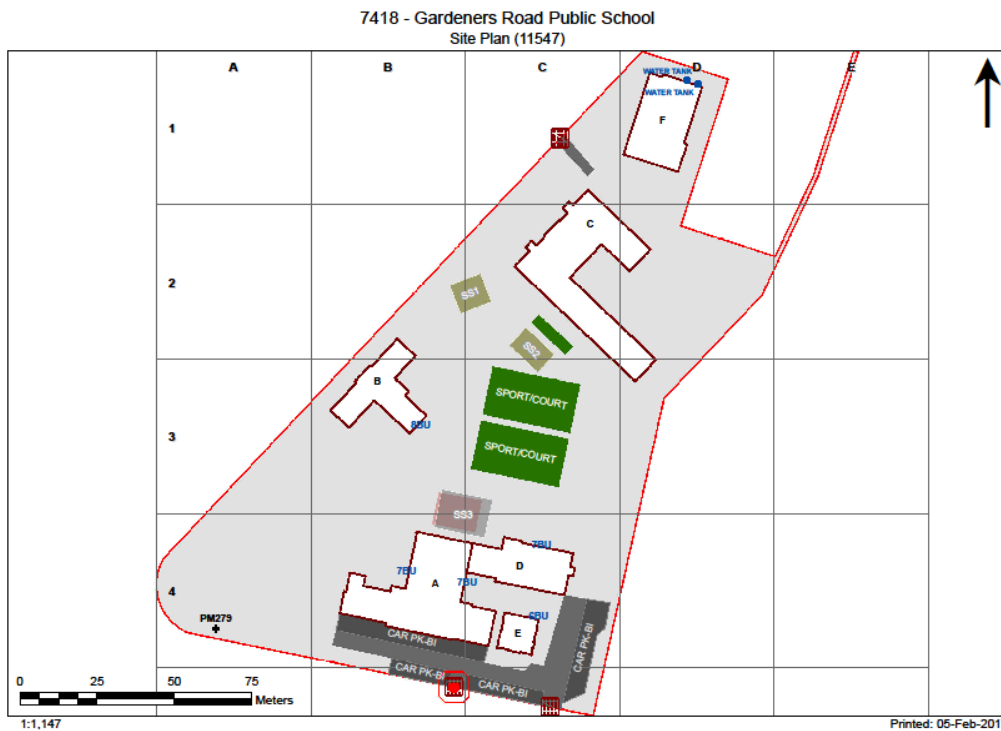

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1899 - Brick/Block (Brick/Block)

Exterior

Wall Cladding	Flat AC Sheeting 7418/B00B/R1007/Wall Linings Internal/S7-Chrysotile (white asbestos)	5m2	South facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Eaves Linings	Flat AC Sheeting 7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)	30m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Gable Verge Linings	Flat AC Sheeting 7418/B00C/R0006/Floor Coverings Res/Textile/S15-Chrysotile (white asbestos)	60m	East facing, West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

Interior

B00A - M0001 - Staff Toilet

No Asbestos

B00A - M0002 - Movement

No Asbestos

B00A - M0003 - Movement

No Asbestos

B00A - M0004 - Staff Toilet

No Asbestos

B00A - M0005 - General Storeroom

No Asbestos

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Canteen

No Asbestos

B00A - R0003 - Disabled Toilet

No Asbestos

B00A - R0004 - Home Base - M

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	62m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Practical Activities - 1hb

No Asbestos

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - Craft Store

No Asbestos

B00A - R0009 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	52m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0010 - Movement						
No Asbestos						
B00A - R0011 - Cleaning Supplies						
No Asbestos						
B00A - R0012 - Communal Space						
No Asbestos						
B00A - R0013 - Raised Platform						
No Asbestos						
B00A - R0014 - Clerical Office/Workroom						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	48m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0015 - Security Store						
Floor Coverings Res/Textile	Vinyl Sheet 7418/B00A/R0015/Floor Coverings Res/Textile/S14					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 7418/B00A/R0015/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00A - R0016 - Staff Toilet						
No Asbestos						
B00A - R0017 - Principal						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0020/Floor Coverings Res/Textile/S11	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0020/Floor Coverings Res/Textile/S12	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to sample 11 7418/B00A/R0020/Floor Coverings Res/Textile/S21					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive attached to Sample 12 7418/B00A/R0020/Floor Coverings Res/Textile/S22					No Asbestos Detected
B00A - R0018 - Movement						
No Asbestos						
B00A - R0019 - Movement						
No Asbestos						
B00A - R0020 - Interview						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0020/Floor Coverings Res/Textile/S11	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0020/Floor Coverings Res/Textile/S12	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to sample 11 7418/B00A/R0020/Floor Coverings Res/Textile/S21					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive attached to sample 12					
	7418/B00A/R0020/Floor Coverings Res/Textile/S22					No Asbestos Detected
B00A - R0021 - Entry Vestibule						
No Asbestos						
B00A - R0022 - Cleaning Distributed Store						
No Asbestos						
B00A - R0023 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00A/R0014/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00A/R0014/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
B00A - R0024 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00A/R0014/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00A/R0014/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
B00A - R0025 - Movement						
No Asbestos						
B00A - R0026 - Stairs						
No Asbestos						
B00A - R0027 - Stairs						
No Asbestos						
B00A - R0028 - Stairs						
No Asbestos						
B00A - R1001 - Duplicating Workroom						
No Asbestos						
B00A - R1002 - Interview						
No Asbestos						
B00A - R1003 - Movement						
No Asbestos						
B00A - R1004 - Movement						
No Asbestos						
B00A - R1005 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	62m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00A/R0014/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00A/R0014/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
B00A - R1006 - Practical Activities - 1hb						
No Asbestos						
B00A - R1007 - Home Base Store						
No Asbestos						
B00A - R1008 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00A/R0014/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00A/R0014/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R1009 - Movement						
No Asbestos						
B00A - R1010 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	52m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1011 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	54m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1012 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	52m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1013 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	47m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1014 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	47m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1015 - Movement						
No Asbestos						
B00A - R1016 - Deputy Principal						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	14m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1017 - Sports Store						
No Asbestos						
B00A - R1018 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	52m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1019 - Home Base						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	54m2	Adhesive to S13	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00A/R0014/Floor Coverings Res/Textile/S13	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R1020 - Stairs

No Asbestos

B00A - R1021 - Stairs

No Asbestos

B00A - R1022 - Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Support Unit - 1925 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	AC Fragments/Debris	2Unit	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)

Interior

B00B - R0001 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	

B00B - R0002 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R0002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	

B00B - R0003 - Toilets - Boys/Girls

No Asbestos

B00B - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	

B00B - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	

B00B - R0006 - Movement

No Asbestos

B00B - R0007 - Cleaning Distributed Store

No Asbestos

B00B - R0008 - General Storeroom

No Asbestos

B00B - R0009 - General Storeroom

No Asbestos

B00B - R0010 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	

B00B - R0011 - Sick Bay - Shower/Toilet

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						

B00B - R0012 - Sick Bay

No Asbestos

B00B - R0013 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	

B00B - R0014 - Practical Activities - 1hb

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		
B00B - R0015 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		
B00B - R0016 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		
B00B - R0017 - Toilets - Boys/Girls						
No Asbestos						
B00B - R0018 - Stairs						
No Asbestos						
B00B - R1001 - Home Base Store - M						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						
B00B - R1002 - Personal Effects - M						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						
B00B - R1003 - Toilet - M						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						
B00B - R1004 - Home Base - M						
Ceiling Structures/Linings	Flat AC Sheeting	76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1004/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		
B00B - R1005 - Practical Activities - M - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						
B00B - R1006 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						
B00B - R1007 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00B/R1007/Partition Walls (Cubicles)/S17				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	6m2	North facing, East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R1007/Wall Linings Internal/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)					
B00B - R1008 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R1007/Partition Walls (Cubicles)/S17					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R1007/Wall Linings Internal/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)					
B00B - R1009 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
B00B - R1010 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)					
B00B - R1011 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)					
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7418/B00B/R1011/Floor Coverings Res/Textile/S18					
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7418/B00B/R1011/Floor Coverings Res/Textile/S18					
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7418/B00B/R1011/Floor Coverings Res/Textile/S19					
B00B - R1012 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)					
B00B - R1013 - Toilets - Boys/Girls						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						
B00B - R1014 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Support Unit - 1925 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)	40m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Gable Verge Linings	Flat AC Sheeting 7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)	70m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00C - R0001 - Home Base - M

No Asbestos

B00C - R0002 - Toilet - M

No Asbestos

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0004 - Movement

No Asbestos

B00C - R0005 - General Storeroom

No Asbestos

B00C - R0006 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7418/B00C/R0006/Floor Coverings Res/Textile/S15	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive attached to Sample 15 7418/B00C/R0006/Floor Coverings Res/Textile/S23					No Asbestos Detected

B00C - R0007 - Staff Toilet

No Asbestos

B00C - R0008 - Staff Room Annexe

No Asbestos

B00C - R0009 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 7418/B00C/R0009/Floor Coverings Res/Textile/S4	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	--------------	--------------------	---------	--

B00C - R0010 - Communal Space

Floor Coverings Res/Textile	Vinyl Tiles 7418/B00C/R0022/Floor Coverings Res/Textile/S3	157m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-------	-------------	--------------------	---------	--

B00C - R0011 - Home Base

No Asbestos

B00C - R0012 - Home Base

No Asbestos

B00C - R0013 - Movement

No Asbestos

B00C - R0014 - Movement

No Asbestos

B00C - R0015 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0016 - Home Base						
Wall Linings Internal	Flat AC Sheeting	48m2	East facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00C/R0016/Wall Linings Internal/S6					Chrysotile (white asbestos)	
B00C - R0017 - Cleaning Supplies						
No Asbestos						
B00C - R0018 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00C/R0022/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00C - R0019 - Movement						
Wall Linings Internal	Flat AC Sheeting	48m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00C/R0019/Wall Linings Internal/S16					Chrysotile (white asbestos)	
B00C - R0020 - Sports Store						
Floor Coverings Res/Textile	Flat AC Sheeting					
7418/B00C/R0020/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00C - R0021 - Home Base - M						
No Asbestos						
B00C - R0022 - Practical Activities - M - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00C/R0022/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00C - R0023 - Drinking Facilities						
Ceiling Structures/Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00C - R0024 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00C - R0025 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library/Other-Community Use - 1925 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Linings	Flat AC Sheeting	60m	North facing, South facing, East facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)					
Ceiling Voids	Non Accessible Area - Height Restriction					

Interior**B00D - R0001 - K.L.A. Store**

Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R0002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7418/B00D/R0006/Ceiling Structures/Linings/S10			No Asbestos Detected	

B00D - R0002 - Movement

No Asbestos

B00D - R0003 - Reading Area

No Asbestos

B00D - R0004 - K.L.A. Store

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00C/R0022/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00D - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7418/B00D/R0006/Ceiling Structures/Linings/S10			No Asbestos Detected	
----------------------------	------------------	--	--	--	-----------------------------	--

B00D - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7418/B00D/R0006/Ceiling Structures/Linings/S10			No Asbestos Detected	
----------------------------	------------------	--	--	--	-----------------------------	--

B00D - R0007 - Movement

No Asbestos

B00D - R0008 - Movement

No Asbestos

B00D - R0009 - Cleaning Distributed Store

No Asbestos

B00D - R0010 - Library Office/Workroom

Ceiling Structures/Linings	Flat AC Sheeting	7418/B00D/R0006/Ceiling Structures/Linings/S10			No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00C/R0022/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00D - R0011 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00B/R0002/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7418/B00D/R0006/Ceiling Structures/Linings/S10			No Asbestos Detected	

B00D - R0012 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	7418/B00D/R0006/Ceiling Structures/Linings/S10			No Asbestos Detected	
----------------------------	------------------	--	--	--	-----------------------------	--

B00D - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7418/B00D/R0006/Ceiling Structures/Linings/S10			No Asbestos Detected	
----------------------------	------------------	--	--	--	-----------------------------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00C/R0022/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00D - R0014 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R0015 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R0016 - Covered Outdoor Learning Area						
Ceiling Structures/Linings	Flat AC Sheeting	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7418/B00E/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00D - R1001 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R1002 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R1003 - Other-Community Use						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R1004 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R1005 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R1006 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R1007 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
7418/B00D/R0006/Ceiling Structures/Linings/S10						
B00D - R9001 - General Storeroom						
No Asbestos						
B00D - R9002 - General Storeroom						
No Asbestos						
B00D - R9003 - General Storeroom						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1925 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	22m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2-Chrysotile (white asbestos)					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00E - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	24m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00E - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	21m2	North facing, South facing, East facing, West facing	Good Condition (1)	Medium (2)	Low Priority (2-3)
	7418/B00E/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	7418/B00E/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00F - R0001 - Communal Space**

No Asbestos

B00F - R0002 - Raised Platform

No Asbestos

B00F - R0003 - Communal/Performance Store

No Asbestos

B00F - R0004 - Hall Chair Store

No Asbestos

B00F - R0005 - P.E. Store

No Asbestos

B00F - R0006 - Toilet - Lobby

No Asbestos

B00F - R0007 - Toilets - Girls

No Asbestos

B00F - R0008 - Sound Cupboard

No Asbestos

B00F - R0009 - Toilets - Boys

No Asbestos

B00F - R0010 - Toilet - Lobby

No Asbestos

B00F - R0011 - Plant

No Asbestos

B00F - R0012 - Cleaning Distributed Store

No Asbestos

B00F - R0013 - Movement

No Asbestos

B00F - R0014 - Main Switch Board

No Asbestos

B00F - R0015 - Covered Outdoor Learning Area

No Asbestos

B00F - R0016 - Movement

No Asbestos

B00F - R0017 - Plant

No Asbestos

B00F - R0018 - Access Shower/Toilet

No Asbestos

B00F - R0019 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017