


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Goulburn High School (8116)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Goulburn Mulwaree

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : Grencap-NAA : 26 - Aug - 2014

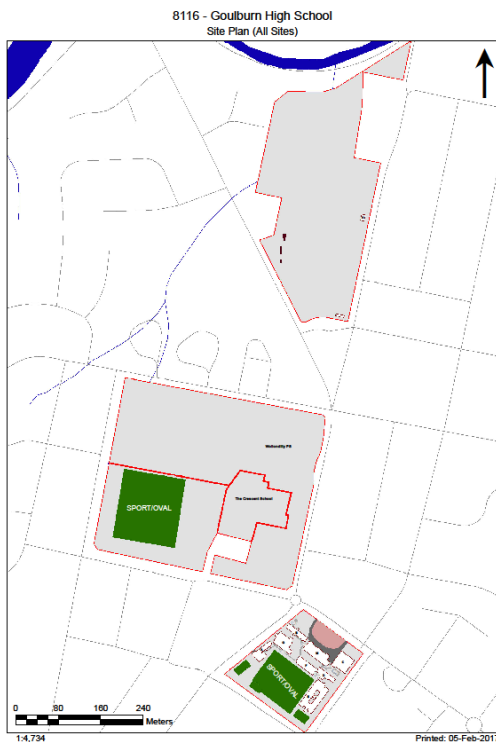

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Technological & Applied Studies - 1960 - Concrete Framed (Concrete Framed)**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00D/Gable Verge Lining/S11					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/Eaves Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Wall Cladding	texted coating - green	100m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00A/Wall Cladding/S24					Chrysotile (white asbestos)

Interior**B00A - R0001 - Staff Study (17.04 m2)**

No Asbestos

B00A - R0002 - General Storeroom (7.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00A/R0002/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00A - R0003 - Staff - Toilet (3.66 m2)

No Asbestos

B00A - R0008 - Secure Storeroom (55.3 m2)

No Asbestos

B00A - R0009 - Movement (34.51 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Ceiling Structures/Linings	Flat AC Sheeting	34.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00A/R0009/Ceiling Structures/Linings/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0010 - Resource/Project Store (11.92 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0011 - General Storeroom (7.31 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0014 - Welding Store (9.34 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00A - R0015 - Materials Store (15.85 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0019 - General Storeroom (3.06 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8116/B00C/R1012/Wall Linings Internal/S7					
B00A - R0020 - Materials Technology L.S. (64.78 m2)						
No Asbestos						
B00A - R0021 - Wood Technology Bay (25.4 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8116/B00A/R0021/Wall Linings Internal/S19					
B00A - R0022 - Materials Store (32.4 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8116/B00A/R0021/Wall Linings Internal/S19					
B00A - R0023 - Dust Extraction Space (2.31 m2)						
No Asbestos						
B00A - R0024 - Distribution Board Cupboard (0.44 m2)						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0025 - Computer Resource (12.46 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0026 - Computer Learning Space (64.43 m2)						
No Asbestos						
B00A - R0027 - Distribution Board Cupboard (0.15 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0028 - External Movement (4.27 m2)						
No Asbestos						
B00A - R0029 - External Movement (4.27 m2)						
No Asbestos						
B00A - R0030 - External Movement (9.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00A/R0009/Ceiling Structures/Linings/S20					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0031 - Welding/Hot Metals Area (12.03 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0032 - Materials Technology L.S. (85.69 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0033 - External Movement (1.87 m2)						
No Asbestos						
B00A - R0034 - Stairs (9.38 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8116/B00C/R0026/Ceiling Structures/Linings/S6					
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0035 - Materials Store (3.08 m2)						
No Asbestos						
B00A - R0036 - General Storeroom (5.93 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1001 - General Storeroom (8.62 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
B00A - R1002 - Materials Technology L.S. (98.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R1004 - Materials Store (15.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R1006 - Resource/Project Store (7.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	7.37m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8116/B00A/R1006/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)
B00A - R1007 - Resource/Project Store (13.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R1008 - Distribution Board Cupboard (0.43 m2)						
						Note: No inspection of live electrical installation.
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R1009 - Movement (17.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R1010 - Dust Extraction Space (2 m2)						
No Asbestos						
B00A - R1011 - Stairs (17.95 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Science/Music - 1960 - Concrete Framed (Concrete Framed)**Exterior**

Ceiling Voids Non Accessible Area
- Height Restriction

Underfloor Voids Non Accessible Area
- Area inaccessible

Interior**B00B - R0007 - Cleaning Store - Distributed (0.82 m2)**

Ceiling Structures/Linings Flat AC Sheeting
8116/B00C/R0025/Ceiling Structures/Linings/S5 **No Asbestos Detected**

B00B - R0008 - Distribution Board Cupboard (0.82 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0009 - Stairs (5.07 m2)

No Asbestos

B00B - R0010 - Staff Study (16.54 m2)

Floor Coverings Vinyl Tiles (Under Floor 16.54m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
Res/Textile Covering/Carpet)
8116/B00B/R1010/Floor Coverings Res/Textile/S16 **Chrysotile (white asbestos)**

B00B - R0011 - Preparation (17.91 m2)

Ceiling Structures/Linings Flat AC Sheeting
8116/B00C/R0025/Ceiling Structures/Linings/S5 **No Asbestos Detected**

B00B - R0012 - Laboratory L.S. (110.12 m2)

Floor Coverings Vinyl Tiles (Under Floor 110.12m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
Res/Textile Covering/Carpet)
8116/B00B/R1010/Floor Coverings Res/Textile/S16 **Chrysotile (white asbestos)**

B00B - R0013 - General Storeroom (9.06 m2)

Floor Coverings Vinyl Tiles (Under Floor 9.06m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
Res/Textile Covering/Carpet)
8116/B00B/R1010/Floor Coverings Res/Textile/S16 **Chrysotile (white asbestos)**

B00B - R0014 - General Storeroom (6.81 m2)

Ceiling Structures/Linings Flat AC Sheeting
8116/B00C/R0025/Ceiling Structures/Linings/S5 **No Asbestos Detected**

B00B - R0016 - General Learning Space (97.6 m2)

No Asbestos

B00B - R0017 - Interview/Meeting (10.94 m2)

No Asbestos

B00B - R0018 - Practical Activities (50.97 m2)

No Asbestos

B00B - R0019 - General Storeroom (10.34 m2)

No Asbestos

B00B - R0020 - Movement (3.83 m2)

No Asbestos

B00B - R0021 - Disabled Toilet (5.05 m2)

No Asbestos

B00B - R0022 - Access Student Shower/Toilet/Change (13.71 m2)

No Asbestos

B00B - R0023 - Movement (36.8 m2)

Floor Coverings Vinyl Tiles (Under Floor 36.8m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
Res/Textile Covering/Carpet)
8116/B00B/R1010/Floor Coverings Res/Textile/S16 **Chrysotile (white asbestos)**

B00B - R0024 - External Movement (8.04 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
B00B - R0025 - External Movement (5.69 m2)						
No Asbestos						
B00B - R0026 - External Movement (9.62 m2)						
No Asbestos						
B00B - R1001 - Design L.S. (65.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	65.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1002 - Movement (24.69 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	24.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1003 - Design L.S. (51.99 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	51.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1004 - Design L.S. (21.83 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	21.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1005 - Resources Store (14.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	14.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1006 - Staff Study (13.93 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	13.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1007 - Movement (22.82 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	22.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1008 - Cleaning Store - Distributed (0.81 m2)						
No Asbestos						
B00B - R1009 - Distribution Board Cupboard (0.81 m2)						
				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R1010 - Music Store (6.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00B/R1010/Floor Coverings Res/Textile/S16	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1011 - Staff Study (18.69 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	18.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1012 - Movement (18.63 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	18.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1013 - General Learning Space (51.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	51.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1014 - Music Learning Space (65.59 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8116/B00B/R1010/Floor Coverings Res/Textile/S16	65.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Chrysotile (white asbestos)

B00B - R1015 - Stairs (3.59 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Science Learning - 1966 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Eaves Linings	Non Accessible Area - Height Restriction

Interior**B00C - R0006 - Staff Study (52.27 m2)**

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	52.27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0007 - General Storeroom (12.53 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	12.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0009 - Distribution Board Cupboard (0.8 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0011 - Cleaning Store - Distributed (5.4 m2)

No Asbestos

B00C - R0012 - Apparatus Store (5.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	5.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	--------	------------	--------------------	---------	--

B00C - R0013 - Toilets-Boys (45.84 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8116/B00C/R0013/Partition Walls (Cubicles)/S4	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00C - R0014 - Toilets-Girls (38.76 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8116/B00C/R0013/Partition Walls (Cubicles)/S4	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00C - R0016 - Preparation (24.03 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00C - R0017 - Growing/Breeding (8.12 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00C - R0018 - General Storeroom (5.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	5.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	--------	------------	--------------------	---------	--

B00C - R0019 - Distribution Board Cupboard (0.59 m2)

Note: No inspection of live electrical installation.

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0020 - Staff - Toilet (5.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0022 - Movement (196.68 m2)						
No Asbestos						
B00C - R0023 - Stairs (0.35 m2)						
No Asbestos						
B00C - R0024 - Stairs (0.32 m2)						
No Asbestos						
B00C - R0025 - External Movement (22.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00C/R0025/Ceiling Structures/Linings/S5					No Asbestos Detected
B00C - R0026 - Staff Study (25.39 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	25.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00C/R0007/Floor Coverings Res/Textile/S23					Chrysotile (white asbestos)
B00C - R0028 - Laboratory L.S. (82.2 m2)						
No Asbestos						
B00C - R0029 - Preparation - Science (25.68 m2)						
No Asbestos						
B00C - R0030 - Chemical Store (12.15 m2)						
No Asbestos						
B00C - R0031 - Laboratory L.S. (82.02 m2)						
No Asbestos						
B00C - R0032 - Laboratory L.S. (82.2 m2)						
No Asbestos						
B00C - R0033 - Lift (2.24 m2)						
No Asbestos						
B00C - R0034 - Covered Area (101.62 m2)						
No Asbestos						
B00C - R1001 - Art Learning Space (80.04 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	80.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00C/R0007/Floor Coverings Res/Textile/S23					Chrysotile (white asbestos)
B00C - R1002 - Resources Store (5.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	5.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00C/R0007/Floor Coverings Res/Textile/S23					Chrysotile (white asbestos)
B00C - R1003 - Distribution Board Cupboard (0.78 m2)						
No Asbestos						
					Note: No inspection of live electrical installation.	
B00C - R1004 - Resources Store (5.98 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	5.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1007 - Kiln Space (22.06 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1008 - Resources Store (10.26 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	10.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1009 - General Learning Space (52.13 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	52.13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1010 - General Storeroom (8.52 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	8.52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1011 - Distribution Board Cupboard (0.56 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00C - R1012 - General Storeroom (7.76 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Flat AC Sheeting 8116/B00C/R0007/Floor Coverings Res/Textile/S23	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00C/R0007/Floor Coverings Res/Textile/S23	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1013 - Staff - Toilet (7.52 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1014 - Staff Study (26.24 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1015 - Special Learning Space (12.92 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	12.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00C - R1016 - Special Learning Space (12.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	12.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00C - R1017 - General Learning Space (53.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00C - R1018 - Computer Learning Space (12.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	12.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00C - R1019 - General Storeroom (12.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	12.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00C - R1020 - Staff Study (24.6 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	24.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00C - R1021 - Computer Learning Space (66.68 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	66.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00C - R1022 - Staff Study (9.54 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	9.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00C - R1023 - Computer Learning Space (52.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	52.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23					Chrysotile (white asbestos)	
B00C - R1024 - Cleaning Store - Distributed (2.99 m2)						
Ceiling Structures/Linings	Vermiculite					
8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1025 - Movement (117.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8116/B00C/R0025/Ceiling Structures/Linings/S5					No Asbestos Detected	
B00C - R1026 - Stairs (14.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8116/B00C/R0025/Ceiling Structures/Linings/S5					No Asbestos Detected	
B00C - R1027 - Art Learning Space (87.5 m2)						
Ceiling Structures/Linings	Vermiculite					
8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	87.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0007/Floor Coverings Res/Textile/S23					Chrysotile (white asbestos)	
B00C - R1028 - Stairs (14.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8116/B00C/R0025/Ceiling Structures/Linings/S5					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Technological & Applied Studies - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 8116/B00F/Eaves Linings/S10	22m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 8116/B00D/Gable Verge Lining/S11	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00D - R0001 - Laundry (14.06 m2)						
No Asbestos						
B00D - R0002 - Pantry (5.86 m2)						
No Asbestos						
B00D - R0003 - Food Technology L.S. (91.66 m2)						
No Asbestos						
B00D - R0004 - Staff Study (12.32 m2)						
No Asbestos						
B00D - R0005 - Food Technology L.S. (88.88 m2)						
No Asbestos						
B00D - R0006 - General Storeroom (6.19 m2)						
No Asbestos						
B00D - R0007 - Distribution Board Cupboard (0.21 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00D - R0008 - Movement (35.04 m2)						
No Asbestos						
B00D - R0009 - Cleaning Store - Distributed (4.68 m2)						
No Asbestos						
B00D - R0010 - Food/Research Space (20.64 m2)						
No Asbestos						
B00D - R0011 - Staff Study (20.47 m2)						
No Asbestos						
B00D - R0012 - Staff - Toilet (4.59 m2)						
No Asbestos						
B00D - R0013 - Distribution Board Cupboard (0.2 m2)					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting 8116/B00F/R0009/Wall Linings Internal/S8					No Asbestos Detected
B00D - R0014 - External Movement (2.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8116/B00D/R0014/Ceiling Structures/Linings/S22					No Asbestos Detected
B00D - R0015 - External Movement (40.18 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Science Learning - 1971 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting 8116/B00C/R1012/Wall Linings Internal/S7					No Asbestos Detected
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00E - R0001 - Laboratory L.S. (88.5 m2)**

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00E - R0002 - Preparation (29.43 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Flue, fume cabinet	Fibre Cement Pipe 8116/B00E/R0023/Floor Coverings Res/Textile/S13	2Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Area inaccessible

B00E - R0003 - General Storeroom (10.05 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0005 - General Learning Space (52.64 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	52.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0006 - Staff - Toilet (12.51 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00E - R0007 - General Learning Space (52.71 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	52.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0008 - General Storeroom (6.25 m2)

Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00E - R0009 - General Learning Space (55.41 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	55.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0010 - General Storeroom (6.21 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0011 - Toilets-Boys (21.82 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Partition Walls (Cubicles)	Compressed AC Sheet 8116/B00C/R0013/Partition Walls (Cubicles)/S4	3m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0012 - Shower/Change (21.62 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00E - R0013 - General Learning Space (55.41 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	55.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0014 - General Storeroom (6.26 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00E - R0016 - General Storeroom (6.25 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00E - R0017 - Movement (160.02 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
In-fill-panel	Flat AC Sheeting 8116/B00E/R0017/In-fill-panel/S12				No Asbestos Detected	
B00E - R0018 - Cleaning Store - Distributed (10.09 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00E - R0019 - Main Switchroom (10.18 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard

B00E - R0020 - General Assistants (20.79 m2)

Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R0021 - Cleaning Store - Distributed (0.65 m2)

No Asbestos

B00E - R0022 - Distribution Board Cupboard (0.64 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0023 - Chemical Store (39.51 m2)

Floor Coverings Res/Textile	Vinyl Tiles	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R0025 - General Storeroom (8.94 m2)

No Asbestos

B00E - R0026 - Cleaning Store - Distributed (0.67 m2)

No Asbestos

B00E - R0027 - Stairs (4.81 m2)

No Asbestos

B00E - R0028 - Distribution Board Cupboard (0.65 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0029 - External Stairs (9.56 m2)

No Asbestos

B00E - R0030 - Stairs (5 m2)

No Asbestos

B00E - R0031 - General Storeroom (8.94 m2)

No Asbestos

B00E - R0032 - Computer Learning Space (52.7 m2)

Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	52.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00E - R0033 - Staff Study (52.63 m2)

Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	52.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00E - R0034 - General Storeroom (25.88 m2)

Ceiling Structures/Linings	Vermiculite					
	8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R0035 - External Movement (55.31 m2)

No Asbestos

B00E - R0036 - Movement (16.05 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R0037 - Movement (14.51 m2)

No Asbestos

B00E - R0038 - External Movement (258.06 m2)

No Asbestos

B00E - R0039 - Laboratory L.S. (82.27 m2)

No Asbestos

B00E - R1001 - General Learning Space (55.18 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 55.18m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8116/B00E/R0023/Floor Coverings Res/Textile/S13 **Chrysotile (white asbestos)**

B00E - R1002 - General Learning Space (79.21 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 79.21m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8116/B00E/R0023/Floor Coverings Res/Textile/S13 **Chrysotile (white asbestos)**

B00E - R1004 - General Storeroom (25.99 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1005 - Staff Study (26.86 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 26.86m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8116/B00E/R0023/Floor Coverings Res/Textile/S13 **Chrysotile (white asbestos)**

B00E - R1006 - Staff - Toilet (11.69 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles) Compressed AC Sheet 3m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8116/B00C/R0013/Partition Walls (Cubicles)/S4 **Chrysotile (white asbestos)**

B00E - R1007 - General Learning Space (52.49 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 52.49m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8116/B00E/R0023/Floor Coverings Res/Textile/S13 **Chrysotile (white asbestos)**

B00E - R1008 - General Storeroom (6.24 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1009 - General Learning Space (55.18 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	55.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
B00E - R1010 - General Storeroom (5.95 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00E - R1011 - Cleaning Store - Distributed (0.65 m2)						
No Asbestos						
B00E - R1012 - Toilets-Boys (22.13 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00E - R1013 - Toilets-Girls (22.03 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00E - R1014 - Distribution Board Cupboard (0.62 m2)						
				Note: No inspection of live electrical installation.		
No Asbestos						
B00E - R1015 - General Learning Space (55.05 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	55.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
B00E - R1016 - General Learning Space (52.92 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	52.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
B00E - R1017 - General Learning Space (52.99 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	52.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
B00E - R1018 - Staff Study (52.78 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	52.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
B00E - R1019 - General Storeroom (65.48 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8116/B00C/R0026/Ceiling Structures/Linings/S6				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	65.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
B00E - R1020 - General Learning Space (66.13 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	66.13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1021 - Staff Study (55.11 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	55.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1022 - Cleaning Store - Distributed (0.64 m2)						
No Asbestos						
B00E - R1023 - Interview/Office - Type 1 (18.64 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	18.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1024 - Interview/Office - Type 1 (18.91 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	18.91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1025 - Distribution Board Cupboard (0.67 m2)						
No Asbestos Note: No inspection of live electrical installation.						
B00E - R1027 - Stairs (19.83 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1028 - Computer Learning Space (12.41 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	12.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1029 - General Learning Space (63.21 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8116/B00E/R0023/Floor Coverings Res/Textile/S13	63.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1030 - External Stairs (9.43 m2)						
No Asbestos						
B00E - R1031 - Stairs (20.17 m2)						
Ceiling Structures/Linings	Vermiculite 8116/B00C/R0026/Ceiling Structures/Linings/S6					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1032 - Movement (12.97 m2)						
No Asbestos						
B00E - R1033 - Movement (13.25 m2)						
No Asbestos						
B00E - R1034 - External Movement (248.6 m2)						
No Asbestos						
B00E - R2001 - General Learning Space (55.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	55.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00E - R2002 - General Storeroom (5.75 m2)						
No Asbestos						
B00E - R2003 - Distribution Board Cupboard (0.38 m2)						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting					
8116/B00C/R0025/Ceiling Structures/Linings/S5					No Asbestos Detected	
B00E - R2004 - General Learning Space (52.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	52.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00E - R2005 - General Storeroom (6.18 m2)						
No Asbestos						
B00E - R2006 - Design L.S. (66.37 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	66.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00E - R2007 - General Storeroom (6.14 m2)						
No Asbestos						
B00E - R2008 - General Storeroom (3.01 m2)						
No Asbestos						
B00E - R2009 - General Storeroom (2.98 m2)						
No Asbestos						
B00E - R2010 - Design L.S. (65.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	65.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00E - R2011 - Toilets-Girls (12.38 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00C/R0013/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
B00E - R2012 - General Learning Space (52.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	52.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00E - R2013 - Cleaning Store - Distributed (0.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8116/B00C/R0025/Ceiling Structures/Linings/S5					No Asbestos Detected	
B00E - R2014 - General Learning Space (55.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	55.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00E/R0023/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00E - R2015 - General Storeroom (5.6 m2)						
No Asbestos						
B00E - R2016 - Movement (119.11 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Flat AC Sheeting
 8116/B00C/R0025/Ceiling Structures/Linings/S5 **No Asbestos Detected**

B00E - R2017 - General Storeroom (5.81 m2)

No Asbestos

B00E - R2018 - Stairs (20.18 m2)

Ceiling Structures/Linings Vermiculite
 8116/B00C/R0026/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R2019 - Stairs (20.18 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/Eaves Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Ceiling Voids	No Asbestos Found					

Interior**B00F - R0001 - Toilets-Girls (88.05 m2)**

No Asbestos

B00F - R0003 - Toilets-Boys (98.37 m2)

No Asbestos

B00F - R0004 - External Movement (201.23 m2)

No Asbestos

B00F - R0006 - General Storeroom (4.72 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/R0006/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	

B00F - R0007 - Staff - Toilet (4.09 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/R0006/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	

B00F - R0008 - General Storeroom (9.69 m2)

No Asbestos

B00F - R0009 - Movement (69.48 m2)

Wall Linings Internal	Flat AC Sheeting					
	8116/B00F/R0009/Wall Linings Internal/S8				No Asbestos Detected	

B00F - R0010 - Office/Store (12.61 m2)

No Asbestos

B00F - R0011 - Student Canteen (71.22 m2)

No Asbestos

B00F - R0012 - Cleaning Store - Distributed (4.92 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Multi Purpose Facilities - 1960 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/Eaves Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00G - M0001 - Movement (3.58 m2)

No Asbestos

B00G - M0002 - General Storeroom (8.59 m2)

No Asbestos

B00G - M0003 - Movement (3.77 m2)

No Asbestos

B00G - M0004 - General Storeroom (9.42 m2)

No Asbestos

B00G - R0001 - Toilets-Girls (5.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected

B00G - R0002 - Multi-Purpose Space (9.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected

B00G - R0003 - Distribution Board Cupboard (0.45 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0004 - Toilets-Boys (5.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected

B00G - R0005 - Multi-Purpose Space (410.34 m2)

No Asbestos

B00G - R0006 - Sport Equipment Store (28.72 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected

B00G - R0007 - Sport Equipment Store (12.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected

B00G - R0008 - Movement (35.37 m2)

No Asbestos

B00G - R0009 - Shower/Change (56.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected

B00G - R0010 - Toilets-Boys (7.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected

B00G - R0011 - Cleaning Store - Distributed (6.63 m2)

No Asbestos

B00G - R0012 - Shower/Change (50.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0013 - Toilets-Girls (7.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected
B00G - R0014 - Chair Store (6.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8116/B00G/R0002/Ceiling Structures/Linings/S14					No Asbestos Detected
B00G - R0015 - Chair Store (13.31 m2)						
No Asbestos						
B00G - R0016 - Movement (13.8 m2)						
No Asbestos						
B00G - R0017 - Stage (90.84 m2)						
No Asbestos						
B00G - R0018 - General Storeroom (18.84 m2)						
No Asbestos						
B00G - R0019 - External Movement (2.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/Eaves Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0020 - External Movement (2.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/Eaves Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0021 - External Movement (4.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/Eaves Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0022 - External Movement (4.27 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4.27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00F/Eaves Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0023 - External Movement (12.3 m2)						
No Asbestos						
B00G - R0024 - External Movement (2.9 m2)						
No Asbestos						
B00G - R9001 - Sport Equipment Store (28.16 m2)						
No Asbestos						
B00G - R9002 - Movement (7.61 m2)						
No Asbestos						
B00G - R9003 - General Storeroom (7.56 m2)						
No Asbestos						
B00G - R9004 - Sport Equipment Store (19.12 m2)						
No Asbestos						
B00G - R9005 - Sport Equipment Store (19.43 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Agricultural Science - 2003 - Brick/Veneer (Brick/Veneer)**Exterior**

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

Ceiling Voids	No Asbestos Found
---------------	-------------------

Underfloor Voids	No Asbestos Found
------------------	-------------------

Interior**B00H - R0001 - External Movement (25.78 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8116/B001/R0001/Ceiling Structures/Linings/S17

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00H - R0002 - Shower/Change (8.07 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8116/B001/R0001/Ceiling Structures/Linings/S17

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00H - R0003 - General Learning Space (21.21 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8116/B001/R0001/Ceiling Structures/Linings/S17

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00H - R0004 - General Storeroom (14.48 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8116/B001/R0001/Ceiling Structures/Linings/S17

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00H - R0005 - Shower/Change (8.12 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8116/B001/R0001/Ceiling Structures/Linings/S17

Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Agricultural Science - 2003 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	2m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B001/R0001/Ceiling Structures/Linings/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B001 - R0001 - Class Tools Storage (14.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B001/R0001/Ceiling Structures/Linings/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0002 - Machine Storage (7.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B001/R0001/Ceiling Structures/Linings/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0003 - General Storeroom (6.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B001/R0001/Ceiling Structures/Linings/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0004 - General Storeroom (1.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B001/R0001/Ceiling Structures/Linings/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0005 - Covered Area (25.76 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Administration/General Learning - 1927 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids Non Accessible Area
 - Area inaccessible

Interior

B00M - M1003 - Seminar (11.14 m2)

No Asbestos

B00M - M1004 - Seminar (11.27 m2)

No Asbestos

B00M - M1005 - Movement (5.66 m2)

No Asbestos

B00M - M1006 - Seminar (9.25 m2)

No Asbestos

B00M - M1007 - Seminar (9.27 m2)

No Asbestos

B00M - M1008 - Movement (5.65 m2)

No Asbestos

B00M - M1009 - Stairs (6.19 m2)

No Asbestos

B00M - M1010 - Stairs (6.19 m2)

No Asbestos

B00M - R0001 - Public Entry (2.68 m2)

No Asbestos

B00M - R0002 - Movement (19.54 m2)

Ceiling Structures/Linings Flat AC Sheeting 20m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

8116/B00M/R0002/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00M - R0004 - No Access (0.77 m2)

No Asbestos

B00M - R0005 - Movement (3.04 m2)

No Asbestos

B00M - R0006 - General Storeroom (7.84 m2)

No Asbestos

B00M - R0007 - Leading Teacher (11.18 m2)

No Asbestos

B00M - R0009 - Deputy Principal Office (13.06 m2)

No Asbestos

B00M - R0010 - Interview/Office - Type 1 (16.47 m2)

No Asbestos

B00M - R0011 - General Storeroom (2.41 m2)

No Asbestos

B00M - R0012 - Staff - Toilet (2.42 m2)

No Asbestos

B00M - R0013 - Staff - Toilet (2.47 m2)

No Asbestos

B00M - R0014 - General Storeroom (13.1 m2)

No Asbestos

B00M - R0015 - Administration - Clerical (11.63 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00M - R0016 - Duplicating Workroom (28.19 m2)						
No Asbestos						
B00M - R0018 - General Learning Space (49.17 m2)						
No Asbestos						
B00M - R0019 - General Learning Space (54.28 m2)						
No Asbestos						
B00M - R0020 - General Learning Space (54.34 m2)						
No Asbestos						
B00M - R0021 - General Learning Space (54.34 m2)						
No Asbestos						
B00M - R0022 - Pupil Entry (2.99 m2)						
No Asbestos						
B00M - R0023 - Pupil Entry (2.7 m2)						
No Asbestos						
B00M - R0024 - General Storeroom (18.42 m2)						
No Asbestos						
B00M - R0025 - General Storeroom (7.49 m2)						
No Asbestos						
B00M - R0027 - Staff Study (51.54 m2)						
No Asbestos						
B00M - R0028 - Commonroom (85.62 m2)						
No Asbestos						
B00M - R0029 - Principal Office (23.21 m2)						
No Asbestos						
B00M - R0030 - Administration - Clerical (43.55 m2)						
No Asbestos						
B00M - R0032 - Clinic - Boys (13.1 m2)						
No Asbestos						
B00M - R0033 - Public Entry (18.55 m2)						
No Asbestos						
B00M - R0034 - Maintenance Bulk Store (47.41 m2)						
No Asbestos						
B00M - R0035 - Stairs (5.7 m2)						
No Asbestos						
B00M - R0036 - External Movement (11.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00M/R0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00M - R0037 - Movement (66.85 m2)						
No Asbestos						
B00M - R0038 - Stairs (5.67 m2)						
No Asbestos						
B00M - R0039 - Movement (108.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00M/R0002/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00M - R0040 - Store (7.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8116/B00M/R0040/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00M - R0041 - Lift (2.1 m2)						
No Asbestos						
B00M - R1001 - Senior Seminar (20.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0002/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20.29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0040/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
B00M - R1002 - Movement (9.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0002/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00M - R1003 - General Storeroom (8.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0040/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0002/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00M - R1005 - Workroom (59.2 m2)						
No Asbestos						
B00M - R1006 - Librarian (12.05 m2)						
No Asbestos						
B00M - R1007 - Staff Study (45.64 m2)						
No Asbestos						
B00M - R1009 - Movement (10.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0002/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00M - R1010 - General Storeroom (20.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0002/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0040/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
B00M - R1011 - Distribution Board Cupboard (0.73 m2)						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R1011/Wall Linings Internal/S3				Chrysotile (white asbestos)	
B00M - R1012 - Stairs (3.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8116/B00M/R0002/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	
B00M - R1013 - Careers Advisers Office (12.38 m2)						
No Asbestos						
B00M - R1014 - Main Area (373.19 m2)						
No Asbestos						
B00M - R1015 - Stairs (0.18 m2)						
No Asbestos						
B00M - R1016 - Stairs (0.18 m2)						
No Asbestos						
B00M - R1017 - Stairs (3.49 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00M - R1018 - Staff - Toilet (4.04 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8116/B00M/R0002/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00M - R1019 - Staff - Toilet (3.71 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8116/B00M/R0002/Ceiling Structures/Linings/S2

Chrysotile (white asbestos)

B00M - R1020 - Lift (2.1 m2)

No Asbestos

B00M - R1021 - Store (30.37 m2)

No Asbestos

B00M - R1022 - Outdoor Learning Area (84.47 m2)

No Asbestos

B00M - R1023 - Outdoor Learning Area (84.85 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017