


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Griffith High School (8118)
Region : Riverina
State Electorate : Murray
Local Government Area : Griffith

Initial Survey : Noel Arnold & Associates : 16 - Dec - 2009
Reviewed By : Greencap-NAA : 18 - May - 2015

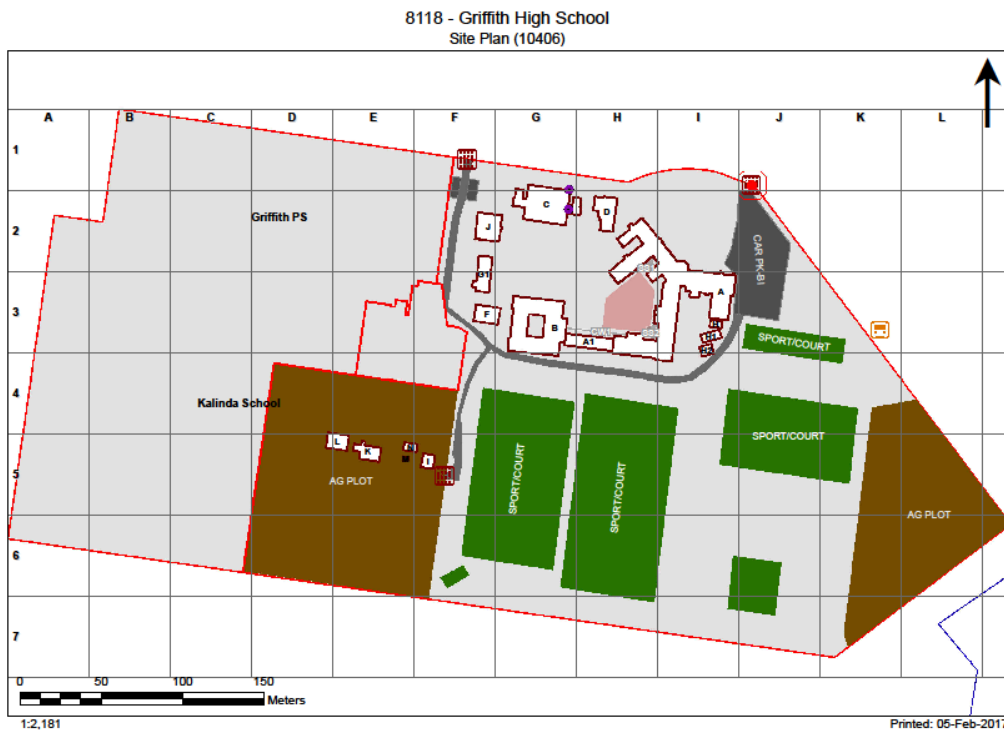

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1934 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction - Extreme Access

Underfloor Voids	No Asbestos Found
------------------	-------------------

Interior**B00A - M0001 - Control Room (10.79 m2)**

No Asbestos

B00A - R0002 - Pupil Entry (28.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8118/B00A/R0005/Ceiling Structures/Linings/S27

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00A - R0004 - Shower/Change (47.87 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8118/B00A/R0005/Ceiling Structures/Linings/S27

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00A - R0005 - Shower/Change (47.77 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8118/B00A/R0005/Ceiling Structures/Linings/S27

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00A - R0006 - General Storeroom (7.85 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

8118/B00A/R0005/Ceiling Structures/Linings/S27

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00A - R0007 - Movement (3.06 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

Assumed Asbestos - Room not identified atoi**B00A - R0008 - Multi-Purpose Space (277.2 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8118/B00A/R0025/Ceiling Structures/Linings/S6				

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Wall Linings Internal	Vermiculite					Limited Samples Taken
		8118/B00A/R0025/Ceiling Structures/Linings/S6				

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00A - R0009 - Sport Equipment Store (17.66 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8118/B00A/R0005/Ceiling Structures/Linings/S27

Chrysotile (white asbestos) , Amosite (brown asbestos)**B00A - R0010 - General Storeroom (7.81 m2)**

No Asbestos

B00A - R0011 - Movement (10.53 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
		8118/B00A/R0025/Ceiling Structures/Linings/S6				

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00A - R0014 - General Storeroom (7.18 m2)**

Safe	Encapsulated Insulation material within unit	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
------	--	-------	-------	----------------------	---------	--------------------

Assumed Asbestos - item inaccessible

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0015 - Principal Office (20.96 m2)						
No Asbestos						
B00A - R0016 - Administration - Clerical (16.26 m2)						
No Asbestos						
B00A - R0017 - Deputy Principal Office (19.55 m2)						
No Asbestos						
B00A - R0018 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Heater Surround	Flat AC Sheeting	1Unit(s)	East	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8118/B00A/R0018/Floor Coverings Res/Textile/S28					
B00A - R0019 - General Learning Space (52.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Heater Surround	Flat AC Sheeting	1Unit(s)	East	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8118/B00A/R0018/Floor Coverings Res/Textile/S28					
B00A - R0020 - General Learning Space (52.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8118/B00A/R0018/Floor Coverings Res/Textile/S28					
B00A - R0021 - General Learning Space (52.92 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Heater Surround	Flat AC Sheeting	1Unit(s)	East	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8118/B00A/R0018/Floor Coverings Res/Textile/S28					
B00A - R0022 - External Movement (1.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0022/Ceiling Structures/Linings/S47					Chrysotile (white asbestos)
B00A - R0023 - General Learning Space (66.31 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Infill Panel To Gas Heater	Flat AC Sheeting	1Unit(s)	East	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8118/B00A/R0024/Infill Panel To Gas Heater/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Adhesive					
8118/B00A/R0018/Floor Coverings Res/Textile/S28				No Asbestos Detected		
B00A - R0024 - General Learning Space (66.31 m2)						
Heater Surround	Flat AC Sheeting	1Unit(s)	West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8118/B00A/R0024/Infill Panel To Gas Heater/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Floor Coverings Res/Textile	Adhesive					
8118/B00A/R0018/Floor Coverings Res/Textile/S28				No Asbestos Detected		
B00A - R0025 - Special Learning Space (72.69 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Heater Surround	Flat AC Sheeting	1Unit(s)	East	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8118/B00A/R0024/Infill Panel To Gas Heater/S7				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Adhesive					
8118/B00A/R0018/Floor Coverings Res/Textile/S28				No Asbestos Detected		
B00A - R0026 - Pupil Entry (11.6 m2)						
No Asbestos						
B00A - R0028 - General Storeroom (5.74 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
B00A - R0030 - Cleaning Store - Distributed (5.81 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
B00A - R0032 - General Storeroom (1.21 m2)						
No Asbestos						
B00A - R0033 - Movement (10.2 m2)						
No Asbestos						
B00A - R0035 - Distribution Board Cupboard (1.31 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R0035/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Backing Board	Non Accessible Area - Electrical Hazard					
B00A - R0038 - Interview/Office - Type 1 (12.01 m2)						
No Asbestos						
B00A - R0040 - Cleaning Store - Distributed (5.9 m2)						
No Asbestos						
B00A - R0041 - Cleaning Supplies Store (11.94 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8118/B00A/R0005/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0042 - Movement (12.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8118/B00A/R0005/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0043 - Staff Study (14.89 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R0043/Floor Coverings Res/Textile/S31				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive attached to sample 31					
8118/B00A/R0043/Floor Coverings Res/Textile/S45				No Asbestos Detected		
B00A - R0044 - Clinic - Girls (11.41 m2)						
No Asbestos						
B00A - R0045 - Clinic-Toilets (3.28 m2)						
No Asbestos						
B00A - R0046 - Staff - Toilet (4.34 m2)						
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R0047/Wall Linings Internal/S29				Chrysotile (white asbestos)		
B00A - R0047 - Staff - Toilet (3.6 m2)						
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R0047/Wall Linings Internal/S29				Chrysotile (white asbestos)		
B00A - R0048 - Commonroom (121.52 m2)						
No Asbestos						
B00A - R0049 - Staff Kitchen (10.39 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R0049/Partition Walls (Cubicles)/S11				Chrysotile (white asbestos)		
B00A - R0050 - Clinic - Boys (15.12 m2)						
No Asbestos						
B00A - R0051 - Staff Study (14.61 m2)						
No Asbestos						
B00A - R0052 - Cleaning Supplies Store (14.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Room refurbished with 53. Now						
B00A - R0053 - Cleaning Store - Distributed (4.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Room refurbished with 52. Now						
B00A - R0054 - External Movement (4.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R0022/Ceiling Structures/Linings/S47				Chrysotile (white asbestos)		
B00A - R0055 - General Learning Space (51.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8118/B00A/R0058/Ceiling Structures/Linings/S48				No Asbestos Detected		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8118/B00A/R0018/Floor Coverings Res/Textile/S28					No Asbestos Detected
B00A - R0056 - General Learning Space (51.06 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8118/B00A/R0058/Ceiling Structures/Linings/S48					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8118/B00A/R0018/Floor Coverings Res/Textile/S28					No Asbestos Detected
B00A - R0057 - General Storeroom (21.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8118/B00A/R0058/Ceiling Structures/Linings/S48					No Asbestos Detected
B00A - R0058 - General Learning Space (51.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8118/B00A/R0058/Ceiling Structures/Linings/S48					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8118/B00A/R0018/Floor Coverings Res/Textile/S28					No Asbestos Detected
B00A - R0059 - General Learning Space (51.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8118/B00A/R0058/Ceiling Structures/Linings/S48					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8118/B00A/R0018/Floor Coverings Res/Textile/S28					No Asbestos Detected
B00A - R0060 - Chair Store (8.69 m2)						
No Asbestos						
B00A - R0061 - External Movement (2.61 m2)						
No Asbestos						
B00A - R0062 - Stairs (5.37 m2)						
No Asbestos						
B00A - R0063 - Stairs (5.92 m2)						
No Asbestos						
B00A - R0064 - Movement (1.84 m2)						
No Asbestos						
B00A - R0066 - Stairs (0.44 m2)						
No Asbestos						
B00A - R0067 - Covered Area (26.44 m2)						
No Asbestos						
B00A - R0068 - Covered Area (26.5 m2)						
No Asbestos						
B00A - R0069 - External Movement (3.02 m2)						
No Asbestos						
B00A - R0070 - Stairs (1.87 m2)						
No Asbestos						
B00A - R0071 - External Movement (1.58 m2)						
No Asbestos						
B00A - R0072 - External Movement (1.25 m2)						
No Asbestos						
B00A - R0073 - Stage (72.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8118/B00A/R0073/Ceiling Structures/Linings/S26					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0074 - Control Room (1.85 m2)						
No Asbestos						
B00A - R0075 - Staff Study (8.03 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R0005/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0076 - Staff - Toilet (2.51 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R0005/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0077 - External Movement (2.2 m2)						
No Asbestos						
B00A - R0078 - External Movement (16.91 m2)						
No Asbestos						
B00A - R0079 - Public Entry (90.52 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0080 - General Storeroom (1.57 m2)						
No Asbestos						
B00A - R0081 - Stairs (0.23 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0082 - Movement (5.63 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0083 - Movement (110.2 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
8118/B00A/R0083/Floor Coverings Res/Textile/S30				No Asbestos Detected		
B00A - R0084 - Distribution Board Cupboard (0.42 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R0085 - Administration - Clerical (60.61 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0086 - Movement (16.97 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0087 - Movement (115.15 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00A/R0025/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0088 - External Movement (1.88 m2)						
No Asbestos						
B00A - R0089 - External Movement (1.82 m2)						
No Asbestos						
B00A - R0090 - External Movement (2.25 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0091 - External Movement (2.3 m2)						
No Asbestos						
B00A - R0092 - Staff - Toilet (1.67 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0093 - Toilet - Lobby (2.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0094 - Toilet - Lobby (4.72 m2)						
No Asbestos						
B00A - R0095 - Staff - Toilet (4.62 m2)						
No Asbestos						
B00A - R1001 - Interview/Office - Type 1 (8.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R1001/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)
B00A - R1002 - General Learning Space (86.16 m2)						
No Asbestos						
B00A - R1003 - Senior Study (21.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0043/Floor Coverings Res/Textile/S31					Chrysotile (white asbestos)
B00A - R1004 - Staff Study (16.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0043/Floor Coverings Res/Textile/S31					Chrysotile (white asbestos)
B00A - R1005 - Cleaning Store - Distributed (2.47 m2)						
No Asbestos						
B00A - R1006 - Special Learning Space (52.48 m2)						
No Asbestos						
B00A - R1007 - General Learning Space (53.33 m2)						
No Asbestos						
B00A - R1008 - Movement (87.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0043/Floor Coverings Res/Textile/S31					Chrysotile (white asbestos)
B00A - R1009 - Plant (27.35 m2)						
Gaskets to AHU	Gasket Material					
	8118/B00A/R1009/Gaskets to AHU/S32					No Asbestos Detected
B00A - R1010 - Administration - Clerical (18.99 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1011 - Movement (161.53 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1012 - General Storeroom (3.15 m2)						
No Asbestos						
B00A - R1013 - Staff Kitchen (4.9 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1014 - Staff Study (33.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1015 - General Storeroom (25.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
Benchtop	Vinyl Sheet					
	8118/B00A/R1015/Benchtop/S44					No Asbestos Detected
B00A - R1016 - Materials Technology L.S. (66.76 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Heater Surround	Flat AC Sheeting	1Unit(s)	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1017 - Resource/Project Store (11.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1018 - General Storeroom (5.17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1019 - General Storeroom (5.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1020 - General Learning Space (66.82 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Heater Surround	Flat AC Sheeting	1Unit(s)	South	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					No Asbestos Detected
B00A - R1021 - Computer Learning Space (71.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Heater Surround	Flat AC Sheeting	1Unit(s)	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					
B00A - R1022 - Music Store (7.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					
B00A - R1023 - General Storeroom (7.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					
B00A - R1024 - General Learning Space (67.3 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Heater Surround	Flat AC Sheeting	1Unit(s)	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					
B00A - R1025 - General Learning Space (65.98 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Heater Surround	Flat AC Sheeting	1Unit(s)	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					
B00A - R1026 - Computer Learning Space (72.7 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8118/B00A/R0025/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Heater Surround	Flat AC Sheeting	1Unit(s)	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00A/R0024/Infill Panel To Gas Heater/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					
B00A - R1027 - Interview/Office - Type 1 (7.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8118/B00A/R1014/Floor Coverings Res/Textile/S33					
B00A - R1028 - General Storeroom (6.86 m2)						
No Asbestos						
B00A - R1029 - General Storeroom (7.04 m2)						
No Asbestos						
B00A - R1030 - General Storeroom (6.88 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1031 - Staff - Toilet (4.71 m2)

Ceiling Structures/Linings Vermiculite
 8118/B00A/R0025/Ceiling Structures/Linings/S6 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R1032 - Cleaning Store - Distributed (1.04 m2)

Ceiling Structures/Linings Flat AC Sheeting 2m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8118/B00A/R1009/Ceiling Structures/Linings/S14 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00A - R1034 - Distribution Board Cupboard (0.37 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Flat AC Sheeting 1m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8118/B00A/R1009/Ceiling Structures/Linings/S14 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

Electrical Backing Board Non Accessible Area
 - Electrical Hazard

B00A - R1036 - Staff - Toilet (5.22 m2)

No Asbestos

B00A - R1037 - Duplicating Workroom (12.49 m2)

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)
 8118/B00A/R1014/Floor Coverings Res/Textile/S33 **No Asbestos Detected**

B00A - R1038 - General Storeroom (15.8 m2)

No Asbestos

B00A - R1039 - Performing Arts Store (9.35 m2)

No Asbestos

B00A - R1040 - General Storeroom (5.86 m2)

No Asbestos

B00A - R1041 - Staff Study (11.99 m2)

No Asbestos

B00A - R1042 - Stairs (13.98 m2)

No Asbestos

B00A - R1043 - Stairs (15.26 m2)

Floor Coverings Res/Textile Vinyl Tiles
 8118/B00A/R1043/Floor Coverings Res/Textile/S34 **No Asbestos Detected**

B00A - R1044 - Stairs (4.65 m2)

No Asbestos

B00A - R1045 - Stairs (10.04 m2)

No Asbestos

B00A - R1046 - Stairs (8.22 m2)

No Asbestos

B00A - R1047 - Staff Study (37.8 m2)

Recently Modified Space Requires Inspection

B00A - R9001 - Materials Store (14.86 m2)

Ceiling Structures/Linings Flat AC Sheeting 15m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8118/B00A/R9002/Ceiling Structures/Linings/S9 **Chrysotile (white asbestos) , Amosite (brown asbestos)**

B00A - R9002 - General Assistants (56.05 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00A/R9002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Sheet					
8118/B00A/R9002/Floor Coverings Res/Textile/S25					No Asbestos Detected	
B00A - R9003 - General Storeroom (31.78 m2)						
No Asbestos						
B00A - R9004 - General Storeroom (15.81 m2)						
No Asbestos						
B00A - R9005 - Sport Equipment Store (47.56 m2)						
Ceiling Structures/Linings	Bituminous membrane					
8118/B00A/R9005/Ceiling Structures/Linings/S24				No Asbestos Detected		
B00A - R9006 - General Storeroom (91.43 m2)						
No Asbestos						
B00A - R9007 - General Storeroom (73.13 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Technological & Applied Studies/Art - 1967 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible. No safe access atoi. Visible from level 2 in BR2027 (Distribution Board Cupboard)					

Interior

B00B - R0001 - Materials Store (30.55 m2)

No Asbestos

B00B - R0002 - External Movement (255.34 m2)

No Asbestos

B00B - R0003 - Distribution Board Cupboard (1.91 m2) Note: No inspection of live electrical installation.

No Asbestos

B00B - R0004 - Plant (32.27 m2)

Gaskets to Boiler	Gasket Material	1Unit(s)	North	Good Condition (1)	Low (1)	Low Priority (2-3)
-------------------	-----------------	----------	-------	--------------------	---------	--------------------

Assumed Asbestos - Boiler presumed removed.

Electrical Backing Board	Non Accessible Area - Electrical Hazard					
--------------------------	--	--	--	--	--	--

B00B - R0005 - General Storeroom (25.02 m2)

Wall Linings Internal	Flat AC Sheeting	8118/B00B/R0005/Wall Linings Internal/S37				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

B00B - R0006 - Art Learning Space (64.75 m2)

Wall Linings Internal	Flat AC Sheeting	8118/B00B/R0005/Wall Linings Internal/S37				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

B00B - R0007 - Toilets-Girls (112.38 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00B/R0009/Partition Walls (Cubicles)/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00B/R0009/Partition Walls (Cubicles)/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0008 - Cleaning Store - Distributed (4.4 m2)

No Asbestos

B00B - R0009 - Toilets-Boys (108.17 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00B/R0009/Partition Walls (Cubicles)/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Wall Linings Internal	Flat AC Sheeting	8118/B00B/R0005/Wall Linings Internal/S37				No Asbestos Detected
-----------------------	------------------	---	--	--	--	-----------------------------

B00B - R0010 - Cleaning Store - Distributed (5.85 m2)

No Asbestos

B00B - R0011 - Student Drinking Facilities (136.81 m2)

No Asbestos

B00B - R0012 - L.P.G. Store (2.26 m2)

No Asbestos

B00B - R0013 - General Storeroom (5.91 m2)

Non Accessible

B00B - R0014 - External Movement (64.31 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0016 - External Stairs (3.1 m2)						
Ceiling Structures/Linings	Vermiculite	4m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8118/B00B/R1019/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)	
B00B - R0017 - Movement (7.13 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0018 - Stairs (0.31 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0019 - Movement (8.85 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1001 - Laboratory L.S. (91.68 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1002 - External Movement (127.04 m2)						
No Asbestos						
B00B - R1005 - General Storeroom (6.09 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00B/R2013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00B - R1006 - Cleaning Store - Distributed (6.04 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00B/R2013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00B - R1007 - General Learning Space (52.08 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00B/R2013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00B - R1008 - Materials Store (12.15 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1009 - Welding Area (19.93 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1010 - Metal Technology Bay (91.61 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1011 - General Storeroom (5.7 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1012 - General Learning Space (58.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1013 - Cleaning Store - Distributed (1.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00B/R2013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1017 - Laboratory L.S. (91.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1018 - Preparation (28.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1019 - Plant Space (9.77 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00B/R1019/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1020 - Staff - Toilet (3.03 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1021 - Distribution Board Cupboard (0.95 m2)						
Electrical Mounting Board	Non Accessible Area - Electrical Hazard					Note: No inspection of live electrical installation.
B00B - R1022 - Staff - Toilet (2.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1023 - Distribution Board Cupboard (0.69 m2)						
No Asbestos						Note: No inspection of live electrical installation.
B00B - R1024 - Stairs (5.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1025 - Stairs (5.72 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1026 - Staff Study (39.23 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00B/R2013/Floor Coverings Res/Textile/S5	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1027 - Preparation - Materials (26.37 m2)						
No Asbestos Found						
B00B - R1028 - Pantry (3.96 m2)						
No Asbestos Found						
B00B - R1029 - Laboratory L.S. (100.05 m2)						
No Asbestos Found						
B00B - R2001 - Resources Store (12.3 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R1019/Floor Coverings Res/Textile/S13	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2002 - External Movement (129.99 m2)						
No Asbestos						
B00B - R2005 - Cleaning Supplies Store (6.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R2013/Floor Coverings Res/Textile/S5	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R2006 - General Storeroom (6.16 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R1019/Floor Coverings Res/Textile/S13	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2007 - General Learning Space (52.36 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00B/R2013/Floor Coverings Res/Textile/S5	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2008 - Music Learning Space (70.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00B/R2013/Floor Coverings Res/Textile/S5	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2009 - Music Store (6.2 m2)						
No Asbestos						
B00B - R2010 - General Storeroom (6.05 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R2013/Floor Coverings Res/Textile/S5	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R2011 - Computer Learning Space (38.88 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00B/R2013/Floor Coverings Res/Textile/S5	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2012 - Cleaning Store - Distributed (1.92 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R2013/Floor Coverings Res/Textile/S5	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2013 - General Storeroom (5.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R2013/Floor Coverings Res/Textile/S5	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2014 - General Learning Space (58.38 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00B/R2013/Floor Coverings Res/Textile/S5	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2015 - General Learning Space (51.85 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00B/R2013/Floor Coverings Res/Textile/S5	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2016 - General Storeroom (6.04 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R1019/Floor Coverings Res/Textile/S13	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2017 - General Storeroom (6.12 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R1019/Floor Coverings Res/Textile/S13	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2018 - General Storeroom (12.68 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R1019/Floor Coverings Res/Textile/S13	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R2019 - General Storeroom (12.71 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00B/R1019/Floor Coverings Res/Textile/S13	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2020 - Design L.S. (67.71 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00B/R2013/Floor Coverings Res/Textile/S5	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2021 - Design L.S. (29.07 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00B/R2013/Floor Coverings Res/Textile/S5	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2024 - Art Learning Space (51.95 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8118/B00B/R2024/Floor Coverings Res/Textile/S36					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive attached to floor tile 8118/B00B/R2024/Floor Coverings Res/Textile/S46	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R2025 - Art Learning Space (65.4 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8118/B00B/R2024/Floor Coverings Res/Textile/S36					No Asbestos Detected
B00B - R2026 - Staff - Toilet (2.95 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2027 - Distribution Board Cupboard (1.07 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Non Accessible Area - Electrical Hazard					
B00B - R2028 - Staff - Toilet (3.35 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2029 - Distribution Board Cupboard (0.72 m2) Note: No inspection of live electrical installation.						
No Asbestos						
B00B - R2030 - Stairs (5.99 m2)						
No Asbestos						
B00B - R2031 - Stairs (5.72 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R2032 - Dark Room (32.41 m2)						
No Asbestos						
B00B - R2033 - Staff Study (39.32 m2)						
Ceiling Structures/Linings	Vermiculite					
	8118/B00B/R0017/Ceiling Structures/Linings/S4					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00B/R2013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library/Science - 1973 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible					
Expansion joint	Resinous Membrane 8118/B00C/R0022/Expansion joint/S39					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B00C - M2001 - Main Area (141.46 m2)

Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00C - M2002 - Interview/Meeting (19.43 m2)

Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00C - M2003 - Interview/Meeting (19.49 m2)

Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

B00C - M2004 - Stairs (2.59 m2)

No Asbestos

B00C - M2005 - Stairs (2.38 m2)

No Asbestos

B00C - R0001 - Plant (20.53 m2)

No Asbestos

B00C - R0003 - General Learning Space (53.66 m2)

Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00C/R0021/Floor Coverings Res/Textile/S2	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00C - R0004 - General Learning Space (59.08 m2)

Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00C/R0021/Floor Coverings Res/Textile/S2	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00C - R0005 - General Learning Space (46.56 m2)

Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	---

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00C/R0021/Floor Coverings Res/Textile/S2	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00C - R0006 - Cleaning Store - Distributed (12.78 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8118/B00C/R0007/Partition Walls (Cubicles)/S38	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	--------------------	--------------------	---------	--

B00C - R0007 - Toilets-Girls (10.36 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00C/R0007/Partition Walls (Cubicles)/S38				Chrysotile (white asbestos)		
B00C - R0008 - Cleaning Store - Distributed (0.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8118/B00C/R0003/Ceiling Structures/Linings/S3				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0009 - Movement (21.97 m2)						
No Asbestos						
B00C - R0010 - Distribution Board Cupboard (0.41 m2)						
				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Electrical Backing Board	Non Accessible Area - Electrical Hazard					
B00C - R0011 - Staff - Toilet (3.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8118/B00C/R0025/Ceiling Structures/Linings/S1				No Asbestos Detected		
B00C - R0012 - Staff - Toilet (3.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8118/B00C/R0025/Ceiling Structures/Linings/S1				No Asbestos Detected		
B00C - R0013 - Staff Study (33.3 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00C/R0003/Ceiling Structures/Linings/S3				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00C - R0014 - General Storeroom (14.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00C - R0015 - General Learning Space (40.78 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00C/R0003/Ceiling Structures/Linings/S3				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	41m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00C - R0016 - General Storeroom (18.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00C - R0017 - Lift (0.52 m2)						
No Asbestos						
B00C - R0018 - General Learning Space (59.29 m2)						
Ceiling Structures/Linings	Vermiculite					
8118/B00C/R0003/Ceiling Structures/Linings/S3				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0019 - General Learning Space (53.73 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8118/B00C/R0021/Floor Coverings Res/Textile/S2	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0020 - Plant (16.93 m2)						
No Asbestos						
B00C - R0021 - Movement (83.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00C/R0021/Floor Coverings Res/Textile/S2	83m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0022 - Main Switchroom (20.2 m2)						
Expansion joint	Resinous Membrane 8118/B00C/R0022/Expansion joint/S39					No Asbestos Detected
Kiln	Non Accessible Area - Area inaccessible					
B00C - R0023 - Stairs (14.98 m2)						
No Asbestos						
B00C - R0024 - Stairs (14.99 m2)						
No Asbestos						
B00C - R0025 - Movement (22.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8118/B00C/R0025/Ceiling Structures/Linings/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 8118/B00C/R0025/Ceiling Structures/Linings/S1					No Asbestos Detected
B00C - R1002 - Laboratory L.S. (91.02 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00C/R0021/Floor Coverings Res/Textile/S2	91m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1005 - Distribution Board Cupboard (0.41 m2)						
Electrical Backing Board	Non Accessible Area - Electrical Hazard					Note: No inspection of live electrical installation.
B00C - R1006 - Laboratory L.S. (90.92 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8118/B00C/R0021/Floor Coverings Res/Textile/S2	91m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1007 - Cleaning Store - Distributed (1.96 m2)						
No Asbestos						
B00C - R1009 - Laboratory L.S. (90.64 m2)						
Ceiling Structures/Linings	Vermiculite 8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00C - R1010 - Staff Study (45.5 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8118/B00C/R0003/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1011 - Lift (1.08 m2)						
No Asbestos						
B00C - R1012 - Laboratory L.S. (90.92 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8118/B00C/R0003/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1013 - Movement (56.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8118/B00C/R0021/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00C - R1014 - Stairs (21.38 m2)						
No Asbestos						
B00C - R1015 - Stairs (21.38 m2)						
No Asbestos						
B00C - R1016 - Movement (36.94 m2)						
No Asbestos						
B00C - R1017 - Movement (3.28 m2)						
No Asbestos						
B00C - R1018 - Movement (1.77 m2)						
No Asbestos						
B00C - R1020 - Preparation - Science (48.11 m2)						
No Asbestos Found						
B00C - R1021 - Store (13.11 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1022 - Movement (21.58 m2)						
Recently Modified Space	Requires Inspection					
B00C - R2002 - Cleaning Store - Distributed (2.51 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8118/B00C/R0003/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R2003 - Main Area (384.54 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8118/B00C/R0003/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R2006 - Staff - Toilet (3.63 m2)						
No Asbestos						
B00C - R2007 - Distribution Board Cupboard (0.4 m2)						
					Note: No inspection of live electrical installation.	
Electrical Backing Board	Non Accessible Area - Electrical Hazard					
B00C - R2008 - Movement (36.81 m2)						
No Asbestos						
B00C - R2009 - Distribution Board Cupboard (0.4 m2)						
					Note: No inspection of live electrical installation.	
Electrical Backing Board	Non Accessible Area - Electrical Hazard					
B00C - R2010 - Staff - Toilet (3.63 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00C - R2013 - Audio Visual Workroom (28.24 m2)

Ceiling Structures/Linings	Vermiculite					
	8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00C/R0021/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00C - R2014 - Workroom (9.36 m2)

Ceiling Structures/Linings	Vermiculite					
	8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00C/R0021/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00C - R2015 - Librarian (9.3 m2)

Ceiling Structures/Linings	Vermiculite					
	8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00C/R0021/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00C - R2016 - Workroom (18.86 m2)

Ceiling Structures/Linings	Vermiculite					
	8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00C/R0021/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00C - R2017 - General Storeroom (9.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8118/B00C/R0021/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00C - R2018 - Stairs (10.7 m2)

No Asbestos

B00C - R2019 - Stairs (10.68 m2)

No Asbestos

B00C - R2020 - Stairs (1.66 m2)

No Asbestos

B00C - R2021 - Stairs (1.63 m2)

No Asbestos

B00C - R2022 - Movement (36.72 m2)

No Asbestos

B00C - R2023 - Movement (2.32 m2)

No Asbestos

B00C - R2024 - Seminar (24.88 m2)

Ceiling Structures/Linings	Vermiculite					
	8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00C - R2025 - Seminar (24.81 m2)

Ceiling Structures/Linings	Vermiculite					
	8118/B00C/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00C - Room+1 - Added Room

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Technological & Applied Studies - 1934 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Food Technology L.S. (71.61 m2)

Floor Coverings Res/Textile	Vinyl Sheet	8118/B00D/R0001/Floor Coverings Res/Textile/S40				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet	8118/B00D/R0001/Floor Coverings Res/Textile/S41				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8118/B00D/R0001/Floor Coverings Res/Textile/S42				No Asbestos Detected
Floor Coverings Res/Textile	Paper	8118/B00D/R0001/Floor Coverings Res/Textile/S43				No Asbestos Detected

B00D - R0004 - Pupil Entry (2.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00D/R0004/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00D/R0004/Wall Linings Internal/S16					Chrysotile (white asbestos)	

B00D - R0005 - Movement (15.36 m2)

No Asbestos

B00D - R0009 - Pupil Entry (1.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8118/B00D/R0004/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

B00D - R0011 - General Storeroom (1.06 m2)

Floor Coverings Res/Textile	Vinyl Sheet	8118/B00D/R0001/Floor Coverings Res/Textile/S41				No Asbestos Detected
-----------------------------	-------------	---	--	--	--	----------------------

B00D - R0012 - General Storeroom (1.04 m2)

Floor Coverings Res/Textile	Vinyl Sheet	8118/B00D/R0001/Floor Coverings Res/Textile/S41				No Asbestos Detected
-----------------------------	-------------	---	--	--	--	----------------------

B00D - R0013 - Food Technology L.S. (73.93 m2)

Floor Coverings Res/Textile	Paper	8118/B00D/R0001/Floor Coverings Res/Textile/S43				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8118/B00D/R0001/Floor Coverings Res/Textile/S42				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet	8118/B00D/R0001/Floor Coverings Res/Textile/S41				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet	8118/B00D/R0001/Floor Coverings Res/Textile/S40				No Asbestos Detected

B00D - R0014 - Staff Study (26.65 m2)

Recently Modified Space Requires Inspection

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - R0015 - Movement (8.06 m2)

Recently Modified Space Requires Inspection

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies - 1912 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible. Visible but not accessible due to clearance and metal fence					

Interior

B00F - R0001 - Materials Store (11.96 m2)

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00F/R0001/Wall Linings Internal/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8118/B00F/R0006/Ceiling Structures/Linings/S19					

B00F - R0002 - Welding Area (10.61 m2)

Wall Linings Internal	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00F/R0001/Wall Linings Internal/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0003 - Metal Technology Bay (11.17 m2)

Wall Linings Internal	Flat AC Sheeting	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B00F/R0001/Wall Linings Internal/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0004 - Materials Technology L.S. (83.32 m2)

No Asbestos

B00F - R0005 - Computer Learning Space (17.41 m2)

No Asbestos

B00F - R0006 - Pupil Entry (3.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8118/B00F/R0006/Ceiling Structures/Linings/S19					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Physical Education - 1993 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Sport Equipment Store (29.79 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Agricultural Science - 1966 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B001/R0003/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior**B001 - R0001 - Class Tools Storage (7.86 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B001/R0003/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B001 - R0002 - Staff Study (22.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8118/B001/R0003/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B001/R0002/Electrical Mounting Board/S22				Chrysotile (white asbestos)	

B001 - R0003 - Machine Storage (17.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	8118/B001/R0003/Ceiling Structures/Linings/S21				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B001 - R0004 - General Storeroom (12.74 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Performing Arts - 2007 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible. Built in 2007
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00J - R0001 - Audio Visual Workroom (76.93 m2)

No Asbestos

B00J - R0002 - Performing Arts Changeroom (11.59 m2)

No Asbestos

B00J - R0003 - Control Room (3.51 m2)

No Asbestos

B00J - R0004 - Music Store (25.72 m2)

No Asbestos

B00J - R0005 - Practice/Seminar (11.29 m2)

No Asbestos

B00J - R0006 - Practice/Seminar (11.35 m2)

No Asbestos

B00J - R0007 - Audio Visual Workroom (79.64 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Agricultural Science - 1970 - Steel (Steel)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00K - R0001 - Animal Space (12.54 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00K - R0002 - Animal Space (36.73 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00K - R0003 - Animal Space (17.56 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00K - R0004 - Movement (11.37 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00K - R0005 - Machine Storage (9.53 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00K - R0006 - Animal Space (29.89 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00K - R0007 - Covered Area (4.64 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Agricultural Science/Mechanica - 1990 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00L - R0001 - Animal Space (50.81 m2)

No Asbestos

B00L - R0002 - Movement (16.85 m2)

No Asbestos

B00L - R0003 - Chemical Store (12.5 m2)

No Asbestos

B00L - R0004 - Machine Storage (36.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Agricultural Science - 1988 - Greenhouse (Greenhouse)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00M - R0001 - Agriculture Covered Area (7.07 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Agricultural Science - 1988 - Greenhouse (Greenhouse)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00N - R0001 - Agriculture Covered Area (40.45 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A1 - Pupil Facilities/General Learning - 1966 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	18m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B0A1/R0004/Ceiling Structures/Linings/S35			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Non Accessible Area - Roof space visible from access hatch in AR0004 only					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B0A1 - R0001 - Student Canteen (41.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B0A1/R0004/Ceiling Structures/Linings/S35			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B0A1 - R0002 - Student Canteen (38.93 m2)

No Asbestos

B0A1 - R0003 - Public Entry (4.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B0A1/R0004/Ceiling Structures/Linings/S35			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B0A1 - R0004 - Staff - Toilet (5.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B0A1/R0004/Ceiling Structures/Linings/S35			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Incinerator	Millboard	1Unit	to wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B0A1 - R0005 - General Learning Space (62.26 m2)

No Asbestos

B0A1 - R0007 - Movement (19.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B0A1/R0004/Ceiling Structures/Linings/S35			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B0A1 - R0008 - Movement (23.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8118/B0A1/R0004/Ceiling Structures/Linings/S35			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0G1 - Technological & Applied Studies - 2005 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0G1 - R0001 - Materials Technology L.S. (112.09 m2)

No Asbestos

B0G1 - R0002 - Resource/Project Store (44.71 m2)

No Asbestos

B0G1 - R0003 - Dust Extraction Space (7.49 m2)

No Asbestos

B0G1 - R0004 - Wood Technology Bay (6.57 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0H1 - Building Services - 2006 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B0H1 - R0001 - General Storeroom (59.41 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0H2 - Building Services - 2006 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B0H2 - R0001 - General Storeroom (44.58 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 505 - D12429 - Admin Staff/Principal/Secure Store : Placement Date - 7/12/2012

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R3 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos		20 m2
---------	---------------	------------------	--	-------

R4 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

R5 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2

OS 601 - D12430 - Learning Unit - Standard/Withdrawal : Placement Date - 7/12/2012

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

OS 750 - D12433 - Learning Unit - ESL : Placement Date - 7/12/2012

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		5.76 m2

Interior

R1 - Es1

End wall panel	Flat AC Sheet	Assumed Asbestos		50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		36 m2

OS 531 - D12473 - Library : Placement Date - 7/12/2012

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
-------------	---------------------	------------------	--	---------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry/classroom						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				63 m2
R2 - Reading Area/workroom						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 843 - D16622 - Country Toilet - Reltb - Boys/Girls : Placement Date - 7/12/2012						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
Interior						
R1 - Staff Toilet						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - Staff Toilet						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
R3 - Female toilet						
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017