


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Gunnedah High School (8188)
Region : New England
State Electorate : Tamworth
Local Government Area : Gunnedah

Initial Survey : Noel Arnold & Associates : 16 - Dec - 2009
Reviewed By : Greencap-NAA : 15 - May - 2015

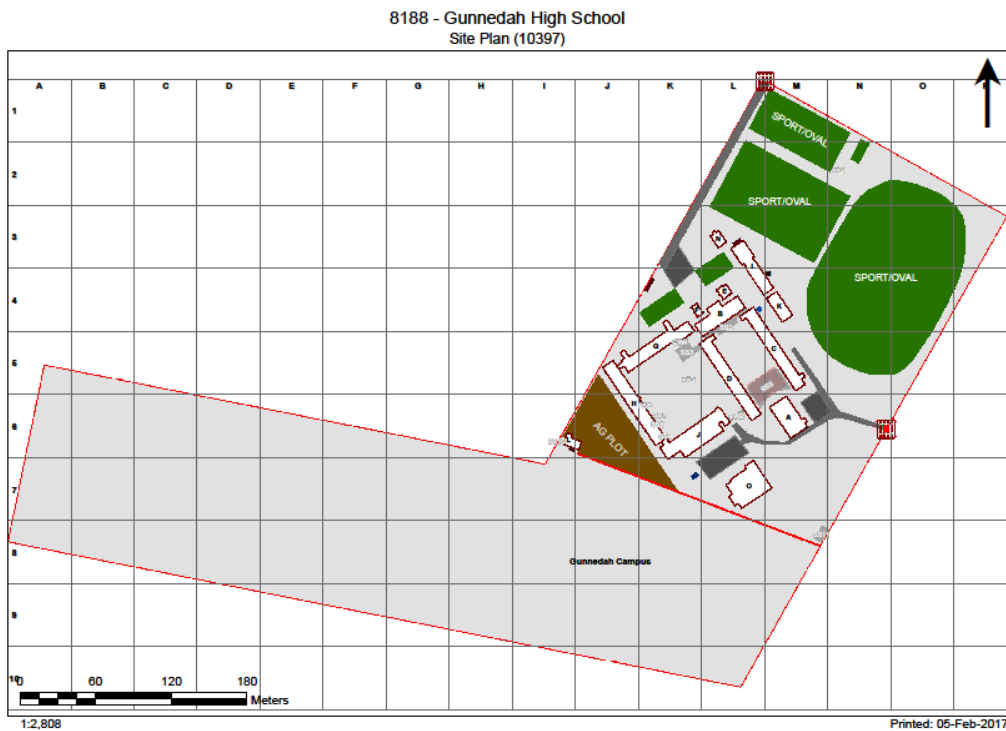

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Multi Purpose Facilities - 1988 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting	28m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/In-fill-panel/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/R0001/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

Interior**B00A - M0001 - Control Room (21.8 m2)**

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/M0001/Wall Linings Internal/S27				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Electrical Backing Board	Resinous Board	0.5m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/M0001/Electrical Backing Board/S28				Chrysotile (white asbestos)	

B00A - M0002 - Control Room (22.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/M0002/Ceiling Structures/Linings/S49				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0001 - External Movement (14.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/R0001/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00A - R0003 - Movement (14.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/R0001/Ceiling Structures/Linings/S24				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00A - R0004 - Multi-Purpose Space (253.76 m2)

No Asbestos

B00A - R0005 - Movement (6.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/R0012/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0006 - Staff - Toilet (1.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/R0012/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/In-fill-panel/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0007 - Performing Arts Changeroom (11.86 m2)


Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R0012/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/In-fill-panel/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0008 - Stage (71.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R0012/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0009 - Movement (6.74 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R0012/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0010 - Staff - Toilet (1.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R0012/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0011 - Performing Arts Changeroom (11.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R0012/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0012 - Student Canteen (22.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22.98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R0012/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0013 - Cleaning Store - Distributed (1.19 m2)						
Wall Linings Internal	Flat AC Sheeting					
8188/B00A/R0013/Wall Linings Internal/S26				No Asbestos Detected		
B00A - R0014 - Main Switch Board Cupboard (5.71 m2)						
No Asbestos						
B00A - R9001 - General Storeroom (13.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R9004/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R9002 - Main Switchroom (4.15 m2)						
Electrical Backing Board	Resinous Board	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Conduit	Fibre Cement Pipe	0.6m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R9002/Conduit/S22				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Cable	Resinous Membrane					
8188/B00A/R9002/Cable/S23				No Asbestos Detected		
B00A - R9003 - Main Switchroom (58.22 m2)						
No Asbestos						
B00A - R9004 - General Storeroom (13.51 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00A/R9004/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - Pupil Facilities - 1961 - Brick/Block (Brick/Block)						
Exterior						
In-fill-panel	Flat AC Sheeting	19m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/In-fill-panel/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground						
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00B/Eaves Linings/S29					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Interior						
B00B - R0001 - Staff Change (4.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00B/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0002 - Staff Change (4.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00B/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0003 - Cleaning Supplies Store (12.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00B/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0005 - Toilets-Boys (48.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00B/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	8188/B00B/R0005/Partition Walls (Cubicles)/S30					
B00B - R0006 - Movement (197.06 m2)						
No Asbestos						
B00B - R0007 - Toilets-Girls (53.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00B/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	8188/B00B/R0005/Partition Walls (Cubicles)/S30					
B00B - R0008 - Shower/Change (40.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00B/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0009 - Sport Equipment Store (10.08 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00B/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0010 - Cleaning Store - Distributed (4.78 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0011 - Cleaning Store - Distributed (4.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0012 - Student Canteen (39.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0013 - Student Canteen (2.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0015 - Staff Change (2.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0016 - Staff - Toilet (1.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0017 - Distribution Board Cupboard (0.26 m2)						
Electrical Backing Board	Resinous Board	.5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard				Note: No inspection of live electrical installation.		
B00B - R0018 - Maintenance Bulk Store (21.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21.33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0019 - Shower (18.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0020 - Office/Store (5.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00B/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		

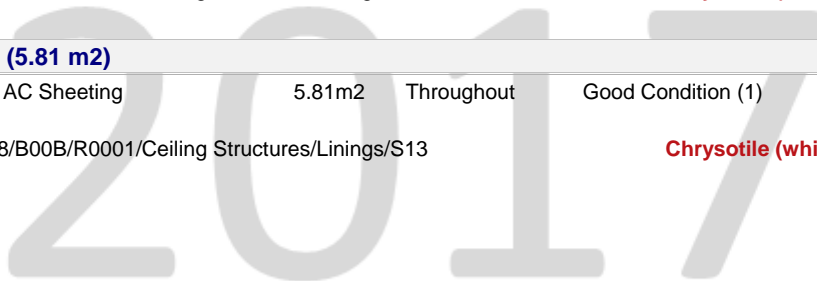

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Various - 1961 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
In-fill-panel	Flat AC Sheeting	200m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/In-fill-panel/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Principal Office (21.91 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8188/B00C/R0032/Floor Coverings Res/Textile/S35					No Asbestos Detected

B00C - R0002 - Staff - Toilet (3.61 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00C/R0002/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0004 - Administration - Clerical (9.37 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8188/B00C/R0032/Floor Coverings Res/Textile/S35					No Asbestos Detected

B00C - R0005 - Interview/Office - Type 1 (9.22 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0006 - Staff - Toilet (4.5 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0007 - Staff - Toilet (1.45 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00C/R0007/Partition Walls (Cubicles)/S36					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0008 - Administration - Clerical (12.36 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00C - R0009 - Staff - Toilet (4.36 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0010 - Staff - Toilet (1.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00C/R0002/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0014 - Laboratory L.S. (84.32 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0018 - Staff Study (17.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0019 - Preparation (8.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0020 - Laboratory L.S. (84.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0022 - Cleaning Store - Distributed (2.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0023 - Staff - Toilet (6.48 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0026 - Distribution Board Cupboard (0.68 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00C - R0027 - External Movement (12.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00C/R0027/Ceiling Structures/Linings/S37					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0028 - Administration - Executive (16.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8188/B00C/R0032/Floor Coverings Res/Textile/S35					No Asbestos Detected
B00C - R0029 - Public Reception (21.87 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00C/R0032/Floor Coverings Res/Textile/S35					No Asbestos Detected
B00C - R0030 - Administration - Clerical (21.53 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0032/Floor Coverings Res/Textile/S35					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00C/R0032/Floor Coverings Res/Textile/S35					No Asbestos Detected
B00C - R0031 - Communications Cupboard (1.32 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0032 - Movement (26.19 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00C/R0032/Floor Coverings Res/Textile/S35					No Asbestos Detected
B00C - R0033 - Distribution Board Cupboard (0.18 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Electrical Hazard</i>
B00C - R0034 - Movement (43.67 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0035 - Movement (21.56 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0036 - Stairs (6.35 m2)						
No Asbestos						
B00C - R0037 - General Storeroom (4.5 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0038 - Preparation - Science (15.1 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0039 - Deputy Principal Office (23.25 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0040 - Other (10.47 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0041 - Student Waiting (9.98 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0042 - Administration - Clerical (26.29 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0043 - Movement (63.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0044 - Stairs (6.92 m2)						
No Asbestos						
B00C - R0045 - Staff Study (41.67 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8188/B00C/R0045/Floor Coverings Res/Textile/S34					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0046 - External Movement (14.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00C/R0027/Ceiling Structures/Linings/S37					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1001 - Cleaning Store - Distributed (6.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00C/R1010/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00C - R1002 - General Learning Space (52.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1003 - General Learning Space (52.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1005 - General Learning Space (52.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1006 - General Learning Space (52.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1007 - General Learning Space (53 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1008 - Seminar (19.26 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1011 - General Storeroom (4.89 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8188/B00C/R1010/Floor Coverings Res/Textile/S3	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1012 - General Learning Space (65.21 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1013 - General Storeroom (4.02 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1014 - Staff Study (21.55 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1015 - General Storeroom (12.81 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0032/Floor Coverings Res/Textile/S35					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1016 - Interview/Office - Type 1 (18.65 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1018 - Uniform Shop (18.2 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00C/R0045/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00C - R1019 - Distribution Board Cupboard (0.25 m2)						
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Note: No inspection of live electrical installation.</i> Assumed Asbestos - Electrical Hazard
B00C - R1020 - Stairs (17.51 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1021 - Interview/Meeting (23.58 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00C/R0045/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00C - R1022 - Movement (145 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00C/R0043/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00C/R0045/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00C - R1023 - Fitness Store (5.95 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite		8188/B00C/R0043/Ceiling Structures/Linings/S33			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)		8188/B00C/R0045/Floor Coverings Res/Textile/S34			No Asbestos Detected
-----------------------------	---	--	---	--	--	----------------------

B00C - R1024 - Stairs (14.72 m2)

Ceiling Structures/Linings	Vermiculite		8188/B00C/R0043/Ceiling Structures/Linings/S33			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1961 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
In-fill-panel	Flat AC Sheeting	200m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/In-fill-panel/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					

Interior**B00D - R0001 - Food Technology L.S. (64.46 m2)**

Ceiling Structures/Linings	Vermiculite	8188/B00D/R0020/Ceiling Structures/Linings/S38				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8188/B00C/R0032/Floor Coverings Res/Textile/S35				No Asbestos Detected	

B00D - R0002 - Cleaning Store - Distributed (4.76 m2)

Ceiling Structures/Linings	Vermiculite	8188/B00D/R0020/Ceiling Structures/Linings/S38				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00D - R0004 - Staff - Toilet (1.45 m2)

Ceiling Structures/Linings	Vermiculite	8188/B00D/R0020/Ceiling Structures/Linings/S38				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	8188/B00D/R0004/Partition Walls (Cubicles)/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)			

B00D - R0005 - Staff Change (3.66 m2)

Ceiling Structures/Linings	Vermiculite	8188/B00D/R0020/Ceiling Structures/Linings/S38				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00D - R0007 - Materials Technology L.S. (65.1 m2)

Ceiling Structures/Linings	Vermiculite	8188/B00D/R0020/Ceiling Structures/Linings/S38				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
Thermacon Heater	Millboard	2Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	
Assumed Asbestos - Item inaccessible							

B00D - R0008 - Resource/Project Store (6.32 m2)

Ceiling Structures/Linings	Vermiculite	8188/B00D/R0020/Ceiling Structures/Linings/S38				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00D - R0009 - Resource/Project Store (3.1 m2)

Ceiling Structures/Linings	Vermiculite	8188/B00D/R0020/Ceiling Structures/Linings/S38				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00D - R0010 - Resource/Project Store (3.1 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0011 - Materials Technology L.S. (65.21 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Millboard	2Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Item inaccessible</i>
B00D - R0012 - Food Technology L.S. (65.77 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Millboard	3Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - item inaccessible</i>
B00D - R0020 - Movement (161.69 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0021 - Stairs (6.22 m2)						
No Asbestos						
B00D - R0024 - Staff Study (40.46 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Millboard	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - item inaccessible</i>
B00D - R0025 - Stairs (6.21 m2)						
No Asbestos						
B00D - R0026 - External Movement (14.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8188/B00D/R0026/Ceiling Structures/Linings/S39	14.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>
B00D - R0027 - Preparation - Materials (18 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0028 - Pantry (3.78 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0029 - Laundry (1.83 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00D - R0030 - Seminar - Type 1 (44.22 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00D/R0020/Ceiling Structures/Linings/S38					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Thermacon Heater	Millboard	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)

Assumed Asbestos - item inaccessible

B00D - R0031 - Food Technology L.S. (83.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0032 - Distribution Board Cupboard (0.17 m2) Note: No inspection of live electrical installation.

No Asbestos

B00D - R0033 - Other (0.52 m2)

No Asbestos

B00D - R1001 - Cleaning Store - Distributed (4.54 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8188/B00D/R1017/Floor Coverings Res/Textile/S8					

B00D - R1002 - General Learning Space (51.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
------------------	-----------	-------	--------------------	----------------------	---------	--------------------

Assumed Asbestos - Area inaccessible

B00D - R1004 - Staff - Toilet (4.84 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00D/R0004/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R1007 - General Learning Space (64.94 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Thermacon Heater	Millboard	2m2	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
------------------	-----------	-----	-------	----------------------	---------	--------------------

Assumed Asbestos - Area inaccessible

B00D - R1008 - General Learning Space (51.48 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R1009 - General Learning Space (51.61 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
------------------	-----------	-------	--------------------	----------------------	---------	--------------------

Assumed Asbestos - Area inaccessible

B00D - R1010 - Materials Technology L.S. (64.39 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Thermacon Heater	Millboard	2Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00D - R1011 - General Storeroom (5.86 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1012 - Materials Store (5.45 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1013 - Distribution Board Cupboard (0.46 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R1014 - General Learning Space (51.62 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00D - R1016 - General Storeroom (4.71 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1017 - Movement (137.76 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8188/B00D/R1017/Floor Coverings Res/Textile/S8					
B00D - R1018 - Stairs (14.83 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1019 - Materials Store (13.72 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1020 - Staff Study (14.91 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1021 - Stairs (32.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R1022 - General Learning Space (58.24 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00D/R0020/Ceiling Structures/Linings/S38					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Millboard	2Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1961 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Area inaccessible

Underfloor Voids - Slab on Ground

Interior

B00E - R0001 - Sport Equipment Store (25.37 m2)

No Asbestos

B00E - R0002 - Toilets-Boys (35.21 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1961 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Area inaccessible

Underfloor Voids - Slab on Ground

Interior

B00F - R0001 - Toilets-Girls (28.52 m2)

No Asbestos

B00F - R0002 - Sport Equipment Store (6.46 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Various - 1961 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					

Interior

B00G - R0001 - Staff - Toilet (2.77 m2)

Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0002 - Staff - Toilet (2.76 m2)

Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0003 - Staff Study (2.88 m2)

Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0004 - General Storeroom (8.18 m2)

Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0005 - Staff Study (33.07 m2)

Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00G/R0009/Floor Coverings Res/Textile/S42					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00G - R0006 - Cleaning Store - Distributed (4.38 m2)

Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00G - R0007 - Distribution Board Cupboard (0.69 m2) Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Electrical Mounting Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00G/R0007/Electrical Mounting Board/S41						Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	4m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00G/R1007/Wall Linings Internal/S40						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00G - R0009 - General Learning Space (57.11 m2)

Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00G/R0009/Floor Coverings Res/Textile/S42					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00G - R0014 - Apparatus Store (25.05 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8188/B00J/R1012/Floor Coverings Res/Textile/S9	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R0016 - Maintenance Bulk Store (2.33 m2)						
No Asbestos						
B00G - R0017 - Maintenance Bulk Store (2.33 m2)						
No Asbestos						
B00G - R0018 - Apparatus Store (16.61 m2)						
No Asbestos						
B00G - R0019 - External Stairs (4.57 m2)						
No Asbestos						
B00G - R0020 - External Movement (194.88 m2)						
No Asbestos						
B00G - R0021 - Resources Store (4.07 m2)						
No Asbestos						
B00G - R0022 - Printing/Photocopying (4.07 m2)						
No Asbestos						
B00G - R0026 - External Stairs (10.58 m2)						
No Asbestos						
B00G - R0027 - Preparation - Science (39.07 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0028 - Laboratory L.S. (91.86 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R0029 - Laboratory L.S. (88.58 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00G/R0001/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00G - R1001 - Practice/Seminar (12.27 m2)						
No Asbestos						
B00G - R1002 - Practice/Seminar (12.21 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8188/B00G/R1002/Floor Coverings Res/Textile/S43	12.21m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1003 - Cleaning Store - Distributed (5.53 m2)						
No Asbestos						
B00G - R1004 - Music Learning Space (66.63 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8188/B00G/R1002/Floor Coverings Res/Textile/S43	66.63m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos)
Thermacon Heater	Millboard	4Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Area inaccessible
B00G - R1005 - Staff Study (25.94 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8188/B00G/R1002/Floor Coverings Res/Textile/S43	25.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00G - R1006 - Music Store (7.55 m2)						
No Asbestos						
B00G - R1007 - Distribution Board Cupboard (0.7 m2)				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	4m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00G/R1007/Wall Linings Internal/S40				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00G - R1008 - General Storeroom (3.88 m2)						
No Asbestos						
B00G - R1009 - Music Learning Space (56.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	56.68m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
8188/B00G/R1002/Floor Coverings Res/Textile/S43				Chrysotile (white asbestos)		
B00G - R1010 - Music Learning Space (53.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	53.57m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
8188/B00G/R1002/Floor Coverings Res/Textile/S43				Chrysotile (white asbestos)		
Thermacon Heater	Millboard	1Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00G - R1011 - Kiln Space (6.32 m2)						
No Asbestos						
B00G - R1012 - Resources Store (5.31 m2)						
No Asbestos						
B00G - R1013 - Art Learning Space (67.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	67.07m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
8188/B00G/R1002/Floor Coverings Res/Textile/S43				Chrysotile (white asbestos)		
Thermacon Heater	Millboard	5Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00G - R1014 - Art Learning Space (56.75 m2)						
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00G - R1015 - Resources Store (6.26 m2)						
No Asbestos						
B00G - R1016 - Resources Store (6.28 m2)						
No Asbestos						
B00G - R1017 - Art Learning Space (51.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00G/R1002/Floor Coverings Res/Textile/S43				Chrysotile (white asbestos)		
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00G - R1018 - External Movement (123.68 m2)						
No Asbestos						
B00G - R1019 - External Stairs (16.5 m2)						
No Asbestos						
B00G - R1020 - External Stairs (15.47 m2)						
No Asbestos						
B00G - R1021 - External Movement (9.98 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - R1022 - Kiln Space (4.76 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Various - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling

Underfloor Voids No Asbestos Found

Interior

B00H - R0001 - Computer Learning Space (51.82 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Thermacon Heater Millboard 2Unit Variable positions Friable Asbestos (5) Low (1) Low Priority (2-3)
Assumed Asbestos - Area inaccessible

B00H - R0002 - Computer Store (6.28 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0003 - Computer Store (6.32 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0004 - General Learning Space (52.93 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Thermacon Heater Millboard 2Unit Variable positions Friable Asbestos (5) Low (1) Low Priority (2-3)
Assumed Asbestos - Area inaccessible

B00H - R0005 - Computer Learning Space (53 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Thermacon Heater Millboard 1Unit Variable positions Friable Asbestos (5) Low (1) Low Priority (2-3)
Assumed Asbestos - Area inaccessible

B00H - R0006 - General Storeroom (6.25 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0007 - Computer Store (6.28 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0008 - General Learning Space (53.36 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Thermacon Heater Millboard 2Unit Variable positions Friable Asbestos (5) Low (1) Low Priority (2-3)
Assumed Asbestos - Area inaccessible

B00H - R0009 - Interview/Office - Type 1 (27.45 m2)

Ceiling Structures/Linings Vermiculite
 8188/B00H/R0001/Ceiling Structures/Linings/S16 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00H - R0010 - Distribution Board Cupboard (0.85 m2)				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00G/R0007/Electrical Mounting Board/S41				Chrysotile (white asbestos)		
B00H - R0011 - Cleaning Store - Distributed (3.21 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R0012 - General Storeroom (6.95 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R0014 - Apparatus Store (9.47 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R0015 - Preparation (29.8 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R0018 - External Stairs (5.63 m2)						
No Asbestos						
B00H - R0019 - Computer Store (13.96 m2)						
Wall Linings Internal	Flat AC Sheeting					
8188/B00H/R0019/Wall Linings Internal/S44				No Asbestos Detected		
B00H - R0020 - External Movement (158.56 m2)						
No Asbestos						
B00H - R0021 - Laboratory L.S. (84.7 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R0022 - Laboratory L.S. (87.19 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1001 - Careers Advisers Office (52.04 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
Floor Coverings Res/Textile	Vinyl Sheet					
8188/B00H/R1015/Floor Coverings Res/Textile/S45				No Asbestos Detected		
B00H - R1002 - General Storeroom (6.25 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1003 - General Storeroom (6.21 m2)						
Ceiling Structures/Linings	Vermiculite					
8188/B00H/R0001/Ceiling Structures/Linings/S16				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	8188/B00H/R1015/Floor Coverings Res/Textile/S45					No Asbestos Detected
B00H - R1004 - General Learning Space (52.78 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Floor Coverings Res/Textile	Vinyl Sheet					
	8188/B00H/R1015/Floor Coverings Res/Textile/S45					No Asbestos Detected
B00H - R1005 - General Learning Space (52.93 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Floor Coverings Res/Textile	Vinyl Sheet					
	8188/B00H/R1015/Floor Coverings Res/Textile/S45					No Asbestos Detected
B00H - R1006 - General Storeroom (6.76 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00H - R1007 - General Storeroom (5.76 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00H - R1008 - General Learning Space (52.57 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Floor Coverings Res/Textile	Vinyl Sheet					
	8188/B00H/R1015/Floor Coverings Res/Textile/S45					No Asbestos Detected
B00H - R1009 - Interview/Office - Type 1 (27.41 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Floor Coverings Res/Textile	Vinyl Sheet					
	8188/B00H/R1015/Floor Coverings Res/Textile/S45					No Asbestos Detected
B00H - R1010 - Distribution Board Cupboard (1 m2)						
Electrical Mounting Board	Resinous Board	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00G/R0007/Electrical Mounting Board/S41					Chrysotile (white asbestos)
B00H - R1011 - Cleaning Store - Distributed (3.17 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1012 - General Storeroom (6.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1013 - General Learning Space (52.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Millboard	NA	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Area inaccessible</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8188/B00H/R1015/Floor Coverings Res/Textile/S45					No Asbestos Detected
B00H - R1014 - General Learning Space (52.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Area inaccessible</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8188/B00H/R1015/Floor Coverings Res/Textile/S45					No Asbestos Detected
B00H - R1015 - General Learning Space (52.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Area inaccessible</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8188/B00H/R1015/Floor Coverings Res/Textile/S45					No Asbestos Detected
B00H - R1016 - General Storeroom (6.23 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1017 - Darkroom Space (51.68 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Area inaccessible</i>						
B00H - R1019 - External Movement (160.64 m2)						
No Asbestos						
B00H - R1020 - General Storeroom (6.23 m2)						
Ceiling Structures/Linings	Vermiculite					
	8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1021 - External Stairs (14.6 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Technological & Applied Studies - 1972 - Brick/Veneer (Brick/Veneer)

Exterior

In-fill-panel	Flat AC Sheeting	100m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00A/In-fill-panel/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	15m2	Northeast & Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00I/Eaves Linings/S32			Chrysotile (white asbestos)		
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground						

Interior

B001 - R0001 - Staff - Toilet (1.45 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B001 - R0002 - General Assistants (10.66 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B001 - R0003 - Materials Store (10.13 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B001 - R0004 - Materials Store (8.62 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B001 - R0005 - Materials Technology L.S. (74.46 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B001 - R0006 - Dust Extraction Space (5.27 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B001 - R0007 - Materials Store (13.45 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B001 - R0008 - Movement (6 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
				Assumed Asbestos - Electrical Hazard		

B001 - R0009 - Materials Technology L.S. (94.62 m2)

Ceiling Structures/Linings	Vermiculite					
	8188/B00K/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B001 - R0010 - Machine Storage (24.57 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B001 - R0018 - Metal Technology Bay (150.56 m2)

No Asbestos

B001 - R0019 - Welding Area (4.12 m2)

No Asbestos

B001 - R0020 - Welding Area (4.19 m2)

No Asbestos

B001 - R0021 - Welding Area (4.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Various - 1961 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0002 - Cleaning Store - Distributed (3.4 m2)**

No Asbestos

B00J - R0003 - Main Switchroom (6.92 m2)

Electrical Mounting Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00G/R0007/Electrical Mounting Board/S41					Chrysotile (white asbestos)	

B00J - R0004 - General Storeroom (25.88 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00J - R0005 - Workroom (32.36 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00J - R0006 - Audio Visual Workroom (29.43 m2)

No Asbestos

B00J - R0007 - Librarian (11.66 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00J - R0008 - Main Area (368.93 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00J - R0009 - Seminar (11.68 m2)

No Asbestos

B00J - R0010 - Seminar (13.57 m2)

No Asbestos

B00J - R0011 - Seminar (12.68 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00J - R0012 - General Storeroom (10.75 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00J - R0013 - Staff Study (27.71 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00J - R0014 - Distribution Board Cupboard (0.75 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00G/R0007/Electrical Mounting Board/S41					Chrysotile (white asbestos)	

B00J - R0015 - Staff - Toilet (4.6 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - R0016 - Toilets-Girls (11.94 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8188/B00D/R0004/Partition Walls (Cubicles)/S7	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R0017 - Toilets-Disabled (12.63 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8188/B00D/R0004/Partition Walls (Cubicles)/S7	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R0019 - External Stairs (5.56 m2)						
No Asbestos						
B00J - R0020 - External Stairs (7.08 m2)						
No Asbestos						
B00J - R0021 - External Movement (17.33 m2)						
No Asbestos						
B00J - R0022 - External Movement (177.38 m2)						
No Asbestos						
B00J - R1001 - Distribution Board Cupboard (0.85 m2)				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board 8188/B00G/R0007/Electrical Mounting Board/S41	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00J - R1002 - Cleaning Store - Distributed (3.08 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R1003 - Interview/Office - Type 1 (13.84 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00J - R1004 - General Learning Space (53.14 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8188/B00J/R1012/Floor Coverings Res/Textile/S9	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Area inaccessible
B00J - R1005 - General Learning Space (53.15 m2)						
Ceiling Structures/Linings	Vermiculite 8188/B00H/R0001/Ceiling Structures/Linings/S16					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Item inaccessible

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	53.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00J/R1012/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00J - R1006 - General Learning Space (53.28 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00J/R1012/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00J - R1007 - General Learning Space (53.36 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00J/R1012/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00J - R1008 - General Storeroom (6.12 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00J/R1012/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00J - R1009 - Commonroom (74.52 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
Floor Coverings Res/Textile	Vinyl Tiles	72.52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00J/R1012/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00J - R1010 - Distribution Board Cupboard (0.75 m2)						
				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00G/R0007/Electrical Mounting Board/S41				Chrysotile (white asbestos)		
B00J - R1011 - Staff - Toilet (4.31 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00J - R1012 - Staff Study (26.17 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00H/R0001/Ceiling Structures/Linings/S16				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00J/R1012/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						
B00J - R1014 - External Movement (151.5 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00J - R1015 - Store (3.94 m2)

No Asbestos

B00J - R1016 - External Stairs (13.96 m2)

No Asbestos

B00J - R1017 - External Stairs (15.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Technological & Applied Studies - 1961 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Non Accessible Area - Height Restriction					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	60m2	Northeast & Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00K/R0005/Ceiling Structures/Linings/S31				Chrysotile (white asbestos)		

Interior

B00K - R0001 - Design L.S. (52.92 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00K/R0002/Ceiling Structures/Linings/S4						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Millboard	3Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8188/B00K/R0002/Floor Coverings Res/Textile/S5						Assumed Asbestos - Area inaccessible
Floor Coverings Res/Textile	Vinyl Tiles	52.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00K/R0002/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)

B00K - R0002 - General Storeroom (6.6 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00K/R0002/Ceiling Structures/Linings/S4						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00K/R0002/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)

B00K - R0003 - General Storeroom (8.76 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00K/R0002/Ceiling Structures/Linings/S4						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00K - R0004 - Seminar/Technology Space (17.09 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00K/R0002/Ceiling Structures/Linings/S4						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00K - R0005 - External Movement (33.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8188/B00K/R0005/Ceiling Structures/Linings/S31						Chrysotile (white asbestos)

B00K - R0006 - Materials Technology L.S. (79.82 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8188/B00K/R0002/Ceiling Structures/Linings/S4						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Millboard	2Unit	Variable positions	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8188/B00K/R0002/Floor Coverings Res/Textile/S5						Assumed Asbestos - Area inaccessible

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Agricultural Science - 1961 - Brick/Block (Brick/Block)

Exterior

Wall Cladding	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00L/Wall Cladding/S46					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00L/Gable Verge Lining/S47					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground						

Interior

B00L - R0001 - Staff Change (7.6 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00C/R0002/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00L - R0002 - Class Tools Storage (34.52 m2)

No Asbestos

B00L - R0003 - Movement (4.33 m2)

No Asbestos

B00L - R0004 - Class Tools Storage (8.91 m2)

No Asbestos

B00L - R0006 - Movement (22.53 m2)

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8188/B00L/R0006/Ceiling Structures/Linings/S48					Chrysotile (white asbestos)

B00L - R0007 - Plant Space (8.63 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Mechanical Services - 2008 - Steel (Steel)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
-------------------------------	--

Underfloor Voids	No Asbestos Found
------------------	-------------------

Interior

B00M - R0001 - Dust Extraction Space (3.29 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Other - 2008 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - External Movement (11.7 m2)

No Asbestos

B00N - R0002 - Movement (1.81 m2)

No Asbestos

B00N - R0003 - Staff Study (12.26 m2)

No Asbestos

B00N - R0004 - General Learning Space - Bd/Cd/Ed (36.04 m2)

No Asbestos

B00N - R0005 - Store (5.22 m2)

No Asbestos

B00N - R0006 - Staff Kitchen (12.71 m2)

No Asbestos

B00N - R0007 - External Movement (4.34 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Physical Education - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Area inaccessible

Underfloor Voids - Slab on Ground

Interior

B000 - R0001 - Gymnasium (489.94 m2)

No Asbestos

B000 - R0002 - Store (22.61 m2)

No Asbestos

B000 - R0003 - Store (24.51 m2)

No Asbestos

B000 - R0004 - Change (29.91 m2)

No Asbestos

B000 - R0005 - Change (28.43 m2)

No Asbestos

B000 - R0006 - First Aid (12.25 m2)

No Asbestos

B000 - R0007 - Toilets-Disabled (9.01 m2)

No Asbestos

B000 - R0008 - Other (0.75 m2)

No Asbestos

B000 - R0009 - Distribution Board Cupboard (0.7 m2)

Note: No inspection of live electrical installation.

No Asbestos

B000 - R0010 - Other (0.58 m2)

No Asbestos

B000 - R0011 - Other (3.13 m2)

No Asbestos

B000 - R0012 - Other (29.22 m2)

No Asbestos

B000 - R0013 - Covered Area (39.53 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017