


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gymea Technology High School (8386)
Region : Sydney
State Electorate : Miranda
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 13 - Jun - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

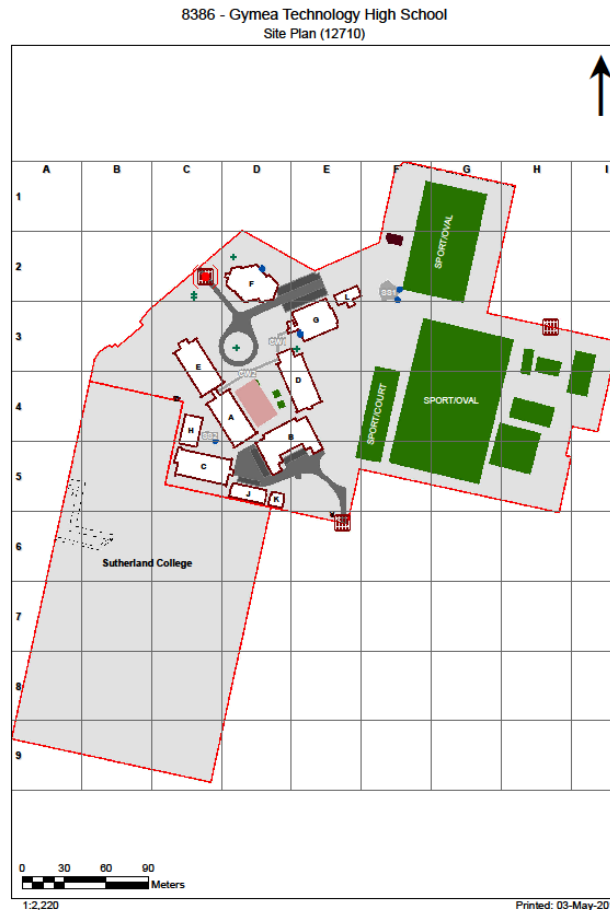

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Technological & Applied Studies/Music - 1970 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel below Window	Flat AC Sheeting	240m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00A/In-fill panels beneath windows/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	110m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00A/Eaves Linings/S24					Chrysotile (white asbestos)
Ceiling Voids	Infills Surrounding Panel Access	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00A/Ceiling Voids/S23					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Debris					No Asbestos Detected
	8386/B00A/Underfloor Voids/S25					

Interior**B00A - R0001 - Resources Store (5.74 m2)**

No Asbestos

B00A - R0002 - Staff Study (26.2 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Staff - Toilet (6.2 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Wall Linings Internal	Flat AC Sheeting	4m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00A/R0003/Wall Linings Internal/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0004 - Food Technology L.S. (87.3 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Class Tools Storage (12.6 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Preparation (25.1 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0007 - Food Technology L.S. (87.3 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Cleaning Store - Distributed (2.92 m2)

Wall Linings Internal	Putty	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00A/R0008/Wall Linings Internal/S27					Chrysotile (white asbestos)

B00A - R0009 - Main Switchroom (6.5 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0010 - Movement (6.6 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0011 - Resources Store (18.67 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0012 - Coffee Kiosk (19.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0013 - Laundry (7.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0014 - Resources Store (9.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - Art Learning Space (75.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0016 - Resources Store (14.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0017 - Multi Media Workshop (24.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0018 - Art Learning Space (67.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0020 - Movement (2.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00A/R0020/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0021 - Resources Store (10.46 m2)						
No Asbestos						
B00A - R0022 - Stairs (1.37 m2)						
No Asbestos						
B00A - R0023 - Movement (102.24 m2)						
No Asbestos						
B00A - R0024 - Stairs (3.24 m2)						
No Asbestos						
B00A - R0025 - Movement (19.94 m2)						
No Asbestos						
B00A - R1001 - Resources Store (5.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Poor Condition (4)	Low (1)	Low Priority (2-3)
	8386/B00A/R1011/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1003 - Staff - Toilet (6.25 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting 8386/B00A/R0003/Wall Linings Internal/S15	4m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1004 - General Learning Space (53.23 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1005 - Computer Learning Space (60.31 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1006 - Computer Store (5.59 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1007 - Music Learning Space (59.77 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1008 - Resources Store (6.13 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1010 - Cleaning Store - Distributed (3.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8386/B00A/R1011/Ceiling Structures/Linings/S16	4m2	All surfaces	Poor Condition (4)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1011 - Distribution Board Cupboard (2.21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8386/B00A/R1011/Ceiling Structures/Linings/S16	3m2	All surfaces	Poor Condition (4)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) Note: No inspection of live electrical installation.
B00A - R1012 - Music Learning Space (52.13 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1013 - Music Store (5.83 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1014 - Computer Learning Space (65.88 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1016 - Design L.S. (67.06 m2)						
Ceiling Structures/Linings	Vermiculite 8386/B00A/R0019/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R1017 - Staff Study (40.09 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8386/B00A/R0019/Ceiling Structures/Linings/S14			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1019 - Movement (17.66 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00A/R0019/Ceiling Structures/Linings/S14			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1020 - Movement (19.78 m2)						
No Asbestos						
B00A - R1021 - Movement (80.72 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00A/R0019/Ceiling Structures/Linings/S14			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1022 - Resources Store (9.71 m2)						
No Asbestos						
B00A - R1023 - Staff Study (24.11 m2)						
No Asbestos						
B00A - R1024 - Tea Room (1.64 m2)						
No Asbestos						
B00A - R1025 - Resources Store (2.91 m2)						
No Asbestos						
B00A - R1026 - General Storeroom (3.24 m2)						
No Asbestos						
B00A - R1027 - Office/Store (22.89 m2)						
No Asbestos						
B00A - R1028 - Stairs (3.32 m2)						
No Asbestos						
B00A - R1029 - Stairs (3.31 m2)						
No Asbestos						
B00A - R1030 - Movement (15.92 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities/Multi Purpose Facilities - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00B/Eaves Linings/S28			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0002 - Cleaning Store - Distributed (14.27 m2)**

No Asbestos

B00B - R0004 - Shower (15.09 m2)

No Asbestos

B00B - R0005 - General Storeroom (9.58 m2)

No Asbestos

B00B - R0006 - General Assistants (11.52 m2)

No Asbestos

B00B - R0008 - Sport Equipment Store (13.2 m2)

No Asbestos

B00B - R0009 - Multi-Purpose Space (325.98 m2)

No Asbestos

B00B - R0010 - Sport Equipment Store (13.08 m2)

No Asbestos

B00B - R0011 - Student Canteen (49.04 m2)

Skylight linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00B/R0011/Skylight linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0012 - Staff - Toilet (5.43 m2)

Skylight linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00B/R0011/Skylight linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0013 - Pantry (10 m2)

Skylight linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00B/R0011/Skylight linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0014 - Sport Equipment Store (9.98 m2)

No Asbestos

B00B - R0015 - Movement (14.47 m2)

No Asbestos

B00B - R0019 - Cleaning Store - Distributed (13.04 m2)

No Asbestos

B00B - R0020 - Shower (14.99 m2)

No Asbestos

B00B - R0021 - Sport Equipment Store (9.85 m2)

No Asbestos

B00B - R0022 - Staff - Toilet (1.68 m2)

No Asbestos

B00B - R0023 - Garden Store Room (9.44 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00B - R0026 - Toilets-Boys (72.29 m2)

No Asbestos

B00B - R0027 - Change (48.41 m2)

No Asbestos

B00B - R0028 - Change (44.75 m2)

No Asbestos

B00B - R0029 - Toilets-Girls (74.3 m2)

No Asbestos

B00B - R0030 - External Movement (21.41 m2)

No Asbestos

B00B - R0031 - External Movement (24.6 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Technological & Applied Studies - 1963 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel below Window	Flat AC Sheeting	120m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00A/In-fill panels beneath windows/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00C/Eaves Linings/S30					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	Infills Surrounding Panel Access	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00C/Ceiling Voids/S29					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Debris	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00C/Underfloor Voids/S31					Chrysotile (white asbestos)

Interior**B00C - R0001 - Design/Technology L.S. (67.12 m2)**

Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0002 - Materials Technology L.S. (80.21 m2)

No Asbestos

B00C - R0004 - Distribution Board Cupboard (0.72 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00C/R0004/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0005 - Dust Extraction Space (4.76 m2)

No Asbestos

B00C - R0006 - Materials Technology L.S. (81.24 m2)

No Asbestos

B00C - R0007 - Project Store - Type 1 (13.76 m2)

Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0008 - Project Store - Type 1 (17.19 m2)

Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0009 - Materials Technology L.S. (95.76 m2)

Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0010 - Welding Area (8 m2)

Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0011 - Resources Store (10.14 m2)

Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0012 - Resources Store (6.09 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0014 - Design L.S. (53.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0015 - Resources Store (6.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0017 - Staff - Toilet (4.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0018 - Movement (79.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00C/R0009/Ceiling Structures/Linings/S10					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0019 - External Movement (13.07 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00C/R0019/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0020 - External Movement (2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00C/R0019/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0021 - External Movement (28.94 m2)						
No Asbestos						
B00C - R0022 - Tea Room (4.73 m2)						
No Asbestos						
B00C - R0023 - Staff Study (16.36 m2)						
No Asbestos						
B00C - R0024 - Food Technology L.S. (53.15 m2)						
No Asbestos						
B00C - R0025 - Resources Store (6.14 m2)						
No Asbestos						
B00C - R0026 - Materials Store (12.1 m2)						
No Asbestos						
B00C - R0027 - Dust Extraction Space (5.74 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration/General Learning - 1963 - Brick/Block (Brick/Block)**Exterior**

In-fill panels beneath windows	Flat AC Sheeting 8386/B00A/In-fill panels beneath windows/S1	240m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 8386/B00D/Eaves Linings/S33	110m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	Infills Surrounding Access Panels 8386/B00D/Ceiling Voids/S32	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - Archive Store (3.7 m2)**

Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00D - R0002 - Movement (31.61 m2)

In-fill above doors	Flat AC Sheeting 8386/B00D/R0002/In-fill above doors/S3					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0009 - General Storeroom (2.92 m2)

Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00D - R0010 - Distribution Board Cupboard (0.25 m2)

No Asbestos Note: No inspection of live electrical installation.

B00D - R0011 - Resources Store (6.37 m2)

Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00D - R0012 - General Learning Space (67.14 m2)

Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00D - R0013 - Cleaning Store - Distributed (2.43 m2)

Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00D - R0014 - Staff - Toilet (6.17 m2)

Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00D - R0015 - Interview/Meeting (26.92 m2)

Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00D - R0016 - General Learning Space (53.08 m2)

Ceiling Structures/Linings	Vermiculite 8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

B00D - R0017 - Printing/Photocopying (53.23 m2)

--	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0018 - Archive Store (6.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0028 - External Movement (9.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00D/R0028/Ceiling Structures/Linings/S34					Chrysotile (white asbestos)
B00D - R0029 - External Movement (15.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8386/Build+1/Room+1/Ceiling Structures/Linings/S2					No Asbestos Detected
B00D - R0030 - Public Entry (71.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0031 - Administration - Clerical (48.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0032 - Student Waiting (12.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0033 - Clinic (10.67 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0034 - Toilets-Disabled (6.33 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0035 - Uniform Shop (3.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0036 - Administration - Executive (12.12 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0037 - Principal Office (20.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0038 - Deputy Principal Office (16.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0039 - Deputy Principal Office (17.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00D/R0002/Ceiling Structures/Linings/S4					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0040 - Movement (69.97 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0041 - Stairs (12.75 m2)						
No Asbestos						
B00D - R0042 - Toilet - Lobby (2.97 m2)						
No Asbestos						
B00D - R0043 - Staff - Toilet (6.79 m2)						
No Asbestos						
B00D - R0044 - Toilet - Lobby (2.85 m2)						
No Asbestos						
B00D - R0045 - Staff - Toilet (6.81 m2)						
No Asbestos						
B00D - R0046 - Interview/Office - Type 1 (13.44 m2)						
No Asbestos						
B00D - R0047 - Interview/Office - Type 1 (8.89 m2)						
No Asbestos						
B00D - R0048 - Commonroom (50.37 m2)						
No Asbestos						
B00D - R0049 - Staff Kitchen (9.06 m2)						
No Asbestos						
B00D - R0050 - Stairs (5.89 m2)						
No Asbestos						
B00D - R1001 - General Learning Space (40.49 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1002 - General Learning Space (66.99 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1003 - Resources Store (9.74 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1004 - Cleaning Store - Distributed (3.24 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1005 - General Learning Space (53.15 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1006 - Resources Store (6.42 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1007 - Computer Learning Space (53.37 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1008 - Resources Store (6.37 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1009 - Staff Study (26.98 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1010 - Staff - Toilet (6.25 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1011 - General Learning Space (53.22 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1012 - General Learning Space (53.37 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1013 - General Learning Space (53.22 m2)						
In-fill-panel above Door	Flat AC Sheeting	8386/B00D/R0002/In-fill above doors/S3				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1014 - General Learning Space (46.19 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1016 - Movement (124.49 m2)						
Ceiling Structures/Linings	Vermiculite	8386/B00D/R0002/Ceiling Structures/Linings/S4				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1017 - Staff Study (31.62 m2)						
No Asbestos						
B00D - R1018 - Tea Room (2.32 m2)						
No Asbestos						
B00D - R1019 - Stairs (21.06 m2)						
No Asbestos						
B00D - R1020 - Stairs (8.89 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Science Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel below Window	Flat AC Sheeting	240m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00A/In-fill panels beneath windows/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	110m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00E/Eaves Linings/S36					Chrysotile (white asbestos)
Ceiling Voids	Infills Surrounding Panel Access	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00E/Ceiling Voids/S35					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - Cleaning Store - Distributed (2.72 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0002 - General Learning Space (53.45 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0003 - Laboratory L.S. (87.18 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0004 - Preparation - Science (38.52 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0006 - Cleaning Store - Distributed (2.76 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0007 - Staff - Toilet (6.04 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Wall Linings Internal	Flat AC Sheeting	4m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00E/R0007/Wall Linings Internal/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0008 - Aboriginal Resource Centre (27.01 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0009 - General Learning Space (53.01 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0010 - General Learning Space (52.48 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R0011 - Distribution Board Cupboard (0.25 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	As debris to floor	Poor Condition (4)	Low (1)	Low Priority (2-3)
	8386/B00E/R0011/Ceiling Structures/Linings/S19					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0012 - General Learning Space (52.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0013 - General Learning Space (53.45 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0014 - Movement (116.41 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0015 - External Movement (1.67 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0016 - Movement (2.95 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0017 - Stairs (9.5 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0018 - Stairs (5.91 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0019 - General Learning Space (42.83 m2)						
No Asbestos						
B00E - R0020 - Laboratory L.S. (43.93 m2)						
No Asbestos						
B00E - R1001 - General Learning Space (53.23 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1002 - General Learning Space (52.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1003 - General Learning Space (52.31 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1004 - General Learning Space (52.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8386/B00E/R0001/Ceiling Structures/Linings/S17					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1005 - General Learning Space (53.23 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1006 - Staff - Toilet (6.1 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1008 - General Learning Space (52.72 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1009 - General Learning Space (52.49 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1010 - Distribution Board Cupboard (0.23 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	As debris to floor	Poor Condition (4)	Low (1)	Low Priority (2-3)
8386/B00E/R0011/Ceiling Structures/Linings/S19						
<i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>						
B00E - R1013 - General Learning Space (39.54 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1014 - General Learning Space (53.45 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1015 - Cleaning Store - Distributed (1.9 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1016 - Movement (118.79 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1017 - Stairs (11.36 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1018 - Stairs (8.77 m2)						
Ceiling Structures/Linings	Vermiculite		8386/B00E/R0001/Ceiling Structures/Linings/S17			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1019 - Resources Store (12.63 m2)						
No Asbestos						
B00E - R1020 - Staff Study (24.48 m2)						
No Asbestos						
B00E - R1021 - Tea Room (1.33 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Access Due To Height						
Wall Cladding	Flat AC Sheeting 8386/B00F/R0004/Wall Linings Internal/S22					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00F/Underfloor Voids/S37					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior**B00F - M0002 - Movement (4.33 m2)**

No Asbestos

B00F - M0003 - Movement (0.57 m2)

No Asbestos

B00F - M0005 - Performance Store (4.08 m2)

Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00F/M0005/Electrical Mounting Board/S38					Chrysotile (white asbestos)

B00F - M0006 - Movement (2.9 m2)

No Asbestos

B00F - M0007 - Control Room (5.08 m2)

No Asbestos

B00F - M0008 - Change (6.03 m2)

No Asbestos

B00F - M0009 - Toilets-Boys (2.22 m2)

No Asbestos

B00F - M0010 - Stairs (4.96 m2)

No Asbestos

B00F - M0011 - Change (6.01 m2)

No Asbestos

B00F - M0012 - Toilets-Girls (2.28 m2)

No Asbestos

B00F - M0013 - Stairs (4.99 m2)

No Asbestos

B00F - R0001 - Stage (94.49 m2)

No Asbestos

B00F - R0002 - Performance Store (1.41 m2)

No Asbestos

B00F - R0003 - Multi-Purpose Space (454.1 m2)

No Asbestos

B00F - R0004 - Toilets-Boys (8.23 m2)

Wall Linings Internal	Flat AC Sheeting 8386/B00F/R0004/Wall Linings Internal/S22					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00F - R0005 - Toilets-Girls (6.36 m2)

No Asbestos

B00F - R0006 - Movement (21.28 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0007 - Distribution Board Cupboard (0.49 m2)				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8386/B00F/R0007/Electrical Mounting Board/S39					Chrysotile (white asbestos)	
B00F - R0008 - Staff Kitchen (15.79 m2)						
No Asbestos						
B00F - R0009 - External Movement (8.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8386/B00F/R0009/Ceiling Structures/Linings/S40					No Asbestos Detected	
B00F - R0010 - Movement (0.1 m2)						
No Asbestos						
B00F - R0011 - Movement (2.14 m2)						
No Asbestos						
B00F - R0012 - Stairs (3 m2)						
No Asbestos						
B00F - R0013 - Movement (2.22 m2)						
No Asbestos						
B00F - R0014 - Stairs (2.69 m2)						
No Asbestos						
B00F - R0015 - External Movement (3.92 m2)						
No Asbestos						
B00F - R0016 - External Movement (2.84 m2)						
No Asbestos						
B00F - R0017 - External Movement (2.88 m2)						
No Asbestos						
B00F - R0018 - External Movement (3.89 m2)						
No Asbestos						
B00F - R9001 - General Storeroom (80.07 m2)						
No Asbestos						
B00F - R9002 - Movement (3.63 m2)						
No Asbestos						
B00F - R9003 - Stairs (1.52 m2)						
No Asbestos						
B00F - R9004 - Movement (3.75 m2)						
No Asbestos						
B00F - R9005 - Stairs (1.55 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - Library/Science Learning - 1970 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00G - M1001 - Plant (24.17 m2)						
No Asbestos						
B00G - M1002 - Interview/Office - Type 1 (15.31 m2)						
No Asbestos						
B00G - M1003 - Plant (24.71 m2)						
No Asbestos						
B00G - M1004 - Senior Study (69.3 m2)						
No Asbestos						
B00G - M1005 - Careers Advisers Office (37.84 m2)						
No Asbestos						
B00G - M1006 - Plant (66.8 m2)						
No Asbestos						
B00G - M1007 - Plant (4.86 m2)						
No Asbestos						
B00G - M1008 - Stairs (1.57 m2)						
No Asbestos						
B00G - M1009 - Stairs (1.56 m2)						
No Asbestos						
B00G - R0001 - Laboratory L.S. (91.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00G/R0007/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0005 - Laboratory L.S. (91.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00G/R0007/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0006 - Apparatus Store (9.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00G/R0013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8386/B00G/R0007/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0007 - Resources Store (7.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00G/R0007/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0010 - Laboratory L.S. (91.04 m2)						
Ceiling Structures/Linings	Vermiculite					
	8386/B00G/R0007/Ceiling Structures/Linings/S6					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00G - R0011 - Distribution Board Cupboard (0.6 m2)						
				Note: No inspection of live electrical installation.		
No Asbestos						
B00G - R0012 - Resources Store (17.38 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8386/B00G/R0013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00G - R0013 - Movement (39.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8386/B00G/R0013/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00G - R0014 - External Movement (3.23 m2)						
No Asbestos						
B00G - R0015 - Cleaning Store - Distributed (7.85 m2)						
No Asbestos						
B00G - R0016 - Plant (9.06 m2)						
No Asbestos						
B00G - R0017 - Distribution Board Cupboard (1.66 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00G - R0018 - External Stairs (7.89 m2)						
No Asbestos						
B00G - R0019 - Preparation - Science (48.56 m2)						
No Asbestos						
B00G - R0020 - Staff Study (45.13 m2)						
No Asbestos						
B00G - R0021 - Tea Room (3.26 m2)						
No Asbestos						
B00G - R0022 - General Learning Space (70.61 m2)						
No Asbestos						
B00G - R0023 - Tea Room (1.45 m2)						
No Asbestos						
B00G - R0024 - External Movement (25.26 m2)						
No Asbestos						
B00G - R1004 - Cleaning Store - Distributed (0.31 m2)						
No Asbestos						
B00G - R1005 - Distribution Board Cupboard (0.29 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00G - R1009 - Audio Visual Workroom (28.31 m2)						
No Asbestos						
B00G - R1010 - Resources Store (12.5 m2)						
No Asbestos						
B00G - R1012 - Librarian (11.52 m2)						
No Asbestos						
B00G - R1013 - Staff - Toilet (2.98 m2)						
No Asbestos						
B00G - R1014 - Movement (1.83 m2)						
No Asbestos						
B00G - R1015 - Staff - Toilet (3.03 m2)						
No Asbestos						
B00G - R1016 - Computer Learning Space (70.25 m2)						
Ceiling Structures/Linings	Vermiculite					
8386/B00G/R0007/Ceiling Structures/Linings/S6					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8386/B00G/R1016/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

- B00G - R1017 - Plant (5.82 m2)**
No Asbestos
- B00G - R1018 - Plant (5.38 m2)**
No Asbestos
- B00G - R1019 - External Stairs (16.63 m2)**
No Asbestos
- B00G - R1020 - Main Entry (33.97 m2)**
No Asbestos
- B00G - R1021 - Main Area (286.59 m2)**
No Asbestos
- B00G - R1022 - Staff Kitchen (12.36 m2)**
No Asbestos
- B00G - R1023 - Library Administration (4.74 m2)**
No Asbestos
- B00G - R1024 - Stairs (1.63 m2)**
No Asbestos
- B00G - R1025 - Stairs (1.63 m2)**
No Asbestos
- B00G - R1026 - Seminar (25 m2)**
No Asbestos
- B00G - R1027 - Seminar (24.95 m2)**
No Asbestos
- B00G - R1028 - Movement (4.04 m2)**
No Asbestos
- B00G - R1029 - Handwashing Facilities (0.25 m2)**
No Asbestos
- B00G - R1030 - External Movement (24.91 m2)**
No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Materials Learning - 1963 - Steel (Steel)**Exterior**

Eaves Linings	Flat AC Sheeting	75m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00H/Eaves Linings/S41					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00H - R0001 - Workshop (71.61 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8386/B00H/R0001/Ceiling Structures/Linings/S21					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8386/B00H/R0001/Wall Linings Internal/S20					

B00H - R0002 - Project Store - Type 1 (11.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8386/B00H/R0001/Ceiling Structures/Linings/S21					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8386/B00H/R0001/Wall Linings Internal/S20					

B00H - R0003 - Materials Store (48.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	8386/B00H/R0001/Ceiling Structures/Linings/S21					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8386/B00H/R0001/Wall Linings Internal/S20					

B00H - R0006 - External Movement (48.65 m2)

No Asbestos

B00H - R0007 - Workshop (81.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Physical Education - 1963 - Timber (Timber)

Exterior

Underfloor Voids	Packing	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00J/Underfloor Voids/S42					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00J - R0001 - Sport Equipment Store (5.36 m2)

No Asbestos

B00J - R0002 - Fitness Laboratory (163.51 m2)

No Asbestos

B00J - R0007 - Staff Study (19.45 m2)

No Asbestos

B00J - R0008 - Tea Room (2.69 m2)

No Asbestos

B00J - R0009 - Movement (9.7 m2)

No Asbestos

B00J - R0010 - Sport Equipment Store (4.97 m2)

No Asbestos

B00J - R0011 - Fitness Laboratory (33.58 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Multi Purpose Facilities - 1930 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Music Store (5.47 m2)

No Asbestos

B00K - R0002 - Music Learning Space (53.67 m2)

No Asbestos

B00K - R0003 - Resources Store (17.99 m2)

No Asbestos

B00K - R0004 - External Movement (14.93 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Performance Learning - 2005 - Timber (Timber)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/Underfloor Voids/S43					Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	30m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/Eaves Linings/S48					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00L - R0001 - Performance Workshop (114.11 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/R0001/Ceiling Structures/Linings/S46					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/R0001/Wall Linings Internal/S45					Chrysotile (white asbestos)
Wall Linings Internal	Upper Wall	10m2	West And South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/R0001/Wall Linings Internal/S47					Chrysotile (white asbestos)

B00L - R0002 - Performance Store (19.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/R0001/Ceiling Structures/Linings/S46					Chrysotile (white asbestos)
Wall Linings Internal	Upper walls	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/R0001/Wall Linings Internal/S47					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/R0001/Wall Linings Internal/S45					Chrysotile (white asbestos)

B00L - R0003 - External Movement (20.84 m2)

Stairs	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8386/B00L/R0003/Stairs/S44					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Y - Building Services - 1962 - Brick/Block (Brick/Block)

Exterior

No Asbestos

Interior

B00Y - R0001 - Plant (1.56 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Building Services - 1962 - Concrete (Concrete)

Exterior

No Asbestos

Interior

B00Z - R0001 - Plant (6 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017