


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Georges River College Peakhurst Campus (8408)  
**Region :** Sydney  
**State Electorate :** Oatley  
**Local Government Area :** Hurstville

**Initial Survey :** Noel Arnold & Associates : 17 - Mar - 2008  
**Reviewed By :** Greencap-NAA : 13 - Aug - 2014

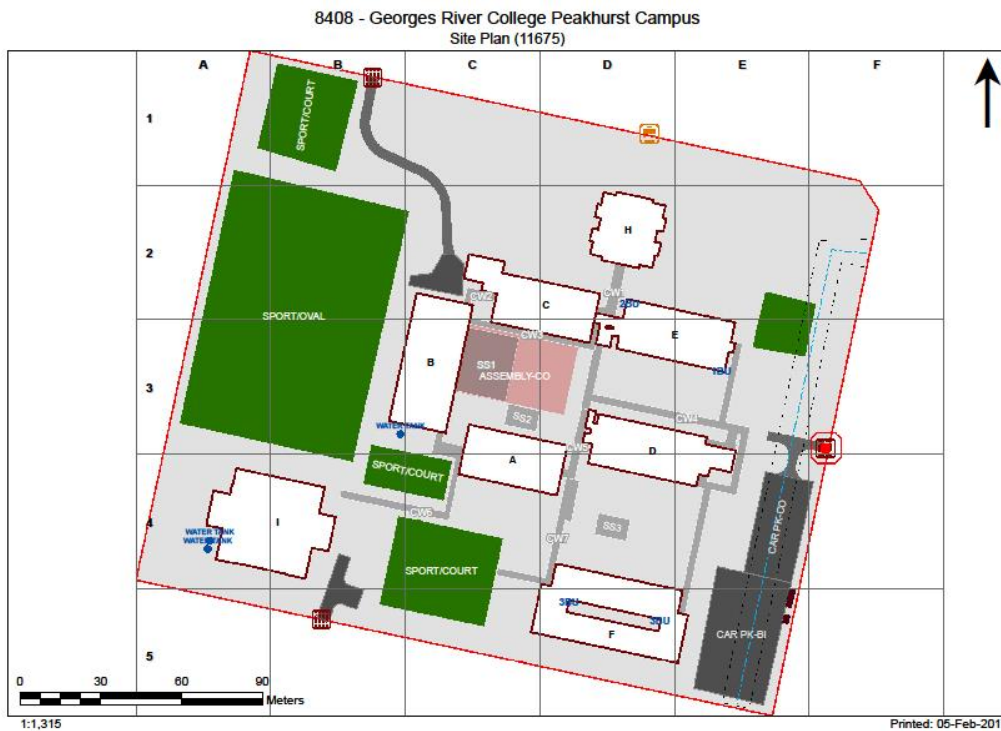

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Science/General Learning - 1964 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-----	---------------	--------------------	---------	--------------------

**Assumed Asbestos - No access height restriction 6m**

Ceiling Voids - Flat Roof	Non Accessible Area - No access points
---------------------------	---

Underfloor Voids	No Asbestos Found
------------------	-------------------

**Interior****B00A - R0001 - Staff - Toilet (5.36 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0002 - Cleaning Store - Distributed (2.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0016/Floor Coverings Res/Textile/S22						Chrysotile (white asbestos)

**B00A - R0003 - Leading Teacher (25.69 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0016/Floor Coverings Res/Textile/S22						Chrysotile (white asbestos)

**B00A - R0004 - Laboratory L.S. (85.93 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0005 - Preparation (39.23 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0006 - Laboratory L.S. (86.59 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0007 - Growing/Breeding (2.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0016/Floor Coverings Res/Textile/S22						Chrysotile (white asbestos)

**B00A - R0008 - Food Technology L.S. (79.57 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0009 - Pantry (5.85 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0010 - Food/Research Space (25.99 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0011 - Food Technology L.S. (79.64 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0012 - Food/Research Space (11.82 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0013 - General Storeroom (6.8 m2)</b>						
No Asbestos						
<b>B00A - R0014 - Main Switchroom (6.8 m2)</b>						
Wall Linings Internal	Flat AC Sheeting 8408/B00A/R0014/Wall Linings Internal/S25	20m2	South facing, East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)  Assumed Asbestos - Sealed unit & live
<b>B00A - R0015 - Staff Study (26.05 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00A/R0016/Floor Coverings Res/Textile/S22	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos)
<b>B00A - R0016 - Movement (115.83 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00A/R0016/Floor Coverings Res/Textile/S22	116m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Door Infill Panel	Flat AC Sheeting 8408/B00A/R0016/Door Infill Panel/S24					No Asbestos Detected
<b>B00A - R0017 - Movement (3.14 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Movement (2.99 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Stairs (3.37 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0020 - Stairs (3.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1001 - Staff - Toilet (5.36 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00A/R0016/Floor Coverings Res/Textile/S22	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1002 - Computer Learning Space (66.1 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00A/R0016/Floor Coverings Res/Textile/S22	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1003 - Design L.S. (39.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00A/R0016/Floor Coverings Res/Textile/S22	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1004 - Design L.S. (65.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00A/R0016/Floor Coverings Res/Textile/S22	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1005 - General Storeroom (6.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00A/R0016/Floor Coverings Res/Textile/S22	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1006 - General Storeroom (6.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00A/R0016/Floor Coverings Res/Textile/S22	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1007 - General Learning Space (53 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00A/R0016/Floor Coverings Res/Textile/S22	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1008 - Cleaning Store - Distributed (5.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00A/R0016/Floor Coverings Res/Textile/S22	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1009 - General Learning Space (52.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00A/R0016/Ceiling Structures/Linings/S23					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00A/R0016/Floor Coverings Res/Textile/S22	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R1010 - General Learning Space (52.19 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0016/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00A/R0016/Ceiling Structures/Linings/S23				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R1011 - Special Learning Space (39.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00A/R0016/Ceiling Structures/Linings/S23				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0016/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R1012 - Special Learning Space (39.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00A/R0016/Ceiling Structures/Linings/S23				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0016/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R1013 - Darkroom Space (11.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00A/R0016/Ceiling Structures/Linings/S23				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R1014 - Darkroom Space (12.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00A/R0016/Ceiling Structures/Linings/S23				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R1015 - Distribution Board Cupboard (0.74 m2)</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	6m2	South facing, East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8408/B00A/R0014/Wall Linings Internal/S25				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0014/Wall Linings Internal/S25				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Sealed unit &amp; live</b>						
<b>B00A - R1016 - Staff Study (26.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00A/R0016/Ceiling Structures/Linings/S23				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0016/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R1017 - Movement (112.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	113m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00A/R0016/Floor Coverings Res/Textile/S22				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00A/R0016/Ceiling Structures/Linings/S23				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R1018 - Stairs (6.04 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 8408/B00A/R0016/Ceiling Structures/Linings/S23 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00A - R1019 - Stairs (6.47 m2)**

Ceiling Structures/Linings Vermiculite  
 8408/B00A/R0016/Ceiling Structures/Linings/S23 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0013/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00B - R0001 - Shower/Change (87.84 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0017/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	

**B00B - R0002 - Cleaning Store - Distributed (8.94 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0002/Floor Coverings Res/Textile/S26					Chrysotile (white asbestos)	

**B00B - R0003 - Shower/Change (42.84 m2)**

No Asbestos

**B00B - R0004 - Garden Store Room (6.07 m2)**

No Asbestos

**B00B - R0005 - Cleaning Supplies Store (22.35 m2)**

No Asbestos

**B00B - R0006 - Garden Store Room (6.33 m2)**

No Asbestos

**B00B - R0007 - Student Canteen (40.87 m2)**

No Asbestos

**B00B - R0008 - Staff - Toilet (2.55 m2)**

No Asbestos

**B00B - R0009 - Office/Store (4.85 m2)**

No Asbestos

**B00B - R0010 - Office/Store (15.75 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0013/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	

**B00B - R0011 - Office/Store (9.65 m2)**

No Asbestos

**B00B - R0012 - Garden Store Room (73.08 m2)**

No Asbestos

**B00B - R0013 - Movement (16.59 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0013/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	

**B00B - R0014 - Movement (236.29 m2)**

Wall Linings Internal	Compressed AC Sheet	25m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0014/Wall Linings Internal/S14					Chrysotile (white asbestos)	

**B00B - R0015 - Movement (132.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	133m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0013/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	

**B00B - R0016 - Garden Store Room (17.11 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00B - R0017 - Toilets-Girls (110.14 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0017/Partition Walls (Cubicles)/S13					<b>Chrysotile (white asbestos)</b>	
Toilet cistern	Moulded fibre cement	3Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0017/Toilet cistern/S35					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00B - R0018 - Movement (9.85 m2)**

No Asbestos

**B00B - R0019 - Staff Study (8.48 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0002/Floor Coverings Res/Textile/S26					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0017/Partition Walls (Cubicles)/S13					<b>Chrysotile (white asbestos)</b>	

**B00B - R0020 - Shower/Change (43.53 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0017/Partition Walls (Cubicles)/S13					<b>Chrysotile (white asbestos)</b>	

**B00B - R0021 - Staff - Toilet (2.84 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00B/R0013/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

**B00B - R0022 - Sport Equipment Store (11.59 m2)**

No Asbestos

**B00B - R0023 - Movement (16.41 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
8408/B00B/R0013/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

**B00B - R0024 - Main Switchroom (6.66 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00C - Technological & Applied Studies - 1964 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00C/R0012/Wall Linings Internal/S32				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Flat Roof	Non Accessible Area - No access points					
Underfloor Voids	No Asbestos Found					

**Interior****B00C - R0001 - Cleaning Store - Distributed (2.88 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00C/R0020/Floor Coverings Res/Textile/S29				<b>Chrysotile (white asbestos)</b>	

**B00C - R0002 - Resource/Project Store (15.64 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8408/B00C/R0020/Ceiling Structures/Linings/S30				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00C - R0003 - Materials Store (3.06 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8408/B00C/R0020/Ceiling Structures/Linings/S30				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00C - R0004 - Materials Technology L.S. (69.01 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8408/B00C/R0020/Ceiling Structures/Linings/S30				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00C - R0005 - Resource/Project Store (10.09 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8408/B00C/R0020/Ceiling Structures/Linings/S30				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

**B00C - R0006 - Design L.S. (66.16 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8408/B00C/R0020/Ceiling Structures/Linings/S30				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00C/R0020/Floor Coverings Res/Textile/S29				<b>Chrysotile (white asbestos)</b>	

**B00C - R0007 - Design L.S. (52.84 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8408/B00C/R0020/Ceiling Structures/Linings/S30				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00C/R0020/Floor Coverings Res/Textile/S29				<b>Chrysotile (white asbestos)</b>	

**B00C - R0008 - General Learning Space (26.27 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8408/B00C/R0020/Ceiling Structures/Linings/S30				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00C/R0020/Floor Coverings Res/Textile/S29				<b>Chrysotile (white asbestos)</b>	

**B00C - R0009 - Cleaning Store - Distributed (2.86 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00C/R0020/Floor Coverings Res/Textile/S29				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00C - R0010 - Staff - Toilet (5.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0011 - Staff Study (25.05 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00C/R0020/Floor Coverings Res/Textile/S29	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0012 - Distribution Board Cupboard (0.67 m2)</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting 8408/B00C/R0012/Wall Linings Internal/S32	8m2	South facing, East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Sealed unit &amp; live</b>
<b>B00C - R0013 - Dust Extraction Space (2.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0014 - Wood Technology L.S. (76.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0015 - Materials Store (19.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0016 - Materials Store (19.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0017 - Metal Technology L.S. (65.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0018 - Metal Technology Bay (27.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Metal work forging stand	Millboard 8408/B00C/R0018/Metal work forging stand/S37	3Unit	Variable positions	Friable Asbestos (5)	Medium (2)	High Priority (6-8) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0019 - Movement (3.34 m2)</b>						
No Asbestos						
<b>B00C - R0020 - Movement (120.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	121m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Door Infill Panels	Flat AC Sheeting 8408/B00C/R0020/Door Infill Panels/S31					No Asbestos Detected
<b>B00C - R0021 - Movement (3.13 m2)</b>						
No Asbestos						
<b>B00C - R0022 - Materials Store (14.89 m2)</b>						
No Asbestos						
<b>B00C - R0023 - Workshop Area (79.45 m2)</b>						
No Asbestos						
<b>B00C - R0024 - Materials Store (32.93 m2)</b>						
No Asbestos						
<b>B00C - R0025 - Stairs (3.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R0026 - Stairs (3.58 m2)</b>						
No Asbestos						
<b>B00C - R1001 - General Storeroom (5.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1002 - Art Learning Space (52.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1003 - Music Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1004 - Music Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00C/R0020/Floor Coverings Res/Textile/S29	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1005 - Music Store (12.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1006 - Music Learning Space (66.25 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	67m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00C - R1007 - Staff - Toilet (5.33 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00C - R1008 - Staff Study (25.08 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00C - R1009 - Distribution Board Cupboard (0.66 m2)</b>				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting 8408/B00C/R0012/Wall Linings Internal/S32	8m2	South facing, East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting 8408/B00C/R0012/Wall Linings Internal/S32	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Sealed unit &amp; live</b>
<b>B00C - R1010 - General Storeroom (2.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1011 - Resources Store (9.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1012 - Kiln Space (25.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1013 - Art Learning Space (53.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00C/R0020/Floor Coverings Res/Textile/S29	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R1014 - Art Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00C/R0020/Ceiling Structures/Linings/S30					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00C/R0020/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
<b>B00C - R1015 - Cleaning Store - Distributed (2.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00C/R0020/Ceiling Structures/Linings/S30				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00C/R0020/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
<b>B00C - R1016 - Resources Store (4.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00C/R0020/Ceiling Structures/Linings/S30				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00C/R0020/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
<b>B00C - R1017 - Resources Store (4.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00C/R0020/Ceiling Structures/Linings/S30				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00C/R0020/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
<b>B00C - R1018 - Art Learning Space (52.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00C/R0020/Ceiling Structures/Linings/S30				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00C/R0020/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
<b>B00C - R1019 - Movement (15.09 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00C/R0020/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00C/R0020/Ceiling Structures/Linings/S30				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00C - R1020 - Movement (79.55 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00C/R0020/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00C/R0020/Ceiling Structures/Linings/S30				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
<b>B00C - R1021 - Movement (9.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00C/R0020/Ceiling Structures/Linings/S30				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00C/R0020/Floor Coverings Res/Textile/S29				Chrysotile (white asbestos)		
<b>B00C - R1022 - Stairs (5.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00C/R0020/Ceiling Structures/Linings/S30				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - R1023 - Stairs (6.01 m2)**

Ceiling Structures/Linings Vermiculite  
 8408/B00C/R0020/Ceiling Structures/Linings/S30

**Limited Samples Taken**

*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00D - Administration/General Learning - 1964 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	-----	---------------	--------------------	---------	--------------------

**Assumed Asbestos - No access height restriction 6m**

Ceiling Voids - Flat Roof	Non Accessible Area - No access points
---------------------------	---

Underfloor Voids	No Asbestos Found
------------------	-------------------

**Interior****B00D - R0001 - Careers Advisers Office (58.03 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0002 - Staff Study (17.25 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00D - R0013 - General Storeroom (25.77 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						

**B00D - R0014 - Interview/Meeting (52.7 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						

**B00D - R0015 - Duplicating Workroom (26.13 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						

**B00D - R0016 - Cleaning Store - Distributed (2.93 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos)</b>						

**B00D - R0017 - Staff - Toilet (5.38 m2)**

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Sealed unit no access</b>						

**B00D - R0018 - Distribution Board Cupboard (1.33 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 8408/B00D/R0018/Wall Linings Internal/S12	8m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - Sealed unit & live**

#### B00D - R0019 - Administration - Clerical (24.29 m2)

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

#### B00D - R0020 - General Storeroom (2.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

#### B00D - R0021 - General Storeroom (2.96 m2)

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

#### B00D - R0022 - Deputy Principal Office (19.22 m2)

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

#### B00D - R0026 - General Storeroom (2.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

#### B00D - R0027 - Staff - Toilet (3.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

#### B00D - R0029 - Toilets-Disabled (6.15 m2)

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

#### B00D - R0030 - Staff - Toilet (5.73 m2)

Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	--

#### B00D - R0031 - Chair Store (2.91 m2)



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0026/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0032 - Movement (10.87 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
8408/B00D/R0032/Ceiling Structures/Linings/S10						
Wall Linings Internal	Flat AC Sheeting	4m2	North facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0032/Wall Linings Internal/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0035 - Movement (63.11 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0026/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0036 - Movement (3.25 m2)</b>						
No Asbestos						
<b>B00D - R0037 - Stairs (3.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0038 - Movement (5.19 m2)</b>						
No Asbestos						
<b>B00D - R0039 - Lift (2.1 m2)</b>						
No Asbestos						
<b>B00D - R0040 - Movement (7.69 m2)</b>						
No Asbestos						
<b>B00D - R0041 - Stairs (3.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0042 - External Movement (16.36 m2)</b>						
No Asbestos						
<b>B00D - R0043 - Interview/Office - Type 1 (12.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0044 - Interview/Office - Type 2 (12.61 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0045 - Movement (82.75 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0046 - First Aid (9.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8						
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00D - R0047 - Interview/Meeting (13.18 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0048 - Interview/Office - Type 1 (19.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0049 - Administration - Clerical (43.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0050 - Movement (74.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0051 - Archive Store (12.84 m2)</b>						
Ceiling Structures/Linings	Textile					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					No Asbestos Detected
<b>B00D - R0052 - Archive Store (1.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0053 - Printing/Photocopying (1.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0054 - Store (10.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0055 - Interview/Office - Type 1 (11.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0056 - Staff Lounge (99.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0057 - Principal Office (33.46 m2)</b>						
No Asbestos						
<b>B00D - R1001 - Staff - Toilet (5.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00D/R0026/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
<b>B00D - R1002 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8408/B00D/R0024/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00D/R0026/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
<b>B00D - R1003 - General Storeroom (12.88 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0026/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00D - R1004 - Computer Learning Space (65.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0026/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R1005 - Computer Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0026/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R1006 - Staff Study (47.25 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0026/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00D - R1007 - Cleaning Store - Distributed (3.15 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0026/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00D - R1008 - Distribution Board Cupboard (1.44 m2)</b>						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	8m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0018/Wall Linings Internal/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00D/R0018/Wall Linings Internal/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Sealed unit &amp; live</b>						
<b>B00D - R1009 - Staff - Toilet (5.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
<b>B00D - R1010 - General Learning Space (52.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00D - R1011 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00D - R1012 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00D - R1013 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00D - R1014 - General Storeroom (6.14 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R1015 - Resources Store (6.17 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R1016 - Computer Learning Space (66.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00D/R0026/Floor Coverings Res/Textile/S9	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00D - R1017 - Movement (106.58 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	107m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00D/R0024/Ceiling Structures/Linings/S8					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00D - R1018 - Movement (13.46 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00D/R0026/Floor Coverings Res/Textile/S9	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 8408/B00D/R0024/Ceiling Structures/Linings/S8 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R1019 - Stairs (6 m2)**

Ceiling Structures/Linings Vermiculite  
 8408/B00D/R0024/Ceiling Structures/Linings/S8 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R1020 - Movement (5.17 m2)**

No Asbestos

**B00D - R1021 - Movement (7.69 m2)**

No Asbestos

**B00D - R1022 - Stairs (5.31 m2)**

Ceiling Structures/Linings Vermiculite  
 8408/B00D/R0024/Ceiling Structures/Linings/S8 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00D - R1023 - External Movement (16.36 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00E - General Learning - 1964 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	All surfaces, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00E/R0012/Wall Linings Internal/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No access points					

**Interior****B00E - R0001 - Laboratory L.S. (93.11 m2)**

Ceiling Structures/Linings	Vermiculite					
	8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0002 - Preparation (39.16 m2)**

Ceiling Structures/Linings	Vermiculite					
	8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0003 - Laboratory L.S. (92.82 m2)**

Ceiling Structures/Linings	Vermiculite					
	8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0004 - General Learning Space (66.25 m2)**

Ceiling Structures/Linings	Vermiculite					
	8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00E - R0005 - Cleaning Store - Distributed (2.99 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00E/R0015/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0006 - General Learning Space (52.7 m2)**

Ceiling Structures/Linings	Vermiculite					
	8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00E/R0015/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0007 - General Storeroom (5.8 m2)**

Ceiling Structures/Linings	Vermiculite					
	8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00E/R0015/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0008 - General Learning Space (52.56 m2)**

Ceiling Structures/Linings	Vermiculite					
	8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00E/R0015/Floor Coverings Res/Textile/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0009 - General Learning Space (52.56 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0010 - Chemical Store (25.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0011 - Staff Study (52.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0012 - Distribution Board Cupboard (0.63 m2)</b>						
Wall Linings Internal	Flat AC Sheeting 8408/B00E/R0012/Wall Linings Internal/S4	8m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Backing Board	Resinous Board 8408/B00E/R0012/Wall Linings Internal/S4	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Sealed unit &amp; live</b>
<b>B00E - R0013 - Staff - Toilet (4.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R0014 - General Storeroom (2.99 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R0015 - Movement (130.37 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	131m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Door Infill Panels	Flat AC Sheeting 8408/B00E/R0015/Door Infill Panels/S3					No Asbestos Detected
<b>B00E - R0016 - Movement (3.26 m2)</b>						
No Asbestos						
<b>B00E - R0017 - Movement (3.32 m2)</b>						
No Asbestos						
<b>B00E - R0018 - Stairs (3.25 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R0019 - Stairs (3.32 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00E - R0020 - Movement (7.48 m2)</b>						
No Asbestos						
<b>B00E - R0021 - Movement (4.29 m2)</b>						
No Asbestos						
<b>B00E - R0022 - Lift (2.1 m2)</b>						
No Asbestos						
<b>B00E - R0023 - Movement (5.23 m2)</b>						
No Asbestos						
<b>B00E - R0024 - External Movement (56.04 m2)</b>						
No Asbestos						
<b>B00E - R0025 - External Movement (6.17 m2)</b>						
No Asbestos						
<b>B00E - R1001 - General Learning Space (52.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00E/R0015/Floor Coverings Res/Textile/S1	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1002 - General Storeroom (9.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1003 - General Storeroom (3.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1004 - Staff Lounge (52.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00E/R0015/Floor Coverings Res/Textile/S1	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1005 - General Learning Space (52.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00E/R0015/Floor Coverings Res/Textile/S1	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1006 - General Storeroom (6.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00E/R0015/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
<b>B00E - R1007 - General Storeroom (6.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00E/R0015/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00E/R0015/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
<b>B00E - R1008 - General Learning Space (52.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00E/R0015/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00E/R0015/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
<b>B00E - R1009 - General Learning Space (52.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00E/R0015/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00E/R0015/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
<b>B00E - R1010 - General Storeroom (10.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00E/R0015/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00E/R0015/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
<b>B00E - R1011 - Cleaning Store - Distributed (1.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00E/R0015/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00E/R0015/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
<b>B00E - R1012 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00E/R0015/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00E/R0015/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
<b>B00E - R1013 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00E/R0015/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00E/R0015/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
<b>B00E - R1014 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8408/B00E/R0015/Ceiling Structures/Linings/S2				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00E/R0015/Floor Coverings Res/Textile/S1	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1015 - General Learning Space (52.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8408/B00E/R0015/Floor Coverings Res/Textile/S1	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1016 - Staff Study (25.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1017 - Distribution Board Cupboard (0.64 m2)</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting 8408/B00E/R0012/Wall Linings Internal/S4	8m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Assumed Asbestos - Sealed unit &amp; live</b>
<b>B00E - R1018 - Staff - Toilet (4.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R1019 - Movement (121.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8408/B00E/R0015/Floor Coverings Res/Textile/S1	122m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00E - R1020 - Stairs (5.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R1021 - Stairs (5.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8408/B00E/R0015/Ceiling Structures/Linings/S2					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00E - R1022 - Movement (7.48 m2)</b>						
No Asbestos						
<b>B00E - R1023 - Movement (4.29 m2)</b>						
No Asbestos						
<b>B00E - R1024 - Movement (5.23 m2)</b>						
No Asbestos						
<b>B00E - R1025 - External Movement (56.04 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning/Science Learning - 1971 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - No access points					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 8408/B00F/Eaves Linings/S36					<b>No Asbestos Detected</b>

**Interior****B00F - R0001 - Laboratory L.S. (90.39 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0002 - Preparation (46.18 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0003 - Chemical Store (3.21 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0004 - Laboratory L.S. (90.66 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0005 - Distribution Board Cupboard (0.92 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	3Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Sealed units &amp; live</b>						

**B00F - R0006 - Cleaning Store - Distributed (5.49 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0007 - Staff Study (35.3 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0008 - Staff Room (42.77 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0009 - Movement (2.37 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0010 - General Learning Space (35.71 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0011 - General Storeroom (6.42 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34						<b>Chrysotile (white asbestos)</b>

**B00F - R0012 - Performance Workspace (65.89 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0013 - Toilets-Disabled (15.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0014 - Office/Store (7.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>
<b>B00F - R0015 - Toilets-Boys (15.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0016 - Apparatus Store (25.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>
<b>B00F - R0017 - General Learning Space (52.85 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0018 - General Storeroom (5.68 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0019 - Distribution Board Cupboard (0.96 m2)</b>						
				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Sealed unit &amp; live</b>						
<b>B00F - R0020 - General Learning Space (52.77 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0021 - General Storeroom (5.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00F - R0022 - General Learning Space (52.92 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0023 - General Learning Space (52.85 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0024 - Staff Study (25.91 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0025 - Staff Study (9.31 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0026 - Staff Study (29.37 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0027 - Staff - Toilet (3.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0028 - Staff - Toilet (3.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Incinerette	Fibre Cement Pipe	6m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Sealed unit no access</b>						
<b>B00F - R0029 - Movement (5.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Vermiculite					
8408/B00F/R0013/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R0030 - Movement (17.37 m2)</b>						
No Asbestos						
<b>B00F - R0031 - Movement (315.51 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
<b>B00F - R0032 - Movement (4.34 m2)</b>						
No Asbestos						
<b>B00F - R0033 - Movement (4.68 m2)</b>						
No Asbestos						
<b>B00F - R1001 - Audio Visual Workroom (26.31 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1002 - General Learning Space (52.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1003 - General Learning Space (52.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1004 - General Learning Space (52.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1005 - General Learning Space (52.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1006 - General Storeroom (6.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1007 - Distribution Board Cupboard (0.67 m2)</b>						
				Note: No inspection of live electrical installation.		
Electric Off Peak Heater	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Sealed unit &amp; live</b>						
<b>B00F - R1008 - General Storeroom (9.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1009 - Cleaning Store - Distributed (2.02 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1010 - General Learning Space (52.7 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1011 - General Storeroom (6.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1012 - General Learning Space (52.77 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34				<b>Chrysotile (white asbestos)</b>		
<b>B00F - R1013 - Staff Study (26.24 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8408/B00F/R0011/Floor Coverings Res/Textile/S34					Chrysotile (white asbestos)	

**B00F - R1014 - General Storeroom (4.18 m2)**

No Asbestos

**B00F - R1015 - Movement (103.97 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Library - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 8408/B00H/R0012/Ceiling Structures/Linings/S6					<b>No Asbestos Detected</b>

**Interior**

**B00H - R0001 - Main Area (402.18 m2)**

No Asbestos

**B00H - R0002 - Movement (9.66 m2)**

No Asbestos

**B00H - R0003 - Audio Visual Workroom (34.86 m2)**

No Asbestos

**B00H - R0004 - General Storeroom (4.92 m2)**

Ceiling Structures/Linings	Compressed AC Sheet 8408/B00H/R0004/Ceiling Structures/Linings/S7					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00H - R0005 - Workroom (40.65 m2)**

No Asbestos

**B00H - R0006 - Librarian (11.87 m2)**

No Asbestos

**B00H - R0007 - Seminar (12.55 m2)**

No Asbestos

**B00H - R0008 - Cleaning Store - Distributed (0.69 m2)**

No Asbestos

**B00H - R0009 - Seminar (20.61 m2)**

No Asbestos

**B00H - R0010 - Staff - Toilet (1.6 m2)**

No Asbestos

**B00H - R0011 - Toilets-Disabled (4.22 m2)**

No Asbestos

**B00H - R0012 - Distribution Board Cupboard (1.15 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 8408/B00H/R0012/Wall Linings Internal/S5					<b>No Asbestos Detected</b>
-----------------------	--	--	--	--	--	-----------------------------


Ceiling Structures/Linings	Flat AC Sheeting 8408/B00H/R0012/Ceiling Structures/Linings/S6					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00H - R0013 - Movement (16.25 m2)**

No Asbestos

**B00H - R0014 - Movement (5.69 m2)**

No Asbestos

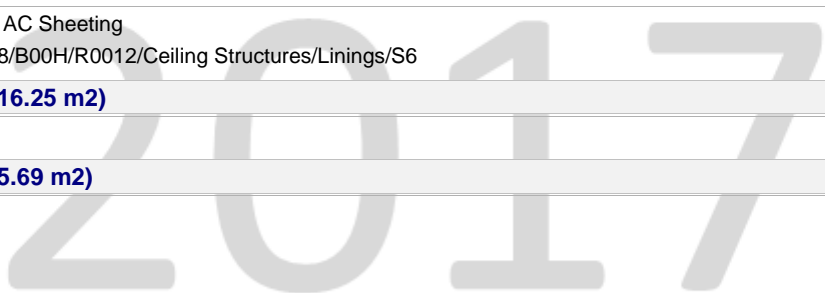



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Multi Purpose Facilities - 2014 - Steel Framed (Steel Framed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

<b>B00I - R0001 - Gymnasium (649.84 m2)</b>	No Asbestos
<b>B00I - R0002 - External Movement (158.36 m2)</b>	No Asbestos
<b>B00I - R0003 - First Aid (16.62 m2)</b>	No Asbestos
<b>B00I - R0004 - Staff Study (20.48 m2)</b>	No Asbestos
<b>B00I - R0005 - Distribution Board Cupboard (1.48 m2)</b>	Note: No inspection of live electrical installation. No Asbestos
<b>B00I - R0006 - Communication Space (0.66 m2)</b>	No Asbestos
<b>B00I - R0007 - Staff - Toilet (6.4 m2)</b>	No Asbestos
<b>B00I - R0008 - Plant (0.51 m2)</b>	No Asbestos
<b>B00I - R0009 - Movement (4.89 m2)</b>	No Asbestos
<b>B00I - R0010 - Sport Equipment Store (21.95 m2)</b>	No Asbestos
<b>B00I - R0011 - Chair Storeroom (12.93 m2)</b>	No Asbestos
<b>B00I - R0012 - Student Change - Type 2 (30.96 m2)</b>	No Asbestos
<b>B00I - R0013 - Stage (4.34 m2)</b>	No Asbestos
<b>B00I - R0014 - Communications Cupboard (0.47 m2)</b>	No Asbestos
<b>B00I - R0015 - Plant (0.47 m2)</b>	No Asbestos
<b>B00I - R0016 - Movement (4.14 m2)</b>	No Asbestos
<b>B00I - R0017 - Movement (19.15 m2)</b>	No Asbestos
<b>B00I - R0019 - Ramp (23.59 m2)</b>	No Asbestos
<b>B00I - R0020 - Stage (115.83 m2)</b>	No Asbestos
<b>B00I - R0022 - Movement (14.73 m2)</b>	No Asbestos
<b>B00I - R0023 - Movement (4.17 m2)</b>	No Asbestos
<b>B00I - R0024 - Student Change - Type 2 (30.93 m2)</b>	No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B001 - R0025 - Plant (0.5 m2)**

No Asbestos

**B001 - R0026 - Performing Arts Store (1.29 m2)**

No Asbestos

**B001 - R0027 - Chair Storeroom (16.57 m2)**

No Asbestos

**B001 - R0028 - Large Equipment Store (25.17 m2)**

No Asbestos

**B001 - R0029 - Toilets-Boys (14.73 m2)**

No Asbestos

**B001 - R0030 - Cleaning Store - Distributed (2.71 m2)**

No Asbestos

**B001 - R0031 - Access Student Shower/Toilet - Type 2 (6.45 m2)**

No Asbestos

**B001 - R0032 - Movement (5.88 m2)**

No Asbestos

**B001 - R0033 - Toilets-Girls (16.74 m2)**

No Asbestos

**B001 - R0034 - Movement (24.47 m2)**

No Asbestos

**B001 - R0035 - Control Room (8.87 m2)**

No Asbestos

**B001 - R0036 - Plant (1.05 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017