


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Granville South Creative and Performing Arts High (8436)
Region : South Western Sydney
State Electorate : Auburn
Local Government Area : Parramatta

Initial Survey : Noel Arnold & Associates : 26 - Mar - 2008
Reviewed By : Grencap-NAA : 29 - May - 2015

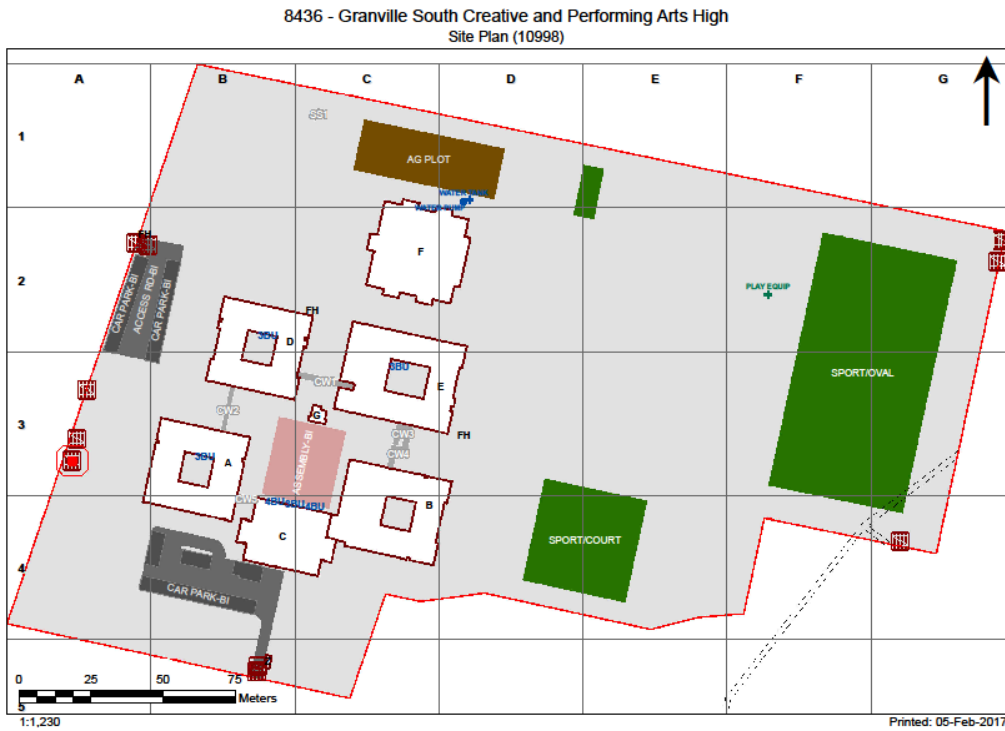

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible . Slab on ground.					
Eaves Linings	Vermiculite 8436/B00A/Eaves Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Interior

B00A - R0001 - General Learning Space (59.64 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00A/R0001/Floor Coverings Res/Textile/S2	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0002 - Lab LS

Ceiling Structures/Linings	Flat AC Sheeting 8436/B00A/R0002/Ceiling Structures/Linings/S41					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00A - R0006 - Toilets-Unisex (2.87 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8436/B00A/R1005/Wall Linings Internal/S6	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0007 - Cleaning Store - Distributed (0.32 m2)

No Asbestos

B00A - R0008 - Distribution Board Cupboard (0.7 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0009 - Interview/Meeting (9.9 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00A/R0018/Floor Coverings Res/Textile/S40	9.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0010 - Administration - Executive (9.39 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00A/R0018/Floor Coverings Res/Textile/S40	9.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0012 - Administration - Clerical (25.57 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00A/R0018/Floor Coverings Res/Textile/S40	25.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0013 - Clinic (12.61 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles					
	8436/B00A/R0013/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0014 - General Storeroom (2.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	2.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R0018/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)
B00A - R0015 - Staff - Toilet (2.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00A - R0016 - Principal Office (19.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R0018/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)
B00A - R0017 - Printing/Photocopying (32.02 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R0018/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)
B00A - R0018 - Movement (28.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	28.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R0018/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)
B00A - R0019 - Cleaning Store - Distributed (2.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R0001/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R0020 - Deputy Principal Office (8.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R0018/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)
B00A - R0021 - Administration - Executive (8.42 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00A/R0018/Floor Coverings Res/Textile/S40	8.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0022 - Staff - Toilet (4.01 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0023 - Staff - Toilet (4.01 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0024 - Deputy Principal Office (8.42 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00A/R0018/Floor Coverings Res/Textile/S40	8.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0025 - General Storeroom (4.78 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00A/R0001/Floor Coverings Res/Textile/S2	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0026 - External Movement (289.39 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0027 - General Storeroom (14.94 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0028 - Distribution Board Cupboard (1.1 m2)						
No Asbestos				Note: No inspection of live electrical installation.		
B00A - R0029 - Cleaning Store - Distributed (2.98 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0030 - Staff Study (35.63 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0031 - Tea Room (1.66 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0032 - Seminar (52.33 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0033 - General Storeroom (13.84 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0034 - Staff Study (38.54 m2)						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R0035 - Tea Room (1.03 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0036 - Resources Store (5.34 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0037 - External Movement (11.45 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0038 - External Stairs (2.82 m2)						
No Asbestos						
B00A - R0039 - External Stairs (3.06 m2)						
No Asbestos						
B00A - R0040 - External Movement (11.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0041 - Student Reception (14.65 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0042 - Administration - Clerical (18.82 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1001 - General Learning Space (59.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R1008/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00A - R1002 - General Learning Space (53.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R1008/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00A - R1003 - General Learning Space (52.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R1008/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00A - R1004 - General Learning Space (59.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R1008/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00A - R1005 - Staff - Toilet (2.87 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00A/R1005/Wall Linings Internal/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8436/B00A/R0001/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - Handwashing Facilities (0.3 m2)						

8436 Granville South Creative and Performing Arts High

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	0.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R0007/Ceiling Structures/Linings/S42				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00A - R1007 - Distribution Board Cupboard (0.73 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	As debris to floor	Poor Condition (4)	Low (1)	Low Priority (2-3)
8436/B00A/R1007/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1008 - General Learning Space (53.9 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
B00A - R1009 - Resources Store (6.21 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
B00A - R1010 - Resources Store (6.25 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
B00A - R1011 - Design L.S. (72.87 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
B00A - R1012 - General Learning Space (53.01 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
B00A - R1016 - Interview/Meeting (25.26 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
B00A - R1017 - General Learning Space (53.68 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00A/R0001/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
B00A - R1018 - Distribution Board Cupboard (1.12 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	As debris to floor	Poor Condition (4)	Low (1)	Low Priority (2-3)
8436/B00A/R1007/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1019 - Cleaning Store - Distributed (2.94 m2)						
No Asbestos						
B00A - R1020 - External Movement (116.55 m2)						
No Asbestos						
B00A - R1021 - Commonroom (74.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	74.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite	74.3m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)
8436/B00A/R1007/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1022 - Staff Kitchen (11.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite	11.6m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)
8436/B00A/R1007/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1023 - Staff Study (26.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R1008/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite	26.1m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)
8436/B00A/R1007/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1024 - External Stairs (4.99 m2)						
Ceiling Structures/Linings	Vermiculite	4.9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8436/B00A/R1007/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1025 - External Stairs (5.01 m2)						
Ceiling Structures/Linings	Vermiculite	5.0m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)
8436/B00A/R1007/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Technological & Applied Studies/Art - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Vermiculite 8436/B00A/Eaves Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Interior

B00B - R0001 - Laundry (32.74 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00B - R0002 - Class Tools Storage (15.67 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00B - R0003 - Resources Store (9.67 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00B - R0004 - Staff - Toilet (2.8 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00B/R0004/Partition Walls (Cubicles)/S24					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0005 - Distribution Board Cupboard (0.71 m2)

Note: No inspection of live electrical installation.

Debris to floor	Flat AC Sheeting	1Unit(s)	Lower portion	Poor Condition (4)	Low (1)	Low Priority (2-3)
	8436/B00B/R0005/Debris to floor/S25					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0006 - Handwashing Facilities (0.34 m2)

No Asbestos

B00B - R0007 - Staff Study (54.04 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00B - R0008 - Resources Store (4.75 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00B - R0009 - Resources Store (5.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00B/R0013/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00B - R0010 - Practice/Seminar (13.14 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R0013/Floor Coverings Res/Textile/S22	13.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0011 - Music Store (15.99 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0012 - Music Learning Space (96.21 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0013 - Staff Study (23.75 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R0013/Floor Coverings Res/Textile/S22	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0014 - Welding Area (4.61 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0015 - Materials Learning Space - Type 1 (95.39 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R0013/Floor Coverings Res/Textile/S22	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0017 - Resources Store (27.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R0013/Floor Coverings Res/Textile/S22	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0018 - Cleaning Store - Distributed (2.89 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0019 - Distribution Board Cupboard (1.09 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R0020 - Food Technology L.S. (72.81 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0021 - Resources Store (8.81 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0022 - Preparation (16.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0023 - Food Technology L.S. (66.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0025 - Chair Store						
Wall Linings Internal	Flat AC Sheeting					
	8436/B00B/Room+1/Wall Linings Internal/S47					No Asbestos Detected
B00B - R0026 - Kiln Space (15.73 m2)						
Recently Modified Space	Requires Inspection					
B00B - R0027 - External Stairs (1.37 m2)						
No Asbestos						
B00B - R0028 - External Stairs (1.3 m2)						
No Asbestos						
B00B - R0029 - External Movement (138.52 m2)						
Recently Modified Space	Requires Inspection					
B00B - R0030 - General Storeroom (34.86 m2)						
Recently Modified Space	Requires Inspection					
B00B - R0031 - Materials Store (6.02 m2)						
Recently Modified Space	Requires Inspection					
B00B - R0032 - External Movement (16.08 m2)						
Recently Modified Space	Requires Inspection					
B00B - R0033 - External Movement (103.23 m2)						
Recently Modified Space	Requires Inspection					
B00B - R1001 - Wood Technology Bay (16.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8436/B00B/R1015/Floor Coverings Res/Textile/S27					No Asbestos Detected
B00B - R1002 - Materials Store (13.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00B/R0013/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1003 - Materials Learning Space - Type 1 (82.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1004 - Materials Learning Space - Type 1 (82.53 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1005 - Dust Extraction Space (2.24 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1006 - Materials Store (13.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R0013/Floor Coverings Res/Textile/S22	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1007 - Materials Store (13.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R0013/Floor Coverings Res/Textile/S22	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1008 - Cleaning Store - Distributed (2.94 m2)						
No Asbestos						
B00B - R1009 - Distribution Board Cupboard (1.12 m2)				Note: No inspection of live electrical installation.		
Debris to floor	Flat AC Sheeting 8436/B00B/R0005/Debris to floor/S25	1Unit(s)	Lower portion	Poor Condition (4)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1010 - Art Learning Space (54.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R0013/Floor Coverings Res/Textile/S22	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1011 - Art Learning Space (53.99 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R0013/Floor Coverings Res/Textile/S22	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1012 - Dark Room						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1013 - Resources Store (10.06 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R1015/Floor Coverings Res/Textile/S27					No Asbestos Detected
B00B - R1015 - Resources Store (12.51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00B/R1015/Floor Coverings Res/Textile/S27					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R1016 - Art Learning Space (66.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00B/R0013/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8436/B00B/R0013/Ceiling Structures/Linings/S23				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1017 - Art Learning Space (59.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00B/R0013/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8436/B00B/R0013/Ceiling Structures/Linings/S23				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1018 - Resources Store (4.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00B/R0013/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8436/B00B/R0013/Ceiling Structures/Linings/S23				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1019 - Resources Store (5.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00B/R0013/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8436/B00B/R0013/Ceiling Structures/Linings/S23				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1020 - Design/Technology L.S. (53.9 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00B/R0013/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
8436/B00B/R0013/Ceiling Structures/Linings/S23				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R1021 - Staff - Toilet (2.84 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00B/R0004/Partition Walls (Cubicles)/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1022 - Distribution Board Cupboard (0.88 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting					
8436/B00B/R0013/Ceiling Structures/Linings/S23				No Asbestos Detected		
B00B - R1023 - Handwashing Facilities (0.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00B/R1023/Ceiling Structures/Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R1024 - External Movement (126.18 m2)						
No Asbestos						
B00B - R1025 - Darkroom Space (2.11 m2)						
Recently Modified Space	Requires Inspection					
B00B - R1026 - Dark Room (18.2 m2)						
Recently Modified Space	Requires Inspection					
B00B - R1027 - Staff Study (24.19 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Recently Modified Space Requires Inspection

B00B - R1028 - Tea Room (1.84 m2)

Recently Modified Space Requires Inspection

B00B - R1029 - External Stairs (4.99 m2)

No Asbestos

B00B - R1030 - External Stairs (5.01 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Multi Purpose Facilities - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Vermiculite 8436/B00A/Eaves Linings/S43					Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Interior

B00C - R0001 - Cleaning Store - Distributed (5.41 m2)

Non Accessible

B00C - R0002 - Sport Equipment Store (9.7 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00C/R0002/Ceiling Structures/Linings/S12					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0003 - Movement (5.7 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00C/R0002/Ceiling Structures/Linings/S12					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0004 - Movement (2.98 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00C/R0002/Ceiling Structures/Linings/S12					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0005 - Sport Equipment Store (10.49 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00C/R0002/Ceiling Structures/Linings/S12					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0006 - Sport Equipment Store (6.23 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00C/R0002/Ceiling Structures/Linings/S12					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0007 - Cleaning Supplies Store (6.23 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00C/R0002/Ceiling Structures/Linings/S12					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0008 - Student Canteen (58.26 m2)

In-fill-panel	Flat AC Sheeting 8436/B00C/R0008/In-fill-panel/S13					No Asbestos Detected
---------------	---	--	--	--	--	----------------------

B00C - R0009 - Staff - Toilet (2.79 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8436/B00C/R0009/Partition Walls (Cubicles)/S14					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00C - R0010 - Pantry (2.91 m2)

No Asbestos

B00C - R0011 - Machine Storage (6.09 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00C/R0002/Ceiling Structures/Linings/S12					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0012 - General Assistants (5.77 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00C/R0002/Ceiling Structures/Linings/S12					Limited Samples Taken
----------------------------	---	--	--	--	--	-----------------------

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0013 - Distribution Board Cupboard (0.73 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0015 - Garden Store Room (14.18 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0016 - General Storeroom (1.99 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0017 - Archive Store (19.37 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0018 - Staff - Toilet (4.73 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0019 - Sport Equipment Store (1.5 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0022 - General Storeroom (10.16 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0023 - Sport Equipment Store (5.42 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0025 - Movement (26.42 m2)						
Recently Modified Space	Requires Inspection					
B00C - R0026 - Multi-Purpose Space (312.1 m2)						
Recently Modified Space	Requires Inspection					
B00C - R0027 - Movement (12.85 m2)						
Recently Modified Space	Requires Inspection					
B00C - R0028 - Stairs (1.7 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0029 - Stairs (2.14 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00C/R0002/Ceiling Structures/Linings/S12			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0030 - External Movement (55.13 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1002 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	8436/B00C/R1002/Ceiling Structures/Linings/S16			No Asbestos Detected	
B00C - R1003 - Staff Change (6.55 m2)						
Non Accessible						
B00C - R1005 - Change (39.2 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
B00C - R1006 - Change (34.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1008/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1004/Partition Walls (Cubicles)/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	8436/B00C/R1006/In-fill-panel/S21				No Asbestos Detected
B00C - R1008 - Staff Shower (6.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1008/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Flue	Resinous pipe	1Unit(s)	North, Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8436/B00C/R1008/Flue/S19				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1008/Floor Coverings Res/Textile/S20				Chrysotile (white asbestos)		
B00C - R1009 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	8436/B00C/R1002/Ceiling Structures/Linings/S16				No Asbestos Detected
B00C - R1011 - Plant (3.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1008/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1012 - Handwashing Facilities (10.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1008/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1013 - Toilets-Girls (24.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1008/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	24.43m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1004/Partition Walls (Cubicles)/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1014 - Plant (3.6 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1015 - Plant (1.31 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1016 - Movement (14.22 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1017 - Stairs (14.46 m2)						
No Asbestos						
B00C - R1018 - Handwashing Facilities (10.51 m2)						
No Asbestos						
B00C - R1019 - Toilets-Boys (23.93 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	23.93m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1004/Partition Walls (Cubicles)/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1020 - Plant (3.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00C/R1008/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1021 - Plant (1.33 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1022 - Movement (14.15 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1023 - Stairs (14.38 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Science Learning/General Learning - 1962 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Vermiculite 8436/B00A/Eaves Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00D - R0005 - Staff - Toilet (2.82 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8436/B00D/R0005/Partition Walls (Cubicles)/S30	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos) , Amosite (brown asbestos)</i>

B00D - R0006 - Cleaning Store - Distributed (0.33 m2)

No Asbestos

B00D - R0007 - Distribution Board Cupboard (0.7 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0008 - Interview/Office - Type 1 (13.58 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00D/R0009/Floor Coverings Res/Textile/S28	13.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00D - R0009 - Resources Store (8.38 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00D/R0009/Floor Coverings Res/Textile/S28	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00D - R0010 - Computer Learning Space (50.52 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00D/R0009/Floor Coverings Res/Textile/S28	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00D - R0013 - Chemical Store (6.27 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00D/R0009/Floor Coverings Res/Textile/S28	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00D - R0014 - Apparatus Store (19.34 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)	
Fume Cupboard	Flat AC Sheeting	1Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00A/R0002/Fume Cupboard/S3					Chrysotile (white asbestos)	
Sinkpad	Fibrous Membrane					
8436/B00D/R0014/Sinkpad/S44					No Asbestos Detected	
B00D - R0015 - Laboratory L.S. (86.51 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)	
B00D - R0016 - General Learning Space (65.11 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)	
B00D - R0017 - Distribution Board Cupboard (1.07 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00D - R0018 - Cleaning Store - Distributed (2.91 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0019 - External Movement (162.66 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0020 - Toilets-Boys (30.95 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0021 - Plant (4.85 m2)						
Recently Modified Space	Requires Inspection					
B00D - R0022 - Toilets-Girls (48.25 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0023 - Plant (4.95 m2)						
Recently Modified Space	Requires Inspection					
B00D - R0024 - Plant (4.95 m2)						
Recently Modified Space	Requires Inspection					
B00D - R0025 - Laboratory L.S. (45.73 m2)						
Ceiling Structures/Linings	Vermiculite					
8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0026 - General Learning Space (40.15 m2)						
Recently Modified Space	Requires Inspection					
B00D - R0027 - Preparation - Science (39.06 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0028 - Laboratory L.S. (49.85 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0029 - General Learning Space (50.07 m2)						
Recently Modified Space	Requires Inspection					
B00D - R0030 - External Stairs (1.69 m2)						
No Asbestos						
B00D - R0031 - External Stairs (1.88 m2)						
No Asbestos						
B00D - R1001 - General Learning Space (59.48 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)
B00D - R1002 - Staff Study (26.21 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)
B00D - R1003 - General Learning Space (52.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)
B00D - R1004 - Movement (4.27 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)
B00D - R1005 - Computer Store (7.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)
B00D - R1006 - Office/Store (13.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00D - R1007 - Music Learning Space (59.4 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00D/R0009/Floor Coverings Res/Textile/S28	59.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1008 - Staff - Toilet (2.84 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8436/B00D/R0005/Partition Walls (Cubicles)/S30	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R1009 - Cleaning Store - Distributed (0.31 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8436/B00D/R1019/Ceiling Structures/Linings/S32	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R1010 - Distribution Board Cupboard (0.74 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting 8436/B00D/R1019/Ceiling Structures/Linings/S32	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R1012 - Staff Study						
Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00D/R0009/Floor Coverings Res/Textile/S28	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1013 - General Learning Space (59.48 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00D/R0009/Floor Coverings Res/Textile/S28	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1014 - General Learning Space (52.94 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00D/R0009/Floor Coverings Res/Textile/S28	52.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1015 - General Learning Space (52.94 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00D/R0009/Floor Coverings Res/Textile/S28	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1016 - General Learning Space (59.48 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00D/R0009/Ceiling Structures/Linings/S29					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)	
B00D - R1017 - General Learning Space (65.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00D/R0009/Ceiling Structures/Linings/S29					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)	
B00D - R1018 - Cleaning Store - Distributed (2.92 m2)						
No Asbestos						
B00D - R1019 - Distribution Board Cupboard (1.09 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Debris to floor	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8436/B00D/R1019/Ceiling Structures/Linings/S32					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R1020 - External Movement (134.71 m2)						
No Asbestos						
B00D - R1021 - Staff Study (75.22 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00D/R0009/Ceiling Structures/Linings/S29					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	75.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00D/R0009/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)	
B00D - R1022 - External Stairs (4.98 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00D/R0009/Ceiling Structures/Linings/S29					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00D - R1023 - External Stairs (4.94 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00D/R0009/Ceiling Structures/Linings/S29					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library/General Learning/Science Learning - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Vermiculite 8436/B00E/Ceiling Voids/S45					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Vermiculite 8436/B00A/Eaves Linings/S43					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Interior**B00E - R0001 - Laboratory L.S. (86 m2)**

Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00E - R0002 - Resources Store (13.19 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00E - R0003 - Resources Store (2.64 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00E - R0004 - Apparatus Store (22.4 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00E - R0005 - Movement Studio (92.93 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00E - R0007 - Fitness Laboratory (51.7 m2)

Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

B00E - R0008 - Apparatus Store (4.9 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	NA	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0009 - General Storeroom (3.66 m2)						
No Asbestos						
B00E - R0011 - Handwashing Facilities (0.33 m2)						
No Asbestos						
B00E - R0012 - Resources Store (4.15 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0013 - General Learning Space (46 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0014 - General Learning Space (52.8 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0015 - General Learning Space (51.26 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0017 - General Learning Space (59.84 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0019 - Handwashing Facilities (0.33 m2)						
No Asbestos						
B00E - R0020 - Toilets-Girls (11.54 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8436/B00E/R0010/Partition Walls (Cubicles)/S35	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8436/B00B/R0013/Ceiling Structures/Linings/S23					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R0021 - Cleaning Store - Distributed (4.28 m2)						
No Asbestos						
B00E - R0022 - Resources Store (17.85 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0023 - Performance Workspace (52.8 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0024 - External Movement (171.81 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Floor Coverings Res/Textile/S33	6.5m2	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8) Chrysotile (white asbestos)
B00E - R0025 - Toilets-Unisex (6.53 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0026 - Change (4.08 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0027 - Sport Equipment Store (13.8 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0028 - Movement (2.13 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0029 - Change (4.17 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00E/R0002/Floor Coverings Res/Textile/S33	4.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0030 - Change (25.64 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00E/R0002/Floor Coverings Res/Textile/S33	25.6m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0031 - Sport Equipment Store (3.96 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	3.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0032 - Other-Vacant (0.52 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0033 - Staff Study (23.73 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00E/R0002/Floor Coverings Res/Textile/S33	23.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0034 - Tea Room (1.89 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Recently Modified Space	Requires Inspection					
B00E - R0035 - External Stairs (3.59 m2)						
No Asbestos						
B00E - R0036 - External Stairs (2.93 m2)						
No Asbestos						
B00E - R0037 - External Movement (37.34 m2)						
Recently Modified Space	Requires Inspection					
B00E - R0038 - External Movement (113.19 m2)						
Recently Modified Space	Requires Inspection					
B00E - R1001 - General Learning Space (59.44 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R1002 - E.S.L. (12.64 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33		Chrysotile (white asbestos)				
B00E - R1003 - E.S.L. (12.57 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33		Chrysotile (white asbestos)				
B00E - R1004 - Deputy Principal Office (16.44 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33		Chrysotile (white asbestos)				
B00E - R1005 - Staff Study (8.98 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33		Chrysotile (white asbestos)				
B00E - R1006 - External Movement (4.59 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33		Chrysotile (white asbestos)				
B00E - R1007 - Careers Advisers Office (12.75 m2)						
Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34		Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33				Chrysotile (white asbestos)		
B00E - R1008 - General Storeroom (2.69 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00E/R0002/Ceiling Structures/Linings/S34				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33				Chrysotile (white asbestos)		
B00E - R1009 - Resources Store (4.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00E/R0002/Ceiling Structures/Linings/S34				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33				Chrysotile (white asbestos)		
B00E - R1010 - General Learning Space (52.58 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00E/R0002/Ceiling Structures/Linings/S34				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33				Chrysotile (white asbestos)		
B00E - R1011 - General Learning Space (59.61 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00E/R0002/Ceiling Structures/Linings/S34				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33				Chrysotile (white asbestos)		
B00E - R1012 - Cleaning Store - Distributed (0.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R1014/Internal door linings./S46				Chrysotile (white asbestos)		
B00E - R1013 - Staff - Toilet (3.75 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00E/R0002/Ceiling Structures/Linings/S34				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
B00E - R1014 - Distribution Board Cupboard (0.69 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R1014/Internal door linings./S46				Chrysotile (white asbestos)		
Electrical Backing Board	Resinous Board	0.2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Internal door linings.	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R1014/Internal door linings./S46				Chrysotile (white asbestos)		
B00E - R1015 - Staff Study (24.56 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8436/B00E/R0002/Ceiling Structures/Linings/S34				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R0002/Floor Coverings Res/Textile/S33				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1017 - Senior Study (15.99 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00E/R0002/Floor Coverings Res/Textile/S33	15.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1018 - Senior Study (16 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8436/B00E/R0002/Floor Coverings Res/Textile/S33	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1019 - Librarian (9.58 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1020 - Audio Visual Workroom (19.43 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1021 - Resources Store (5.46 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1022 - Library Administration (22.33 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1023 - Secure Storeroom (11.35 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8436/B00E/R0002/Floor Coverings Res/Textile/S33	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1024 - Staff - Toilet (3.63 m2)						
Ceiling Structures/Linings	Vermiculite 8436/B00E/R0002/Ceiling Structures/Linings/S34					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1025 - Cleaning Store - Distributed (0.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8436/B00E/R1025/Door linings/S36	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Door linings	Flat AC Sheeting 8436/B00E/R1025/Door linings/S36	2Unit(s)	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1026 - General Storeroom (0.7 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Internal door linings	Flat AC Sheeting	3m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
8436/B00E/R1014/Internal door linings./S46					Chrysotile (white asbestos)	

B00E - R1027 - External Movement (158.88 m2)

Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00E - R1028 - Distribution Board Cupboard (0.68 m2) Note: No inspection of live electrical installation.

Door linings	Flat AC Sheeting	2Unit(s)	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8436/B00E/R1025/Door linings/S36					Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00E - R1029 - Main Entry (55.01 m2)

Recently Modified Space	Requires Inspection					
-------------------------	---------------------	--	--	--	--	--

B00E - R1030 - Main Area (118.93 m2)

Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00E - R1031 - General Learning Space (53.34 m2)

Recently Modified Space	Requires Inspection					
-------------------------	---------------------	--	--	--	--	--

B00E - R1032 - Computer Resource (52.58 m2)

Recently Modified Space	Requires Inspection					
-------------------------	---------------------	--	--	--	--	--

B00E - R1033 - External Stairs (7.53 m2)

Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

B00E - R1034 - External Stairs (7.54 m2)

Ceiling Structures/Linings	Vermiculite	8436/B00E/R0002/Ceiling Structures/Linings/S34				Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 1988 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Unable to access ceiling voids due to flat roof.					
Awnings	Flat AC Sheeting 8436/B00F/Awnings/S48					No Asbestos Detected
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction - Unable to access ceiling voids due to flat roof.					

Interior

B00F - M0003 - Performance Store (26.7 m2)

No Asbestos

B00F - M0004 - Stairs (1.44 m2)

No Asbestos

B00F - R0001 - Chair Store (12.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8436/B00F/R0002/Ceiling Structures/Linings/S39					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00F - R0003 - Movement (5.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8436/B00F/R0002/Ceiling Structures/Linings/S39					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00F - R0004 - Communication Space (1.25 m2)

No Asbestos

B00F - R0006 - Movement (6.11 m2)

No Asbestos

B00F - R0008 - Sport Equipment Store (7.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8436/B00F/R0002/Ceiling Structures/Linings/S39					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00F - R0009 - Staff Shower (5.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8436/B00F/R0002/Ceiling Structures/Linings/S39					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00F - R0010 - Multi-Purpose Space (478.22 m2)

No Asbestos

B00F - R0011 - Movement (3.82 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00F - R0012 - Sport Equipment Store (28.01 m2)

Wall Linings Internal	Flat AC Sheeting 8436/B00F/R0020/Wall Linings Internal/S38					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00F - R0013 - Cleaning Store - Distributed (2.15 m2)

No Asbestos

B00F - R0014 - Toilets-Boys (12.45 m2)

Wall Linings Internal	Flat AC Sheeting 8436/B00F/R0020/Wall Linings Internal/S38					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00F - R0015 - Toilet - Lobby (4.3 m2)

Wall Linings Internal	Flat AC Sheeting 8436/B00F/R0020/Wall Linings Internal/S38					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00F - R0016 - Distribution Board Cupboard (0.99 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0017 - Toilets-Disabled (4.18 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00F - R0018 - Movement (25.15 m2)						
No Asbestos						
B00F - R0019 - Staff Kitchen (12.46 m2)						
No Asbestos						
B00F - R0020 - Toilet - Lobby (6.36 m2)						
Wall Linings Internal	Flat AC Sheeting		8436/B00F/R0020/Wall Linings Internal/S38		No Asbestos Detected	
B00F - R0021 - Toilets-Girls (18.55 m2)						
Wall Linings Internal	Flat AC Sheeting		8436/B00F/R0020/Wall Linings Internal/S38		No Asbestos Detected	
B00F - R0022 - General Storeroom (15.72 m2)						
Wall Linings Internal	Flat AC Sheeting		8436/B00F/R0020/Wall Linings Internal/S38		No Asbestos Detected	
B00F - R0023 - General Storeroom (2.64 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00F - R0025 - Stairs (1.62 m2)						
No Asbestos						
B00F - R0026 - Stairs (1.62 m2)						
No Asbestos						
B00F - R0027 - Toilet - Lobby (1.43 m2)						
No Asbestos						
B00F - R0028 - Change (30.14 m2)						
No Asbestos						
B00F - R0029 - Toilet - Lobby (1.43 m2)						
No Asbestos						
B00F - R0030 - Change (30.72 m2)						
No Asbestos						
B00F - R0031 - Stage (84.74 m2)						
No Asbestos						
B00F - R0032 - Stairs (1.85 m2)						
No Asbestos						
B00F - R0033 - Movement (1.06 m2)						
No Asbestos						
B00F - R0034 - Stairs (6.04 m2)						
No Asbestos						
B00F - R0035 - Movement (1.37 m2)						
No Asbestos						
B00F - R0036 - Stairs (5.63 m2)						
No Asbestos						
B00F - R0037 - External Movement (11.09 m2)						
No Asbestos						
B00F - R0038 - External Movement (11.09 m2)						
No Asbestos						
B00F - R0039 - External Movement (34.09 m2)						
No Asbestos						
B00F - R0040 - External Movement (11.09 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0041 - External Movement (11.09 m2)						
No Asbestos						
B00F - R0042 - External Movement (19.01 m2)						
No Asbestos						
B00F - R1001 - Performance Store (13.02 m2)						
No Asbestos						
B00F - R1002 - Stairs (1.39 m2)						
No Asbestos						
B00F - R1003 - Movement (133.57 m2)						
No Asbestos						
B00F - R1004 - Control Room (6.39 m2)						
No Asbestos						
B00F - R1005 - Stairs (12.06 m2)						
No Asbestos						
B00F - R1006 - Stairs (12.08 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Electrical Services - 1974 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00G - R0001 - Distribution Board Cupboard (3.94 m2) Note: No inspection of live electrical installation.

No Asbestos

B00G - R0002 - General Storeroom (8.75 m2)

No Asbestos

B00G - R0003 - External Movement (10.1 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Building Services - 1965 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00Z - R0001 - Plant (6.16 m2)

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8436_ASB_221112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017