


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Glendale High School (8466)
Region : Hunter/Central Coast
State Electorate : Wallsend
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : AECOM : 14 - Feb - 2017

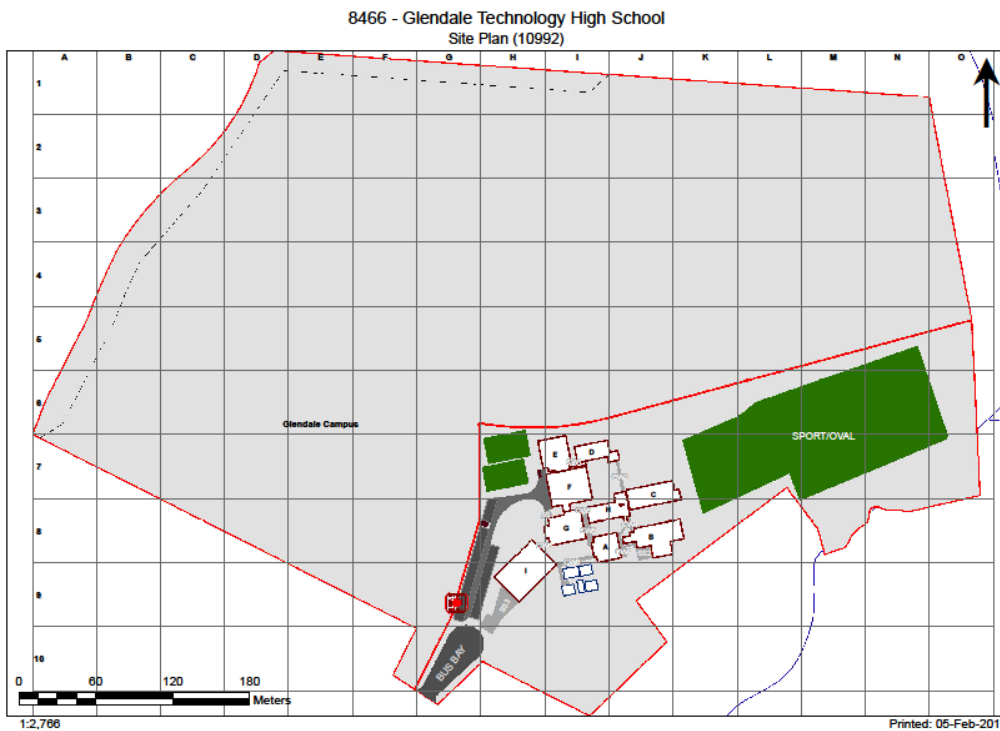

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1968 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void hatch located

Interior

B00A - R0001 - Deputy Principal Office (16.9 m2)

No Asbestos

B00A - R0002 - Staff - Toilet (9.51 m2)

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00A/R0002/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00A - R0003 - Cleaning Store - Distributed (2.75 m2)

No Asbestos

B00A - R0004 - Staff - Toilet (10.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00A/R0002/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

B00A - R0005 - Clinic - Girls (13.05 m2)

No Asbestos

B00A - R0006 - Clinic - Boys (13.61 m2)

No Asbestos

B00A - R0007 - Administration - Clerical (40.11 m2)

No Asbestos

B00A - R0008 - Duplicating Workroom (23.73 m2)

No Asbestos

B00A - R0009 - Security Store (17.17 m2)

No Asbestos

B00A - R0010 - Teachers Aides (13.43 m2)

No Asbestos

B00A - R0011 - Interview/Office - Type 1 (13.24 m2)

No Asbestos

B00A - R0012 - Leading Teacher (13.24 m2)

No Asbestos

B00A - R0013 - Principal Office (19.96 m2)

No Asbestos

B00A - R0014 - Staff - Toilet (3.11 m2)

No Asbestos

B00A - R0015 - General Storeroom (3.15 m2)

No Asbestos

B00A - R0016 - Interview/Office - Type 1 (12.58 m2)

No Asbestos

B00A - R0017 - Interview/Office - Type 1 (11.83 m2)

No Asbestos

B00A - R0018 - Movement (84.7 m2)

No Asbestos

B00A - R0019 - Movement (22.02 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1973 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area	- Area inaccessible, raked ceiling, no access points.				
Underfloor Voids - Slab on Ground	Non Accessible Area	- Area inaccessible				

Interior

B00B - R0001 - Careers Advisers Office (20.09 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00B/R0019/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0002 - Staff - Toilet (11.97 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00B/R0019/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0002/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos)		

B00B - R0003 - Cleaning Store - Distributed (0.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00B - R0004 - General Storeroom (4.34 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00B/R0019/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0005 - Staff - Toilet (13.92 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00B/R0019/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0002/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos)		

B00B - R0006 - Workroom (18.46 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00B/R0019/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0007 - Distribution Board Cupboard (0.63 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00B - R0008 - Cleaning Store - Distributed (0.47 m2)

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00B - R0009 - Workroom (5.7 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00B/R0019/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0010 - Librarian (6.5 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00B/R0019/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R0011 - Senior Study (52.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	8466/B00B/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0012 - Seminar (139.47 m2)						
No Asbestos						
B00B - R0013 - Main Area (205.39 m2)						
Ceiling Structures/Linings	Vermiculite					
	8466/B00B/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0014 - Seminar (12.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	8466/B00B/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0015 - Seminar (12.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	8466/B00B/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0016 - Workroom (54.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	8466/B00B/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0017 - Audio Visual Workroom (26.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8466/B00B/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0018 - General Storeroom (4.02 m2)						
No Asbestos						
B00B - R0019 - Movement (71.96 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00B/R0019/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8466/B00B/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0020 - Movement (1.73 m2)						
Ceiling Structures/Linings	Vermiculite					
	8466/B00B/R0019/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0022 - Stairs (4.24 m2)						
No Asbestos						
B00B - R0023 - Stairs (0.44 m2)						
No Asbestos						
B00B - R0024 - Movement (52.71 m2)						
No Asbestos						
B00B - R1001 - Computer Learning Space (52.92 m2)						
Infill panel under window	Compressed AC Sheet	4Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00B/R1003/In-fill-panel/S5					Chrysotile (white asbestos)
B00B - R1002 - General Learning Space (52.92 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
	8466/B00B/R1003/In-fill-panel/S5					Chrysotile (white asbestos)
B00B - R1003 - Staff Study (19.35 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
In-fill-panel	Compressed AC Sheet	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R1003/In-fill-panel/S5				Chrysotile (white asbestos)		
B00B - R1004 - General Storeroom (6.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00B - R1005 - Cleaning Store - Distributed (3.72 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00B - R1006 - Movement (20.63 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00B - R1007 - General Learning Space (52.92 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8				Chrysotile (white asbestos)		
B00B - R1008 - General Learning Space (52.92 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R1003/In-fill-panel/S5				Chrysotile (white asbestos)		
B00B - R1009 - General Learning Space (52.92 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00B/R1003/In-fill-panel/S5				Chrysotile (white asbestos)		
B00B - R1010 - General Learning Space (65.41 m2)						
Infill panel	Compressed AC Sheet	2.75m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00B/R1003/In-fill-panel/S5				Chrysotile (white asbestos)		
B00B - R1011 - General Learning Space (53.65 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8				Chrysotile (white asbestos)		
B00B - R1012 - General Storeroom (17.42 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Infill panel	Compressed AC Sheet	1.1m2	Below window	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R1003/In-fill-panel/S5				Chrysotile (white asbestos)		
B00B - R1013 - Cleaning Store - Distributed (0.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00B - R1014 - Distribution Board Cupboard (0.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
B00B - R1015 - Staff Study (39.06 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00B/R1003/In-fill-panel/S5				Chrysotile (white asbestos)		
B00B - R1016 - Movement (18.22 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R0019/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00B - R1017 - Movement (1.87 m2)						
No Asbestos						
B00B - R1018 - Movement (37.66 m2)						
No Asbestos						
B00B - R1019 - Stairs (4.24 m2)						
No Asbestos						
B00B - R1020 - Stairs (15.62 m2)						
In-fill-panel	Compressed AC Sheet	2m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00B/R1003/In-fill-panel/S5					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1973 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible, raked ceiling, no accessible ceiling void.

Interior

B00C - R0001 - General Learning Space (54.02 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00C - R0002 - Staff Study (39.59 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00C - R0003 - General Learning Space (53.65 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00C - R0004 - General Learning Space (53.65 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00C - R0005 - Staff Study (53.65 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00C - R0006 - General Storeroom (5.16 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Floor Coverings Res/Textile	Vinyl Tiles 6m2 Throughout	Good Condition (1) Low (1) Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7 Chrysotile (white asbestos)		

B00C - R0007 - Staff - Toilet (4.48 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00C - R0008 - Staff - Toilet (7.03 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00C - R0009 - Apparatus Store (36.11 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00C/R0007/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Floor Coverings Res/Textile	Vinyl Tiles 37m2 Throughout	Good Condition (1) Low (1) Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7 Chrysotile (white asbestos)		

B00C - R0010 - Distribution Board Cupboard (0.77 m2)

Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles 1m2 Throughout	Good Condition (1) Low (1) Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7 Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0011 - General Storeroom (10.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8466/B00C/R0007/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00C - R0012 - Cleaning Store - Distributed (2.87 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8466/B00C/R0007/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00C - R0013 - Staff Study (14.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8466/B00C/R0007/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0014 - Staff Study (22.86 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8466/B00C/R0007/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0015 - General Storeroom (11.34 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8466/B00C/R0007/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00C - R0016 - General Learning Space (54.02 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8466/B00C/R0007/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0017 - External Movement (2.05 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8466/B00C/R0007/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0018 - Movement (93.18 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8466/B00C/R0007/Ceiling Structures/Linings/S6					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00C - R0019 - Stairs (5.47 m2)						
No Asbestos						
B00C - R0020 - Covered Area (28.82 m2)						
No Asbestos						
B00C - R1001 - General Learning Space (53.65 m2)						
In-fill-panel	Compressed AC Sheet	4m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)
B00C - R1002 - Computer Learning Space (53.65 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	
B00C - R1003 - Staff Study (19.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
Infill panel	Compressed AC Sheet	1Unit	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	
B00C - R1004 - Movement (18.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00C - R1005 - General Learning Space (52.91 m2)						
In-fill-panel	Compressed AC Sheet	4m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	
B00C - R1006 - General Learning Space (52.92 m2)						
In-fill-panel	Compressed AC Sheet	4m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	
B00C - R1007 - General Learning Space (52.91 m2)						
In-fill-panel	Compressed AC Sheet	4m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	
B00C - R1008 - General Learning Space (52.92 m2)						
In-fill-panel	Compressed AC Sheet	4m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	
B00C - R1009 - Staff Study (19.17 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	
B00C - R1010 - Distribution Board Cupboard (1.27 m2)						
				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00C - R1011 - Cleaning Store - Distributed (3.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00C - R1012 - General Storeroom (10.83 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
Infill panel	Compressed AC Sheet	1.1m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	
B00C - R1013 - Staff Study (38.88 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00B/R1003/In-fill-panel/S5					Chrysotile (white asbestos)	
B00C - R1014 - Computer Learning Space (52.91 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R1015 - Movement (1.64 m2)						
No Asbestos						
B00C - R1016 - Movement (27.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R0006/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
B00C - R1017 - Stairs (14.56 m2)						
In-fill-panel	Compressed AC Sheet	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00C/R1001/In-fill-panel/S8					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Science Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible, raked ceiling, no access space.					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Infill panel	Corrugated AC Sheeting	8m2	First Floor, below windows	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00E/R1021/Recently Modified Space/S31					Chrysotile (white asbestos)

Interior**B00D - R0001 - Laboratory L.S. (91.04 m2)**

Ceiling Structures/Linings	Vermiculite					
	8466/B00D/R0001/Ceiling Structures/Linings/S29					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0002 - General Storeroom (13.14 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00D/R0001/Ceiling Structures/Linings/S29					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00D/R0002/Floor Coverings Res/Textile/S30					Chrysotile (white asbestos)

B00D - R0003 - Preparation (30.62 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00D/R0001/Ceiling Structures/Linings/S29					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00D/R0002/Floor Coverings Res/Textile/S30					Chrysotile (white asbestos)

B00D - R0004 - Apparatus Store (4.25 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00D/R0001/Ceiling Structures/Linings/S29					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00D/R0002/Floor Coverings Res/Textile/S30					Chrysotile (white asbestos)

B00D - R0005 - Laboratory L.S. (91.04 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00D/R0001/Ceiling Structures/Linings/S29					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0006 - Distribution Board Cupboard (1.29 m2)

Note: No inspection of live electrical installation.

Door Lining	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00D/R0006/Door Backing/S28					Chrysotile (white asbestos)

B00D - R0008 - Movement (36.81 m2)

No Asbestos

B00D - R0009 - Bulk Store (7.56 m2)

No Asbestos

B00D - R0010 - Stairs (1.44 m2)

No Asbestos

B00D - R0011 - Lift (2.24 m2)

No Asbestos

B00D - R0012 - Movement (4.22 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00D - R0013 - Movement (70.91 m2)						
No Asbestos						
B00D - R0014 - Movement (4.22 m2)						
No Asbestos						
B00D - R1001 - Art Learning Space (91.86 m2)						
No Asbestos						
B00D - R1002 - Staff Study (30.08 m2)						
No Asbestos						
B00D - R1003 - Resources Store (4.17 m2)						
No Asbestos						
B00D - R1004 - Bulk Store (13.39 m2)						
No Asbestos						
B00D - R1005 - Art Learning Space (91.86 m2)						
No Asbestos						
B00D - R1006 - Distribution Board Cupboard (1.24 m2)						
						Note: No inspection of live electrical installation.
Door Lining	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00D/R0006/Door Backing/S28						Chrysotile (white asbestos)
B00D - R1008 - Stairs (6.45 m2)						
No Asbestos						
B00D - R1009 - Movement (4.22 m2)						
No Asbestos						
B00D - R1010 - Movement (68.32 m2)						
No Asbestos						
B00D - R1011 - Machine Storage (4.22 m2)						
No Asbestos						
B00D - R9001 - Kiln Space (35.32 m2)						
No Asbestos						
B00D - R9002 - Movement (4.22 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies - 1968 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area	- Area inaccessible, raked ceiling, no ceiling space.				
Underfloor Voids - Slab on Ground	Non Accessible Area	- Area inaccessible				

Interior

B00E - R0001 - Materials Technology L.S. (82.26 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0002 - Welding Area (21.65 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0003 - Materials Store (10.3 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0004 - Design/Technology L.S. (81.9 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0005 - Materials Store (18.1 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0006 - Workshop (73.36 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0007 - Materials Store (8.1 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0008 - Materials Store (4.97 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0009 - Distribution Board Cupboard (2.46 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0010 - Cleaning Store - Distributed (2.7 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0011 - Toilets-Boys (65.01 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00E/R0011/Ceiling Structures/Linings/S24	Limited Samples Taken			
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00E/R0011/Partition Walls (Cubicles)/S22					Chrysotile (white asbestos)	
B00E - R0012 - Movement (33.25 m2)						
Ceiling Structures/Linings	Vermiculite					
8466/B00E/R0011/Ceiling Structures/Linings/S24					Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00E - R0015 - Movement (9.34 m2)						
No Asbestos						
B00E - R0016 - Resource/Project Store (10.11 m2)						
No Asbestos						
B00E - R0018 - Stairs (1.55 m2)						
No Asbestos						
B00E - R0020 - Movement (88.57 m2)						
No Asbestos						
B00E - R1001 - Materials Technology L.S. (81.73 m2)						
Infill panel	Compressed AC Sheet	2.7m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00E/R1021/Recently Modified Space/S31					Chrysotile (white asbestos)	
B00E - R1002 - General Storeroom (7.43 m2)						
No Asbestos						
B00E - R1003 - Materials Store (21.29 m2)						
No Asbestos						
B00E - R1004 - Materials Technology L.S. (81.91 m2)						
Infill panel	Compressed AC Sheet	2.7m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00E/R1021/Recently Modified Space/S31					Chrysotile (white asbestos)	
B00E - R1005 - Dust Extraction Space (2.16 m2)						
No Asbestos						
B00E - R1006 - Cleaning Store - Distributed (0.83 m2)						
No Asbestos						
B00E - R1007 - Materials Store (12.15 m2)						
No Asbestos						
B00E - R1008 - Design L.S. (52.93 m2)						
Infill panel	Compressed AC Sheet	2.7m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00E/R1021/Recently Modified Space/S31					Chrysotile (white asbestos)	
B00E - R1009 - Staff Study (25.7 m2)						
Infill panel	Compressed AC Sheet	1.1m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00E/R1021/Recently Modified Space/S31					Chrysotile (white asbestos)	
B00E - R1010 - Cleaning Store - Distributed (0.96 m2)						
No Asbestos						
B00E - R1011 - Design L.S. (52.93 m2)						
Infill panel	Compressed AC Sheet	2.2m2	Below window	Good Condition (1)	Medium (2)	Low Priority (2-3)
8466/B00E/R1021/Recently Modified Space/S31					Chrysotile (white asbestos)	
B00E - R1012 - Materials Store (14.1 m2)						
No Asbestos						
B00E - R1013 - Distribution Board Cupboard (0.55 m2)						
Note: No inspection of live electrical installation.						
Door Lining	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00E/R1013/Door Backing/S23					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1015 - Movement (48.04 m2)						
No Asbestos						
B00E - R1018 - Stairs (5.69 m2)						
No Asbestos						
B00E - R1020 - Craft Store (13.19 m2)						
Wall Linings Internal	Compressed AC Sheet	0.55m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00E/R1021/Recently Modified Space/S31					Chrysotile (white asbestos)	
B00E - R1021 - Movement (57.52 m2)						
No Asbestos		1.65m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
B00E - R9001 - Chair Store (27.3 m2)						
No Asbestos						
B00E - R9002 - General Assistants (17.64 m2)						
No Asbestos						
B00E - R9003 - Garden Store Room (63.28 m2)						
No Asbestos						
B00E - R9005 - External Movement (28.97 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 1968 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area	- Area inaccessible, raked ceiling. No ceiling space access.				
Underfloor Voids - Slab on Ground	Non Accessible Area	- Area inaccessible				

Interior

B00F - R0001 - Stage (60.02 m2)

No Asbestos

B00F - R0002 - Multi-Purpose Space (249.89 m2)

No Asbestos

B00F - R0003 - Cleaning Supplies Store (19.02 m2)

No Asbestos

B00F - R0004 - Cleaning Supplies Store (5.64 m2)

No Asbestos

B00F - R0005 - Cleaning Store - Distributed (0.92 m2)

No Asbestos

B00F - R0006 - Materials Store (16.94 m2)

No Asbestos

B00F - R0007 - Distribution Board Cupboard (0.77 m2)

Note: No inspection of live electrical installation.

Door Lining	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R0007/Door Backing/S26						Chrysotile (white asbestos)

B00F - R0008 - Staff - Toilet (3.88 m2)

No Asbestos

B00F - R0009 - Student Canteen (53.9 m2)

Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R0009/Floor Coverings Res/Textile/S25						Chrysotile (white asbestos)

B00F - R0010 - Bulk Store (6.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R0009/Floor Coverings Res/Textile/S25						Chrysotile (white asbestos)

B00F - R0011 - Sport Equipment Store (18.46 m2)

No Asbestos

B00F - R0012 - Sport Equipment Store (16.04 m2)

No Asbestos

B00F - R0013 - Main Switchroom (9.23 m2)

No Asbestos

B00F - R0014 - Movement (80.12 m2)

Ceiling Structures/Linings	Vermiculite	8466/B00F/R0014/Ceiling Structures/Linings/S27				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00F - R0015 - Movement (2.01 m2)

No Asbestos

B00F - R0016 - Movement (2.01 m2)

No Asbestos

B00F - R0017 - Staff - Toilet (3.42 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0018 - Movement (22.11 m2)						
No Asbestos						
B00F - R0019 - Stairs (8.75 m2)						
No Asbestos						
B00F - R0021 - External Movement (244.07 m2)						
No Asbestos						
B00F - R1001 - Cleaning Store - Distributed (4.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1002 - Staff Shower (11.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1003 - Staff - Toilet (8.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
In-fill-panel	Compressed AC Sheet	2m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/In-fill-panel/S20					Chrysotile (white asbestos)	
B00F - R1004 - Movement (4.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1005 - Toilets-Boys (14.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1006 - Shower/Change (45.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1007 - Shower/Change (45.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1008 - Toilets-Girls (15.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1009 - Staff - Toilet (9.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
In-fill-panel	Compressed AC Sheet	2m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/In-fill-panel/S20					Chrysotile (white asbestos)	
B00F - R1010 - Movement (4.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1011 - Cleaning Store - Distributed (4.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R1012 - Staff Shower (10.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00F/R1003/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00F - R1013 - Movement (1.99 m2)						
No Asbestos						
B00F - R1014 - Movement (1.99 m2)						
No Asbestos						
B00F - R1015 - Movement (56.16 m2)						
No Asbestos						
B00F - R1016 - Movement (11.07 m2)						
No Asbestos						
B00F - R1017 - Stairs (18.36 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Technological & Applied Studies - 1968 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible raked ceiling, no access space.					

Interior

B00G - R0001 - Toilets-Girls (66.18 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8466/B00G/R0001/Partition Walls (Cubicles)/S15	48m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0002 - Distribution Board Cupboard (0.9 m2) Note: No inspection of live electrical installation.

Door Lining	Flat AC Sheeting 8466/B00G/R0002/Door Backing/S16	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-------------	--	-----	------	--------------------	---------	--

B00G - R0008 - Movement (30.63 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00G - R0009 - Garden Store Room (5.83 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00G - R0010 - Distribution Board Cupboard (4.46 m2) Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00G - R0011 - Cleaning Store - Distributed (4.34 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00G - R0012 - General Storeroom (6.52 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8466/B00G/R0007/Floor Coverings Res/Textile/S17	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0013 - Laundry (15.98 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8466/B00G/R0007/Floor Coverings Res/Textile/S17	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0014 - Food Technology L.S. (82.35 m2)

Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8466/B00G/R0007/Floor Coverings Res/Textile/S17	83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00G - R0015 - Food/Research Space (16.2 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8466/B00G/R0007/Floor Coverings Res/Textile/S17	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R0016 - Pantry (15.09 m2)						
Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8466/B00G/R0007/Floor Coverings Res/Textile/S17	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R0018 - Movement (1.91 m2)						
No Asbestos						
B00G - R0021 - Movement (11.31 m2)						
No Asbestos						
B00G - R0022 - Stairs (1.49 m2)						
No Asbestos						
B00G - R0023 - Movement (14.77 m2)						
No Asbestos						
B00G - R0024 - Preparation (15.6 m2)						
No Asbestos						
B00G - R0025 - Pantry (9.72 m2)						
No Asbestos						
B00G - R0026 - Kitchen - Type 1 (104.56 m2)						
No Asbestos						
B00G - R0027 - Preparation (14.34 m2)						
No Asbestos						
B00G - R0028 - Movement (10.44 m2)						
No Asbestos						
B00G - R0029 - Staff Lounge (48.94 m2)						
No Asbestos						
B00G - R0030 - Staff Study (32.02 m2)						
No Asbestos						
B00G - R0031 - Movement (59.54 m2)						
Ceiling Structures/Linings	Vermiculite 8466/B00G/R0001/Ceiling Structures/Linings/S14					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R1001 - General Learning Space (65.97 m2)						
In-fill-panel	Compressed AC Sheet 8466/B00G/R1005/In-fill-panel/S18	2.2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1002 - Distribution Board Cupboard (1.1 m2)						
Note: No inspection of live electrical installation.						
Door Lining	Flat AC Sheeting 8466/B00G/R0002/Door Backing/S16	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1003 - General Learning Space (65.97 m2)						
In-fill-panel	Compressed AC Sheet 8466/B00E/R1021/Recently Modified Space/S31	2.2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1004 - General Learning Space (65.52 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
In-fill-panel	Compressed AC Sheet	4m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00G/R1005/In-fill-panel/S18					Chrysotile (white asbestos)	
B00G - R1005 - Staff Study (13.64 m2)						
In-fill-panel	Compressed AC Sheet	2m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00G/R1005/In-fill-panel/S18					Chrysotile (white asbestos)	
B00G - R1006 - Movement (16.56 m2)						
No Asbestos						
B00G - R1007 - Music Learning Space (65.79 m2)						
In-fill-panel	Compressed AC Sheet	2.2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00G/R1005/In-fill-panel/S18					Chrysotile (white asbestos)	
B00G - R1008 - Music Learning Space (65.79 m2)						
In-fill-panel	Compressed AC Sheet	2.2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00G/R1005/In-fill-panel/S18					Chrysotile (white asbestos)	
B00G - R1009 - Staff Study (32.3 m2)						
In-fill-panel	Compressed AC Sheet	1.1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00G/R1005/In-fill-panel/S18					Chrysotile (white asbestos)	
B00G - R1010 - General Learning Space (65.97 m2)						
In-fill-panel	Compressed AC Sheet	2.2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00G/R1005/In-fill-panel/S18					Chrysotile (white asbestos)	
B00G - R1011 - Materials Store (9.81 m2)						
No Asbestos						
B00G - R1012 - Materials Store (4.79 m2)						
No Asbestos						
B00G - R1013 - Movement (75.9 m2)						
No Asbestos						
B00G - R1014 - Movement (1.83 m2)						
No Asbestos						
B00G - R1015 - Cleaning Store - Distributed (0.81 m2)						
No Asbestos						
B00G - R1016 - Movement (11.31 m2)						
No Asbestos						
B00G - R1017 - Stairs (6.01 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Science Learning - 1968 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible - raked ceiling, no ceiling space points.					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Infill panel	Compressed AC Sheet	7.5m2	First floor. Under windows.	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00G/R1005/In-fill-panel/S18					Chrysotile (white asbestos)

Interior

B00H - R0001 - Laboratory L.S. (91.12 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00H/R0001/Ceiling Structures/Linings/S12					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00H - R0002 - Preparation (30.9 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00H/R0001/Ceiling Structures/Linings/S12					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Floor Coverings Res/Textile	Vinyl Tiles					
	8466/B00H/R1002/Floor Coverings Res/Textile/S9					No Asbestos Detected

B00H - R0003 - Apparatus Store (3.85 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00H/R0001/Ceiling Structures/Linings/S12					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Floor Coverings Res/Textile	Vinyl Tiles					
	8466/B00H/R1002/Floor Coverings Res/Textile/S9					No Asbestos Detected

B00H - R0004 - Preparation (13.24 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00H/R0001/Ceiling Structures/Linings/S12					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Floor Coverings Res/Textile	Vinyl Tiles					
	8466/B00H/R1002/Floor Coverings Res/Textile/S9					No Asbestos Detected

B00H - R0005 - Laboratory L.S. (90.66 m2)

Ceiling Structures/Linings	Vermiculite					
	8466/B00H/R0001/Ceiling Structures/Linings/S12					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00H - R0009 - Lift (0.28 m2)

No Asbestos

B00H - R0010 - Distribution Board Cupboard (1.27 m2)

Note: No inspection of live electrical installation.

Door Lining	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8466/B00H/R1010/Door backing/S10					Chrysotile (white asbestos)

B00H - R0013 - External Stairs (15.75 m2)

No Asbestos

B00H - R0014 - External Movement (150.27 m2)

No Asbestos

B00H - R0015 - Movement (8.59 m2)

No Asbestos

B00H - R0016 - External Movement (6.69 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00H - R0017 - Toilets-Disabled (10.53 m2)						
No Asbestos						
B00H - R1001 - Laboratory L.S. (92 m2)						
No Asbestos						
B00H - R1002 - Preparation (31.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8466/B00H/R1002/Floor Coverings Res/Textile/S9					No Asbestos Detected	
B00H - R1003 - Apparatus Store (3.75 m2)						
No Asbestos						
B00H - R1004 - Chemical Store (13.35 m2)						
No Asbestos						
B00H - R1005 - Laboratory L.S. (92 m2)						
No Asbestos						
B00H - R1009 - Lift (0.27 m2)						
Electrical Backing Board	Resinous Board	0.03m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Assumed live cabinet, visual						
B00H - R1010 - Distribution Board Cupboard (1.27 m2)						
					Note: No inspection of live electrical installation.	
Dining Lining	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00H/R1010/Door backing/S10					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8466/B00H/R1010/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	
B00H - R1013 - External Stairs (23.94 m2)						
No Asbestos						
B00H - R1014 - External Movement (141.85 m2)						
No Asbestos						
B00H - R1016 - Movement (8.89 m2)						
No Asbestos						
B00H - R1017 - External Movement (6.72 m2)						
No Asbestos						
B00H - R1018 - Toilets-Disabled (10.54 m2)						
No Asbestos						
B00H - R9001 - Movement (4.22 m2)						
No Asbestos						
B00H - R9002 - Lift (2.27 m2)						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Multi Purpose Facilities - 1997 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior**B00I - M0001 - Movement (4.12 m2)**

No Asbestos

B00I - M0002 - Movement (4.12 m2)

No Asbestos

B00I - R0001 - Stage (66.59 m2)

No Asbestos

B00I - R0002 - Movement (2.14 m2)

No Asbestos

B00I - R0003 - Movement (2.16 m2)

No Asbestos

B00I - R0004 - Movement (53.31 m2)

No Asbestos

B00I - R0005 - Shower/Change (33.98 m2)

No Asbestos

B00I - R0006 - Toilets-Girls (18.18 m2)

No Asbestos

B00I - R0007 - Cleaning Store - Distributed (3.82 m2)

No Asbestos

B00I - R0008 - Student Canteen (15.8 m2)

No Asbestos

B00I - R0009 - Chair Store (19.85 m2)

No Asbestos

B00I - R0010 - Chair Store (19.71 m2)

No Asbestos

B00I - R0011 - Sport Equipment Store (30.37 m2)

No Asbestos

B00I - R0012 - Sport Equipment Store (21.05 m2)

No Asbestos

B00I - R0013 - Control Room (1.25 m2)

No Asbestos

B00I - R0014 - Distribution Board Cupboard (2.3 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00I - R0015 - Disabled Toilet (5.53 m2)

No Asbestos

B00I - R0016 - Toilets-Boys (23.65 m2)

No Asbestos

B00I - R0017 - Shower/Change (26.69 m2)

No Asbestos

B00I - R0018 - Multi-Purpose Space (514.74 m2)

No Asbestos

B00I - R0021 - Movement (196.11 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10966 - Learning Unit - Standard/Withdrawal : Placement Date - 5/02/1997

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

NS 020 - D11625 - Staff Study/Store : Placement Date - 13/01/2004

Exterior

No Asbestos Found.

Interior

R1 - Staff Room

No Asbestos Found.

R2 - Store

No Asbestos Found.

R3 - Entry

No Asbestos Found.

OS 621 - D13021 - Single Learning Unit - H/Cap : Placement Date - 21/12/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	14.4 m2

Interior

R1 - Home Base-I.O.

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	77 m2

R2 - Toilets-Disabled

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

R3 - Laundry

Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2
---------	---------------	------------------	------

OS 601 - D13846 - Learning Unit - Standard/Withdrawal : Placement Date - 9/02/2002

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
OS 601 - D14485 - Learning Unit - Standard/Withdrawal : Placement Date - 25/01/2005						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017