


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Gulgong High School (8546)
Region : Western NSW
State Electorate : Dubbo
Local Government Area : Mid-Western

Initial Survey : Noel Arnold & Associates : 16 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Aug - 2016

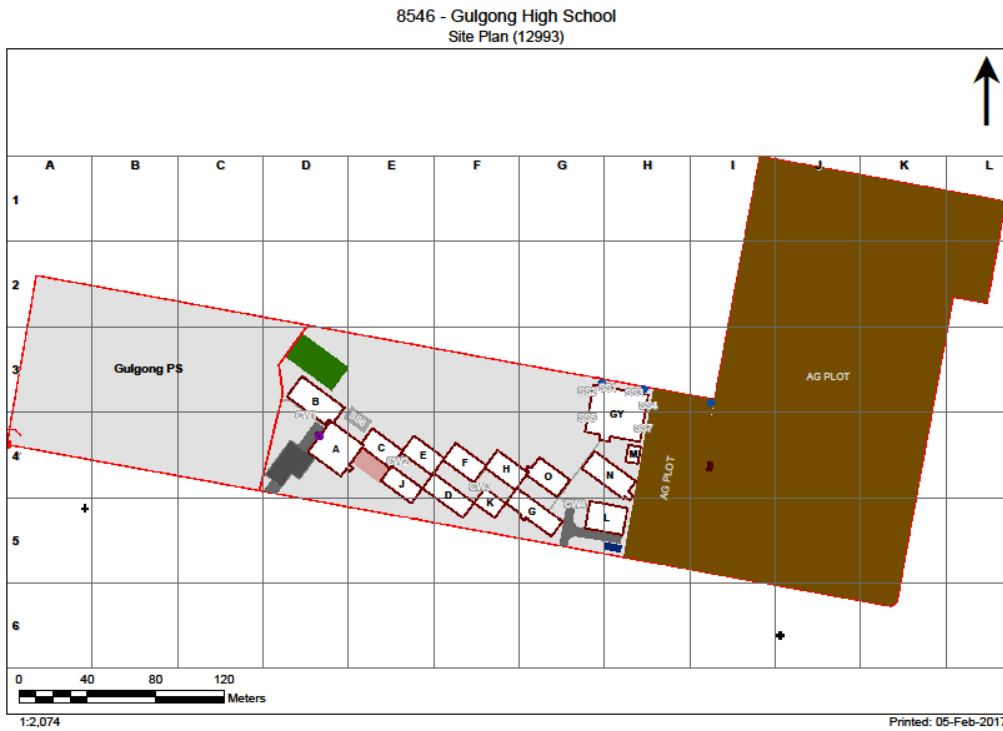

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1978 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8546/B00J/Gable Verge Lining/S13					Chrysotile (white asbestos)

Interior**B00A - M1002 - Computer Learning Space**

No Asbestos

B00A - M1004 - Careers Advisers Office

No Asbestos

B00A - M1005 - Movement

No Asbestos

B00A - M1006 - Senior Study

No Asbestos

B00A - M1007 - Stairs

No Asbestos

B00A - R0001 - Deputy Principal Office

No Asbestos

B00A - R0002 - Interview/Office - Type 1

No Asbestos

B00A - R0003 - Principal Office

No Asbestos

B00A - R0004 - Commonroom

No Asbestos

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Main Switchroom

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8546/B00A/R0006/Electrical Mounting Board/S15					Chrysotile (white asbestos)

B00A - R0007 - Cleaning Supplies Store

Floor Coverings Res/Textile	Vinyl Tiles					
	8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00A - R0008 - Staff - Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8546/B00F/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00A - R0009 - Staff - Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8546/B00F/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Seminar

No Asbestos

B00A - R0012 - Seminar

No Asbestos

B00A - R0013 - Staff Study

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0014 - Clinic - Girls						
Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R0015 - Clinic-Toilets						
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Encapsulated material within unit						
B00A - R0016 - General Storeroom						
No Asbestos						
B00A - R0017 - Staff - Toilet						
No Asbestos						
B00A - R0018 - Administration - Clerical						
Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R0021 - Movement						
No Asbestos						
B00A - R0022 - External Movement						
No Asbestos						
B00A - R0023 - Movement						
No Asbestos						
B00A - R0024 - General Storeroom						
No Asbestos						
B00A - R0025 - Security Store						
Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R0026 - Administration - Clerical						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
8546/B00A/R0026/Floor Coverings Res/Textile/S14					No Asbestos Detected	
B00A - R0028 - Lift						
No Asbestos						
B00A - R0029 - Stairs						
No Asbestos						
B00A - R1001 - Movement						
No Asbestos						
B00A - R1002 - Main Area						
No Asbestos						
B00A - R1003 - Seminar						
Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R1004 - Audio Visual Workroom						
No Asbestos						
B00A - R1005 - Librarian						
No Asbestos						
B00A - R1006 - Workroom						
Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R1007 - Staff - Toilet						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00F/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)	
B00A - R1008 - Staff - Toilet						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00F/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)	
B00A - R1009 - Cleaning Store - Distributed						
Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B00A - R1010 - General Storeroom						
No Asbestos						
B00A - R1012 - Movement						
No Asbestos						
B00A - R1013 - Movement						
No Asbestos						
B00A - R1014 - Stairs						
No Asbestos						
B00A - R1015 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Multi Purpose Facilities/Pupil Facilities - 1978 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building

Interior

B00B - R0001 - Staff - Toilet

No Asbestos

B00B - R0002 - Office/Store

Floor Coverings Res/Textile	Vinyl Sheet	8546/B00B/R0004/Floor Coverings Res/Textile/S2	No Asbestos Detected
-----------------------------	-------------	--	----------------------

B00B - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet	8546/B00B/R0004/Floor Coverings Res/Textile/S2	No Asbestos Detected
-----------------------------	-------------	--	----------------------

B00B - R0004 - Cleaning Store - Distributed

Floor Coverings Res/Textile	Vinyl Sheet	8546/B00B/R0004/Floor Coverings Res/Textile/S2	No Asbestos Detected
-----------------------------	-------------	--	----------------------

B00B - R0005 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0006 - Student Canteen

Floor Coverings Res/Textile	Vinyl Sheet	8546/B00B/R0004/Floor Coverings Res/Textile/S2	No Asbestos Detected
-----------------------------	-------------	--	----------------------

B00B - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Sheet	8546/B00B/R0004/Floor Coverings Res/Textile/S2	No Asbestos Detected
-----------------------------	-------------	--	----------------------

B00B - R0008 - Toilets-Boys

Partition Walls (Cubicles)	Compressed AC Sheet	8546/B00B/R0008/Partition Walls (Cubicles)/S1	No Asbestos Detected
----------------------------	---------------------	---	----------------------

B00B - R0009 - Stage

Floor Coverings Res/Textile	Vinyl Sheet	8546/B00B/R0004/Floor Coverings Res/Textile/S2	No Asbestos Detected
-----------------------------	-------------	--	----------------------

B00B - R0010 - Toilets-Girls

Partition Walls (Cubicles)	Compressed AC Sheet	8546/B00B/R0008/Partition Walls (Cubicles)/S1	No Asbestos Detected
----------------------------	---------------------	---	----------------------

B00B - R0011 - Multi-Purpose Space

No Asbestos

B00B - R0012 - Chair Store

No Asbestos

B00B - R0013 - Cleaning Supplies Store

No Asbestos

B00B - R0014 - Sport Equipment Store

No Asbestos

B00B - R0015 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Music/Pupil Facilities - 1978 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00C/Gable Verge Lining/S11					Chrysotile (white asbestos)	

Interior**B00C - R0001 - External Movement**

No Asbestos

B00C - R0002 - Toilets-Boys

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00C/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B00C - R0003 - Sports Store

No Asbestos

B00C - R0004 - Toilets-Girls

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00C/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B00C - R0005 - Music Learning Space

No Asbestos

B00C - R0006 - Music Learning Space

No Asbestos

B00C - R0007 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00C/R0007/Electrical Mounting Board/S16					Chrysotile (white asbestos)	

B00C - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Science - 1978 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00J/Gable Verge Lining/S13					Chrysotile (white asbestos)	

Interior**B00D - R0001 - Darkroom Space**

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

B00D - R0004 - Preparation

Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected	

B00D - R0005 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00D/R0005/Electrical Mounting Board/S17					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
8546/B00D/R0005/Wall Linings Internal/S6					Chrysotile (white asbestos)	

B00D - R0007 - External Movement

No Asbestos

B00D - R0008 - General Learning Space - Type 10

No Asbestos

B00D - R0009 - Science Laboratory

No Asbestos

B00D - R0010 - General Learning Space - Type 10

No Asbestos

B00D - R0011 - Science Laboratory

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies - 1978 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00C/Gable Verge Lining/S11					Chrysotile (white asbestos)	

Interior

B00E - R0011 - External Movement						
No Asbestos						
B00E - R0012 - External Movement						
No Asbestos						
B00E - R0013 - General Learning Space						
No Asbestos						
B00E - R0014 - Pantry						
No Asbestos						
B00E - R0015 - Main Switch Board Cupboard						
No Asbestos						
B00E - R0016 - Kitchen - Type 1						
No Asbestos						
B00E - R0017 - Laundry						
No Asbestos						
B00E - R0018 - Plant						
No Asbestos						
B00E - R0019 - Preparation - Materials						
No Asbestos						
B00E - R0020 - Preparation - Materials						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Pupil Facilities - 1978 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00C/Gable Verge Lining/S11					Chrysotile (white asbestos)	

Interior**B00F - R0001 - Shower/Change**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00F/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)	

B00F - R0002 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00C/R0007/Electrical Mounting Board/S16					Chrysotile (white asbestos)	

Electrical Mounting Board	Resinous Board	8546/B00F/R0002/Electrical Mounting Board/S18				No Asbestos Detected
---------------------------	----------------	---	--	--	--	-----------------------------

B00F - R0003 - Shower/Change

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00F/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)	

B00F - R0004 - General Learning Space

No Asbestos

B00F - R0005 - General Learning Space

No Asbestos

B00F - R0006 - External Movement

No Asbestos

B00F - R0007 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Technological & Applied Studies - 1978 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00G/Gable Verge Lining/S12					Chrysotile (white asbestos)	

Interior

B00G - R0001 - Distribution Board Cupboard Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board					No Asbestos Detected
8546/B00F/R0002/Electrical Mounting Board/S18						

B00G - R0008 - Materials Store

No Asbestos

B00G - R0009 - Project Store - Type 1

No Asbestos

B00G - R0010 - Materials Technology L.S.

No Asbestos

B00G - R0011 - Outdoor Workshop

No Asbestos

B00G - R0012 - External Movement

No Asbestos

B00G - R0013 - Plant

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Art - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00C/Gable Verge Lining/S11					Chrysotile (white asbestos)	

Interior

B00H - R0001 - Art Learning Space

Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00E/R0005/Floor Coverings Res/Textile/S4					No Asbestos Detected	

B00H - R0002 - Workshop

Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00E/R0005/Floor Coverings Res/Textile/S4					No Asbestos Detected	

B00H - R0003 - Kiln Space

Floor Coverings Res/Textile	Vinyl Tiles					
8546/B00E/R0005/Floor Coverings Res/Textile/S4					No Asbestos Detected	

B00H - R0004 - Design L.S.

No Asbestos

B00H - R0005 - External Movement

No Asbestos

B00H - R0006 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Senior Learning/General Learning - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
8546/B00J/Gable Verge Lining/S13					Chrysotile (white asbestos)	

Interior

B00J - R0001 - General Learning Space

No Asbestos

B00J - R0002 - General Learning Space

No Asbestos

B00J - R0003 - General Storeroom

No Asbestos

B00J - R0004 - Staff Study

No Asbestos

B00J - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities/Science - 1978 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - No manhole in Building					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8546/B00G/Gable Verge Lining/S12					Chrysotile (white asbestos)

Interior**B00K - R0001 - Toilets-Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8546/B00F/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00K - R0002 - Toilets-Boys

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8546/B00F/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00K - R0003 - Cleaning Store - Distributed

No Asbestos

B00K - R0006 - Staff Study

No Asbestos

B00K - R0007 - Apparatus Store

Floor Coverings Res/Textile	Vinyl Tiles					
	8546/B00D/R0006/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00K - R0008 - External Movement

No Asbestos

B00K - R0009 - Movement

No Asbestos

B00K - R0010 - Store

No Asbestos

B00K - R0011 - Staff - Toilet

No Asbestos

B00K - R0012 - Staff - Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Technological & Applied Studies - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - General Learning Space

No Asbestos

B00L - R0002 - Materials Workshop - Type 2

No Asbestos

B00L - R0003 - Welding Area

No Asbestos

B00L - R0004 - Outdoor Workshop

No Asbestos

B00L - R0005 - External Movement

No Asbestos

B00L - R0006 - Materials Store

No Asbestos

B00L - R0007 - Project Store - Type 1

No Asbestos

B00L - R0008 - Resource/Project Store

No Asbestos

B00L - R0009 - Main Switch Board Cupboard

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Building Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0002 - General Assistants

No Asbestos

B00M - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Technological & Applied Studies - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - General Learning Space	No Asbestos
B00N - R0002 - General Learning Space	No Asbestos
B00N - R0003 - Music Learning Space	No Asbestos
B00N - R0004 - Music Store	No Asbestos
B00N - R0005 - Music Learning Space	No Asbestos
B00N - R0006 - Plant	No Asbestos
B00N - R0007 - External Movement	No Asbestos
B00N - R0008 - Plant	No Asbestos
B00N - R0009 - External Movement	No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Technological & Applied Studies - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B000 - R0001 - Toilets-Disabled

No Asbestos

B000 - R0002 - Special Learning Space

No Asbestos

B000 - R0003 - General Learning Space

No Asbestos

B000 - R0004 - General Learning Space

No Asbestos

B000 - R0005 - Plant

No Asbestos

B000 - R0006 - External Movement

No Asbestos

B000 - R0007 - Plant

No Asbestos

B000 - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0GY - Physical Education - 1978 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B0GY - R0001 - Gymnasium

No Asbestos

B0GY - R0002 - Shower/Change

No Asbestos

B0GY - R0003 - Shower/Change

No Asbestos

B0GY - R0004 - Staff Shower

No Asbestos

B0GY - R0005 - Cleaning Store - Distributed

No Asbestos

B0GY - R0006 - Toilets-Disabled

No Asbestos

B0GY - R0007 - Movement

No Asbestos

B0GY - R0008 - Distribution Board Cupboard

Note: No inspection of live electrical installation.

No Asbestos

B0GY - R0009 - Control Room

No Asbestos

B0GY - R0010 - Staff Study

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B0GY - R0011 - Sport Equipment Store

No Asbestos

B0GY - R0013 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017