


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kanwal Public School (2259)
Region : Hunter/Central Coast
State Electorate : Wyong
Local Government Area : Wyong

Initial Survey : Noel Arnold & Associates : 29 - Mar - 2008
Reviewed By : Grencap-NAA : 20 - Mar - 2015

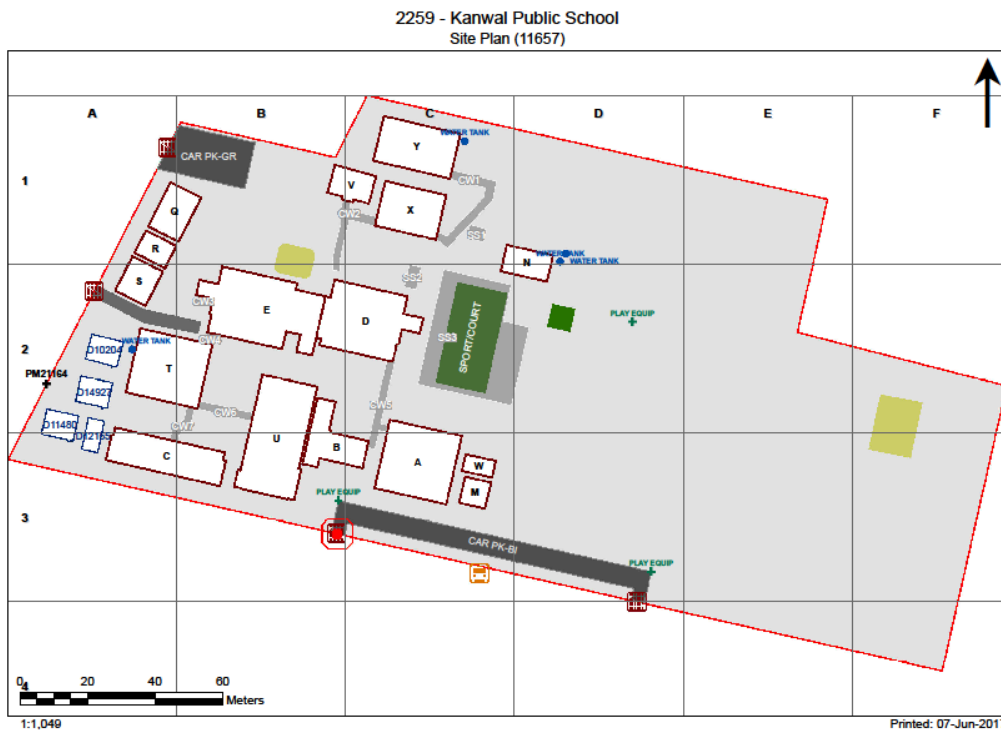

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1965 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior**B00A - R0001 - Staff Toilet (3.48 m2)**

Ceiling Structures/Linings	Vermiculite 2259/B00A/R0001/Ceiling Structures/Linings/S23	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0002 - Staff Toilet (3.62 m2)

Ceiling Structures/Linings	Vermiculite 2259/B00A/R0001/Ceiling Structures/Linings/S23	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00A - R0003 - Entry Vestibule (12.74 m2)

Panels Under Windows	Flat AC Sheeting 2259/B00A/R0012/Panels Under Windows/S2	No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 2259/B00A/R0001/Ceiling Structures/Linings/S23	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Floor Coverings Res/Textile	Vinyl Tiles 2259/B00A/R0017/Floor Coverings Res/Textile/S22	No Asbestos Detected

B00A - R0004 - Clerical Office (22.91 m2)

Panels Under Windows	Flat AC Sheeting 2259/B00A/R0006/Infill panel above & below windows/S31	No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 2259/B00A/R0001/Ceiling Structures/Linings/S23	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Floor Coverings Res/Textile	Vinyl Tiles 2259/B00A/R0017/Floor Coverings Res/Textile/S22	No Asbestos Detected

B00A - R0005 - Plant (0.61 m2)

Ceiling Structures/Linings	Vermiculite 2259/B00A/R0001/Ceiling Structures/Linings/S23	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Floor Coverings Res/Textile	Vinyl Tiles 2259/B00A/R0017/Floor Coverings Res/Textile/S22	No Asbestos Detected

B00A - R0006 - Sick Bay (9.7 m2)

Ceiling Structures/Linings	Vermiculite 2259/B00A/R0001/Ceiling Structures/Linings/S23	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Wall Linings Internal	Flat AC Sheeting 2259/B00A/R0008/Wall Linings Internal/S30	No Asbestos Detected
Infill panel above & below windows	Compressed AC Sheet 2259/B00A/R0006/Infill panel above & below windows/S31	No Asbestos Detected

B00A - R0007 - Staff Shower/Change (2.56 m2)

Ceiling Structures/Linings	Vermiculite 2259/B00A/R0001/Ceiling Structures/Linings/S23	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		
Wall Linings Internal	Flat AC Sheeting 2259/B00A/R0008/Wall Linings Internal/S30	No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0008 - Staff Toilet (4.04 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
			2259/B00A/R0001/Ceiling Structures/Linings/S23			<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
			2259/B00A/R0008/Wall Linings Internal/S30			
B00A - R0009 - Interview (12.83 m2)						
Panels Under Windows	Flat AC Sheeting					No Asbestos Detected
			2259/B00A/R0006/Infill panel above & below windows/S31			
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
			2259/B00A/R0001/Ceiling Structures/Linings/S23			<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0010 - Principal (21.73 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
			2259/B00A/R0001/Ceiling Structures/Linings/S23			<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Panels Under Windows	Flat AC Sheeting					No Asbestos Detected
			2259/B00A/R0006/Infill panel above & below windows/S31			
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
			2259/B00A/R0017/Floor Coverings Res/Textile/S22			
B00A - R0011 - Staff Room (72.2 m2)						
Panels Under Windows	Flat AC Sheeting					No Asbestos Detected
			2259/B00A/R0006/Infill panel above & below windows/S31			
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
			2259/B00A/R0001/Ceiling Structures/Linings/S23			<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
			2259/B00A/R0017/Floor Coverings Res/Textile/S22			
B00A - R0012 - Staff Room Annexe (26.59 m2)						
Panels Under Windows	Flat AC Sheeting					No Asbestos Detected
			2259/B00A/R0006/Infill panel above & below windows/S31			
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
			2259/B00A/R0001/Ceiling Structures/Linings/S23			<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
			2259/B00A/R0017/Floor Coverings Res/Textile/S22			
B00A - R0013 - Interview (11.57 m2)						
Panels Under Windows	Flat AC Sheeting					No Asbestos Detected
			2259/B00A/R0006/Infill panel above & below windows/S31			
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
			2259/B00A/R0001/Ceiling Structures/Linings/S23			<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
			2259/B00A/R0017/Floor Coverings Res/Textile/S22			
B00A - R0014 - Deputy Principal (12.38 m2)						
Panels Under Windows	Flat AC Sheeting					No Asbestos Detected
			2259/B00A/R0006/Infill panel above & below windows/S31			
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
			2259/B00A/R0001/Ceiling Structures/Linings/S23			<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2259/B00A/R0017/Floor Coverings Res/Textile/S22					No Asbestos Detected
B00A - R0015 - Duplicating Workroom (31.97 m2)						
Panels Under Windows	Flat AC Sheeting					
	2259/B00A/R0006/Infill panel above & below windows/S31					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	2259/B00A/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0016 - Distribution Board (0.87 m2)						
	Note: No inspection of live electrical installation.					
Ceiling Structures/Linings	Vermiculite					
	2259/B00A/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00A - R0017 - Cleaning Distributed Store (0.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	2259/B00A/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles					
	2259/B00A/R0017/Floor Coverings Res/Textile/S22					No Asbestos Detected
B00A - R0018 - Security Store (22.53 m2)						
No Asbestos						
B00A - R0019 - Movement (34.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	2259/B00A/R0001/Ceiling Structures/Linings/S23					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles					
	2259/B00A/R0017/Floor Coverings Res/Textile/S22					No Asbestos Detected
B00A - R0020 - External Movement (95.77 m2)						
Panels Under Windows	Flat AC Sheeting					
	2259/B00A/R0020/Panels Under Windows/S1					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0009/Ceiling Structures/Linings/S32				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting					No Asbestos Detected
	2259/B00B/Gable Verge Lining/S33					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00B - R0001 - Uniform Shop (8.78 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0009/Ceiling Structures/Linings/S32				Chrysotile (white asbestos)	

B00B - R0002 - General Assistant/Bulk Store (14.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0007/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	

B00B - R0003 - Canteen (50.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2259/B00B/R0003/Floor Coverings Res/Textile/S34					
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0007/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	

B00B - R0005 - Staff Toilet (1.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0007/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	

B00B - R0006 - Handwashing Facilities (2.7 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2259/B00B/R0003/Floor Coverings Res/Textile/S5					
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0009/Ceiling Structures/Linings/S32				Chrysotile (white asbestos)	

B00B - R0007 - Movement (3.01 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	2259/B00B/R0003/Floor Coverings Res/Textile/S5					
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0007/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	

B00B - R0008 - Canteen Office/Store (1.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0007/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	

B00B - R0009 - External Movement (53.83 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2259/B00B/R0009/Wall Linings Internal/S4					
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00B/R0009/Ceiling Structures/Linings/S32				Chrysotile (white asbestos)	

B00B - R0010 - Toilets - Boys (9.24 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00B/R0009/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)	
B00B - R0011 - Toilets - Girls (29.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00B/R0009/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1973 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/Eaves Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - Home Base Store (6.45 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/R0001/Ceiling Structures/Linings/S35					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/R0008/Wall Linings Internal/S11					Chrysotile (white asbestos)

B00C - R0002 - Home Base (67.38 m2)

Panels Around Heater	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/R0007/Panels Around Heater/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0003 - Home Base (53.87 m2)

No Asbestos

B00C - R0004 - Practical Activities - 1hb (8.28 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	2259/B00C/R0005/Floor Coverings Res/Textile/S13					No Asbestos Detected

B00C - R0005 - Practical Activities - 1hb (14.7 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	2259/B00C/R0005/Floor Coverings Res/Textile/S13					No Asbestos Detected

B00C - R0006 - Home Base (53.87 m2)

Panels Around Heater	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/R0007/Panels Around Heater/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0007 - Home Base (54.17 m2)

Panels Around Heater	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/R0007/Panels Around Heater/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0008 - Practical Activities - 1hb (6.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/R0001/Ceiling Structures/Linings/S35					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/R0008/Wall Linings Internal/S11					Chrysotile (white asbestos)

B00C - R0009 - External Movement (60.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00C/R0009/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1965 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00D - R0001 - Home Base (63.87 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/R0001/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)

B00D - R0002 - Practical Activities - 1hb (9.51 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/R0001/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)

B00D - R0003 - Practical Activities - 1hb (9.51 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/R0001/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)

B00D - R0004 - Home Base (63.86 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/R0001/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)

B00D - R0005 - Cleaning Supplies (5.67 m2)

No Asbestos

B00D - R0006 - Home Base (63.87 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/R0001/Floor Coverings Res/Textile/S40					Chrysotile (white asbestos)

B00D - R0007 - Practical Activities - 1hb (9.5 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00E/R0009/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)		
B00D - R0008 - Distribution Board (0.37 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0009 - Practical Activities - 1hb (9.51 m2)						
Ceiling Structures/Linings	Vermiculite					
2259/B00D/R0010/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0010 - Home Base (63.87 m2)						
Ceiling Structures/Linings	Vermiculite					
2259/B00D/R0010/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00D/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00D - R0011 - External Movement (117.15 m2)						
No Asbestos						
B00D - R0012 - External Stairs (15.81 m2)						
No Asbestos						
B00D - R1001 - Home Base (50.83 m2)						
Ceiling Structures/Linings	Vermiculite					
2259/B00D/R0010/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00D/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00D - R1002 - Practical Activities - 1hb (22.11 m2)						
Ceiling Structures/Linings	Vermiculite					
2259/B00D/R0010/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00E/R0009/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)		
B00D - R1003 - Practical Activities - 1hb (22.11 m2)						
Ceiling Structures/Linings	Vermiculite					
2259/B00D/R0010/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00D/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00D - R1004 - Home Base (50.83 m2)						
Ceiling Structures/Linings	Vermiculite					
2259/B00D/R0010/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00D/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00D - R1005 - Movement (16.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00D/R1005/Ceiling Structures/Linings/S26				Chrysotile (white asbestos)		
B00D - R1006 - Home Base (50.83 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2259/B00D/R0001/Floor Coverings Res/Textile/S40	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1007 - Practical Activities - 1hb (22.11 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R1008 - Practical Activities - 1hb (22.11 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 2259/B00E/R0009/Floor Coverings Res/Textile/S14	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1009 - Home Base (50.83 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2259/B00D/R0001/Floor Coverings Res/Textile/S40	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1010 - Movement (33.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2259/B00D/R1005/Ceiling Structures/Linings/S26	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1011 - Stairs (21.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2259/B00D/R1005/Ceiling Structures/Linings/S26	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Pupil Facilities - 1965 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00E - R0001 - Toilets - Boys (26.83 m2)**

No Asbestos

B00E - R0002 - Cleaning Distributed Store (1.22 m2)

No Asbestos

B00E - R0003 - Toilets - Girls (21.55 m2)

No Asbestos

B00E - R0004 - Cleaning Distributed Store (5.96 m2)

No Asbestos

B00E - R0005 - Home Base (77.09 m2)

Ceiling Structures/Linings	Vermiculite					
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00E - R0006 - Practical Activities - 1hb (18.65 m2)

Ceiling Structures/Linings	Vermiculite					
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00E/R0009/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

B00E - R0007 - Home Base Store (3.02 m2)

No Asbestos

B00E - R0008 - Home Base (77.09 m2)

Ceiling Structures/Linings	Vermiculite					
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00E - R0009 - Practical Activities - 1hb (18.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00E/R0009/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite					
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00E - R0010 - Home Base Store (3.02 m2)

No Asbestos

B00E - R0011 - Distribution Board (1.13 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite					
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00E - R0012 - General Assistant/Bulk Store (14.9 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0013 - General Storeroom (8.69 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0014 - General Storeroom (12.84 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0015 - Sports Store (16.65 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0016 - Garden Store (12.03 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0017 - External Movement (201.89 m2)						
No Asbestos						
B00E - R0018 - P.E. Store (5 m2)						
No Asbestos						
B00E - R0019 - Kiln Room (8.61 m2)						
No Asbestos						
B00E - R0020 - External Stairs (16.6 m2)						
No Asbestos						
B00E - R0021 - External Stairs (5.78 m2)						
No Asbestos						
B00E - R1001 - Home Base (52.99 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1002 - Practical Activities - 1hb (20.97 m2)						
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1003 - Practical Activities - 1hb (20.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2259/B00E/R0009/Floor Coverings Res/Textile/S14	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1004 - Home Base (52.53 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2259/B00E/R0009/Floor Coverings Res/Textile/S14	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 2259/B00D/R0010/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1005 - Movement (17.03 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
B00E - R1006 - Home Base (52.98 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1007 - Practical Activities - 1hb (20.97 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1008 - Practical Activities - 1hb (20.97 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00E/R0009/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
B00E - R1009 - Home Base (52.98 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00E/R0009/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
B00E - R1010 - Toilets - Girls (13.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
B00E - R1011 - Cleaning Distributed Store (4.51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00E/R0009/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
B00E - R1012 - Interview (14.58 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00E/R0009/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2259/B00D/R0010/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00E - R1013 - Toilets - Boys (17.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
B00E - R1014 - Movement (67.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
B00E - R1015 - Stairs (22.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)
B00E - R1016 - Stairs (22.33 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00D/Eaves Linings/S41					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Other-Community Use - 1965 - Timber (Timber)**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior**B00M - R0001 - Plant (39.01 m2)**

Panels Behind Heater	Flat AC Sheeting	2m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00M/R0001/Panels Behind Heater/S21					Chrysotile (white asbestos)	

B00M - R0002 - External Movement (15.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
2259/B00M/R0002/Ceiling Structures/Linings/S18						

B00M - R0003 - Toilets - Boys/Girls (3.05 m2)

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
2259/B00M/R0003/Floor Coverings Res/Textile/S19						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2259/B00M/R0003/Wall Linings Internal/S20					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities - 1965 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Wall Cladding	Flat AC Sheeting 2259/B00N/Wall Cladding/S15					No Asbestos Detected
Gable Ends	Flat AC Sheeting 2259/B00N/Wall Cladding/S15					No Asbestos Detected
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00N - R0001 - Communal Space (86.18 m2)**

Wall Linings Internal	Flat AC Sheeting 2259/B00N/R0001/Wall Linings Internal/S16					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2259/B00N/R0001/Ceiling Structures/Linings/S17					No Asbestos Detected

B00N - R0002 - External Movement (20.27 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2259/B00N/R0001/Ceiling Structures/Linings/S17					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - General Learning - 1965 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2259/B00R/Eaves Linings/S38					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00Q - R0001 - Home Base Store (7.08 m2)

Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00Q - R0002 - Home Base (52.34 m2)

No Asbestos

B00Q - R0003 - Home Base (52.33 m2)

Infill panels behind heater	Compressed AC Sheet	2m2	North west	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

2259/B00Q/R0003/Infill panels behind heater/S39

B00Q - R0005 - Practical Activities - 1hb (10.13 m2)

No Asbestos

B00Q - R0006 - Practical Activities - 1hb (13.26 m2)

No Asbestos

B00Q - R0007 - Home Base Store (3.74 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 1965 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2259/B00R/Eaves Linings/S38					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00R - R0001 - Home Base (52.2 m2)

Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00R - R0003 - Home Base Store (3.59 m2)

No Asbestos

B00R - R0004 - Practical Activities - 1hb (13.49 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - General Learning - 1965 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	6m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00S/R0006/Ceiling Structures/Linings/S37			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	Debris	2m2	Variable positions	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
	2259/B00S/Underfloor Voids/S36			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B00S - R0001 - Home Base (53.29 m2)

Panels Behind Heater	Flat AC Sheeting	2m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00S/R0001/Panels Behind Heater/S6			Chrysotile (white asbestos)		

B00S - R0006 - General Storeroom (4.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00S/R0006/Ceiling Structures/Linings/S37			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - No access live electrical equipment					

B00S - R0007 - External Movement (3.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2259/B00S/R0006/Ceiling Structures/Linings/S37			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00S - R0008 - Practical Activities - 1hb (12.24 m2)

No Asbestos

B00S - R0009 - Home Base Store (3.82 m2)

No Asbestos

B00S - R0010 - Special Programs Room - Type 1 (26.72 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00T - Library - 1993 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00T - R0001 - Reading Area (219.63 m2)**

No Asbestos

B00T - R0002 - Communications Room (13.28 m2)

No Asbestos

B00T - R0003 - Library Office/Workroom (25.84 m2)

No Asbestos

B00T - R0004 - Movement (14.47 m2)

No Asbestos

B00T - R0005 - External Movement (12.6 m2)

No Asbestos

B00T - R0006 - Special Programs Room (41.4 m2)

No Asbestos

B00T - R0007 - Distribution Board (0.92 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00T - R0008 - Security Store (1.98 m2)

No Asbestos

B00T - R0009 - Plant (4.93 m2)

No Asbestos

B00T - R0010 - External Movement (43.54 m2)

No Asbestos

B00T - R0011 - Disabled Toilet (6.15 m2)

No Asbestos

B00T - R0012 - Cleaning Distributed Store (3.25 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - Communal Facilities - 1993 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00U - R0001 - External Movement (231.56 m2)**

No Asbestos

B00U - R0002 - Communal Space (203.83 m2)

No Asbestos

B00U - R0003 - Plant (0.56 m2)

Ceiling Structures/Linings Flat AC Sheeting
2259/B00U/R0006/Ceiling Structures/Linings/S29 **No Asbestos Detected**

B00U - R0004 - Cleaning Distributed Store (19.6 m2)

Ceiling Structures/Linings Flat AC Sheeting
2259/B00U/R0006/Ceiling Structures/Linings/S29 **No Asbestos Detected**

B00U - R0005 - Raised Platform (46.32 m2)

No Asbestos

B00U - R0006 - P.E. Store (17.72 m2)

Ceiling Structures/Linings Flat AC Sheeting
2259/B00U/R0006/Ceiling Structures/Linings/S29 **No Asbestos Detected**

B00U - R0007 - Distribution Board (1.04 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00U - R0008 - External Movement (21.41 m2)

No Asbestos

B00U - R0009 - External Movement (17.36 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00V - General Learning - 2006 - Concrete (Concrete)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00V - R0001 - Seminar/Study (7.08 m2)

No Asbestos

B00V - R0002 - Seminar/Study (7.14 m2)

No Asbestos

B00V - R0003 - Movement (6 m2)

No Asbestos

B00V - R0004 - Staff Toilet (1.27 m2)

No Asbestos

B00V - R0005 - Special Programs Room (78.02 m2)

No Asbestos

B00V - R0006 - External Movement (0.72 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00W - Building Services - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00W - R0001 - General Assistant/Bulk Store (45.15 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00X - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00X - R0001 - Practical Activities - 1hb (14.47 m2)

No Asbestos

B00X - R0002 - Personal Effects Storage (4.49 m2)

No Asbestos

B00X - R0003 - Home Base Store (6.11 m2)

No Asbestos

B00X - R0004 - Home Base (60.28 m2)

No Asbestos

B00X - R0005 - Withdrawal Space - 2hb (11.56 m2)

No Asbestos

B00X - R0006 - Practical Activities - 1hb (14.51 m2)

No Asbestos

B00X - R0007 - Personal Effects Storage (4.49 m2)

No Asbestos

B00X - R0008 - Home Base Store (6.11 m2)

No Asbestos

B00X - R0009 - Home Base (60.28 m2)

No Asbestos

B00X - R0010 - External Movement (45.84 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Y - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00Y - R0001 - Practical Activities - 1hb (14.07 m2)**

No Asbestos

B00Y - R0002 - Personal Effects Storage (4.3 m2)

No Asbestos

B00Y - R0003 - Home Base Store (6.29 m2)

No Asbestos

B00Y - R0004 - Home Base (59.74 m2)

No Asbestos

B00Y - R0005 - Withdrawal Space - 2hb (11.67 m2)

No Asbestos

B00Y - R0006 - Practical Activities - 1hb (13.79 m2)

No Asbestos

B00Y - R0007 - Personal Effects Storage (4.7 m2)

No Asbestos

B00Y - R0008 - Home Base Store (6.37 m2)

No Asbestos

B00Y - R0009 - Home Base (59.98 m2)

No Asbestos

B00Y - R0010 - External Movement (54.32 m2)

No Asbestos

B00Y - R0011 - Movement (5.46 m2)

No Asbestos

B00Y - R0012 - Special Programs Store (9.72 m2)

No Asbestos

B00Y - R0013 - Practical Activities (6.48 m2)

No Asbestos

B00Y - R0014 - Special Programs Room (27.66 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10204 - Learning Unit - Standard With P.A.A. : Placement Date - 13/05/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11480 - Learning Unit - Standard With P.A.A. : Placement Date - 28/03/2001

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

NS 020 - D12165 - Staff Study/Store : Placement Date - 10/08/1999

Exterior

No Asbestos Found.

Interior

R1 - Staff Room

No Asbestos Found.

R2 - Store

No Asbestos Found.

R3 - Entry

No Asbestos Found.

OS 602 - D14927 - Learning Unit - Standard With P.A.A. : Placement Date - 18/01/2001

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017