


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Karuah Public School (2263)
Region : Hunter/Central Coast
State Electorate : Port Stephens
Local Government Area : Port Stephens

Initial Survey : Noel Arnold & Associates : 23 - May - 2008
Reviewed By : Greencap-NAA : 07 - Oct - 2015

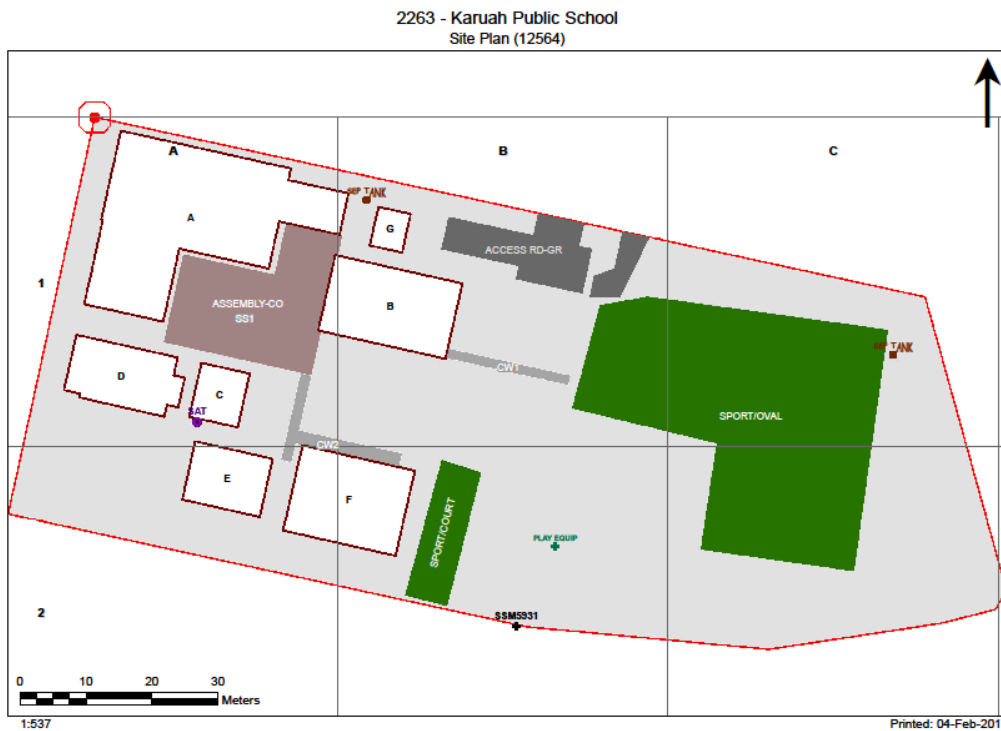

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - Administration/General Learning - 1968 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|-----------------------------------|---------------------------------|-------|--------------------|--------------------|---------|------------------------------------|
| Gable Verge Lining | Flat AC Sheeting | 25m2 | Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/Gable Verge Lining/S1 | | | | | Chrysotile (white asbestos) |
| Eaves Linings | Flat AC Sheeting | 100m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/Eaves Linings/S10 | | | | | Chrysotile (white asbestos) |
| Infil panel | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2263/B00A/Infil panel/S11 | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |

Interior**B00A - R0001 - Toilets - Girls**

| | | | | | | |
|----------------------------|---|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0017/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) |
| Partition Walls (Cubicles) | Compressed AC Sheet | 8m2 | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0001/Partition Walls (Cubicles)/S4 | | | | | Chrysotile (white asbestos) |

B00A - R0002 - Toilets - Girls

| | | | | | | |
|----------------------------|---|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0017/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) |

B00A - R0003 - External Movement

| | | | | | | |
|----------------------------|---|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 12m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0017/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) |

B00A - R0004 - Toilets - Boys

| | | | | | | |
|----------------------------|---|------|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0017/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) |
| Partition Walls (Cubicles) | Compressed AC Sheet | 5m2 | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0001/Partition Walls (Cubicles)/S4 | | | | | Chrysotile (white asbestos) |

B00A - R0005 - Toilets - Boys

| | | | | | | |
|----------------------------|---|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0017/Ceiling Structures/Linings/S3 | | | | | Chrysotile (white asbestos) |

B00A - R0006 - General Storeroom

No Asbestos

B00A - R0007 - Practical Activities - 1hb

| | | | | | | |
|-----------------------------|--|------|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 10m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0009/Floor Coverings Res/Textile/S5 | | | | | Chrysotile (white asbestos) |

B00A - R0008 - Communal Space

| | | | | | | |
|-----------------------------|---|------|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) | 84m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0023/Floor Coverings Res/Textile/S12 | | | | | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Adhesive | | | | | No Asbestos Detected |
| | 2263/B00A/R0023/Floor Coverings Res/Textile/S13 | | | | | |

B00A - R0009 - Movement

| | | | | | | |
|-----------------------------|--|------|------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 15m2 | East | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0009/Floor Coverings Res/Textile/S5 | | | | | Chrysotile (white asbestos) |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|--|--------|--------------------|----------------------------|-------------|--|
| Sample No | | | | | Test Result | |
| B00A - R0010 - Communal Space | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) 2263/B00A/R0023/Floor Coverings Res/Textile/S12 | 60m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Adhesive 2263/B00A/R0023/Floor Coverings Res/Textile/S13 | | | | | No Asbestos Detected |
| B00A - R0011 - Practical Activities - 1hb | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles 2263/B00A/R0009/Floor Coverings Res/Textile/S5 | 11m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0012 - Distribution Board Note: No inspection of live electrical installation. | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles 2263/B00A/R0009/Floor Coverings Res/Textile/S5 | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0013 - Staff Room | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles 2263/B00A/R0009/Floor Coverings Res/Textile/S5 | 26m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0014 - Staff Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0015 - Staff Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0016 - Cleaning Distributed Store | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0017 - External Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 2263/B00A/R0017/Ceiling Structures/Linings/S3 | 84m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| In-fill-panel | Flat AC Sheeting 2263/B00A/R0017/In-fill-panel/S2 | 10m | Throughout | Some Damage - Unsealed (3) | Medium (2) | Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) |
| B00A - R0018 - General Storeroom | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0019 - Home Base | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) 2263/B00A/R0023/Floor Coverings Res/Textile/S12 | 58m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Adhesive 2263/B00A/R0023/Floor Coverings Res/Textile/S13 | | | | | No Asbestos Detected |
| B00A - R0020 - Home Base Store | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles 2263/B00A/R0023/Floor Coverings Res/Textile/S12 | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0021 - Distribution Board Note: No inspection of live electrical installation. | | | | | | |
| Electrical Backing Board | Resinous Board | 1Unit | South | Good Condition (1) | Low (1) | Low Priority (2-3) Assumed Asbestos - Electrical Hazard |
| Wall Linings Internal | Flat AC Sheeting 2263/B00A/R0021/Wall Linings Internal/S14 | 10m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| B00A - R0022 - Clerical Office/Workroom | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0023 - Principal | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---|--|--------|--------------------|--------------------|-------------|--|
| Sample No | | | | | Test Result | |
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet) 2263/B00A/R0023/Floor Coverings Res/Textile/S12 | 15m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Adhesive 2263/B00A/R0023/Floor Coverings Res/Textile/S13 | | | | | No Asbestos Detected |
| B00A - R0024 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0025 - Security Store | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0026 - External Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting 2263/B00A/R0017/Ceiling Structures/Linings/S3 | 24m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| In-fill-panel | Flat AC Sheeting 2263/B00A/Infil panel/S11 | | | | | No Asbestos Detected |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00B - Library - 1975 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|-----------------------------------|-------------------|
| Ceiling Voids - Raked Ceiling | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

Interior

B00B - R0001 - External Movement

No Asbestos

B00B - R0002 - K.L.A. Store

No Asbestos

B00B - R0003 - Library Office/Workroom

No Asbestos

B00B - R0004 - Reading Area

No Asbestos

B00B - R0005 - Distribution Board

Note: No inspection of live electrical installation.

| | | | | | | |
|----------------------------|---|-----|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/R0017/Ceiling Structures/Linings/S3 | | | | Chrysotile (white asbestos) | |
| Wall Linings Internal | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00B/R0005/Wall Linings Internal/S15 | | | | Chrysotile (white asbestos) | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - Pupil Facilities - 1975 - Timber (Timber)**Exterior**

| | | | | | | |
|------------------|-----------------------------|------|------|--------------------|---------|------------------------------------|
| Eaves Linings | Flat AC Sheeting | 10m2 | East | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2263/B00A/Eaves Linings/S10 | | | | | Chrysotile (white asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior**B00C - R0001 - External Movement**

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 2263/B00C/R0001/Wall Linings Internal/S16 | | | | | No Asbestos Detected |

B00C - R0002 - Canteen

| | | | | | | |
|-----------------------------|---|-------|-------|--------------------|---------|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 2263/B00C/R0004/Floor Coverings Res/Textile/S17 | | | | | No Asbestos Detected |
| Floor Coverings Res/Textile | Adhesive | | | | | |
| | 2263/B00C/R0004/Floor Coverings Res/Textile/S18 | | | | | No Asbestos Detected |
| Electrical Backing Board | Resinous Board | 1Unit | South | Good Condition (1) | Low (1) | Low Priority (2-3) |

Assumed Asbestos - Electrical Hazard**B00C - R0003 - Staff Toilet**

No Asbestos

B00C - R0004 - Canteen Office/Store

| | | | | | | |
|-----------------------------|---|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Sheet | | | | | |
| | 2263/B00C/R0004/Floor Coverings Res/Textile/S17 | | | | | No Asbestos Detected |
| Floor Coverings Res/Textile | Adhesive | | | | | |
| | 2263/B00C/R0004/Floor Coverings Res/Textile/S18 | | | | | No Asbestos Detected |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning/Communal Facilities - 1981 - Timber (Timber)

Exterior

| | | | | | | |
|---------------------------|---|------|------------|--------------------|---------|--|
| Wall Cladding | Flat AC Sheeting 2263/B00D/Wall Cladding/S9 | | | | | No Asbestos Detected |
| Eaves Linings | Flat AC Sheeting 2263/B00D/Eaves Linings/S19 | 20m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) |
| Ceiling Voids - Flat Roof | No Asbestos Found | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | |

Interior

B00D - R0001 - External Movement

No Asbestos

B00D - R0002 - General Assistant/Bulk Store

No Asbestos

B00D - R0004 - Sports Store

No Asbestos

B00D - R0005 - Home Base

No Asbestos

B00D - R0006 - Special Programs Room

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - Special Purpose - 2010 - Steel (Steel)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Movement

No Asbestos

B00E - R0003 - Disabled Toilet

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00F - R0001 - External Movement

No Asbestos

B00F - R0002 - Practical Activities - 1hb

No Asbestos

B00F - R0003 - Home Base Store

No Asbestos

B00F - R0004 - Home Base

No Asbestos

B00F - R0005 - Withdrawal Space - 2hb

No Asbestos

B00F - R0006 - Home Base

No Asbestos

B00F - R0007 - Home Base Store

No Asbestos

B00F - R0008 - Practical Activities - 1hb

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00G - Building Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00G - R0001 - General Storeroom

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D14608 - Learning Unit - Standard With P.A.A. : Placement Date - 28/06/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017