


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kearsley Public School (2267)
Region : Hunter/Central Coast
State Electorate : Cessnock
Local Government Area : Cessnock

Initial Survey : Noel Arnold & Associates : 15 - May - 2008
Register Issue Date : 22 - Mar - 2017

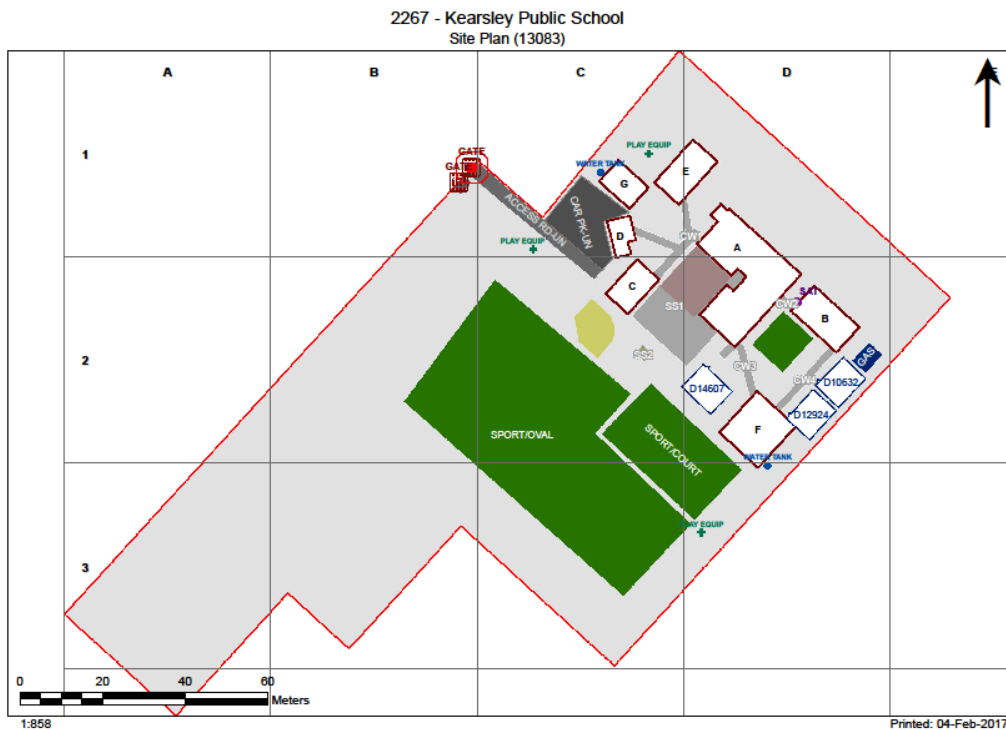

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1916 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2267/B00A/Eaves Linings/S2					Chrysotile (White asbestos)
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00A - R0002 - Entry Vestibule

No Asbestos

B00A - R0003 - Principal

No Asbestos

B00A - R0004 - Clerical Office

No Asbestos

B00A - R0005 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles					
	2267/B00A/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0006 - Staff Toilet

No Asbestos

B00A - R0007 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles					
	2267/B00A/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0008 - Movement

No Asbestos

B00A - R0013 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	2267/B00A/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0014 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	2267/B00A/R0007/Floor Coverings Res/Textile/S1					No Asbestos Detected

B00A - R0015 - Covered Outdoor Learning Area

No Asbestos

B00A - R0016 - External Movement

No Asbestos

B00A - R0017 - External Movement

No Asbestos

B00A - R0018 - Home Base Store

No Asbestos

B00A - R0019 - Home Base Store

No Asbestos

B00A - R0020 - Withdrawal Space - 1hb

No Asbestos

B00A - R0021 - Home Base

No Asbestos

B00A - R0022 - Home Base

No Asbestos

B00A - R0023 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1913 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2267/B00A/Eaves Linings/S2					Chrysotile (White asbestos)
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00B - R0003 - External Movement

No Asbestos

B00B - R0004 - Home Base Store

No Asbestos

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1965 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 2267/B00C/R0002/Ceiling Structures/Linings/S3	No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 2267/B00C/R0002/Partition Walls (Cubicles)/S4	No Asbestos Detected

B00C - R0003 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 2267/B00C/R0002/Ceiling Structures/Linings/S3	No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 2267/B00C/R0002/Partition Walls (Cubicles)/S4	No Asbestos Detected

B00C - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 2267/B00C/R0002/Ceiling Structures/Linings/S3	No Asbestos Detected
----------------------------	---	----------------------

B00C - R0005 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting 2267/B00C/R0002/Ceiling Structures/Linings/S3	No Asbestos Detected
----------------------------	---	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Communal Facilities - 1950 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - Sports Store

No Asbestos

B00D - R0002 - Canteen

No Asbestos

B00D - R0003 - Canteen Office/Store

No Asbestos

B00D - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 2005 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00E - R0001 - Raised Platform

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00E - R0002 - Communal Space

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00F - R0001 - External Movement

No Asbestos

B00F - R0002 - Reading Area

No Asbestos

B00F - R0003 - Library Office/Workroom

No Asbestos

B00F - R0004 - K.L.A. Store

No Asbestos

B00F - R0005 - Communications Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other - 2006 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00G - R0001 - Covered Outdoor Learning Area

No Asbestos

B00G - R0002 - Sports Store

No Asbestos

B00G - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D10632 - Learning Unit - Standard/Withdrawal : Placement Date - 19/02/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D12924 - Learning Unit - Standard/Withdrawal : Placement Date - 14/04/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D14607 - Learning Unit - Standard/Withdrawal : Placement Date - 10/12/2014

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017