


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kegworth Public School (2270)  
**Region :** Sydney  
**State Electorate :** Balmain  
**Local Government Area :** Leichhardt

**Initial Survey :** Noel Arnold & Associates : 30 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 14 - Feb - 2017

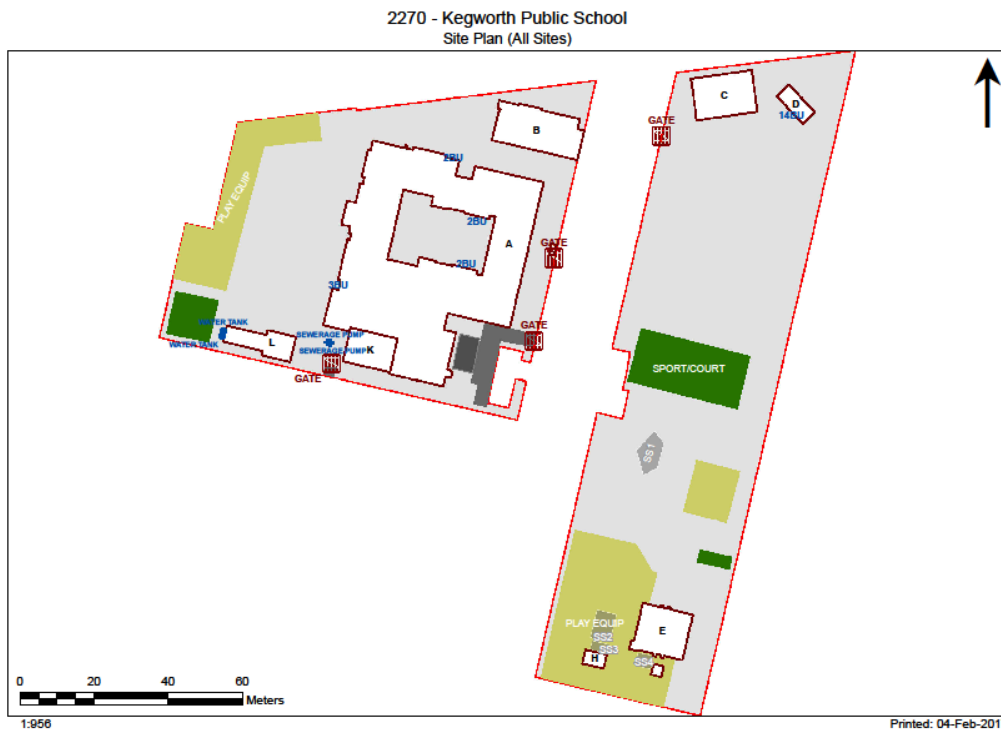

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1887 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	400m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2270/B00A/Eaves Linings/S12					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Flat Roof	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2270/B00A/Ceiling Voids - Flat Roof/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00A - R0001 - Withdrawal Space - 1hb (15.34 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00A/R9027/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>

**B00A - R0002 - Uniform Shop (7.4 m2)**

No Asbestos

**B00A - R0003 - Movement (32.39 m2)**

No Asbestos

**B00A - R0004 - Distribution Board (0.85 m2)**

Note: No inspection of live electrical installation.

Linings to Doors	Flat AC Sheeting					
	2270/B00A/R0036/Linings to Doors/S4					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2270/B00A/R0037/Wall Linings Internal/S5					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0005 - Staff Room (46.53 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00A/R9027/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>

**B00A - R0006 - Staff Kitchen (4.71 m2)**

No Asbestos

**B00A - R0007 - Duplicating Workroom (18.58 m2)**

No Asbestos

**B00A - R0008 - Movement (36.66 m2)**

No Asbestos

**B00A - R0009 - Clerical Office/Workroom (9.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00A/R9027/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>

**B00A - R0010 - Clerical Office (11.66 m2)**

No Asbestos

**B00A - R0011 - Deputy Principal (17.66 m2)**

No Asbestos

**B00A - R0012 - Principal (23.16 m2)**

No Asbestos

**B00A - R0013 - Sick Bay (3.92 m2)**

No Asbestos

**B00A - R0014 - Practical Activities - 1hb (18.11 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00A/R9027/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
<b>B00A - R0015 - Home Base (55.77 m2)</b>						
No Asbestos						
<b>B00A - R0016 - Home Base (44.16 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Practical Activities - 1hb (21.01 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00A/R9027/Floor Coverings Res/Textile/S1						<b>No Asbestos Detected</b>
<b>B00A - R0018 - Movement (19.5 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Staff Toilet (3.56 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2270/B00A/R0019/Ceiling Structures/Linings/S3						<b>Chrysotile (white asbestos)</b>
<b>B00A - R0020 - Security Store (10.28 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Movement (25.23 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00A/R9027/Floor Coverings Res/Textile/S1						<b>No Asbestos Detected</b>
<b>B00A - R0023 - Movement (38.27 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00A/R9027/Floor Coverings Res/Textile/S1						<b>No Asbestos Detected</b>
<b>B00A - R0024 - External Movement (4.39 m2)</b>						
No Asbestos						
<b>B00A - R0025 - Entry Vestibule (4.84 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Toilets - Boys (4.22 m2)</b>						
No Asbestos						
<b>B00A - R0027 - Movement (22.79 m2)</b>						
No Asbestos						
<b>B00A - R0028 - Library Office/Workroom (10.32 m2)</b>						
No Asbestos						
<b>B00A - R0029 - Reading Area (84.57 m2)</b>						
No Asbestos						
<b>B00A - R0030 - Seminar/Study (9.2 m2)</b>						
No Asbestos						
<b>B00A - R0031 - Seminar/Study (9.15 m2)</b>						
No Asbestos						
<b>B00A - R0032 - Communications Room (13.45 m2)</b>						
No Asbestos						
<b>B00A - R0033 - Library Office/Workroom (6.82 m2)</b>						
No Asbestos						
<b>B00A - R0034 - Library Office/Workroom (17.15 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00A/R9027/Floor Coverings Res/Textile/S1						<b>No Asbestos Detected</b>
<b>B00A - R0035 - Movement (1.36 m2)</b>						
No Asbestos						
<b>B00A - R0036 - Toilets - Girls (3.61 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0037 - Cleaning Distributed Store (1.72 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2270/B00A/R0037/Wall Linings Internal/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R0038 - Distribution Board (0.66 m2)</b>					Note: No inspection of live electrical installation.	
Linings to Doors	Flat AC Sheeting					<b>No Asbestos Detected</b>
2270/B00A/R0036/Linings to Doors/S4						
<b>B00A - R0039 - External Movement (6.1 m2)</b>						
No Asbestos						
<b>B00A - R0040 - Movement (13.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
2270/B00A/R0047/Ceiling Structures/Linings/S7				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0041 - Movement (6.9 m2)</b>						
No Asbestos						
<b>B00A - R0042 - General Assistant/Bulk Store (8.77 m2)</b>						
No Asbestos						
<b>B00A - R0043 - Toilets - Girls (3.32 m2)</b>						
No Asbestos						
<b>B00A - R0044 - Cleaning Distributed Store (2.07 m2)</b>						
No Asbestos						
<b>B00A - R0045 - Toilets - Boys (3.34 m2)</b>						
No Asbestos						
<b>B00A - R0046 - Movement (33.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
2270/B00A/R0047/Ceiling Structures/Linings/S7				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0047 - Practical Activities - 1hb (20.14 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
2270/B00A/R9027/Floor Coverings Res/Textile/S1						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
2270/B00A/R0047/Ceiling Structures/Linings/S7				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0048 - Home Base (46.95 m2)</b>						
No Asbestos						
<b>B00A - R0049 - Withdrawal Space - 1hb (10.78 m2)</b>						
No Asbestos						
<b>B00A - R0050 - Practical Activities - 1hb (23.46 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
2270/B00A/R9027/Floor Coverings Res/Textile/S1						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
2270/B00A/R0047/Ceiling Structures/Linings/S7				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0051 - Home Base (52.51 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
2270/B00A/R0047/Ceiling Structures/Linings/S7				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00A - R0052 - General Storeroom (10.44 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
<b>B00A - R0053 - Home Base (54.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite		2270/B00A/R0047/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0054 - Practical Activities - 1hb (19.29 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles		2270/B00A/R9027/Floor Coverings Res/Textile/S1			No Asbestos Detected
Ceiling Structures/Linings	Vermiculite		2270/B00A/R0047/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0055 - Movement (79.22 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles		2270/B00A/R9027/Floor Coverings Res/Textile/S1			No Asbestos Detected
Ceiling Structures/Linings	Vermiculite		2270/B00A/R0047/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0056 - External Movement (20.71 m2)</b>						
No Asbestos						
<b>B00A - R0057 - Distribution Board (0.58 m2)</b>						
						Note: No inspection of live electrical installation.
Linings to Doors	Flat AC Sheeting		2270/B00A/R0036/Linings to Doors/S4			No Asbestos Detected
<b>B00A - R0058 - Toilets - Boys (14.46 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
<b>B00A - R0059 - Toilets - Girls (17.03 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
<b>B00A - R0061 - Movement (25.52 m2)</b>						
No Asbestos						
<b>B00A - R0062 - Disabled Toilet (2.5 m2)</b>						
No Asbestos						
<b>B00A - R0063 - Practical Activities - 1hb (25.74 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles		2270/B00A/R9027/Floor Coverings Res/Textile/S1			No Asbestos Detected
Ceiling Structures/Linings	Vermiculite		2270/B00A/R0047/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0064 - Home Base (72.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite		2270/B00A/R0047/Ceiling Structures/Linings/S7			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0065 - External Movement (1.44 m2)</b>						
No Asbestos						
<b>B00A - R0066 - External Movement (1.44 m2)</b>						
No Asbestos						
<b>B00A - R0067 - Drinking Facilities (1.3 m2)</b>						
No Asbestos						
<b>B00A - R0068 - Home Base (62.55 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0069 - Practical Activities - 1hb (25.1 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0070 - Toilets - Boys/Girls (2.05 m2)</b>						
No Asbestos						
<b>B00A - R0071 - External Movement (1.44 m2)</b>						
No Asbestos						
<b>B00A - R0072 - External Movement (1.44 m2)</b>						
No Asbestos						
<b>B00A - R0073 - Cleaning Supplies (8.97 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0074 - Cleaning Distributed Store (3.09 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0075 - Movement (2.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0076 - Movement (16.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0077 - Security Store (9.53 m2)</b>						
No Asbestos						
<b>B00A - R0078 - Movement (40.09 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected
<b>B00A - R0079 - Movement (19.26 m2)</b>						
No Asbestos						
<b>B00A - R0080 - Staff Toilet (4.81 m2)</b>						
No Asbestos						
<b>B00A - R0081 - Staff Toilet (5.45 m2)</b>						
No Asbestos						
<b>B00A - R0082 - Security Store (4.27 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2270/B00A/R0019/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0083 - Practical Activities - 1hb (18.14 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00A/R9027/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>	
<b>B00A - R0084 - Home Base (73.08 m2)</b>						
No Asbestos						
<b>B00A - R0085 - Clerical Office (14.19 m2)</b>						
No Asbestos						
<b>B00A - R0086 - Movement (8.65 m2)</b>						
No Asbestos						
<b>B00A - R0087 - Movement (15.17 m2)</b>						
No Asbestos						
<b>B00A - R0088 - Cleaning Distributed Store (1.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00A/R9027/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2270/B00A/R0019/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0089 - Stairs (9.58 m2)</b>						
No Asbestos						
<b>B00A - R0090 - Stairs (17.08 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00A/R9027/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>	
<b>B00A - R0091 - Stairs (0.21 m2)</b>						
No Asbestos						
<b>B00A - R0092 - Stairs (6.01 m2)</b>						
No Asbestos						
<b>B00A - R0093 - Stairs (6.22 m2)</b>						
No Asbestos						
<b>B00A - R0096 - External Movement (2.86 m2)</b>						
No Asbestos						
<b>B00A - R0097 - External Stairs (12.09 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Reading Area (101.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
2270/B00A/R0047/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1002 - Movement (6.96 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
2270/B00A/R0047/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1003 - Security Store (8.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
2270/B00A/R0047/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R1004 - Personal Effects Storage (15.83 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1005 - Toilets - Girls (3.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1006 - Cleaning Distributed Store (2.19 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1007 - Toilets - Boys (3.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1008 - Movement (86.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1009 - Practical Activities - 1hb (19.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1010 - Home Base (49.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1011 - Security Store (9.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1012 - Withdrawal Space - 1hb (9.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1013 - Practical Activities - 1hb (22.58 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1014 - Home Base (52.04 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1015 - Home Base (55.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1016 - Practical Activities - 1hb (18.94 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1017 - Staff Room Annexe (9.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1018 - Withdrawal Space - 1hb (9.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1019 - Practical Activities - 1hb (20.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1020 - Home Base (54.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1021 - Security Store (17.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1022 - Distribution Board (0.44 m2)</b>						
					Note: No inspection of live electrical installation.	
Linings to Doors	Flat AC Sheeting	2270/B00A/R0036/Linings to Doors/S4				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1023 - Home Base (52.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1024 - Practical Activities - 1hb (22.77 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2270/B00A/R9027/Floor Coverings Res/Textile/S1				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1025 - Withdrawal Space - 1hb (9.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1026 - Security Store (9.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1027 - Home Base (49.64 m2)</b>						
Ceiling Structures/Linings	Vermiculite	2270/B00A/R0047/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1028 - Practical Activities - 1hb (20.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00A/R9027/Floor Coverings Res/Textile/S1					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1029 - Movement (15.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1030 - Toilets - Boys (3.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1031 - Cleaning Distributed Store (2.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1032 - Toilets - Girls (3.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1033 - Movement (6.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1034 - Staff Room Annexe (9.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00A/R9027/Floor Coverings Res/Textile/S1					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1035 - Seminar/Study (28.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1036 - Stairs (2.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1037 - Stairs (4.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1038 - Stairs (5.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1039 - Stairs (6.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2270/B00A/R0047/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R9001 - General Storeroom (17.99 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R9002 - Main Switch Board (8.46 m2)</b>						
No Asbestos						
<b>B00A - R9011 - External Movement (1.26 m2)</b>						
No Asbestos						
<b>B00A - R9012 - External Movement (1.26 m2)</b>						
No Asbestos						
<b>B00A - R9013 - Drinking Facilities (1.26 m2)</b>						
No Asbestos						
<b>B00A - R9021 - Hall Chair Store (9.48 m2)</b>						
No Asbestos						
<b>B00A - R9022 - Movement (4.47 m2)</b>						
Non Accessible						
No Asbestos						
<b>B00A - R9023 - Cleaning Distributed Store (2.69 m2)</b>						
No Asbestos						
Non Accessible						
<b>B00A - R9024 - General Storeroom (15.34 m2)</b>						
No Asbestos						
<b>B00A - R9025 - Movement (10.84 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00A/R9027/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>	
<b>B00A - R9026 - Stairs (4.36 m2)</b>						
Non Accessible						
<b>B00A - R9031 - Communal/Performance Store (9.92 m2)</b>						
No Asbestos						
<b>B00A - R9032 - Hall Chair Store (9.65 m2)</b>						
No Asbestos						
<b>B00A - R9033 - Access Shower/Toilet (7.28 m2)</b>						
No Asbestos						
<b>B00A - R9034 - P.E. Store (17.4 m2)</b>						
No Asbestos						
<b>B00A - R9035 - Sound Cupboard (2.91 m2)</b>						
No Asbestos						
<b>B00A - R9036 - Communal Space (182.03 m2)</b>						
No Asbestos						
<b>B00A - R9037 - Movement (11.32 m2)</b>						
No Asbestos						
<b>B00A - R9038 - Raised Platform (48.52 m2)</b>						
No Asbestos						
<b>B00A - R9039 - Ramp (6.07 m2)</b>						
No Asbestos						
<b>B00A - R9040 - Movement (6.03 m2)</b>						
No Asbestos						
<b>B00A - R9041 - Covered Outdoor Learning Area (185.95 m2)</b>						
No Asbestos						
<b>B00A - R9042 - External Stairs (12.09 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Communal Facilities - 1977 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00B - R0001 - External Movement (3.74 m2)**

No Asbestos

**B00B - R0002 - Staff Room Annexe (9.89 m2)**

No Asbestos

**B00B - R0003 - Teachers Aide Special Ed (13.3 m2)**

No Asbestos

**B00B - R0004 - Movement (51.22 m2)**

No Asbestos

**B00B - R0005 - Raised Platform (31.35 m2)**

No Asbestos

**B00B - R0006 - Communal Space (44.87 m2)**

No Asbestos

**B00B - R0007 - Communal Space (56.44 m2)**

No Asbestos

**B00B - R0008 - Cleaning Distributed Store (2.7 m2)**

Floor Coverings Res/Textile	Vinyl Tiles						
	2270/B00B/R0008/Floor Coverings Res/Textile/S9						<b>No Asbestos Detected</b>

**B00B - R0009 - Distribution Board (0.44 m2)**

Note: No inspection of live electrical installation.

Panels to Doors	Flat AC Sheeting	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2270/B00B/R0009/Panels to Doors/S8					<b>Chrysotile (white asbestos)</b>

**B00B - R0010 - External Movement (1.65 m2)**

No Asbestos

**B00B - R0011 - Stairs (2.02 m2)**

No Asbestos

**B00B - R1001 - Toilets - Boys (2.28 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00B/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

**B00B - R1002 - Cleaning Distributed Store (1.83 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00B/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

**B00B - R1003 - Special Programs Room (52.48 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00B/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

**B00B - R1004 - Home Base (52.41 m2)**

No Asbestos

**B00B - R1005 - Home Base (57.59 m2)**

No Asbestos

**B00B - R1006 - General Storeroom (5.51 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2270/B00B/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R1007 - Movement (3.46 m2)</b>						
No Asbestos						
<b>B00B - R1008 - Toilets - Girls (1.84 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
2270/B00B/R0008/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>	
<b>B00B - R1009 - Movement (29.59 m2)</b>						
No Asbestos						
<b>B00B - R1010 - Stairs (4.79 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Other-After School Care - 1887 - Timber (Timber)**

**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00C - R0001 - Out Of School Hours Care Centre (13.95 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2270/B00C/R0001/Ceiling Structures/Linings/S10	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B00C - R0003 - Home Base - Pre (74.03 m2)**

No Asbestos

**B00C - R0004 - Garden Store (7.38 m2)**

No Asbestos

**B00C - R0005 - Sports Store (3.3 m2)**

No Asbestos

**B00C - R0006 - External Movement (13.36 m2)**

No Asbestos

**B00C - R0007 - External Movement (14.68 m2)**

No Asbestos

**B00C - R0008 - External Movement (46.96 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1887 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00D - R0001 - Toilets - Girls (17.26 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2270/B00D/R0001/Partition Walls (Cubicles)/S11					<b>Chrysotile (white asbestos)</b>	

**B00D - R0002 - Toilets - Boys (17.17 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2270/B00D/R0001/Partition Walls (Cubicles)/S11					<b>Chrysotile (white asbestos)</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00E - Pre-School Facilities - 1887 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior****B00E - R0010 - General Storeroom (3.87 m2)**

No Asbestos

**B00E - R0011 - General Storeroom (7.35 m2)**

No Asbestos

**B00E - R0012 - Laundry - Pre (5.65 m2)**

No Asbestos

**B00E - R0013 - General Storeroom (5.58 m2)**

No Asbestos

**B00E - R0014 - Practical Activities - Pre (11.15 m2)**

No Asbestos

**B00E - R0015 - Home Base - Pre (58.54 m2)**

No Asbestos

**B00E - R0016 - Toilets-Unisex (12.05 m2)**

No Asbestos

**B00E - R0017 - Kitchen - Pre (4.87 m2)**

No Asbestos

**B00E - R0018 - Staff Room (17.96 m2)**

No Asbestos

**B00E - R0019 - Staff Toilet (1.74 m2)**

No Asbestos

**B00E - R0020 - Movement (3.42 m2)**

No Asbestos

**B00E - R0021 - Movement (3.65 m2)**

No Asbestos

**B00E - R0022 - External Movement (25.03 m2)**

No Asbestos

**B00E - R0023 - No Access (0.27 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Other - 2006 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids      No Asbestos Found

Ceiling Voids          No Asbestos Found

**Interior**

**B00G - R0001 - Plant (3.27 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Other - 2007 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids      No Asbestos Found

Ceiling Voids          No Asbestos Found

**Interior**

**B00H - R0001 - General Storeroom (21.73 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Other - 2007 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids      No Asbestos Found

Ceiling Voids          No Asbestos Found

**Interior**

**B00J - R0001 - General Storeroom (7.72 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities/Other - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00K - R0001 - Canteen (26.42 m2)**

No Asbestos

**B00K - R0002 - Canteen Office/Store (9.24 m2)**

No Asbestos

**B00K - R0003 - Toilets - Girls/Disabled Cubicle (25 m2)**

No Asbestos

**B00K - R0004 - Toilets - Boys/Disabled Cubicle (15.29 m2)**

No Asbestos

**B00K - R0005 - Cleaning Distributed Store (1.51 m2)**

No Asbestos

**B00K - R0006 - External Movement (27.92 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning/Other - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior**

**B00L - R0001 - Special Programs Room (33.76 m2)**

No Asbestos

**B00L - R0002 - Special Programs Store (12.82 m2)**

No Asbestos

**B00L - R0003 - Garden Store (13.3 m2)**

No Asbestos

**B00L - R0004 - General Assistant/Bulk Store (15.72 m2)**

No Asbestos

**B00L - R0005 - Sports Store (12.56 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017