


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Keiraville Public School (2271)
Region : Illawarra and South East
State Electorate : Keira
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 23 - Apr - 2008
Reviewed By : AECOM : 18 - Jun - 2015

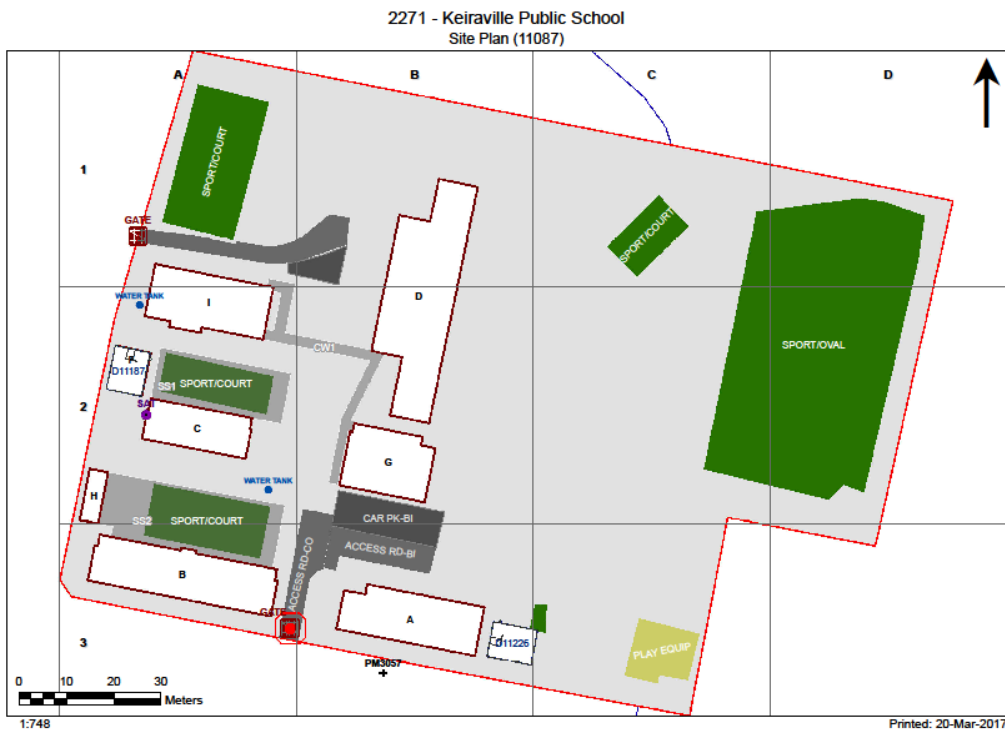

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - Administration/Communal Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|-----------------------------------|--|------|--------------|--------------------|------------------------------------|--------------------|
| Eaves Linings | Flat AC Sheeting | 25m2 | North, South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00A/R1001/Ceiling Structures/Linings/S13 | | | | Chrysotile (white asbestos) | |
| Gable Verge Lining | Flat AC Sheeting | 15m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00A/R1001/Ceiling Structures/Linings/S13 | | | | Chrysotile (white asbestos) | |
| In-fill-panel | Compressed AC Sheet | 25m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00A/R0008/In-fill-panel/S8 | | | | Chrysotile (white asbestos) | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior**B00A - R0001 - Raised Platform (48.9 m2)**

No Asbestos

B00A - R0002 - Communal Space (122.76 m2)

No Asbestos

B00A - R0003 - Movement (19.24 m2)

No Asbestos

B00A - R0004 - Hall Chair Store (6.09 m2)

No Asbestos

B00A - R0005 - Uniform Shop (4.39 m2)

No Asbestos

B00A - R0006 - Canteen Office/Store (3.07 m2)

No Asbestos

B00A - R0007 - Canteen (22.81 m2)

No Asbestos

B00A - R0008 - Movement (50.67 m2)

| | | | | | | |
|---------------|----------------------------------|-----|-------|--------------------|------------------------------------|--------------------|
| In-fill-panel | Flat AC Sheeting | 25m | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00A/R0008/In-fill-panel/S8 | | | | Chrysotile (white asbestos) | |

B00A - R1001 - Movement (45.53 m2)

| | | | | | | |
|----------------------------|--|------|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 50m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00A/R1001/Ceiling Structures/Linings/S13 | | | | Chrysotile (white asbestos) | |

| | | | | | | |
|---------------|----------------------------------|-----|-------|--------------------|------------------------------------|--------------------|
| In-fill-panel | Flat AC Sheeting | 12m | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00A/R0008/In-fill-panel/S8 | | | | Chrysotile (white asbestos) | |

B00A - R1002 - Home Base (56.81 m2)

| | | | | | | |
|----------------------------|--|--|--|--|---|-----------------------|
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 2271/B00A/R1006/Ceiling Structures/Linings/S14 | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |

B00A - R1003 - Home Base Store (4.07 m2)

| | | | | | | |
|-----------------------------|--|-----|------------|--------------------|------------------------------------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | |

B00A - R1004 - Movement (5.1 m2)

| | | | | | | |
|----------------------------|--|--|--|--|---|-----------------------|
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| | 2271/B00A/R1006/Ceiling Structures/Linings/S14 | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--|-------------|-----------------------|
| Sample No | | | | Test Result | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | | |
| B00A - R1005 - Personal Effects Storage (12.95 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 2271/B00A/R1006/Ceiling Structures/Linings/S14 | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 13m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | | |
| B00A - R1006 - Home Base (56.73 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 2271/B00A/R1006/Ceiling Structures/Linings/S14 | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | | |
| B00A - R1007 - Home Base Store (4.1 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | | |
| B00A - R1008 - Principal (16.1 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 2271/B00A/R1006/Ceiling Structures/Linings/S14 | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | | |
| B00A - R1009 - Duplicating Workroom (8.51 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 2271/B00A/R1006/Ceiling Structures/Linings/S14 | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | | |
| B00A - R1010 - Cleaning Distributed Store (2.44 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | | |
| B00A - R1011 - Sick Bay (4.77 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 5m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | | |
| B00A - R1012 - Staff Toilet (5.59 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | | |
| B00A - R1013 - General Storeroom (5.04 m2) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | | |
| B00A - R1014 - Main Switch Board (0.78 m2) | | | | | | |
| Wall Linings Internal | Compressed AC Sheet | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00D/R0007/Wall Linings Internal/S4 | | | | Chrysotile (white asbestos) | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00D/R0007/Wall Linings Internal/S4 | | | | Chrysotile (white asbestos) | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00A/R1014/Floor Coverings Res/Textile/S9 | | | | Chrysotile (white asbestos) | | |
| B00A - R1015 - Movement (10.12 m2) | | | | | | |
| Ceiling Structures/Linings | Vermiculite | | | | | Limited Samples Taken |
| 2271/B00A/R1006/Ceiling Structures/Linings/S14 | | | | Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - R1016 - Clerical Office (17.93 m2)

Ceiling Structures/Linings Vermiculite
 2271/B00A/R1006/Ceiling Structures/Linings/S14 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R1017 - Entry Vestibule (8.65 m2)

Ceiling Structures/Linings Vermiculite
 2271/B00A/R1006/Ceiling Structures/Linings/S14 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00B - General Learning - 1965 - Timber (Timber)**Exterior**

| | | | | | | |
|------------------|---|------|------------|--------------------|---|--------------------|
| Eaves Linings | Flat AC Sheeting | 30m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00B/Eaves Linings/S15 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Underfloor Voids | Non Accessible Area - Area inaccessible - due to debris/storage. | | | | | |

Interior**B00B - R0001 - Movement (39.31 m2)**

| | | | | | | |
|---------------|----------------------------------|-----|-------|--------------------|------------------------------------|--------------------|
| In-fill-panel | Flat AC Sheeting | 25m | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00B/R0001/In-fill-panel/S6 | | | | Chrysotile (white asbestos) | |

B00B - R0002 - Cleaning Supplies (6.1 m2)

No Asbestos

B00B - R0003 - Withdrawal Space - 1hb (12.68 m2)

No Asbestos

B00B - R0004 - Movement (3.01 m2)

No Asbestos

B00B - R0005 - Home Base (53.58 m2)

| | | | | | | |
|-----------------|-------------------------------------|----------|----------------------|--------------------|---|--------------------|
| Heater Surround | Compressed AC Sheet | 5Unit(s) | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00B/R0012/Heater Backboard/S7 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00B - R0006 - Home Base (53.57 m2)

| | | | | | | |
|-----------------|-------------------------------------|----------|----------------------|--------------------|---|--------------------|
| Heater Surround | Compressed AC Sheet | 5Unit(s) | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00B/R0012/Heater Backboard/S7 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00B - R0007 - Music Store (12.69 m2)

No Asbestos

B00B - R0008 - Music Store (9.33 m2)

No Asbestos

B00B - R0009 - Movement (8.66 m2)

No Asbestos

B00B - R0010 - Movement (39.33 m2)

| | | | | | | |
|---------------|----------------------------------|-----|-------|--------------------|------------------------------------|--------------------|
| In-fill-panel | Flat AC Sheeting | 20m | North | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00B/R0001/In-fill-panel/S6 | | | | Chrysotile (white asbestos) | |

B00B - R0011 - Home Base (53.65 m2)

| | | | | | | |
|-----------------|-------------------------------------|----------|----------------------|--------------------|---|--------------------|
| Heater Surround | Compressed AC Sheet | 5Unit(s) | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00B/R0012/Heater Backboard/S7 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00B - R0012 - Home Base (53.44 m2)

| | | | | | | |
|-----------------|-------------------------------------|----------|----------------------|--------------------|---|--------------------|
| Heater Surround | Compressed AC Sheet | 5Unit(s) | South, Lower portion | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00B/R0012/Heater Backboard/S7 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | |

B00B - R0013 - General Storeroom (5.55 m2)

No Asbestos

B00B - R0014 - General Storeroom (16.44 m2)

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |
| B00B - R9001 - Garden Store (38.15 m2) | | | | | | |

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - Library - 1891 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|---------------|------------------|------|------------|--------------------|---------|--------------------|
| Eaves Linings | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
|---------------|------------------|------|------------|--------------------|---------|--------------------|

Assumed Asbestos - Height Restriction

| | | | | | | |
|---------------|-------------------|--|--|--|--|--|
| Ceiling Voids | No Asbestos Found | | | | | |
|---------------|-------------------|--|--|--|--|--|

| | | | | | | |
|------------------|--|--|--|--|--|--|
| Underfloor Voids | Non Accessible Area - Area inaccessible | | | | | |
|------------------|--|--|--|--|--|--|

Interior

B00C - R0004 - Communications Room (40.71 m2)

No Asbestos

B00C - R0005 - Reading Area (15.18 m2)

No Asbestos

B00C - R0006 - Seminar/Study (5.8 m2)

No Asbestos

B00C - R0007 - Seminar/Study (9.81 m2)

No Asbestos

B00C - R0008 - Movement (5.08 m2)

No Asbestos

B00C - R0009 - Movement (6.78 m2)

No Asbestos

B00C - R0010 - Staff Toilet (2.1 m2)

| | | | | | | |
|-----------------------------|-------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | | 2271/B00C/R0010/Floor Coverings Res/Textile/S5 | | | | No Asbestos Detected |

B00C - R0011 - Staff Toilet (2.18 m2)

| | | | | | | |
|-----------------------------|-------------|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | | 2271/B00C/R0010/Floor Coverings Res/Textile/S5 | | | | No Asbestos Detected |

B00C - R0012 - Withdrawal Space - 1hb (22.18 m2)

No Asbestos

B00C - R0013 - Withdrawal Space - 1hb (15.56 m2)

No Asbestos

B00C - R0014 - Special Programs Room (38.71 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning - 1965 - Brick/Veneer (Brick/Veneer)**Exterior**

| | | | | | | |
|------------------|-----------------------------|------|------------|--------------------|---------|------------------------------------|
| Eaves Linings | Flat AC Sheeting | 50m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00D/Eaves Linings/S10 | | | | | Chrysotile (white asbestos) |
| Underfloor Voids | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |

Interior**B00D - R0001 - Personal Effects Storage (9.65 m2)**

No Asbestos

B00D - R0002 - Home Base (51.61 m2)

No Asbestos

B00D - R0003 - Home Base Store (4.36 m2)

No Asbestos

B00D - R0004 - Withdrawal Space - 1hb (5.07 m2)

No Asbestos

B00D - R0005 - Home Base (69.53 m2)

No Asbestos

B00D - R0006 - Withdrawal Space - 1hb (10.68 m2)

No Asbestos

B00D - R0007 - Withdrawal Space - 1hb (6.27 m2)

No Asbestos

B00D - R0008 - Practical Activities - 1hb (3.84 m2)

No Asbestos

B00D - R0009 - Toilets - Boys/Girls (3.4 m2)

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Compressed AC Sheet | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00D/R0007/Wall Linings Internal/S4 | | | | | Chrysotile (white asbestos) |

B00D - R0010 - Home Base Store (4.36 m2)

No Asbestos

B00D - R0011 - Movement (8.39 m2)

No Asbestos

B00D - R0012 - Personal Effects Storage (11.15 m2)

No Asbestos

B00D - R0013 - Home Base Store (4.31 m2)

No Asbestos

B00D - R0014 - Home Base (51.18 m2)

No Asbestos

B00D - R0015 - Withdrawal Space - 1hb (3.97 m2)

No Asbestos

B00D - R0016 - Staff Toilet (3.42 m2)

No Asbestos

B00D - R0017 - Movement (8.49 m2)

| | | | | | | |
|-----------------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00D/R0017/Floor Coverings Res/Textile/S1 | | | | | Chrysotile (white asbestos) |

B00D - R0018 - Deputy Principal (17.52 m2)

No Asbestos

B00D - R0019 - Staff Room (35.6 m2)

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

No Asbestos

B00D - R0020 - Distribution Board (0.69 m2) Note: No inspection of live electrical installation.

| | | | | | | |
|--|------------------|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00D/R0020/Wall Linings Internal/S3 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

| | | | | | | |
|--|---------------------|------|------------|---|---------|--------------------|
| Wall Linings Internal | Compressed AC Sheet | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00D/R0020/Wall Linings Internal/S3 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00D - R0021 - General Storeroom (6.83 m2)

No Asbestos

B00D - R0022 - Security Store (21.52 m2)

| | | | | | | |
|--|-------------|------|------------|------------------------------------|---------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 22m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00D/R0022/Floor Coverings Res/Textile/S2 | | | | Chrysotile (white asbestos) | | |

| | | | | | | |
|-----------------------------|------------------|------|------------|------------------------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 22m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00D/Eaves Linings/S10 | | | | Chrysotile (white asbestos) | | |

B00D - R0023 - Movement (3.7 m2)

| | | | | | | |
|-----------------------------|------------------|-----|------------|------------------------------------|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00D/Eaves Linings/S10 | | | | Chrysotile (white asbestos) | | |

B00D - R0024 - Sports Store (37.32 m2)

| | | | | | | |
|--|------------------|--|--|--|-----------------------------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| 2271/B00D/R0024/Ceiling Structures/Linings/S11 | | | | | No Asbestos Detected | |

B00D - R0025 - Movement (191.41 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - Special Purpose - 1950 - Timber (Timber)

Exterior

| | |
|------------------|--|
| Underfloor Voids | Non Accessible Area - Area inaccessible - limited access gained due to low clearance. |
| Ceiling Voids | No Asbestos Found |

Interior

B00F - R0001 - Movement (15.35 m2)

No Asbestos

B00F - R0002 - Home Base (48.96 m2)

| | | | | | | |
|--|------------------|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 49m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2271/B00F/R0002/Ceiling Structures/Linings/S16 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00G - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|-----------------------------------|-----------------------------|------|------------|---|---------|--------------------|
| Eaves Linings | Flat AC Sheeting | 40m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| Ceiling Voids - Flat Roof | No Asbestos Found | | | | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | |

Interior**B00G - R0001 - Toilets - Girls (33.77 m2)**

| | | | | | | |
|----------------------------|-----------------------------|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 34m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

B00G - R0002 - Staff Toilet (2.97 m2)

| | | | | | | |
|----------------------------|-----------------------------|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 3m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

B00G - R0003 - Toilets - Boys (33.9 m2)

| | | | | | | |
|----------------------------|-----------------------------|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 34m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

B00G - R0004 - Toilets - Boys (40.94 m2)

| | | | | | | |
|----------------------------|-----------------------------|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 41m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

B00G - R0005 - Staff Toilet (3.03 m2)

| | | | | | | |
|----------------------------|-----------------------------|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

B00G - R0006 - Toilets - Girls (45.17 m2)

| | | | | | | |
|----------------------------|-----------------------------|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 46m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

B00G - R0007 - Movement (31.99 m2)

| | | | | | | |
|----------------------------|-----------------------------|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

B00G - R0008 - Movement (25.95 m2)

| | | | | | | |
|----------------------------|-----------------------------|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 26m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2271/B00G/Eaves Linings/S12 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00H - Pupil Facilities - 1950 - Timber (Timber)

Exterior

| | |
|-----------------------------------|-------------------|
| Ceiling Voids - Flat Roof | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

Interior

B00H - R0001 - Movement (42.9 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B001 - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Underfloor Voids | No Asbestos Found |
| Ceiling Voids | No Asbestos Found |

Interior

B001 - R0001 - Reading Area (169.21 m2)

No Asbestos

B001 - R0002 - Library Office/Workroom (22.83 m2)

No Asbestos

B001 - R0003 - Communications Room (8.01 m2)

No Asbestos

B001 - R0004 - K.L.A. Store (14.71 m2)

No Asbestos

B001 - R0005 - External Movement (38.35 m2)

No Asbestos

B001 - R0006 - Main Switch Board (0.71 m2)

No Asbestos

B001 - R0007 - Toilet - Lobby (2.46 m2)

No Asbestos

B001 - R0008 - Staff Toilet (4.74 m2)

No Asbestos

B001 - R0009 - Cleaning Distributed Store (3.63 m2)

No Asbestos

B001 - R0010 - External Movement (7.66 m2)

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11142 - Learning Unit - Standard With P.A.A. : Placement Date - 27/04/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11187 - Learning Unit - Standard With P.A.A. : Placement Date - 16/04/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11226 - Learning Unit - Standard With P.A.A. : Placement Date - 25/02/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11836 - Learning Unit - Standard With P.A.A. : Placement Date - 27/04/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2271_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017