


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kellys Plains Public School (2273)  
**Region :** New England  
**State Electorate :** Northern Tablelands  
**Local Government Area :** Armidale Dumaresq

**Initial Survey :** Noel Arnold & Associates : 20 - May - 2008  
**Reviewed By :** AECOM : 29 - Apr - 2016

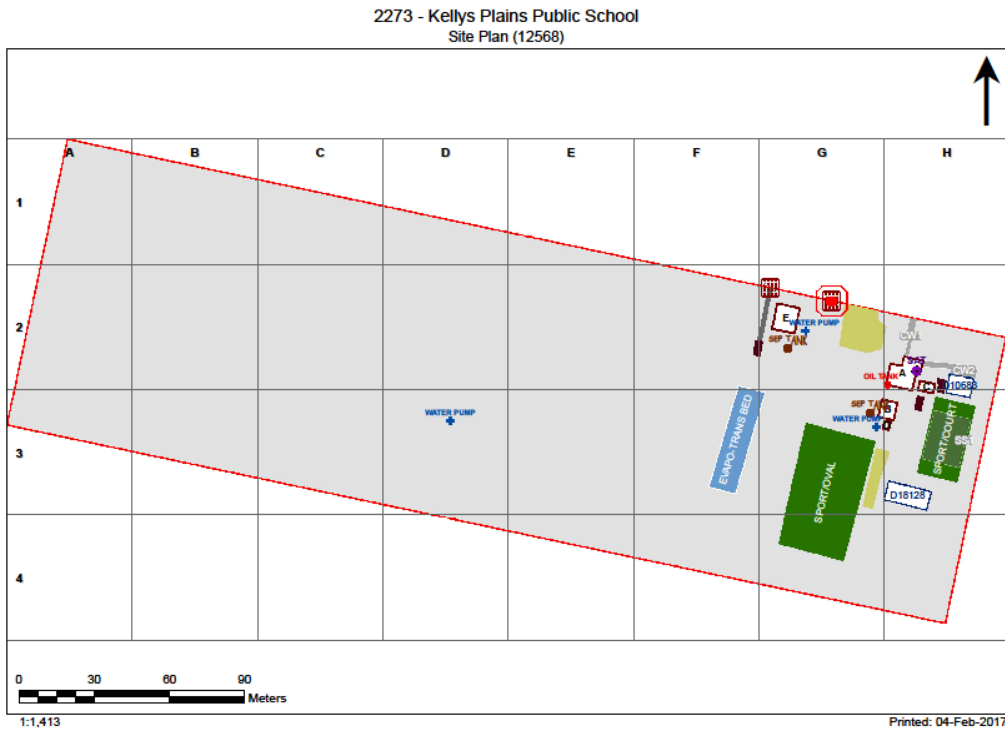

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1863 - Timber (Timber)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no access points.					
Underfloor Voids	AC Fragments/Debris	0.015m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	2273/B00A/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	4m2	East and west	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction to eastern and</b>					

**Interior****B00A - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00A/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0002 - Home Base**

Floor Coverings Res/Textile	Vinyl Sheet					
	2273/B00A/R0002/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>

**B00A - R0003 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet					
	2273/B00A/R0002/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>

**B00A - R0004 - Principal**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00A/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00A/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0007 - Ramp**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities/Staff Facilities - 1971 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, flat roof, no access points.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible slab on ground, no access points.					
Eaves Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0005/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**Interior****B00B - R0001 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0005/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**B00B - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0002/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0005/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**B00B - R0003 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0005/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**B00B - R0004 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0002/Partition Walls (Cubicles)/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0005/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**B00B - R0005 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0005/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

**B00B - R0006 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2273/B00B/R0005/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1971 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof    Non Accessible Area  
 - Area inaccessible, closed awning, no access points.

Underfloor Voids -        No Asbestos Found  
 Packing to Floor Joists

**Interior**

**B00C - R0001 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 2007 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

**Interior**

**B00D - R0001 - Disabled Toilet**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Multi Purpose Facilities - 2009 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible slab on ground, no access points.
Ceiling Voids	No Asbestos Found

**Interior**

**B00E - R0001 - Communal Space**

No Asbestos

**B00E - R0002 - General Storeroom**

No Asbestos

**B00E - R0003 - Practical Activities**

No Asbestos

**B00E - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

**OS 601 - D10683 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 500 - D18128 - Admin - Library : Placement Date - 10/04/2002**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	20.16 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	13 m2

#### R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2
---------	---------------	------------------	-------

#### R3 - Staff Room/Kitchen

Ceiling	Flat AC Sheet	Assumed Asbestos	19 m2
---------	---------------	------------------	-------

#### R4 - Clerical Office

Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2
---------	---------------	------------------	-------

#### R5 - Library

Ceiling	Flat AC Sheet	Assumed Asbestos	54 m2
---------	---------------	------------------	-------

#### R6 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos	0 m2
---------	---------------	------------------	------

#### R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2

#### R8 - Entry to toilet

Ceiling	Flat AC Sheet	Assumed Asbestos	0 m2
---------	---------------	------------------	------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017