


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kellyville Public School (2274)
Region : Western Sydney
State Electorate : Castle Hill
Local Government Area : The Hills

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : Parsons Brinckerhoff : 14 - May - 2015

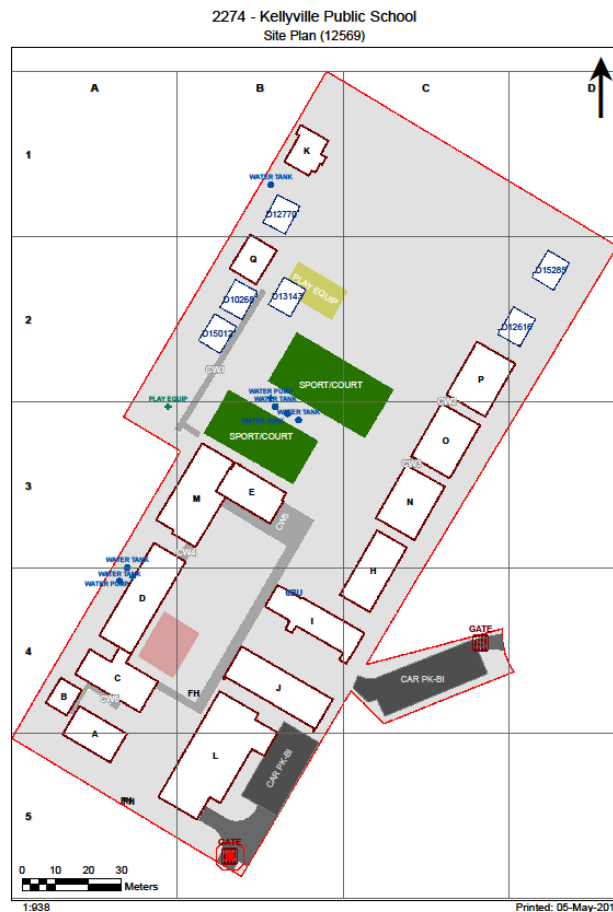

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Staff Facilities - 1898 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0002 - Staff Room (98.15 m2)

No Asbestos

B00A - R0003 - External Movement (31.15 m2)

In-fill-panel	Flat AC Sheeting	6m	North, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00A/R0003/In-fill-panel/S1				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00A/R0003/In-fill-panel/S1				Chrysotile (white asbestos)	

B00A - R0004 - Distribution Board (0.34 m2) Note: No inspection of live electrical installation.

No Asbestos

B00A - R0005 - General Storeroom (19.09 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Music - 1912 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - External Movement (16.65 m2)

No Asbestos

B00B - R0002 - Special Programs Room (44.36 m2)

Ceiling Hatch	Flat AC Sheeting	1m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2274/B00B/R0002/Ceiling Hatch/S19				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration/General Learning - 1971 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North, South, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B001/Eaves Linings/S25					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B001/Gable Verge Lining/S26					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No access into Underfloor Void - No hatch located					

Interior**B00C - R0001 - External Movement (40.64 m2)**

No Asbestos

B00C - R0003 - Clerical Office (19.08 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2274/B00C/R0021/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0009 - Main Switch Board (8.26 m2)

No Asbestos

B00C - R0010 - Staff Toilet (5.22 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2274/B00C/R0021/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0013 - Security Store (2.97 m2)

No Asbestos

B00C - R0014 - Communications Room (7.03 m2)

No Asbestos

B00C - R0019 - Principal (20.71 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2274/B00C/R0021/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0020 - Entry Vestibule (29.59 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2274/B00C/R0021/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0021 - Movement (18.45 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2274/B00C/R0021/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0022 - Sick Bay - Shower/Toilet (7.58 m2)

No Asbestos

B00C - R0023 - Sick Bay (6.36 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2274/B00C/R0021/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0024 - Duplicating Workroom (28.94 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2274/B00C/R0021/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0025 - Staff Toilet (2.24 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Decorative Coating	Vermiculite 2274/B00C/R0025/Decorative Coating/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0026 - Handwashing Facilities (2.2 m2)						
Decorative Coating	Vermiculite 2274/B00C/R0025/Decorative Coating/S20					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0027 - Stairs (3.55 m2)						
No Asbestos						
B00C - R1002 - Home Base (56.87 m2)						
No Asbestos						
B00C - R1003 - Personal Effects Storage (6.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2274/B00C/R1003/Floor Coverings Res/Textile/S4	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1004 - Home Base Store (6.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2274/B00C/R1003/Floor Coverings Res/Textile/S4	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1006 - Home Base Store (7.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2274/B00C/R1001/Ceiling Structures/Linings/S3	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1007 - Home Base Store (6.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2274/B00C/R1003/Floor Coverings Res/Textile/S4	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1008 - Personal Effects Storage (6.79 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 2274/B00C/R1003/Floor Coverings Res/Textile/S4	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1009 - Home Base (56.95 m2)						
No Asbestos						
B00C - R1010 - Stairs (5.9 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2274/B00C/R1011/Ceiling Structures/Linings/S17	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1011 - Movement (55.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2274/B00C/R1011/Ceiling Structures/Linings/S17	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Administration - 1972 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 2274/B00I/Eaves Linings/S25	45m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 2274/B00I/Gable Verge Lining/S26	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 2274/B00D/Panels under Windows/S5	24m2	East, Upper portion, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No access - No hatch located					

Interior**B00D - R0001 - External Movement (71.52 m2)**

In-fill-panel	Flat AC Sheeting 2274/B00D/Panels under Windows/S5	12m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	---	-----	--------------------	--------------------	---------	--

B00D - R0002 - Home Base (59.11 m2)

Ceiling Structures/Linings	Vermiculite 2274/B00D/R0018/Ceiling Structures/Linings/S6	Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works				
----------------------------	--	---	--	--	--	--

B00D - R0003 - Home Base Store (6.67 m2)

Floor Coverings Res/Textile	Vinyl Sheet (Under Carpet) 2274/B00D/R0003/Floor Coverings Res/Textile/S21	No Asbestos Detected				
Decorative Coating	Vermiculite 2274/B00C/R0025/Decorative Coating/S20	Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works				

B00D - R0004 - Personal Effects Storage (7.18 m2)

Ceiling Structures/Linings	Vermiculite 2274/B00D/R0018/Ceiling Structures/Linings/S6	Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works				
----------------------------	--	---	--	--	--	--

B00D - R0005 - Movement (8.53 m2)

No Asbestos

B00D - R0006 - Movement (6.53 m2)

No Asbestos

B00D - R0007 - Uniform Shop (9.63 m2)

No Asbestos

B00D - R0008 - Personal Effects Storage (6.21 m2)

Ceiling Structures/Linings	Vermiculite 2274/B00D/R0018/Ceiling Structures/Linings/S6	Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works				
----------------------------	--	---	--	--	--	--

B00D - R0009 - Distribution Board (0.87 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 2274/B00D/R0018/Ceiling Structures/Linings/S6	Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works				
----------------------------	--	---	--	--	--	--

B00D - R0010 - Home Base Store (6.75 m2)

Ceiling Structures/Linings	Vermiculite 2274/B00D/R0018/Ceiling Structures/Linings/S6	Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works				
----------------------------	--	---	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0011 - Home Base (58.63 m2)						
Ceiling Structures/Linings	Vermiculite		2274/B00D/R0018/Ceiling Structures/Linings/S6			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0015 - Interview (15.52 m2)						
Ceiling Structures/Linings	Vermiculite		2274/B00D/R0018/Ceiling Structures/Linings/S6			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0016 - Interview (11.93 m2)						
Ceiling Structures/Linings	Vermiculite		2274/B00D/R0018/Ceiling Structures/Linings/S6			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0017 - Movement (7.47 m2)						
Ceiling Structures/Linings	Vermiculite		2274/B00D/R0018/Ceiling Structures/Linings/S6			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0018 - Interview (17.68 m2)						
Ceiling Structures/Linings	Vermiculite		2274/B00D/R0018/Ceiling Structures/Linings/S6			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0019 - General Storeroom (19.24 m2)						
Ceiling Structures/Linings	Vermiculite		2274/B00D/R0018/Ceiling Structures/Linings/S6			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0020 - Stairs (1.57 m2)						
No Asbestos						
B00D - R0021 - Stairs (1.57 m2)						
No Asbestos						
B00D - R1001 - Movement (70.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
			2274/B00C/R1001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	12m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
			2274/B00D/Panels under Windows/S5			Chrysotile (white asbestos)
B00D - R1002 - Home Base (58.54 m2)						
No Asbestos						
B00D - R1003 - Home Base Store (6.75 m2)						
No Asbestos						
B00D - R1004 - Personal Effects Storage (7.31 m2)						
No Asbestos						
B00D - R1005 - Movement (6.53 m2)						
No Asbestos						
B00D - R1006 - General Storeroom (8.84 m2)						
No Asbestos						
B00D - R1007 - Personal Effects Storage (6.23 m2)						
No Asbestos						
B00D - R1008 - Distribution Board (0.87 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00D - R1009 - Home Base Store (6.75 m2)						
No Asbestos						
B00D - R1010 - Home Base (58.87 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R1011 - Home Base (58.87 m2)						
No Asbestos						
B00D - R1012 - Home Base Store (6.75 m2)						
No Asbestos						
B00D - R1013 - Personal Effects Storage (7.26 m2)						
No Asbestos						
B00D - R1014 - Stairs (5.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2274/B00C/R1011/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	
B00D - R9001 - External Movement (24.53 m2)						
No Asbestos						
B00D - R9002 - Toilets - Boys (35.17 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	24m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2274/B00D/R9003/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
B00D - R9003 - Toilets - Girls (37.55 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	North, South, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2274/B00D/R9003/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
B00D - R9004 - Cleaning Distributed Store (8.26 m2)						
No Asbestos						
B00D - R9005 - Movement (4.49 m2)						
No Asbestos						
B00D - R9006 - Stairs (3.96 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00E/Eaves Linings/S23					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0002 - Home Base (53.88 m2)

In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	2274/B00E/R0002/In-fill-panel/S8					

B00E - R0003 - Home Base (53.8 m2)

No Asbestos

B00E - R0004 - Other-Community Use (13.43 m2)

No Asbestos

B00E - R0005 - Other-Community Use (12.92 m2)

No Asbestos

B00E - R0006 - Home Base Store (4.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00E/R0006/Ceiling Structures/Linings/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0007 - Practical Activities - 2hb (34.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00E/R0006/Ceiling Structures/Linings/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1969 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00I/Gable Verge Lining/S26				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	25m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00I/Eaves Linings/S25				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	10m2	East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00H/R0001/Panel under Windows/S11				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - External Movement (44.14 m2)

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00H/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	10m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00H/R0001/Panel under Windows/S11				Chrysotile (white asbestos)	

B00H - R0002 - Personal Effects Storage (7.27 m2)

No Asbestos

B00H - R0003 - Home Base Store (6.32 m2)

No Asbestos

B00H - R0004 - Home Base (56.8 m2)

No Asbestos

B00H - R0005 - Home Base (85.27 m2)

No Asbestos

B00H - R0006 - Toilets - Boys/Girls (3.59 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	North, South, East, West, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00H/R0006/Wall Linings Internal/S9				Chrysotile (white asbestos)	

B00H - R0007 - Home Base Store (3.13 m2)


No Asbestos

B00H - R0008 - Personal Effects Storage (7.2 m2)

No Asbestos

B00H - R9001 - P.E. Store (28.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00H/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	

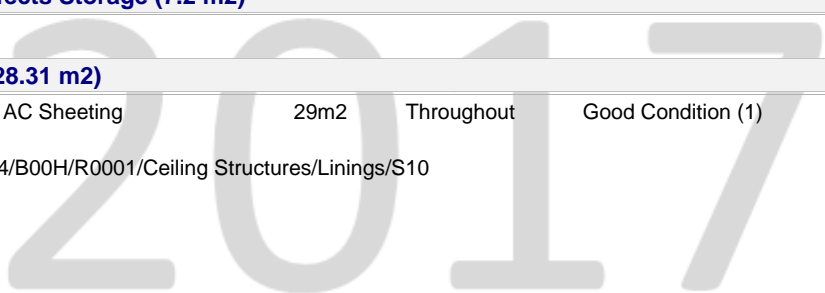

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning/Pupil Facilities - 1962 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 2274/B00I/Eaves Linings/S25	80m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 2274/B00I/Gable Verge Lining/S26	10m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00I - R0001 - Home Base Store (5.62 m2)**

No Asbestos

B00I - R0002 - Personal Effects Storage (7.71 m2)

No Asbestos

B00I - R0003 - External Movement (4.86 m2)

No Asbestos

B00I - R0004 - Home Base (56.77 m2)

No Asbestos

B00I - R0005 - Home Base (78.33 m2)

No Asbestos

B00I - R0006 - External Movement (4.83 m2)

No Asbestos

B00I - R0007 - Personal Effects Storage (6.01 m2)

No Asbestos

B00I - R0008 - Home Base Store (5.91 m2)

No Asbestos

B00I - R0009 - Toilets - Boys/Girls (1.76 m2)

Wall Linings Internal	Flat AC Sheeting 2274/B00I/R0009/Wall Linings Internal/S12	15m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------------	---	------	-----------------------------	--------------------	---------	---

B00I - R0010 - Toilets - Girls (29.31 m2)

No Asbestos

B00I - R0011 - Disabled Toilet (5.69 m2)

No Asbestos

B00I - R0012 - Toilets - Boys (20.43 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1969 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00I/Gable Verge Lining/S26				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	35m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00I/Eaves Linings/S25				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	17m2	South, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00H/R0001/Panel under Windows/S11				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00J - R0001 - External Movement (65.41 m2)**

In-fill-panel	Flat AC Sheeting	8m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00J/R0001/Panel under Windows/S15				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00H/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)	

B00J - R0002 - Personal Effects Storage (8.46 m2)

No Asbestos

B00J - R0003 - Home Base Store (4.92 m2)

No Asbestos

B00J - R0004 - Home Base (57.83 m2)

No Asbestos

B00J - R0005 - Home Base (57.6 m2)

No Asbestos

B00J - R0006 - Home Base Store (4.89 m2)

No Asbestos

B00J - R0007 - Personal Effects Storage (8.43 m2)

No Asbestos

B00J - R0008 - Withdrawal Space - 2hb (14.59 m2)

No Asbestos

B00J - R0009 - General Storeroom (7.07 m2)

No Asbestos

B00J - R0016 - Cleaning Distributed Store (3.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00J/R0016/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	

B00J - R0017 - Practical Activities - 1hb (16.52 m2)

No Asbestos

B00J - R0018 - Home Base (57.33 m2)

No Asbestos

B00J - R9001 - General Assistant/Bulk Store (58.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2274/B00J/R9001/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00J - R9002 - General Assistant/Bulk Store (187.37 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Other-After School Care - 1995 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Withdrawal - Pre (18.12 m2)

No Asbestos

B00K - R0002 - Other-Community Use (36.8 m2)

No Asbestos

B00K - R0003 - Kitchen - Pre (13.68 m2)

No Asbestos

B00K - R0004 - Toilets - Boys/Girls - Pre (2.86 m2)

No Asbestos

B00K - R0005 - Toilets - Boys/Girls - Pre (5.68 m2)

No Asbestos

B00K - R0006 - Withdrawal - Pre (6.79 m2)

No Asbestos

B00K - R0007 - Practical Activities - Pre (6.69 m2)

No Asbestos

B00K - R0008 - Staff Room - Pre (8.76 m2)

No Asbestos

B00K - R0009 - External Movement (7.46 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Communal Facilities/Pupil Facilities - 1997 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2274/B00L/Eaves Linings/S24					No Asbestos Detected

Interior

B00L - R0001 - Canteen (45.73 m2)

No Asbestos

B00L - R0002 - Canteen Office/Store (10.75 m2)

No Asbestos

B00L - R0003 - External Movement (8.7 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2274/B00L/Eaves Linings/S24					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00L - R0004 - Cleaning Distributed Store (3.17 m2)

No Asbestos

B00L - R0005 - Disabled Toilet (6.14 m2)

No Asbestos

B00L - R0006 - Distribution Board (0.77 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0007 - P.E. Store (14.74 m2)

No Asbestos

B00L - R0008 - Plant (0.6 m2)

No Asbestos

B00L - R0009 - Hall Chair Store (10.06 m2)

No Asbestos

B00L - R0010 - Toilets - Boys (5.86 m2)

No Asbestos

B00L - R0011 - Shower/Change (2.51 m2)

No Asbestos

B00L - R0012 - Toilets - Girls (7.75 m2)

No Asbestos

B00L - R0013 - External Movement (14.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2274/B00L/Eaves Linings/S24					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00L - R0014 - Community Clinic (17.99 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00L - R0015 - Community Clinic (2.45 m2)

No Asbestos

B00L - R0016 - Community Clinic (6.98 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00L - R0017 - External Movement (14.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2274/B00L/Eaves Linings/S24					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00L - R0018 - Raised Platform (47.18 m2)

No Asbestos

B00L - R0019 - Communal Space (214.65 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00L - R0020 - External Movement (149.27 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2274/B00L/Eaves Linings/S24					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Library/Staff Facilities - 1998 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2274/B00M/Eaves Linings/S22					No Asbestos Detected

Interior**B00M - R0001 - Reading Area (224.04 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0002 - Communications Room (13.97 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0003 - Staff Toilet (4.08 m2)

No Asbestos

B00M - R0004 - No Access (3.81 m2)

No Asbestos

B00M - R0005 - Library Office/Workroom (31.5 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00M - R0006 - Distribution Board (0.81 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0007 - External Movement (3.95 m2)

No Asbestos

B00M - R0008 - External Movement (55.67 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning - 2007 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0005 - External Movement (43.07 m2)

No Asbestos

B00N - R0006 - Practical Activities - 1hb (19.48 m2)

No Asbestos

B00N - R0007 - Home Base Store (6.15 m2)

No Asbestos

B00N - R0008 - Home Base (60.6 m2)

No Asbestos

B00N - R0009 - Withdrawal Space - 2hb (11.35 m2)

No Asbestos

B00N - R0010 - Home Base (60.74 m2)

No Asbestos

B00N - R0011 - Home Base Store (6.19 m2)

No Asbestos

B00N - R0012 - Practical Activities - 1hb (19.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B000 - R0001 - External Movement (43.37 m2)

No Asbestos

B000 - R0002 - Practical Activities - 1hb (19.57 m2)

No Asbestos

B000 - R0003 - Home Base Store (6.09 m2)

No Asbestos

B000 - R0004 - Home Base (60.82 m2)

No Asbestos

B000 - R0005 - Withdrawal Space - 2hb (11.51 m2)

No Asbestos

B000 - R0006 - Home Base (60.78 m2)

No Asbestos

B000 - R0007 - Home Base Store (6.31 m2)

No Asbestos

B000 - R0008 - Practical Activities - 1hb (19.53 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00P - R0001 - External Movement (43.36 m2)

No Asbestos

B00P - R0002 - Practical Activities - 1hb (19.58 m2)

No Asbestos

B00P - R0003 - Home Base Store (6.08 m2)

No Asbestos

B00P - R0004 - Home Base (60.6 m2)

No Asbestos

B00P - R0005 - Withdrawal Space - 2hb (11.54 m2)

No Asbestos

B00P - R0006 - Home Base (60.8 m2)

No Asbestos

B00P - R0007 - Home Base Store (6.09 m2)

No Asbestos

B00P - R0008 - Practical Activities - 1hb (19.51 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - General Learning/Other - 2007 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00Q - R0001 - External Movement (20.84 m2)

No Asbestos

B00Q - R0002 - Special Programs Room (70.23 m2)

No Asbestos

B00Q - R0003 - Special Programs Store (8.65 m2)

No Asbestos

B00Q - R0004 - Withdrawal Space - 1hb (8.46 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10268 - Learning Unit - Standard With P.A.A. : Placement Date - 10/02/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12616 - Learning Unit - Standard With P.A.A. : Placement Date - 17/11/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12770 - Learning Unit - Standard With P.A.A. : Placement Date - 28/11/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

- D13143 - : Placement Date - 6/10/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found.

OS 602 - D14457 - Learning Unit - Standard With P.A.A. : Placement Date - 30/11/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15012 - Learning Unit - Standard With P.A.A. : Placement Date - 6/10/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D15285 - Learning Unit - Standard With P.A.A. : Placement Date - 2/12/2015						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017