


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Kempsey West Public School (2279)  
**Region :** North Coast  
**State Electorate :** Oxley  
**Local Government Area :** Kempsey

**Initial Survey :** Noel Arnold & Associates : 24 - Apr - 2008  
**Reviewed By :** AECOM : 29 - Oct - 2014

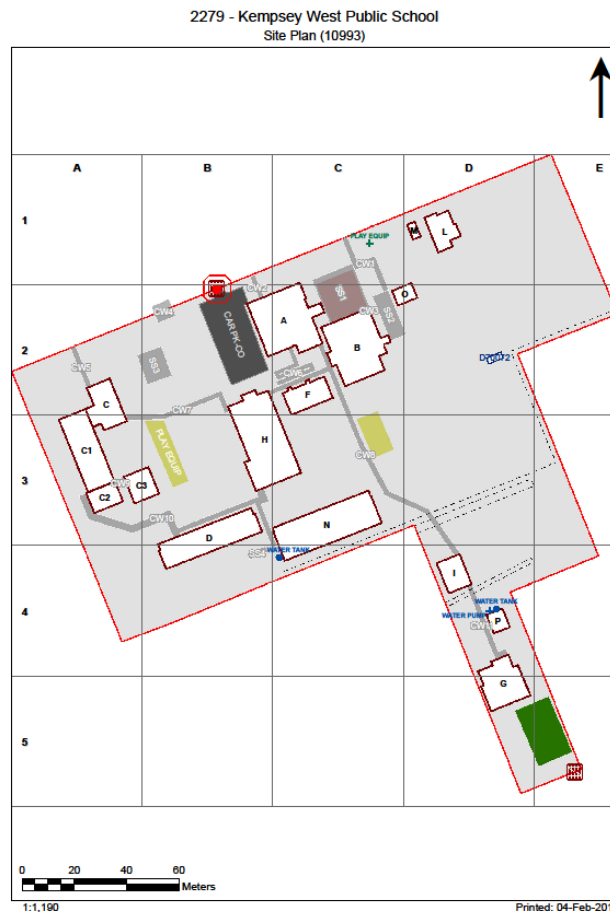

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Library - 1972 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Flat AC Sheeting 2279/B00A/In-fill-panel/S34					<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting 2279/B00A/In-fill-panel/S36	4m2	South, above AR0001	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area  - Area inaccessible due to fixed ceilings. Lower level consists of concrete slab coated with vermiculite. Upper portion features a raked ceiling with strammit tiles.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00A - R0001 - Garden Store (18.67 m2)**

No Asbestos

**B00A - R0002 - Staff Toilet (5.44 m2)**

No Asbestos

**B00A - R0003 - General Storeroom (2.84 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2279/B00A/R0003/Floor Coverings Res/Textile/S4	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------------	---	-----	------------	--------------------	---------	--

**B00A - R0004 - General Assistant/Bulk Store (21.7 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2279/B00A/R0003/Floor Coverings Res/Textile/S4	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------------	---	------	------------	--------------------	---------	--

**B00A - R0005 - Principal (18.97 m2)**

Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00A - R0006 - Staff Toilet (2.24 m2)**

Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00A - R0007 - General Storeroom (2.31 m2)**

Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00A - R0008 - Sick Bay (7.8 m2)**

Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00A - R0009 - Clerical Office (12.99 m2)**

Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	---	--	--	--	--	---

**B00A - R0010 - Entry Vestibule (14.41 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2279/B00A/R0003/Floor Coverings Res/Textile/S4	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00A - R0011 - Clerical Office (13.82 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0012 - Interview (13.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0013 - Staff Toilet (5.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0014 - Staff Toilet (6.72 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 2279/B00A/R0014/Partition Walls (Cubicles)/S18	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0015 - Cleaning Supplies (1.46 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 2279/B00A/R0003/Floor Coverings Res/Textile/S4	1.4m2	Floor	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00A - R0016 - Cleaning Supplies (4 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Staff Room (56.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 2279/B00A/R0003/Floor Coverings Res/Textile/S4	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00A - R0018 - General Storeroom (15.5 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 2279/B00A/R0003/Floor Coverings Res/Textile/S4	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0019 - Duplicating Workroom (16.14 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 2279/B00A/R0003/Floor Coverings Res/Textile/S4	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 2279/B00A/R0017/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0020 - General Storeroom (29.52 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Main Switch Board (5.7 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Staff Room Annexe (13.31 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Movement (29.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 2279/B00A/R0003/Floor Coverings Res/Textile/S4	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	2279/B00A/R0017/Ceiling Structures/Linings/S33					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00A - R0025 - External Movement (120.01 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Stairs (10.58 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Reading Area (185.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Adjacent AR1002	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00A/R0003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1002 - Reading Area (52.56 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Library Office/Workroom (19.17 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Library Office/Workroom (5.54 m2)</b>						
No Asbestos						
<b>B00A - R1005 - Movement (26.05 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Adjacent AR1004	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00A/R0003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1006 - Cleaning Supplies (2.31 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Toilets - Boys (4.47 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00A/R0014/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1008 - Toilets - Girls (4.47 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00A/R0014/Partition Walls (Cubicles)/S18					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1009 - Communications Room (12.49 m2)</b>						
No Asbestos						
<b>B00A - R1010 - Communications Room (12.46 m2)</b>						
No Asbestos						
<b>B00A - R1011 - Movement (19.98 m2)</b>						
No Asbestos						
<b>B00A - R1012 - Stairs (14.99 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior****B00B - R0001 - Toilets - Boys (29.64 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2279/B00B/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Compressed AC Sheet	8m	Behind cistern	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2279/B00B/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Toilets - Girls (29.64 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00B/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Compressed AC Sheet	10m	Behind cistern	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00B/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	

**B00B - R0004 - Cleaning Supplies (5.41 m2)**

No Asbestos

**B00B - R0005 - Shower/Change (13.43 m2)**

No Asbestos

**B00B - R0006 - Movement (33.92 m2)**

Ceiling Structures/Linings	Vermiculite					
2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	24m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00A/R0003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>	

**B00B - R0007 - Home Base (65.92 m2)**

Ceiling Structures/Linings	Vermiculite					
2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R0008 - Home Base (65.92 m2)**

Ceiling Structures/Linings	Vermiculite					
2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R0009 - Cleaning Supplies (2.55 m2)**

Ceiling Structures/Linings	Vermiculite					
2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00A/R0003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>	

**B00B - R0011 - Shower/Change (16.88 m2)**

No Asbestos

**B00B - R0012 - Garden Store (3.45 m2)**

No Asbestos

**B00B - R0013 - Distribution Board (0.42 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0014 - External Movement (3.78 m2)</b>						
No Asbestos						
<b>B00B - R0015 - External Movement (39.62 m2)</b>						
No Asbestos						
<b>B00B - R0016 - Movement (7 m2)</b>						
No Asbestos						
<b>B00B - R0017 - Stairs (8.1 m2)</b>						
No Asbestos						
<b>B00B - R0018 - Home Base - M (64.19 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	2279/B00B/R0018/Wall Linings Internal/S38					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Paper backing to VFT.					
	2279/B00B/R0018/Floor Coverings Res/Textile/S39					<b>No Asbestos Detected</b>
<b>B00B - R0019 - Home Base Store - M (8.75 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00B/R0018/Floor Coverings Res/Textile/S39					<b>No Asbestos Detected</b>
<b>B00B - R0020 - External Movement (8.35 m2)</b>						
No Asbestos						
<b>B00B - R1001 - Home Base (65.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1002 - Home Base (65.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1003 - Movement (52.61 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00B/R1003/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite					
	2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1004 - Distribution Board (0.42 m2)</b>						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B00B - R1005 - Cleaning Supplies (0.24 m2)</b>						
No Asbestos						
<b>B00B - R1006 - Home Base (65.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1007 - Home Base (65.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2279/B00B/R0008/Ceiling Structures/Linings/S3					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00B - R1008 - Movement (18.69 m2)</b>						
No Asbestos						
<b>B00B - R1009 - Stairs (16.58 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Room+1 - R0018**

In-fill-panel	Flat AC Sheeting 2279/B00B/Room+1/In-fill-panel/S29					<b>No Asbestos Detected</b>
---------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration - 1967 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B00C - R0001 - Craft Store (10.57 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00C/R0006/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>	

**B00C - R0002 - Staff Room (19.9 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent sink	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00C/R0006/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>	

**B00C - R0003 - Interview (19.04 m2)**

No Asbestos

**B00C - R0004 - Community Clinic (17.55 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00C/R0006/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>	

**B00C - R0005 - Staff Toilet (6.54 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00C/R0006/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>	

**B00C - R0006 - Movement (17.57 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00C/R0006/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>	

**B00C - R0008 - External Movement (80.39 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1947 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00D/Eaves Linings/S42					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Minor FCS debris sampled. Limited access towards western end of the void due to low</b>					

**Interior****B00D - R0001 - General Storeroom (5.51 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5.5m2	Floor	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00C/R0006/Floor Coverings Res/Textile/S23					<b>Chrysotile (white asbestos)</b>

**B00D - R0002 - Withdrawal Space - 1hb (22.37 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2279/B00D/R0002/Ceiling Structures/Linings/S40					

**B00D - R0003 - Practical Activities - 1hb (16.33 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2279/B00D/R0007/Wall Linings Internal/S37					

**B00D - R0004 - Practical Activities - 1hb (16.33 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2279/B00D/R0007/Wall Linings Internal/S37					

**B00D - R0005 - Movement (6.69 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00A/R0003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>

**B00D - R0006 - Practical Activities - 1hb (16.33 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2279/B00D/R0007/Wall Linings Internal/S37					

**B00D - R0007 - Practical Activities - 1hb (21.86 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2279/B00D/R0007/Wall Linings Internal/S37					

**B00D - R0008 - Movement (3.2 m2)**

No Asbestos

**B00D - R0009 - Home Base Store (5.64 m2)**

No Asbestos

**B00D - R0010 - Staff Room Annexe (12.66 m2)**

In-fill-panel	Flat AC Sheeting	2m	Behind sink	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2279/B00D/R0010/In-fill-panel/S35					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00D - R0011 - Home Base (53.59 m2)**

No Asbestos

**B00D - R0012 - Home Base (53.59 m2)**

No Asbestos

**B00D - R0013 - Movement (9.15 m2)**

No Asbestos

**B00D - R0014 - Staff Room Annexe (12.51 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - R0015 - Home Base (53.59 m2)**

No Asbestos

**B00D - R0016 - Home Base (53.59 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1915 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00F/Eaves Linings/S41					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2279/B00F/Underfloor Voids/S41					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**Interior**

**B00F - R0001 - Cleaning Supplies (10.01 m2)**

No Asbestos

**B00F - R0002 - Home Base Store (4.19 m2)**

No Asbestos

**B00F - R0003 - Withdrawal Space - 1hb (5.43 m2)**

No Asbestos

**B00F - R0004 - Home Base (43.92 m2)**

No Asbestos

**B00F - R0005 - Practical Activities - 1hb (17.28 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00J/R0001/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting					
	2279/B00F/R0006/Wall Linings Internal/S30					<b>No Asbestos Detected</b>

**B00F - R0006 - Practical Activities - 1hb (17.04 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00J/R0001/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting					
	2279/B00F/R0006/Wall Linings Internal/S30					<b>No Asbestos Detected</b>

**B00F - R0007 - Home Base (43.31 m2)**

No Asbestos

**B00F - R0008 - External Movement (1.31 m2)**

No Asbestos

**B00F - R0009 - External Movement (1.31 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1918 - Brick/Block (Brick/Block)****Exterior**

Wall Cladding	Flat AC Sheeting 2279/B00G/Room+1/Roof Cladding/S11	30m2	Level 1, North + East	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	Flat AC Sheeting 2279/B00G/R0009/Ceiling Structures/Linings/S8					<b>No Asbestos Detected</b>
Underfloor Voids	No Asbestos Found					

**Interior****B00G - R0001 - Home Base (47.83 m2)**

Chalk Board	Flat AC Sheeting 2279/B00G/R0010/Chalk Board/S10	20m2	Behind new board + perimeter walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00G - R0002 - Movement (16.4 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00G - R0003 - Staff Room Annexe (8.08 m2)**

No Asbestos

**B00G - R0004 - Movement (2.44 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00G - R0005 - P.E. Store (5.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00G - R0006 - Cleaning Supplies (4.08 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00G - R0008 - Withdrawal Space - 1hb (11.22 m2)**

In-fill-panel	Flat AC Sheeting 2279/B00G/R0008/In-fill-panel/S9					<b>No Asbestos Detected</b>
---------------	--	--	--	--	--	-----------------------------

**B00G - R0009 - Movement (50.74 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting 2279/B00G/R0009/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting 2279/B00G/R0009/Wall Linings Internal/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 2279/B00G/R0009/Ceiling Structures/Linings/S8					<b>No Asbestos Detected</b>

**B00G - R0010 - Home Base (47.96 m2)**

Chalk Board	Flat AC Sheeting 2279/B00G/R0010/Chalk Board/S10	20m2	Behind new board + perimeter walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00G - R0011 - External Movement (10.06 m2)**

No Asbestos

**B00G - R0012 - Stairs (7.64 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
<b>B00G - R1001 - Home Base (48.24 m2)</b>						
Chalk Board	Flat AC Sheeting	20m2	Behind new board + perimeter walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2279/B00G/R0010/Chalk Board/S10					<b>Chrysotile (white asbestos)</b>
<b>B00G - R1002 - Practical Activities - 1hb (24.31 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
<b>B00G - R1003 - Movement (12.88 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
<b>B00G - R1004 - Movement (4.29 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
<b>B00G - R1005 - Withdrawal Space - 1hb (13.77 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	2279/B00G/R1005/Wall Linings Internal/S20					<b>No Asbestos Detected</b>
<b>B00G - R1006 - Home Base (47.9 m2)</b>						
Chalk Board	Flat AC Sheeting	20m2	Behind new board + perimeter walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2279/B00G/R0010/Chalk Board/S10					<b>Chrysotile (white asbestos)</b>
<b>B00G - R1007 - Stairs (12.85 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2279/B00G/R0009/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
<b>B00G - Room+1 - Bubbler Annexe</b>						
Roof	Corrugated AC Sheeting	6m2	Exterior, West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2279/B00G/Room+1/Roof Cladding/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 1947 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B00H - R0002 - Hall Chair Store (14.35 m2)**

No Asbestos

**B00H - R0003 - Canteen Office/Store (5.6 m2)**

No Asbestos

**B00H - R0004 - Canteen Office/Store (5.6 m2)**

No Asbestos

**B00H - R0005 - Canteen (45.08 m2)**

No Asbestos

**B00H - R0006 - Sports Store (17.1 m2)**

No Asbestos

**B00H - R0007 - Disabled Toilet (3.6 m2)**

Wall Linings Internal	Flat AC Sheeting					
	2279/B00H/R0020/Wall Linings Internal/S15					<b>No Asbestos Detected</b>

**B00H - R0008 - Communal Space (185.81 m2)**

No Asbestos

**B00H - R0009 - Movement (31.58 m2)**

Wall Cladding	Flat AC Sheeting					
	2279/B00H/R0023/Wall Cladding/S13					<b>No Asbestos Detected</b>

**B00H - R0010 - Toilets - Boys (11.61 m2)**

Wall Linings Internal	Flat AC Sheeting					
	2279/B00H/R0020/Wall Linings Internal/S15					<b>No Asbestos Detected</b>

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00H/R0021/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting					
	2279/B00H/R0020/Ceiling Structures/Linings/S17					<b>No Asbestos Detected</b>

**B00H - R0011 - Hall Chair Store (2.94 m2)**

No Asbestos

**B00H - R0012 - Raised Platform (54.71 m2)**

No Asbestos

**B00H - R0013 - Hall Chair Store (3.15 m2)**

No Asbestos

**B00H - R0014 - Toilets - Girls (11.25 m2)**

Wall Linings Internal	Flat AC Sheeting					
	2279/B00H/R0020/Wall Linings Internal/S15					<b>No Asbestos Detected</b>

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00H/R0021/Partition Walls (Cubicles)/S16					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Flat AC Sheeting					
	2279/B00H/R0020/Ceiling Structures/Linings/S17					<b>No Asbestos Detected</b>

**B00H - R0015 - Shower/Change (2.52 m2)**

Wall Linings Internal	Flat AC Sheeting					
	2279/B00H/R0020/Wall Linings Internal/S15					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00H/R0021/Partition Walls (Cubicles)/S16				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Ceiling Structures/Linings/S17					
<b>B00H - R0016 - Plant (2.1 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Wall Linings Internal/S15					
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Ceiling Structures/Linings/S17					
<b>B00H - R0017 - Cleaning Supplies (1.21 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Wall Linings Internal/S15					
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Ceiling Structures/Linings/S17					
<b>B00H - R0018 - Movement (5.87 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Wall Linings Internal/S15					
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Ceiling Structures/Linings/S17					
<b>B00H - R0019 - Movement (16.4 m2)</b>						
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0023/Wall Cladding/S13					
<b>B00H - R0020 - Movement (6.36 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Wall Linings Internal/S15					
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Ceiling Structures/Linings/S17					
<b>B00H - R0021 - Shower/Change (3 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Wall Linings Internal/S15					
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B00H/R0021/Partition Walls (Cubicles)/S16				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Ceiling Structures/Linings/S17					
<b>B00H - R0022 - Distribution Board (1.8 m2)</b>						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Wall Linings Internal/S15					
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0020/Ceiling Structures/Linings/S17					
<b>B00H - R0023 - External Movement (112.29 m2)</b>						
Wall Cladding	Flat AC Sheeting					No Asbestos Detected
	2279/B00H/R0023/Wall Cladding/S13					
<b>B00H - R0024 - External Movement (23.9 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B001/R0006/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B001/R0006/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	AC Fragments/Debris	NA	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Minor FCS debris to top of ceiling.</b>					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B001 - R0001 - Staff Toilet (4.45 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B001/R0006/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	

**B001 - R0002 - Toilets - Girls (26.39 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B001/R0006/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2279/B00B/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos)</b>	

**B001 - R0003 - Toilets - Boys (23.91 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B001/R0006/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2279/B00B/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos)</b>	

**B001 - R0004 - Staff Toilet (2.07 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B001/R0006/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	

**B001 - R0006 - External Movement (45.54 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2279/B001/R0006/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos)</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Other-Community Use - 1952 - Timber (Timber)****Exterior**

Wall Cladding	Flat AC Sheeting 2279/B00L/Wall Cladding/S28					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00L - R0001 - Clerical Office (15.23 m2)**

Gasket	Rope 2279/B00L/R0001/Fireplace Door Seal/S25					<b>No Asbestos Detected</b>
--------	---	--	--	--	--	-----------------------------

**B00L - R0002 - Tutorial Centre (25.59 m2)**

No Asbestos

**B00L - R0003 - Clerical Office (11.9 m2)**

No Asbestos

**B00L - R0004 - Staff Shower/Change (3.9 m2)**

No Asbestos

**B00L - R0005 - Duplicating Workroom (7.29 m2)**

No Asbestos

**B00L - R0006 - Staff Kitchen (4.81 m2)**

No Asbestos

**B00L - R0007 - Movement (1.69 m2)**

No Asbestos

**B00L - R0008 - Staff Toilet (1.75 m2)**

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2279/B00L/R0008/Wall Linings Internal/S26						<b>Chrysotile (white asbestos)</b>

**B00L - R0009 - Cleaning Distributed Store (0.45 m2)**

No Asbestos

**B00L - R0010 - Clerical Office (9.08 m2)**

No Asbestos

**B00L - R0011 - Entry Vestibule (8.14 m2)**

No Asbestos

**B00L - R0012 - Movement (1.2 m2)**

No Asbestos

**B00L - R0013 - Movement (18.56 m2)**

No Asbestos

**B00L - R0014 - Home Base Store (3.63 m2)**

No Asbestos

**B00L - R9001 - Sports Store (16.74 m2)**

In-fill-panel	Flat AC Sheeting 2279/B00L/R9001/In-fill-panel/S27					<b>No Asbestos Detected</b>
---------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Other-Community Use - 1920 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Wall Cladding	Flat AC Sheeting	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2279/B00M/Wall Cladding/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible due to no access point.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00M - R0001 - Garage/Carport (17.46 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

### B00N - General Learning/Special Purpose Learning - 2011 - Brick/Veneer (Brick/Veneer)

#### Exterior

No Asbestos

#### Interior

##### B00N - R0001 - External Movement (42.57 m2)

No Asbestos

##### B00N - R0002 - Practical Activities (19.11 m2)

No Asbestos

##### B00N - R0003 - Home Base Store (6.41 m2)

No Asbestos

##### B00N - R0004 - Home Base (60.47 m2)

No Asbestos

##### B00N - R0005 - Withdrawal Space - 2hb (11.64 m2)

No Asbestos

##### B00N - R0006 - Home Base (60.47 m2)

No Asbestos

##### B00N - R0007 - Home Base Store (6.41 m2)

No Asbestos

##### B00N - R0008 - Practical Activities (18.28 m2)

No Asbestos

##### B00N - R0009 - Main Switch Board (0.62 m2)

No Asbestos

##### B00N - R0010 - Home Base - P (67.75 m2)

No Asbestos

##### B00N - R0011 - Home Base Store - P (5.82 m2)

No Asbestos

##### B00N - R0012 - Practical Activities - P - 2hb (37.98 m2)

No Asbestos

##### B00N - R0013 - Access Shower/Toilet (18.47 m2)

No Asbestos

##### B00N - R0014 - Laundry - P (5.12 m2)

No Asbestos

##### B00N - R0015 - Access Shower/Toilet (6.27 m2)

No Asbestos

##### B00N - R0016 - Main Switch Board (0.57 m2)

No Asbestos

##### B00N - R0017 - Home Base - P (67.67 m2)

No Asbestos

##### B00N - R0018 - Home Base Store - P (5.79 m2)

No Asbestos

##### B00N - R0019 - External Movement (51.46 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Storage - 2013 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B000 - R0001 - External Movement (17.43 m2)**

No Asbestos

**B000 - R0002 - General Storeroom (29.54 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Other - 2012 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00P - R0001 - Sports Store (47.24 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0C1 - General Learning - 1967 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior****B0C1 - R0001 - Distribution Board (4.27 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	-------	--------------------	---------	--------------------

**Assumed Asbestos - Electrical Hazard****B0C1 - R0002 - Home Base Store (6.37 m2)**

No Asbestos

**B0C1 - R0003 - Toilets - Boys/Girls (4.63 m2)**

No Asbestos

**B0C1 - R0004 - Home Base (97.25 m2)**

No Asbestos

**B0C1 - R0005 - Home Base (97.25 m2)**

No Asbestos

**B0C1 - R0006 - Toilets - Boys/Girls (3.99 m2)**

No Asbestos

**B0C1 - R0007 - Cleaning Supplies (4.37 m2)**

No Asbestos

**B0C1 - R0008 - General Storeroom (4.83 m2)**

No Asbestos

**B0C1 - R0009 - External Movement (68.82 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0C2 - Pupil Facilities - 1967 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling  
Non Accessible Area  
- Area inaccessible due to no designated access point.

Underfloor Voids - Slab on Ground  
Non Accessible Area  
- No asbestos was found.

**Interior****B0C2 - R0001 - Toilets - Girls (26.67 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00B/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	

Wall Linings Internal	Flat AC Sheeting				<b>No Asbestos Detected</b>	
2279/B0C2/R0001/Wall Linings Internal/S2						

**B0C2 - R0002 - Plant (5 m2)**

Toilet Cistern	Moulded Fibre Cement	8Unit(s)	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2279/B0C2/R0002/Cistern/S31					<b>Chrysotile (white asbestos)</b>	

Flue	Fibre Cement Pipe	3m	North	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
2279/B0C2/R0002/Pipe/S32					<b>Chrysotile (white asbestos)</b>	

**B0C2 - R0003 - Toilets - Boys (30.25 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2279/B00B/R0001/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	

**B0C2 - R0004 - External Movement (25.58 m2)**

No Asbestos

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0C3 - General Learning - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B0C3 - R0001 - Movement (6.66 m2)**

No Asbestos

**B0C3 - R0002 - Distribution Board (0.98 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	------	--------------------	---------	--------------------

**Assumed Asbestos - Electrical Hazard**

**B0C3 - R0003 - Home Base Store (7.15 m2)**

No Asbestos

**B0C3 - R0004 - Home Base (57.21 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Adjacent sink	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	-----	---------------	--------------------	---------	--------------------

2279/B00C/R0006/Floor Coverings Res/Textile/S23

**Chrysotile (white asbestos)**

**B0C3 - R0005 - External Movement (22 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 971 - D70072 - Shed - Container (Garden/Sports/Bulk) : Placement Date - 14/11/2006**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Garden Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017