


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kendall Public School (2280)
Region : North Coast
State Electorate : Port Macquarie
Local Government Area : Port Macquarie-Hastings

Initial Survey : Noel Arnold & Associates : 27 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 29 - Aug - 2016

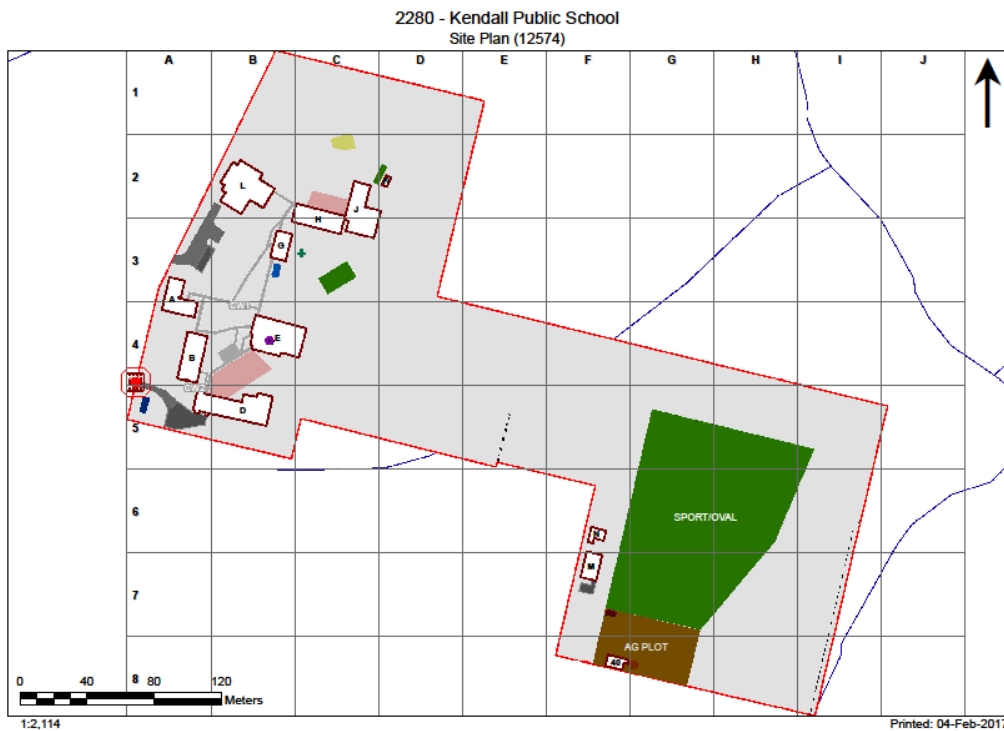

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1880 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 2280/B00A/Eaves Linings/S19	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 2280/B00A/Underfloor Voids - Packing to Floor Joists/S22	1m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Underfloor Void	Compressed AC Sheet 2280/B00A/Underfloor Void/S23					No Asbestos Detected

Interior**B00A - R0002 - Sick Bay (13.54 m2)**

No Asbestos

B00A - R0005 - Movement (26.47 m2)

No Asbestos

B00A - R0006 - Movement (20.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2280/B00A/R0006/Ceiling Structures/Linings/S4	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 2280/B00A/R0006/Wall Linings Internal/S5	3m2	North facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0011 - Principal (19.93 m2)

No Asbestos

B00A - R0012 - Deputy Principal (11.57 m2)

No Asbestos

B00A - R0015 - Movement (22.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2280/B00A/R0006/Ceiling Structures/Linings/S4	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	--------------	--------------------	---------	--

B00A - R0017 - Sick Bay (10.73 m2)

Wall Linings Internal	Flat AC Sheeting 2280/B00A/R0019/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00A - R0018 - Access Shower/Toilet (6.24 m2)

Wall Linings Internal	Flat AC Sheeting 2280/B00A/R0019/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00A - R0019 - Staff Toilet (4.99 m2)

Wall Linings Internal	Flat AC Sheeting 2280/B00A/R0019/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00A - R0020 - Staff Kitchen (9.54 m2)

No Asbestos

B00A - R0021 - Staff Room (57.18 m2)

No Asbestos

B00A - R0022 - Clerical Office/Workroom (47.81 m2)

No Asbestos

B00A - R0023 - Communications Room (4.95 m2)

Floor Coverings Res/Textile	Compressed AC Sheet 2280/B00A/R0023/Floor Coverings Res/Textile/S1	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00A - R0024 - Main Switch Board (2.37 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2280/B00A/R0023/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1982 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00B - R0004 - Distribution Board (0.6 m2) Note: No inspection of live electrical installation.

No Asbestos

B00B - R0005 - Movement (85.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting	86m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2280/B00B/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0006 - Practical Activities - 1hb (19.13 m2)

No Asbestos

B00B - R0007 - Withdrawal Space - 2hb (15.97 m2)

No Asbestos

B00B - R0008 - Practical Activities - 1hb (20.3 m2)

No Asbestos

B00B - R0009 - Home Base Store (7.85 m2)

No Asbestos

B00B - R0010 - Home Base (79.36 m2)

No Asbestos

B00B - R0011 - Home Base (75.01 m2)

No Asbestos

B00B - R0012 - Home Base Store (8.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1971 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior**B00D - R0001 - Movement (13.3 m2)**

Ceiling Structures/Linings Flat AC Sheeting 14m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

2280/B00D/R0001/Ceiling Structures/Linings/S25

Chrysotile (white asbestos)

B00D - R0008 - Distribution Board (0.94 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0009 - Movement (97.38 m2)

Ceiling Structures/Linings Vermiculite 98m2 All surfaces Friable Asbestos (5) Low (1) Low Priority (2-3)

2280/B00D/R0013/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

B00D - R0010 - Movement (40.64 m2)

Ceiling Structures/Linings Vermiculite 36m2 All surfaces Friable Asbestos (5) Low (1) Low Priority (2-3)

2280/B00D/R0013/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

B00D - R0012 - Canteen Office/Store (3.74 m2)

Ceiling Structures/Linings Vermiculite 70m2 All surfaces Friable Asbestos (5) Low (1) Low Priority (2-3)

2280/B00D/R0013/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

B00D - R0013 - Staff Toilet (3.43 m2)

Ceiling Structures/Linings Vermiculite 3m2 Western area Friable Asbestos (5) Low (1) Low Priority (2-3)

2280/B00D/R0013/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

B00D - R0014 - Cleaning Supplies (1.65 m2)

No Asbestos

B00D - R0015 - Garden Store (6.64 m2)

No Asbestos

B00D - R0016 - Practical Activities - 1hb (13.87 m2)

No Asbestos

B00D - R0017 - Home Base (71.83 m2)

Ceiling Structures/Linings Vermiculite 5m2 Western area Friable Asbestos (5) Low (1) Low Priority (2-3)

2280/B00D/R0013/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

B00D - R0018 - Home Base Store (7.59 m2)

No Asbestos

B00D - R0019 - Home Base Store (7.15 m2)

Ceiling Structures/Linings Vermiculite 4m2 East facing Friable Asbestos (5) Low (1) Low Priority (2-3)

2280/B00D/R0013/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

B00D - R0020 - Withdrawal Space - 2hb (12.13 m2)

Ceiling Structures/Linings Vermiculite 5m2 East and west structural beams Friable Asbestos (5) Low (1) Low Priority (2-3)

2280/B00D/R0013/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

B00D - R0021 - Home Base (63.87 m2)

Ceiling Structures/Linings Vermiculite 20m2 Variable positions Friable Asbestos (5) Low (1) Low Priority (2-3)

2280/B00D/R0013/Ceiling Structures/Linings/S8

Chrysotile (white asbestos)

B00D - R0022 - Practical Activities - 1hb (13.43 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R0023 - Movement (3.45 m2)						
No Asbestos						
B00D - R0024 - Movement (5.03 m2)						
Wall Linings Internal	Flat AC Sheeting					
	2280/B00D/R0024/Wall Linings Internal/S9					No Asbestos Detected
B00D - R0025 - Security Store (31.94 m2)						
Floor Coverings Res/Textile	Resinous Membrane	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00D/R0025/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)
B00D - R0026 - Lift (2.25 m2)						
No Asbestos						
B00D - R0027 - Stairs (18.19 m2)						
No Asbestos						
B00D - R1001 - Distribution Board (1.55 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00D - R1015 - Stairs (18.19 m2)						
No Asbestos						
B00D - R1016 - Movement (78.99 m2)						
No Asbestos						
B00D - R1017 - Home Base Store (7.01 m2)						
Ceiling Structures/Linings	Vermiculite	7m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	2280/B00D/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
B00D - R1018 - Withdrawal Space - 1hb (10.13 m2)						
Ceiling Structures/Linings	Vermiculite	11m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	2280/B00D/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
B00D - R1019 - Home Base (60.78 m2)						
Ceiling Structures/Linings	Vermiculite	30m2	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	2280/B00D/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
B00D - R1020 - Practical Activities - 1hb (18.82 m2)						
No Asbestos						
B00D - R1021 - Practical Activities - 1hb (19.68 m2)						
No Asbestos						
B00D - R1022 - Home Base (60.04 m2)						
Ceiling Structures/Linings	Vermiculite	30m2	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	2280/B00D/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
B00D - R1023 - Withdrawal Space - 1hb (8.28 m2)						
No Asbestos						
B00D - R1024 - Home Base Store (5.64 m2)						
No Asbestos						
B00D - R1025 - Special Programs Room (44 m2)						
Ceiling Structures/Linings	Vermiculite	44m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	2280/B00D/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
B00D - R1026 - Access Shower/Toilet (7.96 m2)						
No Asbestos						
B00D - R1027 - Lift (2.25 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R9001 - Movement (20.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2280/B00D/R0001/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)	
B00D - R9002 - Special Programs Room (48.89 m2)						
No Asbestos						
B00D - R9003 - Duplicating Workroom (3.4 m2)						
No Asbestos						
B00D - R9004 - Computer Learning Space (36.21 m2)						
No Asbestos						
B00D - R9005 - Withdrawal Space - 1hb (16.89 m2)						
No Asbestos						
B00D - R9006 - Movement (13.22 m2)						
No Asbestos						
B00D - R9007 - Movement (13.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2280/B00D/R0001/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)	
B00D - R9008 - Movement (18.26 m2)						
Ceiling Structures/Linings	Vermiculite					
2280/B00D/R9008/Ceiling Structures/Linings/S8					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2280/B00D/R9008/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2280/B00D/R9008/Wall Linings Internal/S10					Chrysotile (white asbestos)	
B00D - R9009 - Distribution Board (1.08 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00D - R9010 - Welding Area (21.57 m2)						
No Asbestos						
B00D - R9011 - Cleaning Supplies (3.6 m2)						
No Asbestos						
B00D - R9012 - Materials Technology L.S. (127.83 m2)						
Ceiling Structures/Linings	Vermiculite	128m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
2280/B00D/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	128m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2280/B00D/R9012/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
B00D - R9013 - Materials Store (15.05 m2)						
Ceiling Structures/Linings	Vermiculite	16m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
2280/B00D/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2280/B00D/R9012/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	
B00D - R9014 - Stairs (12.73 m2)						
No Asbestos						
B00D - R9015 - Lift (2.25 m2)						
No Asbestos						
B00D - R9016 - Movement (7.28 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library/Communal Facilities - 1983 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	100m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00E/Eaves Linings/S12				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

Interior

B00E - R0001 - Cleaning Supplies (10.4 m2)

No Asbestos

B00E - R0002 - Distribution Board (1.45 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0004 - Staff Toilet (9.6 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00E/R0005/Partition Walls (Cubicles)/S13				Chrysotile (white asbestos)	

B00E - R0005 - Staff Toilet (6.06 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00E/R0005/Partition Walls (Cubicles)/S13				Chrysotile (white asbestos)	

B00E - R0006 - Cleaning Supplies (5.25 m2)

No Asbestos

B00E - R0008 - Reading Area (282.77 m2)

No Asbestos

B00E - R0010 - Library Office/Workroom (24.52 m2)

No Asbestos

B00E - R0011 - General Storeroom (12.37 m2)

No Asbestos

B00E - R0013 - Covered Outdoor Learning Area (74.01 m2)

No Asbestos

B00E - R0014 - K.L.A. Store (24.64 m2)

No Asbestos

B00E - R0015 - Movement (61.78 m2)

No Asbestos

B00E - R9001 - Special Programs Room (199.35 m2)

No Asbestos

B00E - R9002 - General Storeroom (9.76 m2)

No Asbestos

B00E - R9003 - Sports Store (51.23 m2)

No Asbestos

B00E - R9004 - General Assistant/Bulk Store (10.57 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	2280/B00E/R9004/Floor Coverings Res/Textile/S26				No Asbestos Detected	

B00E - R9005 - Movement (66.74 m2)

No Asbestos

B00E - R9006 - Distribution Board (1.09 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R9008 - Movement (46.18 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1966 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00G/Eaves Linings/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00G - R0001 - General Storeroom (14.48 m2)

No Asbestos

B00G - R0002 - Toilets - Girls (34.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00G/R0002/Ceiling Structures/Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0003 - Toilets - Boys (35.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00G/R0002/Ceiling Structures/Linings/S24			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0004 - Garden Store (7.09 m2)

No Asbestos

B00G - R0005 - Movement (41.48 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1966 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00H - R0016 - Distribution Board (0.28 m2) Note: No inspection of live electrical installation.

No Asbestos

B00H - R0017 - Movement (78.12 m2)

No Asbestos

B00H - R0018 - Home Base Store (6.56 m2)

No Asbestos

B00H - R0019 - Withdrawal Space - 1hb (9.52 m2)

No Asbestos

B00H - R0020 - Home Base (79.79 m2)

No Asbestos

B00H - R0021 - Practical Activities - 1hb (18.15 m2)

No Asbestos

B00H - R0022 - Home Base (71.62 m2)

No Asbestos

B00H - R0023 - Withdrawal Space - 1hb (8.92 m2)

No Asbestos

B00H - R0024 - Home Base Store (6.32 m2)

No Asbestos

B00H - R0025 - Access Shower/Toilet (6.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting	
	2280/B00H/R0025/Ceiling Structures/Linings/S15	No Asbestos Detected

B00H - R0026 - Practical Activities - 1hb (18.75 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 1966 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	100m2	Perimeter of building	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00J/Eaves Linings/S14					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					

Interior

B00J - M0001 - Home Base Store (13.78 m2)

No Asbestos

B00J - R0001 - Personal Effects Storage (12.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2280/B00J/Eaves Linings/S14					Chrysotile (white asbestos)

B00J - R0002 - Home Base (63.45 m2)

No Asbestos

B00J - R0003 - Movement (18.93 m2)

No Asbestos

B00J - R0004 - Withdrawal Space - 1hb (13.58 m2)

No Asbestos

B00J - R0005 - Home Base Store (6.07 m2)

No Asbestos

B00J - R0006 - Home Base (63.06 m2)

No Asbestos

B00J - R0007 - Music Store (6.08 m2)

No Asbestos

B00J - R0008 - Practical Activities - 1hb (54.92 m2)

No Asbestos

B00J - R0009 - Home Base Store (2.61 m2)

No Asbestos

B00J - R0010 - Movement (18.93 m2)

No Asbestos

B00J - R0011 - Covered Outdoor Learning Area (155.13 m2)

No Asbestos

B00J - R9001 - Movement (43.8 m2)

No Asbestos

B00J - R9002 - Distribution Board (0.92 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00J - R9003 - Craft Store (23.9 m2)

No Asbestos

B00J - R9004 - Sports Store (24 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Shed - 1950 - Timber Shed (Timber Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00K - R0001 - Canteen Covered Area (17.25 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Communal Facilities/Pupil Facilities - 2003 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

No Asbestos

Ceiling Voids No Asbestos Found

Interior**B00L - R0001 - Covered Outdoor Learning Area (219.24 m2)**

No Asbestos

B00L - R0002 - Canteen (27.53 m2)

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0003 - Canteen Office/Store (9.55 m2)

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0004 - Movement (23.43 m2)

No Asbestos

B00L - R0005 - Communal/Performance Store (8.73 m2)

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0006 - Movement (4.76 m2)

No Asbestos

B00L - R0007 - Cleaning Supplies (6.87 m2)

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0008 - Sports Store (6.22 m2)

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0009 - Communications Cupboard (1.83 m2)

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0010 - Toilets - Girls (10.29 m2)

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0011 - Distribution Board (0.54 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0012 - Communal Space (146.64 m2)

No Asbestos

B00L - R0013 - Movement (22.26 m2)

No Asbestos

B00L - R0014 - Raised Platform (46.74 m2)

No Asbestos

B00L - R0015 - Movement (6.43 m2)

No Asbestos

B00L - R0016 - Hall Chair Store (8.73 m2)

Wall Linings Internal Flat AC Sheeting
2280/B00L/R0011/Wall Linings Internal/S2 **No Asbestos Detected**

B00L - R0017 - P.E. Store (12.44 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting		2280/B00L/R0011/Wall Linings Internal/S2			No Asbestos Detected
B00L - R0018 - Toilets - Boys (10.79 m2)						
Wall Linings Internal	Flat AC Sheeting		2280/B00L/R0011/Wall Linings Internal/S2			No Asbestos Detected
B00L - R0019 - Cleaning Distributed Store (2.89 m2)						
Wall Linings Internal	Flat AC Sheeting		2280/B00L/R0011/Wall Linings Internal/S2			No Asbestos Detected
B00L - R0020 - Access Shower/Toilet (5.01 m2)						
Wall Linings Internal	Flat AC Sheeting		2280/B00L/R0011/Wall Linings Internal/S2			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Other/Pupil Facilities - 2014 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00M - R0001 - Toilets - Girls (29.72 m2)

No Asbestos

B00M - R0002 - Staff Toilet (5.28 m2)

No Asbestos

B00M - R0003 - Disabled Toilet (5.56 m2)

No Asbestos

B00M - R0004 - Plant (5.71 m2)

No Asbestos

B00M - R0005 - Toilets - Boys (27.99 m2)

No Asbestos

B00M - R0006 - Other-Not Used (26.98 m2)

No Asbestos

B00M - R0007 - External Movement (39.37 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Other/Staff Facilities - 2014 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Sports Store (35.75 m2)

No Asbestos

B00N - R0002 - Staff Kitchen (1.65 m2)

No Asbestos

B00N - R0003 - Staff Toilet (3.84 m2)

No Asbestos

B00N - R0004 - External Movement (17.64 m2)

No Asbestos

B00N - R0005 - External Movement (2.63 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B040 - Shed - 1962 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B040 - R0001 - Movement (16.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

2280/B040/R0001/Ceiling Structures/Linings/S16

Chrysotile (white asbestos)

B040 - R0002 - Garden Store (14.46 m2)

No Asbestos

B040 - R0003 - Plant Space (14.59 m2)

No Asbestos

B040 - R0004 - Plant Space (19.53 m2)

No Asbestos

B040 - R0005 - Toilets - Boys (5.29 m2)

Wall Linings Internal	Flat AC Sheeting	2280/B040/R0005/Wall Linings Internal/S17
-----------------------	------------------	---

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017