

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Kenthurst Public School (2284)
Region : Northern Sydney
State Electorate : Castle Hill
Local Government Area : The Hills

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 15 - Sep - 2016



2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible - sealed access.					
Eaves Linings	Flat AC Sheeting	30m ²	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						
Wall Cladding	Flat AC Sheeting	32m ²	Below windows, infill panels, south	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00A/R1011/Wall Linings Internal/S7				Chrysotile (white asbestos)		

Interior**B00A - R0001 - Practical Activities - 1hb (18.4 m²)**

Floor Coverings Res/Textile	Vinyl Tiles	19m ²	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2284/B00A/R0001/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0002 - Home Base (52 m²)

Ceiling Structures/Linings	Vermiculite					
2284/B00A/R0001/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0003 - Home Base (59.2 m²)

Ceiling Structures/Linings	Vermiculite					
2284/B00A/R0001/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0004 - Practical Activities - 1hb (12.8 m²)

Floor Coverings Res/Textile	Vinyl Tiles	13m ²	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2284/B00A/R0001/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0005 - Practical Activities - 1hb (12.8 m²)

Floor Coverings Res/Textile	Vinyl Tiles	13m ²	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		
Ceiling Structures/Linings	Vermiculite					
2284/B00A/R0001/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0006 - Home Base (58.4 m²)

Ceiling Structures/Linings	Vermiculite					
2284/B00A/R0001/Ceiling Structures/Linings/S6				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0007 - Cleaning Supplies (7.91 m²)

Floor Coverings Res/Textile	Vinyl Tiles	8m ²	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0008 - Security Store (15.37 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0009 - Deputy Principal (13.01 m2)						
Ceiling Structures/Linings	Vermiculite					
2284/B00A/R0001/Ceiling Structures/Linings/S6					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0010 - General Storeroom (7.64 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0011 - Staff Toilet (3.84 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00A/R0011/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
B00A - R0012 - Movement (3.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
2284/B00A/R0001/Ceiling Structures/Linings/S6					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0013 - Staff Toilet (3.48 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00A/R0011/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
B00A - R0014 - Toilets - Girls (28.79 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2284/B00A/R0011/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
B00A - R0015 - Toilets - Boys (29.62 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2284/B00A/R0011/Partition Walls (Cubicles)/S13					Chrysotile (white asbestos)	
B00A - R0017 - Personal Effects Storage (77.74 m2)						
No Asbestos						
B00A - R0018 - Sports Store (3.84 m2)						
No Asbestos						
B00A - R0019 - Cleaning Distributed Store (3.84 m2)						
No Asbestos						
B00A - R1001 - Practical Activities - 1hb (18.3 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1002 - Home Base (52.05 m2)						
No Asbestos						
B00A - R1003 - Home Base (52.21 m2)						
No Asbestos						
B00A - R1004 - Practical Activities - 1hb (18.38 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1006 - Practical Activities - 1hb (12.74 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1007 - Home Base (57.3 m2)						
No Asbestos						
B00A - R1008 - General Storeroom (46.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	NA	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1009 - Home Base (58.4 m2)						
No Asbestos						
B00A - R1010 - Practical Activities - 1hb (12.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1011 - Personal Effects Storage (73.32 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00C/R0002/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	Below windows, infill panels	Some Damage / Unsealed (3)	Medium (2)	Medium Priority (4-5)
2284/B00A/R1011/Wall Linings Internal/S7					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1898 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00B - R0001 - Reading Area (97.4 m2)

No Asbestos

B00B - R0002 - Reading Area (21.39 m2)

Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - Library Office/Workroom (9.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0004 - Library Office/Workroom (10.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0004/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		

B00B - R0005 - Personal Effects Storage (10.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0002/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Wall Linings Internal	Flat AC Sheeting	2m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0005/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					

Interior

B00C - R0001 - Communal Space (103.56 m2)

No Asbestos

B00C - R0002 - Movement (93.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	94m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00C/R0002/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/General Learning - 1970 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0009/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction >3m.					
Wall Cladding	Flat AC Sheeting	16m2	Below windows, infill panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2284/B00A/R1011/Wall Linings Internal/S7					Chrysotile (white asbestos)

Interior**B00D - R0001 - Toilets - Boys (23.58 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2284/B00D/R0002/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00D - R0002 - Toilets - Girls (22.41 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2284/B00D/R0002/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00D - R0003 - Cleaning Distributed Store (1.05 m2)

No Asbestos

B00D - R0004 - Personal Effects Storage (7.56 m2)

No Asbestos

B00D - R0005 - Home Base Store (6.3 m2)

No Asbestos

B00D - R0006 - Home Base (56.59 m2)

No Asbestos

B00D - R0007 - Home Base (56.51 m2)

No Asbestos

B00D - R0008 - Home Base Store (6.11 m2)

No Asbestos

B00D - R0009 - Personal Effects Storage (45.64 m2)

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00D/R0009/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00D - R0010 - Personal Effects Storage (7.26 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Administration/General Learning - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting 2284/B00F/R0009/Ceiling Structures/Linings/S4	20m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable verge lining	Flat AC Sheeting Assumed Asbestos - Height Restriction >3m.	20Unit(s)	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Wall Cladding	Flat AC Sheeting 2284/B00A/R1011/Wall Linings Internal/S7	12m2	Below windows, infill panels	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting 2284/B00E/R9003/Joist packing/S16	NA	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00E - R0001 - Staff Room (57.28 m2)						
No Asbestos						
B00E - R0002 - General Storeroom (5.91 m2)						
No Asbestos						
B00E - R0003 - Distribution Board (1.54 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00E - R0004 - Staff Kitchen (3.33 m2)						
No Asbestos						
B00E - R0005 - Movement (2.29 m2)						
No Asbestos						
B00E - R0006 - Deputy Principal (12.04 m2)						
No Asbestos						
B00E - R0007 - Principal (15.5 m2)						
No Asbestos						
B00E - R0008 - Entry Vestibule (17.72 m2)						
No Asbestos						
B00E - R0009 - Staff Toilet (4.08 m2)						
Wall Linings Internal	Flat AC Sheeting 2284/B00B/R0002/Ceiling Structures/Linings/S1	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0010 - Movement (5.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2284/B00D/R0009/Ceiling Structures/Linings/S9	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0011 - Movement (5.72 m2)						
No Asbestos						
B00E - R0012 - Clerical Office (15.01 m2)						
No Asbestos						
B00E - R0013 - Clerical Office (15.01 m2)						
No Asbestos						
B00E - R0014 - Sick Bay (7.69 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

No Asbestos

B00E - R0015 - Staff Toilet (4.01 m2)

Wall Linings Internal	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0002/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0016 - General Storeroom (7.01 m2)

No Asbestos

B00E - R0017 - Cleaning Distributed Store (4.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00B/R0004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00E - R0018 - Canteen Office/Store (2.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00C/R0002/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		

B00E - R0019 - Canteen Office/Store (2.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00C/R0002/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		

B00E - R0020 - Canteen (16.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00C/R0002/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		

B00E - R0021 - Movement (27.81 m2)

Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00C/R0002/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		

B00E - R0022 - Movement (44.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00D/R0009/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		

B00E - R9001 - General Assistant/Bulk Store (13.19 m2)

No Asbestos

B00E - R9002 - Garden Store (13.55 m2)

No Asbestos

B00E - R9003 - General Storeroom (42.57 m2)

Joist packing	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2284/B00E/R9003/Joist packing/S16				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0009/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/Gable verge lining/S17			Chrysotile (white asbestos)		

Interior**B00F - R0001 - Toilets - Boys/Girls (3.26 m2)**

No Asbestos

B00F - R0002 - Personal Effects Storage (2.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0004/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		

B00F - R0003 - Practical Activities - 1hb (21.26 m2)

Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00B/R0004/Floor Coverings Res/Textile/S2			Chrysotile (white asbestos)		

B00F - R0004 - Home Base (71.44 m2)

Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink, southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0004/Wall Linings Internal/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0004/Wall Linings Internal/S18			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00F - R0005 - Home Base (85.18 m2)

No Asbestos

B00F - R0006 - Personal Effects Storage (10.5 m2)

No Asbestos

B00F - R0007 - Movement (3.24 m2)

No Asbestos

B00F - R0008 - Movement (4.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0009/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0009 - Toilets - Boys/Girls (3.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0009/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Special Purpose - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction >3m.						

Interior

B00G - R0001 - Home Base (53.73 m2)

No Asbestos

B00G - R0002 - Interview (13.29 m2)

No Asbestos

B00G - R0003 - Movement (3.4 m2)

No Asbestos

B00G - R0004 - Teachers Aide Special Ed (9.1 m2)

No Asbestos

B00G - R0005 - General Storeroom (3.93 m2)

Non Accessible

B00G - R0006 - General Storeroom (8.4 m2)

No Asbestos

B00G - R0007 - Home Base (53.51 m2)

No Asbestos

B00G - R0008 - Main Switch Board (1.09 m2)

Electrical Mounting Board	Resinous Board	5Unit	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						


Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
2284/B00A/Room+1/Wall Linings Internal/S5						

B00G - R0009 - Movement (16.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
2284/B00B/R0002/Ceiling Structures/Linings/S1						

B00G - R0010 - Personal Effects Storage (24.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
2284/B00B/R0002/Ceiling Structures/Linings/S1						

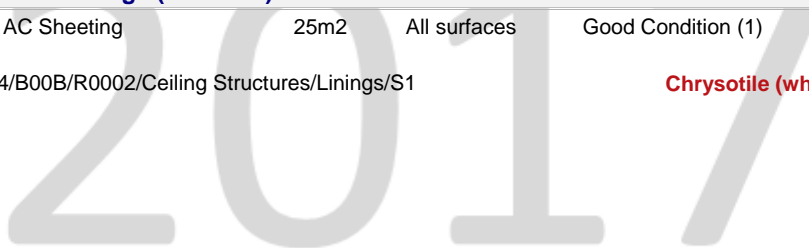

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Communal Facilities - 1970 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B001/Wall Cladding/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	4m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0009/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B001 - R0001 - Entry Vestibule (6.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0009/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B001/R0001/Wall Linings Internal/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0002 - Community Clinic (11.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0009/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B001/R0001/Wall Linings Internal/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0003 - Staff Toilet (4.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B00F/R0009/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2284/B001/R0001/Wall Linings Internal/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Floor Coverings Res/Textile	Vinyl Tiles					
	2284/B001/R0003/Floor Coverings Res/Textile/S12					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1987 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00J - R0001 - P.E. Store (27.21 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00K - R0001 - Covered Outdoor Learning Area (215.85 m2)**

No Asbestos

B00K - R0002 - Communal Space (138.02 m2)

No Asbestos

B00K - R0003 - Movement (6.08 m2)

No Asbestos

B00K - R0004 - Raised Platform (63.96 m2)

No Asbestos

B00K - R0005 - Movement (11.54 m2)

No Asbestos

B00K - R0006 - Movement (14.08 m2)

No Asbestos

B00K - R0007 - Chair Storeroom (9.28 m2)

No Asbestos

B00K - R0008 - Communal/Performance Store (9.07 m2)

No Asbestos

B00K - R0009 - P.E. Store (12.99 m2)

No Asbestos

B00K - R0010 - Toilet - Lobby (2.34 m2)

No Asbestos

B00K - R0011 - Toilets - Girls (7.34 m2)

No Asbestos

B00K - R0012 - Sound Cupboard (2.02 m2)

No Asbestos

B00K - R0013 - Toilet - Lobby (3.39 m2)

No Asbestos

B00K - R0014 - Toilets - Boys (5.71 m2)

No Asbestos

B00K - R0015 - Cleaning Distributed Store (3.49 m2)

No Asbestos

B00K - R0016 - Plant (1.53 m2)

No Asbestos

B00K - R0017 - Main Switch Board (3.26 m2)

No Asbestos

B00K - R0018 - Access Shower/Toilet (6.87 m2)

No Asbestos

B00K - R9001 - General Storeroom (14.65 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2284_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017